

7260200

ASS. REC. BY:

REF: CS/FCI/906588/Klgd3n2

Special Instruction:

Assignee: Kalvin

ASSIGNMENT (Office)

CWS

From (Person): Karen Tanof FCIDate/Time: 5.47pm 18/9/19

Estimated Cost:

Bill to:

OD/FF/WS/TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SHC 5806Z

Insured:

SHA 4076E

at Workshop n/s

Transcab

Tel:

6287 6666

of

No. 2 Amk St-63

Policy No:

Claim No:

D19006019MFSH

Sum Insured:

Excess:

Make of Veh:

D.O.A.

17/9/2019

(Client's Record)

CA / REV / REP. / REV 24 HRS

(DS)

H.O.D. Endorsement:

Date/Time:

9.33am 19/9/19

Person Contacted:

ZhenweiVehicle IN/OUT

Date/Time

Action/Instruction

Estimate ✓SHC 5806Z-XSHA 4076E - NBA / INC 7017101 / yDUA: 22/7/201720/9/19 @ 2.10pm revised to Karen Tan by email.

ASS. REC. BY:

Kahr

REF: FCS

ASSIGNMENT

From:

Date:

19/9/19

Estimated Cost:

OD ☒ TP WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SHC58062

at Workshop m/s:

Trans cub

of

No. 2 AMK St-63

Insured:

Policy No:

Claims No:

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

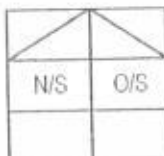

Bal. or Market Value:

IDAC Accident Rpt: Consistent?: Yes or No

GIA / PR Seen: Consistent?: Yes or No

Est. Repairs: 2 days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS 'DS

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No:

SHC 58062

Yr Regn:

3 Aug 2015

Type: M.Car / M.Cycle / Bus / Van / Lorry / T/ab / Prime Mover /

Truck / Trailer or

Make:

Renault Latitude

C.C.

1995

Colour:

Red/White

A/C:

Insured / Std / NI / NA

Sp. Reading

527181

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

VF1ABL15 AUC 282160

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD / Rim or

Tyre Size:

F:

215 / 60R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Hiti Combat

Front

Rear

R/Bal.

7

mm

R/Bal.

7

mm

L/Bal.

7

mm

L/Bal.

7

mm

D.O.A.

12/9/19

D.O.I.

19/9/19

Survey held at

Tousch

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

23/9/19

Lum 4, \$2150 / 207. LTR 24503.47, 92/100

42

RECEIVED 23 SEP 2019

Date/time, File Pass to?



Preli. Report

1) 23/9/19



Final Report

Date/Time, File Return to?

2)

Days Of Repair: 2

Resurvey No. of Trip: 1

Add Fee:



Site Insp (\$)



Interview (\$)



Tech. Invs (\$)



Meal and (\$)

Survey Fee:

Transportation:

S + RS \$

Photos

Other

TOTAL

350

Report Format:

TP

Lump Sum / 11.50

2150



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: D19006019MFSH
Our Ref: CS/FCI19016588/K1qd3

Date: 20 September 2019

The Motor Claims Department
MS First Capital Insurance Ltd

Dear Sir/Madam,


INITIAL INSPECTION REPORT OF VEHICLE NO. SHC 5806Z .

Please be informed that we had conducted the inspection of the abovementioned vehicle on 19/09/2019 at the premises of M/s TRANS-CAB, and have the following to report:-

Workshop Estimate Amount	: <u>S\$ 26,653.47</u> .
Revised Estimate Amount	: <u>S\$ 2,781.06</u> .
"Check" Items Amount	: <u>S\$ -</u> .
Market Value	: <u>S\$ -</u> .
LTA Reimbursement Value	: <u>S\$ -</u> .
Nett Value	: <u>S\$ -</u> .

Description of Damage:

The vehicle sustained damages at the rear portion.

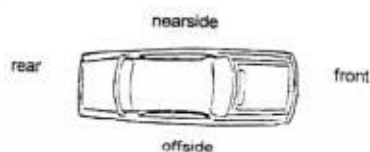

Yours faithfully

Kalvin
Automotive Assessor

MOTOR SURVEY ASSIGNMENT

Date	18-09-2019	Our Ref No. D19006019MFSH
Accident Date	17-09-2019	Claim Type. Third Party
Insured Vehicle	SHA4076E	Third Party Vehicle. SHC5806Z
Survey Location	NO. 2 ANG MO KIO STREET 63	
Contact Person.	KEK ZHEWEI	
Contact No.	62876666/ 0	Fax No. 62571330
Survey Type	WITHOUT PREJUDICE: WE ADMIT LIABILITY QUANTUM TO BE AGREED:	
Appointed Surveyor	LKK AUTO CONSULTANTS PTE LTD	
Contact Person	NA	Fax No. 68416315
Contact Number.	NA	

FOR DIRECT SETTLEMENT

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

THIRD PARTY SURVEY REQUEST

Cc : Workshop	TRANS-CAB AUTO SERVICES PTE LTD	Attention. NIL
Cc : TP Solicitor	NA	TP Solicitor Fax No. NA
Officer Incharge	KARENT	

IMPORTANT NOTE

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.
 This is a computer generated letter, no signature required.

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Friday, 20 September 2019 2:10 PM
To: 'CWS Motor Claims'; assignments
Cc: 'Karen Tan'; SUR
Subject: RE: SURVEY ASSESSMENT - D19006019MFSH/1
Attachments: CSFCI19016588K1qd3.pdf

Dear Karen,

Enclosed herewith preliminary advice of SHC 5806Z.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAUTO) <admin-d@lkkauto.com>
Sent: Thursday, 19 September 2019 10:17 AM
To: 'CWS Motor Claims' <cwsmotorclaims@msfirstcapital.com.sg>; assignments <assignments@lkkauto.com>
Cc: 'Karen Tan' <karentan@msfirstcapital.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: SURVEY ASSESSMENT - D19006019MFSH/1

Dear Sir/Mdm,

Thank you for the assignment.

Best Regards

G.NIVITHA

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: CWS Motor Claims [<mailto:cwsmotorclaims@msfirstcapital.com.sg>]
Sent: Wednesday, 18 September 2019 5:47 PM
To: ASSIGNMENTS@LKKAUTO.COM
Cc: CWS Motor Claims <cwsmotorclaims@msfirstcapital.com.sg>; Karen Tan <karentan@msfirstcapital.com.sg>
Subject: PRI: SURVEY ASSESSMENT - D19006019MFSH/1

Dear Sir/Mdm,

We refer to the above reference.

Please find attached the necessary documents for survey.

Kindly submit your report via CWS within the next 14 days.

Enquire PARF/COE Rebate for Registered Vehicle

The information contained herein is correct as at 17 Sep 2019

<https://vix.scribd.com/document/68907089/Introduction-to-Probability-and-Statistics>

Trans-cab Auto Services Pte Ltd**AAD1909-14**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5806Z

4s \$2150 / 2015

Vehicle No.:

SHC 5806Z

Chassis No.:

VF1ABL15AUC282180

Vehicle Make:

RENAULT

Vehicle Model:

LATITUDE

Date of Accident :

17.9.19

Third Party Insurer :

FCIL

Date of Registration :

3/8/2015

		PART		LIST
1	1	BUMPER COVER REAR	- Part	\$ 561.70
2	1	BUMPER LOWER REAR	-	\$ 411.90
3	1	BUMPER BRACKET CTR REAR	X sue	\$ 98.10
4	1	BUMPER BRACKET SIDE RH REAR	X sue	\$ 82.10
5	1	BUMPER RETAINER RH REAR	X sue	\$ 59.80
6	1	BUMPER REFLECTOR RH	-	\$ 16.60
7	1	BUMPER BRACKET SIDE LH REAR	X sue	\$ 80.80
8	1	BUMPER RETAINER LH REAR	X sue	\$ 54.20
9	1	BUMPER REFLECTOR LH	X sue	\$ 16.60
10	1	BUMPER BEAM REAR	- Part	\$ 547.80
11	1	BUMPER BEAM BRACKET LH REAR	X sue	\$ 114.50
12	1	BUMPER BEAM BRACKET RH REAR	X sue	\$ 100.90
13	1	OUTER PANEL REAR (End Panel)	X sue	\$ 745.80
14	1	OUTER PANEL REAR (End Panel) TRIM	X sue	\$ 404.56
15	1	TAILLAMP RH	X sue	\$ 313.10
16	1	TAILLAMP PANEL RH	X sue	\$ 401.40
17	1	TAILLAMP LH	X sue	\$ 401.40
18	1	TAILLAMP PANEL LH	X sue	\$ 401.40
19	1	BOOT REAR	X sue	\$ 1,677.20
20	1	BOOT FINISHER	X sue	\$ 344.70
21	1	BOOT WHEATERSTRIP	X sue	\$ 178.20
22	1	BOOT REFLECTOR LAMP LH	X sue	\$ 277.70
23	1	BOOT REFLECTOR LAMP RH	X sue	\$ 277.70
24	1	BOOT BADGE 'RENAULT'	X 2	\$ 82.40
25	1	BOOT BADGE	X 2	\$ 95.80
26	1	BOOT STRUT LH	X sue	\$ 145.10
27	1	BOOT STRUT RH	X sue	\$ 145.10

Trans-cab Auto Services Pte Ltd**AAD1909-143**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5806Z

28	1	BOOT HINGE LH	X <i>see</i>	\$	254.20
29	1	BOOT HINGE RH	X <i>see</i>	\$	253.80
30	1	BOOT INNER TRIM BOARD	X <i>see</i>	\$	611.00
31	1	BOOT SWITCH	X <i>see</i>	\$	113.00
32	1	BOOT LOCK	X <i>see</i>	\$	246.60
33	1	BOOT LOCK CATCH	X <i>see</i>	\$	41.70
34	1	EXHAUST CAP REAR	X <i>see</i>	\$	125.40
35	1	EXHAUST REAR	X <i>see</i>	\$	5,263.60

TOTAL \$ 14,945.86**10% \$ 1,494.59****\$ 13,451.27****Special Nett**

1	1SET	PARKING AID	<i>slide</i>	\$	700.00 <i>400</i>
2	1SET	REAR BUMPER CLIP	<i>see</i>	\$	66.00
3	1SET	BUMPER BRACKET CTR CLIP	X <i>see</i>	\$	33.00
4	1SET	BUMPER BRACKET SIDE CLIP RH RR	X <i>see</i>	\$	10.00
5	1SET	BUMPER RETAINER RH CLIP RR	X <i>see</i>	\$	20.00
6	1SET	BUMPER BRACKET SIDE CLIP LH RR	X <i>see</i>	\$	10.00
7	1SET	BUMPER RETAINER CLIP LH RR	X <i>see</i>	\$	20.00
8	1SET	BUMPER LOWER REAR RIVET	<i>see</i>	\$	22.00
9	1SET	BUMPER LOWER REAR CLIP	<i>see</i>	\$	66.00
10	1	BOOT STICKER "Trans-cab"	X <i>see</i>	\$	30.00
11	1	BOOT STICKER "6555-3333"	X <i>see</i>	\$	30.00
12	1	EXHAUST MOUNTING REAR	X <i>see</i>	\$	16.00
13	2	REAR WINDSCREEN SEALANT	X <i>see</i>	\$	80.00
14	1	WINDSCREEN MOULDING	X <i>see</i>	\$	100.00
15	1	REAR WINDSCREEN INNER SPONGE SEAL	X <i>see</i>	\$	100.00
16	1	BOOT INNER TRIM CLIP	X <i>see</i>	\$	45.00
17	1SET	BOOT FINISHER CLIP	X <i>see</i>	\$	24.20
18	1	TAILLAMP CLIP LH	X <i>see</i>	\$	5.00
19	1	TAILLAMP CLIP RH	X <i>see</i>	\$	5.00
20	1	Rear Bumper Protector	X <i>see</i>	\$	100.00

TOTAL \$ 1,482.20**TOTAL PARTS \$ 14,933.47**

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5806ZLKK Auto Consultants hereby notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "without prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

AAD1909-143

Acknowledged by Repairer

Signature:

LABOURTo transfer of bootlid fittings, attachments and
perform water seepage test.\$ 170.00 X^mTo remove and refit interior fittings, trimings,
garnish, fittings and other, to enable repair.\$ 380.00 X^m

To Rust-Proofing Of The Affected Areas.

\$ 170.00 X^m

To Check Electrical Lighting Concerned.

\$ 170.00 X^m

To transfer of tire, rim and on wheel balancing.

\$ 170.00 X^m

To reinstall rear bumper parking sensor.

\$ ~~170.00~~ 60Panel Beating, Knocking And Straightening The
Necessary Portion, Remove And Renewal Of Parts,
Adjust And Realign The Same\$ ~~4,500.00~~ 300To transfer of rear end panel fittings, attachment
and perform water seepage test.\$ 170.00 X^mTo transfer of rear windscreen glass to facilitate
bodywork repair.\$ 170.00 X^mTo check steering geometry and computer wheel
alignment\$ 220.00 X^mTo transfer of rear bumper fittings, attachment and
perform water seepage test.\$ 380.00 X^mLabour charge to mount and dismount vehicle on
jig bench, to facilitate repair.\$ 380.00 X^m

Putty and spray painting of the affected portion.

\$ ~~4,500.00~~ 220

To repair and realign rear exhaust pipe.

\$ ~~170.00~~ 50**TOTAL \$ 11,720.00****Over All Total \$ 26,653.47****LUMP SUM (REPAIR DAY) 15 DAYS**

Kala (C/KK)

19/9/19 1700L

2 Days

4/5

After Repair photo



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD			Ref : CS/FCI19016588/K1qd3n2	
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Date : 30-09-2019	
			Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHA 4076E	Veh. Inspected	SHC 5806Z	
Policy No.		Coverage (\$)	0.00	
Claim No.	D19006019MFSH	Excess (\$)	0.00	
Assign From	KARENT	Assign Date	18/09/2019	
2. Vehicle Particulars & Condition				
Make & Model	RENAULT LATITUDE	c.c	1995	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	VF1ABL15AUC282180	Colour	RED / WHITE	
Odometer	527181	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	GITI COMFORT	7 mm	
L/H Front Tyre	215/60 R16	GITI COMFORT	7 mm	
R/H Rear Tyre	215/60 R16	GITI COMFORT	7 mm	
L/H Rear Tyre	215/60 R16	GITI COMFORT	7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	17/09/2019	Inspection Date	19/09/2019	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A)DAMAGES CONSISTENT TO ACCIDENT REPORT. B)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. C)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		2 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 5806Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER REAR	DEFORMED	561.70	561.70
1	BUMPER LOWER REAR	CRACKED	411.90	411.90
1	BUMPER BRACKET CTR REAR	SERVICEABLE	98.10	-
1	BUMPER BRACKET SIDE RH REAR	SERVICEABLE	82.10	-
1	BUMPER RETAINER RH REAR	SERVICEABLE	59.80	-
1	BUMPER REFLECTOR RH	CRACKED	16.60	16.60
1	BUMPER BRACKET SIDE LH REAR	SERVICEABLE	80.80	-
1	BUMPER RETAINER LH REAR	SERVICEABLE	54.20	-
1	BUMPER REFLECTOR LH	SERVICEABLE	16.60	-
1	BUMPER BEAM REAR	BENT	547.80	547.80
1	BUMPER BEAM BRACKET LH REAR	SERVICEABLE	114.50	-
1	BUMPER BEAM BRACKET RH REAR	SERVICEABLE	100.90	-
1	OUTER PANEL REAR (END PANEL)	SERVICEABLE	745.80	-
1	OUTER PANEL REAR (END PANEL) TRIM	SERVICEABLE	404.56	-
1	TAILLAMP RH	SERVICEABLE	313.10	-
1	TAILLAMP PANEL RH	SERVICEABLE	401.40	-
1	TAILLAMP LH	SERVICEABLE	401.40	-
1	TAILLAMP PANEL LH	SERVICEABLE	401.40	-
1	BOOT REAR	SERVICEABLE	1,677.20	-
1	BOOT FINISHER	SERVICEABLE	344.70	-
1	BOOT WEATHERSTRIP	SERVICEABLE	178.20	-
1	BOOT REFLECTOR LAMP LH	SERVICEABLE	277.70	-
1	BOOT REFLECTOR LAMP RH	SERVICEABLE	277.70	-
1	BOOT BADGE "RENAULT"	NOT NECESSARY	82.40	-
1	BOOT BADGE	NOT NECESSARY	95.80	-
1	BOOT STRUT LH	SERVICEABLE	145.10	-
1	BOOT STRUT RH	SERVICEABLE	145.10	-
1	BOOT HINGE LH	SERVICEABLE	254.20	-
1	BOOT HINGE RH	SERVICEABLE	253.80	-
1	BOOT INNER TRIM BOARD	SERVICEABLE	611.00	-
1	BOOT SWITCH	SERVICEABLE	113.00	-

Report Ref No. CS/FCI19016588/K1qd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BOOT LOCK	SERVICEABLE	246.60	-
1	BOOT LOCK CATCH	SERVICEABLE	41.70	-
1	EXHAUST CAP REAR	CUT	125.40	125.40
1	EXHAUST REAR	SERVICEABLE	5,263.60	-
	LESS 10% DISCOUNT		-1,494.59	-166.34
			13,451.27	1,497.06
	SPECIAL NETT ITEMS			
1	SET PARKING AID (SN)	SHORTED	700.00	400.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	66.00	66.00
1	SET BUMPER BRACKET CTR CLIP (SN)	NOT NECESSARY	33.00	-
1	SET BUMPER BRACKET SIDE CLIP RH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER RH CLIP RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER BRACKET SIDE CLIP LH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER CLIP LH RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER LOWER REAR RIVET (SN)	NECESSARY	22.00	22.00
1	SET BUMPER LOWER REAR CLIP (SN)	NECESSARY	66.00	66.00
1	BOOT STICKER "TRANS-CAB" (SN)	NOT NECESSARY	30.00	-
1	BOOT STICKER "6555-3333" (SN)	NOT NECESSARY	30.00	-
1	EXHAUST MOUNTING REAR (SN)	SERVICEABLE	16.00	-
2	REAR WINDSCREEN SEALANT (SN)	NOT NECESSARY	80.00	-
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	100.00	-
1	REAR WINDSCREEN INNER SPONGE SEAL (SN)	NOT NECESSARY	100.00	-
1	BOOT INNER TRIM CLIP (SN)	NOT NECESSARY	45.00	-
1	SET BOOT FINISHER CLIP (SN)	NOT NECESSARY	24.20	-
1	TAILLAMP CLIP LH (SN)	NOT NECESSARY	5.00	-
1	TAILLAMP CLIP RH (SN)	NOT NECESSARY	5.00	-
1	REAR BUMPER PROTECTOR (SN)	NOT NECESSARY	100.00	-
			1,482.20	554.00
	LABOUR			
	TO TRANSFER OF BOOTLID FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-

Report Ref No. CS/FCI19016588/K1qd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH, FITTINGS AND OTHER,TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	TO RUST-PROOFING OF THE AFFECTED AREAS.	NOT NECESSARY	170.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.	NOT NECESSARY	170.00	-
	TO TRANSFER OF TIRE,RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO REINSTALL REAR BUMPER PARKING SENSOR.		170.00	60.00
	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME.		4,500.00	300.00
	TO TRANSFER OF REAR END PANEL FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR WINDSCREEN GLASS TO FACILITATE BODYWORK REPAIR.	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER OF REAR BUMPER FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH,TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		4,500.00	220.00
	TO REPAIR AND REALIGN REAR EXHAUST PIPE.		170.00	50.00
			11,720.00	630.00
GRAND TOTAL			26,653.47	2,681.06
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,150.00

Report Ref No. CS/FCI19016588/K1qd3n2

KALVIN ANG WEI KUN

Automotive Assessor / Investigator

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.