



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

EQ INSURANCE COMPANY LTD  
5 MAXWELL ROAD  
#17-00 TOWER BLOCK  
MND COMPLEX  
SINGAPORE 069110

INV No. AC2005362  
INV Date 03/08/2020  
Reference CC4/EQI19016925/Kga3q2  
Code EQI



#### PROFESSIONAL SERVICE FEE

Vehicle No. SJQ 7620G  
Insured Veh. YN 3782L  
Claim No. DM19HO02647-JG  
Policy No. DMCPHQ19-003294  
Accident Date 20/09/2019  
Inspection Date 25/09/2019

Description	Total
Survey Inspection	160.00
Digital Photographs	
Transportation	
<b>Subtotal</b>	<b>160.00</b>
<b>GST (7%)</b>	<b>11.20</b>
<b>Grand Total</b>	<b>171.20</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

EQ INSURANCE COMPANY LTD

Ref : CC4/EQ119016925/Kga3q2

5 MAXWELL ROAD  
#17-00 TOWER BLOCK  
MND COMPLEXSINGAPORE 069110

Date : 03-08-2020



Code : EQI

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	YN 3782L	<b>Veh. Inspected</b>	SJQ 7620G
<b>Policy No.</b>	DMCPHQ19-003294	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	DM19HO02647-JG	<b>Excess (\$)</b>	0.00
<b>Assign From</b>		<b>Assign Date</b>	25/09/2019

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	TOYOTA VIOS (A)	<b>c.c</b>	1497
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2009
<b>Chassis No.</b>	MR053HY9305112847	<b>Colour</b>	METALLIC BLUE
<b>Odometer</b>	125765	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	STANDARD ALLOY RIM
<b>General</b>	GOOD		

### 3. Conditions of Tyres

	Size	Make	Balance
<b>R/H Front Tyre</b>	195/65 R15	KAPSEN	8 mm
<b>L/H Front Tyre</b>	195/65 R15	KAPSEN	8 mm
<b>R/H Rear Tyre</b>	195/65 R15	BRIDGESTONE	7 mm
<b>L/H Rear Tyre</b>	195/65 R15	BRIDGESTONE	7 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION.  
DAMAGES SEE DETAILS.

### 5. General Information

<b>Accident Date</b>	20/09/2019	<b>Inspection Date</b>	25/09/2019
<b>Survey held at</b>	SUPREME AUTO SERVICE PTE LTD 176 SIN MING DRIVE #02-01 SIN MING AUTOCARE SINGAPORE 575721		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.  
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **3 Working Days**



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJQ 7620G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
1	FRONT HEAD LIGHT	CUT	415.60	415.60
1	FRONT BUMPER	CRACKED	486.30	486.30
15	FRONT BUMPER CLIP @\$3.50	NECESSARY	52.50	52.50
1	FRONT BUMPER GRILLE	SERVICEABLE	85.20	-
1	FRONT FENDER	BENT	390.80	390.80
	LESS 25% DISCOUNT		-357.60	-336.30
			1,072.80	1,008.90
<b>LABOUR</b>				
	TO REMOVE AND REPLACE THE PARTS MENTIONED ABOVE ,PANEL BEAT AND REALIGN THE NECESSARY AFFECTED AREAS.		400.00	300.00
	TO APPLY PUTTY & SPRAY PAINTING ON AFFECTED AREAS.		600.00	400.00
	TO CHECK WIRING SYSTEM.		50.00	20.00
			1,050.00	720.00
<b>GRAND TOTAL</b>			<b>2,122.80</b>	<b>1,728.90</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>1,050.00</b>

Report Ref No. CC4/EQ119016925/Kga3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJQ 7620G

INSPECTION

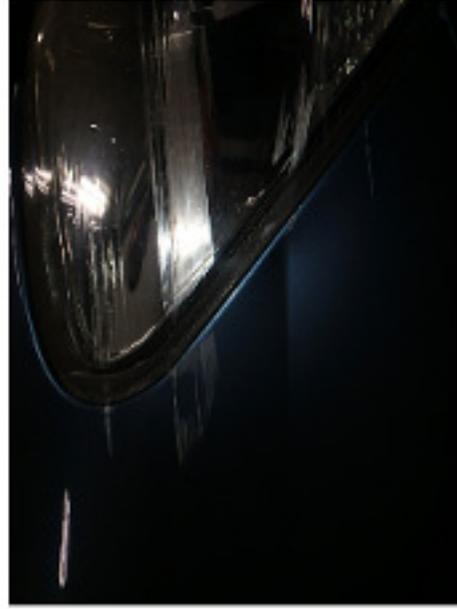




## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

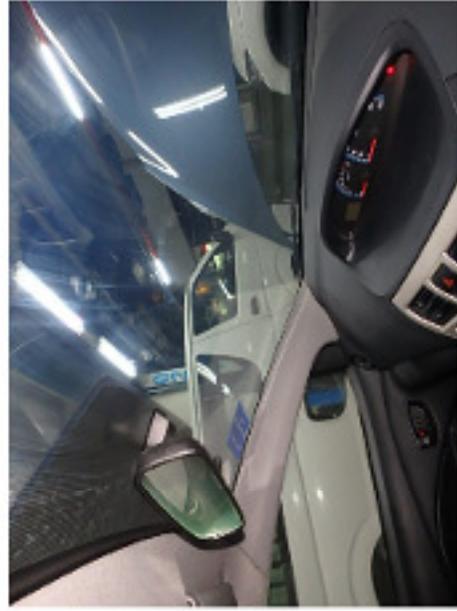



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

