

ALG CC31A29M017217/THF302

Taufik

Meriman

① TP / WS / TP RES / OD RES / EVA / INV / MV

SNM 86604, 2019 June

① 14 Cycle / Bus / Van / Lorry / Taxi / Prime Mover / Truck / Trailer or

Make: Audi Q2 999

Colour: Red AC Insured / 50 / N / NA

Sp Reading: 2243 TP Res Insured / 50 / N / NA

Engine: WAM 77 ZG 72CA 022515

Gen Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Wheel: Nil / SBRim / STD ARim or

Tyre Size: F: 215/55R17

R: -

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU (PIR) SUMI /

TOYO / YOKO or

Front: 7 mm R/Bal 7 mm

L/Bal: 2 mm U/Bal: 7 mm

D.O.A: 30/9/19 @ 1030

Survey held at: Premium Behari

Type of Damage: (P) Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision

Excess: hbq 4500/-

NS	OS

Est. or Market Value

#120K 7136K

Est. Accident Spot Consistent? Yes or No

Est. EP Spot Consistent? Yes or No

Est. Expense days Res: Yes or No

Est. Sum % J Val: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date Person Contacted

Date / Time Action / Instruction

SNM 86604 - x

110 @ 14:36 - Revert via meriman

2110 @ 17:04 - mandat approved by Victor Koh

2110 @ 4:40pm email premium advise repair excess \$4500/-

Part by part \$29,657.12, 12 days (red: 23739.88, 44%)

RECEIVED 06 FEB 2020

Report Format

Prel. Report

512 Typist

Final Report

Days Of Repair: 12

Resurvey No. of Trip:

Survey Fee

200

Add Fee:  Site Insp. \$5

Trip Cost \$5

Trip Cost \$5

Trip Cost \$5

Report Format

Est. Sum \$29,657.12

11

211

## Denise Tay (LKKAuto)

---

**From:** Denise Tay (LKKAuto)  
**Sent:** Wednesday, 2 October 2019 5:40 PM  
**To:** 'Premiumauto Claims'  
**Cc:** SUR; Admin-D (LKKAuto)  
**Subject:** RE: OD CLAIM FOR SMM 8660 U

Dear Sir,

As instructed by our client, please proceed to repair the insured vehicle **SMM 8660U (Excess S\$4,500.00 /-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

\*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

**Denise Tay** | Case Handler

**LKK Auto Consultants Pte Ltd**

Phone: 6256-3561 | email: [denisetay@lkkauto.com](mailto:denisetay@lkkauto.com) | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

---

**From:** Premiumauto Claims <[claims@premiumauto.com.sg](mailto:claims@premiumauto.com.sg)>  
**Sent:** Tuesday, 1 October 2019 2:52 PM  
**To:** Denise Tay (LKKAuto) <[denisetay@lkkauto.com](mailto:denisetay@lkkauto.com)>  
**Cc:** SUR <[sur@lkkauto.com](mailto:sur@lkkauto.com)>; Admin-D (LKKAuto) <[admin-d@lkkauto.com](mailto:admin-d@lkkauto.com)>; Claims <[claims@premiumauto.com.sg](mailto:claims@premiumauto.com.sg)>  
**Subject:** RE: OD CLAIM FOR SMM 8660 U

Dear Denise,

Kindly assist to update us repair approval. Attached is the surveyor marked estimate for your reference.

Thank you.

**Best Regards,**  
**Kelvin Khoo**  
**Claims Advisor**

**Premium Automobiles Pte Ltd (Reg No 199902271W)**

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183

e. [claims@premiumauto.com.sg](mailto:claims@premiumauto.com.sg) w. [www.audi.com.sg](http://www.audi.com.sg)

**Audi Showroom, Audi Centre** 281 Alexandra Road Singapore 159938 p. +65 6836 2223

> Back to OneMotoring

### Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	791F
Vehicle Details	
Vehicle No.:	SMM8660U
Vehicle to be Exported:	No
Intended Deregistration Date:	01 Oct 2019
Vehicle Make:	AUDI
Vehicle Model:	Q2 1.0 TFSI S TRONIC
Primary Colour:	Red
Manufacturing Year:	2018
Engine No.:	CHZB23255
Chassis No.:	WAUZZZGA2KA022513
Maximum Power Output:	85.0 kW (113 bhp)
Open Market Value:	\$23,678.00
Original Registration Date:	27 Jun 2019
First Registration Date:	27 Jun 2019
Transfer Count:	0
Actual ARF Paid:	\$25,150.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	26 Jun 2029
PARF Rebate Amount:	\$18,862.00
Intended COE Rebate Details	
COE Expiry Date:	26 Jun 2029
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$27,000.00
COE Rebate Amount:	\$26,287.00
<b>Total Rebate Amount:</b>	<b>\$45,149.00</b>

The information contained herein is correct as at 01 Oct 2019

OK

## View Received Message

This mail is associated with :

**\*SMM8660U (9377473010SG)**  
OD  
Sep 26 2019 6:10PM  
[FENG ZEPING]  
Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

**From** AIG Asia Pacific Insurance Pte. Ltd. (AIG\_SG), sent on 02/10/2019 17:04 PM.  
**To** LKK\_HQ  
**Subject** Alert - Adj Mandate Approved (S\$20717.00) - SMM8660U - Claim Handler: Chan, Yoke Shi

Approved:20717.00:Re-inspection to be done for damage check and supplementary items / labour.

### DOCUMENTS SUMMARY

There are no documents.

**Note: This document has not been finalised.**  
**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.  
AIG Building  
78 Shenton Way #08-16  
Singapore 079120

From: LKK Auto Consultants Pte Ltd  
51 Ubi Ave 1 #01-25  
Paya Ubi Industrial Park  
Singapore 408933

Attn:

Date: 01 Oct 2019

**Preliminary Advice**

Vehicle No	: SMM8660U	Accident Date	: 26/09/2019
Make	: AUDI Q2	Policy No.	: 1900114594
Assignment Date	: 01/10/2019	Excess	: S\$0.00
Date of Inspection	: 30/09/2019	Est. Duration of Repair	: 8.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (UBI) 55 UBI ROAD 1 SINGAPORE 408699		

**Point of Impact / General Description of Damages**

The vehicle sustained impact / damages front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	53,400.00
Revised Amount	:S\$	20,717.00
Check Items (Estimated)	:S\$	22,559.00
Total	:S\$	43,276.00
Lump Sum Repair	:S\$	

**Total Loss Consideration**

New for Old Value	:S\$	
Pre-Accident Value	:S\$	120,000.00
COE / PARF Rebate	:S\$	45,149.00
Salvage Value	:S\$	
Margin for Repair	:S\$	74,851.00

**Remarks**

- ( x ) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- ( ) The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- ( ) Other comments :

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	27/09/2019 14:35
Date Of Accident	26/09/2019 18:10
Exact Location Of Accident	JUNCTION FROM BOONLAY WAY TO JURONG TOWN HALL ROAD
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMM8660U
<b>Insured/Policyholder</b>	
Name Of Registered Owner	FENG ZEPING
NRIC No	S7467791F
Email Address	KEVIN.FENGZEPING@GMAIL.COM
Mobile Phone No	(LOCAL) +65-96257185
Alternative Phone No	OFFICE-96257185

### Vehicle Particulars

Manufacturer	AUDI
Model	AUDI Q2 1.0 TFSI S TRONIC
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	

Vehicle Category	PRIVATE CAR
------------------	-------------

### Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	YES
Policy Number	1900114594
Cover Note Number	

### Driver

Name of Driver	FENG ZEPING
NRIC No	S7467791F
Date Of Birth	02/03/1974
Occupation	INDOOR
Date Of Driving Pass	01/07/2019
Driving Experience	0 YEAR AND 2 MONTH
Gender	MALE
Mobile Number	(LOCAL) +65-96257185
Fax Number	
Contact Number	OFFICE-96257185
Email Address	KEVIN.FENGZEPING@GMAIL.COM

Address 12 CHOA CHU KANG GROVE  
 #06-28  
 Postcode 688208  
 Was driver an employee of the Insured's Company NO  
 If No, Relationship of the Driver with the Insured OWNER  
 Vehicle Registration Number of Driver's Own Vehicle -  
 -  
 Insurance Company of Driver's Own Vehicle -  
 -

**General Information of the Accident**

Type Of Accident COLLISION - HEAD TO REAR  
 Weather Conditions CLEAR  
 Road Surface DRY

**Other Information**

Was any foreign vehicle involved in this accident? NO  
 Number of vehicles (including own vehicle) involved in the accident 2  
 Was any body injured in the Accident? NO  
 Was any injured conveyed to hospital by ambulance?  
 Was any other material or property damaged? YES  
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO  
 Number of Passengers (Including Driver) 2  
 Passenger 1 NAME: : LE PEIHAN  
 GENDER: : FEMALE

**Details of Police Action**

Was the accident reported to the police? NO  
 If Yes, Please state which Police Station  
 Was notice of intended Prosecution given? NO  
 If Yes, against whom?

**Circumstances of Accident**

DURING LEFT TURN, THE SPEED OF CAR REDUCES TO LOW ALREADY. AT THAT MOMENT, AN ANT WAS HITING ME ON THE NECK SO I WAS TRYING TO REMOVE IT. JUST AT THAT MOMENT I DIDNT TAKE GOOD CARE SO MY CAR KNOCKED ONE LORRY INFRONT OF ME AT THE REAR PORTION.

**Attachment(s)**

Are accident photos available for attachment? YES  
 Was there any video captured by Car Camera? NO  
 Was there any audio recorded? NO

**DETAILS OF OTHER VEHICLE PROPERTY 1**

Vehicle Registration Number GBC2754E  
 Vehicle Make/Model/Colour  
 Details Of Properties  
 Vehicle Category PRIVATE CAR  
 Name of Driver  
 NRIC/Passport Number  
 Contact Number  
 Address  
 Postcode  
 Insurance Company Name

## Sketch Plan

### SKETCH PLAN

#### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodging of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
- (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
  - (ii) for complying with requirements under any regulations, laws or court orders.

冯泽平

Policyholder's Signature  
Date & Time:

冯泽平

Driver's Signature  
(If driver is not the policyholder)  
Date & Time:




Reporting Centre Personnel's Signature  
Name: 陈少昊, Tony  
NRIC/PIN No.: G8C87792E

Nature Of Damage

No. Of Passenger (Including Driver)

Sketch Plan #2

SKETCH PLAN

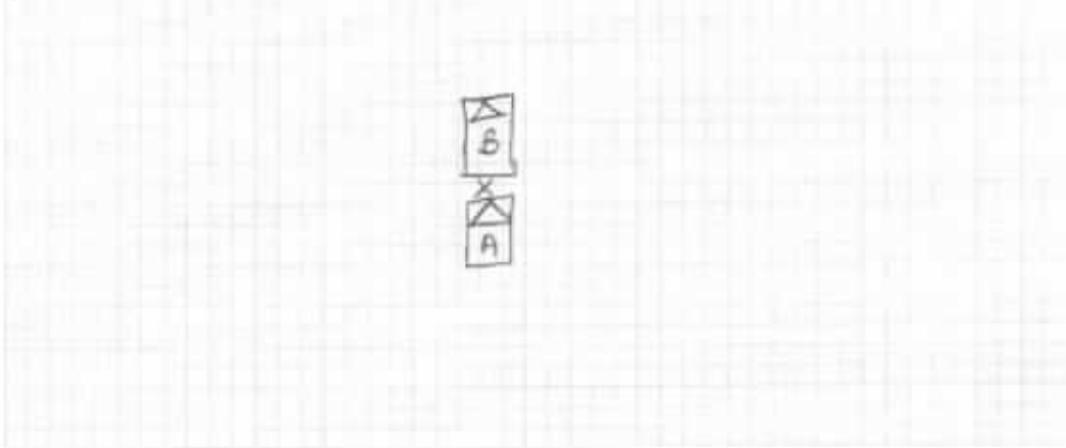

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

During a left turn, the speed of car reduced to low already. At that moment an ant was biting me on the neck so I was trying to remove it. Just at that moment I didn't take good care so my car knocked the one lorry in front of me at the rear portion.

DECLARATION

We declare the foregoing particulars are true in every respect.

冯译平  
Policyholder's Signature  
Date & Time:

冯译平  
Driver's Signature  
(If driver is not the policyholder)  
Date & Time:

  
Reporting Centre Personnel's Signature  
Name: Ash Chi HAO, Boy  
NRIC/ID No: GRS87752K

Accident Photo







AIG Asia Pacific Insurance Pte. Ltd  
AIG Building  
78 Shenton Way  
#07-16

**MOTOR ACCIDENT INTERVIEW FORM**

NAME : Feng Zeping  
VEHICLE NUMBER : SHM 8660U  
DATE/ TIME OF ACCIDENT : 26/9/2019  
PLACE OF ACCIDENT : Junction from Boon Lay Way to Jurong Town Hall Road  
THIRD PARTY VEHICLE (IF ANY) : \_\_\_\_\_

.....  
WHERE DID YOU START YOUR JOURNEY AND WHERE WAS THE INTENDED DESTINATION BEFORE THE ACCIDENT?

Started from Block S19, Jurong West, destination is  
12 Choa Chu Kang Grove

DID YOU DRINK ANY ALCOHOLIC DRINKS BEFORE YOU DRIVE ON THE DAY OF THE ACCIDENT? IF YES, DID THE TRAFFIC POLICE CONDUCT ANY BREATHE-ANALYSER TEST ON YOU? IF YES, WHAT WAS THE RESULTS?

No.

WHAT IS THE TYPE OF COLLISION AND THE EXTENSIVENESS OF THE DAMAGES TO ALL VEHICLES INVOLVED?

Hit the rear.

WERE YOU OR YOUR PASSENGER/S INJURED? IF INJURED, WHICH HOSPITAL? WERE YOU TAKEN TO THE TRAFFIC POLICE FOR INVESTIGATION?

No.

Feng Zeping 冯泽平

NAME:

**I AFFIRMED THE ABOVE INFORMATION IS GIVEN TO MY BEST KNOWLEDGE**

## UNDERTAKING

I, Feng Zeping, (NRIC No. S 791F), hereby confirm that the Singapore Accident Statement lodged by me on 26/9/2019 at 6.10 PM hours pertaining to the accident involving motor car Reg. No: SMM 8660U, in which I was the driver are true and accurate to the best of my knowledge, information and belief.

I acknowledge that my insurers are not liable under the contract of insurance if there is a breach of policy terms and conditions.

In the event that an unrelated/unreported third party property or injury claim arises or there is evidence emerges that there is a breach of policy terms and conditions, I irrevocably undertake to absolve my insurer from all liability under the contract of insurance and I undertake to re-pay any sums paid by my insurers pursuant to the contract of insurance upon receipt of written demand by my insurers.

Signature : 冯泽平  
Name of Insured / Driver : Feng Zeping  
Nric No. : S 791F  
Date : 27/9/2019

Signature : 冯泽平  
Name of Policyholder : Feng Zeping  
Nric No. : S 791F  
Date : 27/9/2019

# Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

WIP:13953

## Telefax

Estimate : Accident Repairs  
Workshop : Ubi Road 1  
Contact No : 6366 2323  
Fax No : 6841 1183  
Reference : PA/OD/1169/2019/GW  
Date : 28-Sep-19

Vehicle in workshop. Kindly arrange for survey.

### AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr. Feng ZePing  
Address : 12 Choa Chu Kang Grove  
: #06-28  
Singapore 688208  
Telephone : HP +65 96257185  
Type of Claim : Own Damage Claims  
Policy No. : 1900114594  
Vehicle No : **SMM 8660 U**  
Model Code : Q2 1.0 TFSI S TRONIC  
Model / Year : 29/9/2017  
Engine No : CHZ 823255  
Chassis No : WAUZZZGA2KA022513  
Mileage :  
Date In :  
Estimated By : Johnny Boo / Allan Wu  
Accident Date : 26-Sep-19  
Place of Accident : Junction from BoonLay Way to Jurong

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Estimated Labour Charges for Accident Vehicle SMM 8660 U

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
1	To tow vehicle from accident scene.	S/N \$ 280.00	X nm
2	To remove, check and reinstall front wire harness for headlights, horns, outside temperature sensor and headlight washer assy.	S/N \$ 360.00	✓ ✓
3	To remove and renew aircon condenser, radiator and additional radiator check electrical fans and control unit. Pressurise cooling system. To carry out vacuum and regas.	S/N \$ 1,400.00	? ✓
4	To dismantle rhs front door panel trim. To remove and reinstall rhs wing mirror assy.	S/N \$ 300.00	✓ ✓
5	To remove and renew front windscreen.	S/N \$ 480.00	✓ ✓
6	To install front windscreen solar film.	S/N \$ 400.00	✓ X nm.
<b>TOTAL LABOUR CHARGES</b>		<b>\$ 3,220.00</b>	

*↳ sales agreement.*

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Estimated Labour Charges for Accident Vehicle SMM 8660 U

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
7	To dismantle and renew front bumper, both front fenders, bonnet and both headlights. To renew front lock carrier and align to position. Re-organise crash management components. Reinstall all parts removed.	\$ 7,200.00	2500. 4000 ✓
8	To respray front bumper, bonnet, hinges, both front fenders, rhs upper A- pillar and rhs front door.	\$ 6,300.00	2750. 2750
9	To carry out diagnostic check.	S/N \$ 192.00	✓ 192
<b>TOTAL LABOUR CHARGES</b>		<b>: \$ 16,912.00</b>	

# Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	FRONT BUMPER	S 1,706.00	de 1364
2	FRONT BUMPER FIXING PARTS	S 314.00	? X nn
3	FRONT BUMPER GRILLE -CENTER	S 179.00	de 443.20
4	FRONT BUMPER AIR GUIDE GRILLE-LH/RH	245.60 2 S 154	LH-? RH-mis
5	FRONT BUMPER END CAP-LH/RH	24.40 2 S 31	LH-? RH-mis
6	FRONT BUMPER SPOILER	S 273.00	? 218 de
7	FRONT BUMPER CLOSING ELEMENT	S 142.00	? X }
8	FRONT BUMPER WHEEL SPOILER-LH/RH	S 62.00	? X } nn
9	FRONT BUMPER ADAPTER-LH	S 32.00	? X }
10	FRONT BUMPER ADAPTER-RH	S 38.00	? X }
11	RADIATOR GRILLE	S 1,301.00	av 1040.00
12	RADIATOR GRILLE STRIKER PLATE	S 114.00	? 91.20 bt
13	FOAM FILLER PIECE	S 71.00	? 50.09 de
14	FRONT BUMPER CARRIER	S 625.00	? X nn
15	FRONT BUMPER TOP COVER	S 91.00	de 72.50
16	FRONT BUMPER GUIDE SECTION-RH	S 32.00	de 25.60
17	SIGN CAUTION	S 13.00	de 9.70
18	AIR CONDITIONER STICKER	S 7.00	de 5.12
19	SIGNAL HORN-RH	S 180.00	? X nn
20	SIGNAL HORN SPRING SHACKLE-RH	S 29.00	? X nn
<b>SUB-TOTAL SPARE PARTS CHARGES</b>		<b>S 5,579.00</b>	

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved  
Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
21	FRONT FENDER-LH/RH	2 S	2,094.00 <i>bt ✓ 1675.70</i>
22	FRONT FENDER ATTACHMENT PARTS	2 S	72.00 ? <i>X ny</i>
23	FRONT FENDER UPPER BRACKET-LH/RH	2 S <i>14</i>	28.00 <i>LH-? RH-66 ✓</i>
24	FRONT FENDER BRACKET-LH/RH	2 S	86.00 ? <i>68.16 bt ✓</i>
25	FRONT FENDER LOWER BRACKET-LH/RH	2 S	28.00 ? <i>22.08 bt ✓</i>
26	FRONT FENDER BRACE-LH/RH	2 S	58.00 ? <i>40.08 bt ✓</i>
27	FRONT FENDER CLOSING ELEMENT-LH/RH	2 S	60.00 ?
28	FRONT FENDER INSULATION-LH/RH	2 S	138.00 ?
29	FRONT WHEEL HOUSING LINER SEAL-UPPER	2 S	66.00 ? <i>un</i>
30	FRONT WHEEL HOUSING LINER BRACKET-LH/RH	2 S	44.00 ?
31	FRONT WHEEL HOUSING LINER-LH/RH	2 S	366.00 <i>X ny</i>
32	FRONT WHEEL HOUSING LINER ATTACHMENT PARTS	2 S	103.00 <i>X ny</i>
33	BONNET	S	2,549.00 <i>bt ✓ 2039.70</i>
34	BONNET ATTACHMENT PARTS	S	149.00 <i>X ny</i>
35	BONNET LID HINGE-LH/RH	2 S	112.00 <i>bt ✓ 87.48</i>
36	BONNET GAS FILLED STRUT-RH	S	93.00 <i>X ny</i>
37	BONNET GAS FILLED STURT BRACKET-RH	S	31.00 <i>X ny</i>
38	BONNET STRIKER-LH/RH	2 S	200.00 ? <i>159.04 bt ✓</i>
39	BONNET SOUND ABSORBER	S	201.00 ? <i>160.80 de ✓</i>
40	BONNET IMPACT PROTECTION- CENTER	S	27.00 <i>de ✓ 21.70</i>
<b>SUB- TOTAL SPARE PARTS CHARGES</b>			<b>\$ 6,505.00</b>

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved  
Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
41	BONNET IMPACT PROTECTION-LH	\$ 28.00	de - 22
42	BONNET IMPACT PROTECTION-RH	\$ 27.00	de - 21.70
43	BONNET HINGE COVER	2 \$ 74.00	? X nn
44	BONNET HINGE REAR COVER	2 \$ 28.00	? X nn
45	PLENUM CHAMBER COVER	\$ 144.00	? 114.80 de -
46	WATER BOX	\$ 124.00	? X nn
47	BONNET LID LOCK WITH MIRCRO	2 \$ 367.00	? 293.60 bt -
48	BONNET FLAT CONNECTOR HOUSING	\$ 12.00	? X nn
49	BONNET FLAT CONNECTOR HOUSING BRACKET	\$ 6.00	? X nn
50	BONNET BOWDEN CABLE-CENTER	\$ 53.00	? 41.68 dis -
51	BONNET LID LOCK CABLE	\$ 67.00	? X nn
52	BONNET LID LOCK CABLE COVER	\$ 9.00	? X nn
53	BONNET RELEASE ELEMENT	\$ 53.00	? 41.68 bt -
54	BONNET BOWDEN CABLE-LH/RH	2 \$ 106.00	? 83.36 dis -
55	BONNET RELEASE LEVER	\$ 12.00	? 9.60 de -
56	FRONT WHEEL COVER-LH/RH	2 \$ 588.00	? photo 469.60 de -
57	HEALDIGHT MOUNTING-LH/RH	85602 \$ 107	LH - 2, RH - 1
58	LED HEADLIGHT-LH/RH	7185.60 4491 2 \$ 8,982.00	LH - 2, RH - 1
59	LED HEADLIGHT POWER MODULE	\$ 693.00	? X nn
60	LED HEADLIGHT CONTROL UNIT	\$ 508.00	? X nn
<b>SUB-TOTAL SPARE PARTS CHARGES</b>		<b>\$ 12,095.00</b>	

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved  
Spare parts are Special Nett.

04129

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
61	LED HEAT SINK-RH	\$ 666.00	? Y nn
62	HEAD LIGHT VENTILATION HOSE-RH	\$ 26.00	? 20.72 out
63	HEADLIGHT COMPENSATING PIECE	\$ 44.00	? X
64	HEADLIGHT LIFT CYLINDER-RH	\$ 128.00	? X } nx
65	HEADLIGHT WASHER HOSE PIPE	\$ 170.00	? X }
66	LED HEADLIGHT WASHER T PIECE	\$ 27.00	? X }
67	LOCK CARRIER	\$ 907.00	? 725-60 br
68	A/C CONDENSER	\$ 503.00	? X nn
69	A/C REFRIGERANT LINE	\$ 601.00	? X nn
70	A/C REFRIGERANT LINE FOR COMPRESSOR TO CONDENSOR	\$ 461.00	? 36380 br
71	A/C REFRIGERANT LINE BRACKET	\$ 25.00	? X nn
72	RADIATOR	\$ 878.00	? 718-80 br
73	ADDITIONAL RADIATOR	\$ 837.00	? 6866 br
74	RADIATOR BUSH LOWER	2 \$ 18.00	? H.24 dev
75	RADIATOR BRACKET UPPER	2 \$ 77.00	? G1.28 dev
76	COOLANT	\$ 165.00	? 13134 new
77	RADIATOR FAN WITH FAN RING	\$ 1,483.00	? X nn
78	RADIATOR AIR GUIDE-LH /RH	2 \$ 54.00	? 21.36 dev
79	RADIATOR SEAL- RH OUTER	\$ 6.00	? 7.98 new
80	RADIATOR AIR GUIDE-UPPER CENTRE	\$ 19.00	? 15.22 dev
<b>SUB-TOTAL SPARE PARTS CHARGES</b>		<b>\$ 7,076.00</b>	

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved  
Spare parts are Special Nett.

2095

21224

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
81	AIR INTAKE FOR AIR GUIDIE	\$ 53.00	? ah
82	AID INTAKE HOSE	\$ 62.00	? 49.20 dev
83	AIR INTAKE SEAL	\$ 13.00	? } nn
84	AIR INTAKE DUCT	\$ 19.00	? } nn
85	AIR INTAKE FOR WATER DRAINAGE HOSE	\$ 31.00	? } nn
86	AIR INTAKE MANIFOLD	\$ 129.00	? } nn
87	AIR INTAKE AIR FILTER	\$ 259.00	? } nn
88	AIR INTAKE INLET MANIFOLD	\$ 588.00	? } nn
89	AIR INTAKE GASKET	\$ 13.00	? } nn
90	CHARGE AIR COOLER	\$ 692.00	? } nn
91	CHARGE AIR COOLER GASKET	\$ 13.00	? } nn
92	CHARGE AIR COOLER SEAL	\$ 13.00	? } nn
93	FRONT WINDSCREEN	\$ 913.00	OK - 730.40
94	FRONT WINDSCREEN RAIN FOIL SENSOR	\$ 728.00	? 102.40 dev
95	PRIMER	\$ 19.00	OK - 14.88
96	FRONT WINDOW APERTURE SEAL-RH OUTER	\$ 119.00	X } nn
97	FRONT WINDOW GUIDE-RH	\$ 377.00	X } nn
98	EXTERNAL TEMPERATURE SENSOR	\$ 53.00	X } nn
99	FRONT WINDSCREN SEALANT	S/N \$ 200.00	OK - 200
100	FRONT NO. PLATE	S/N \$ 40.00	OK - 40
101	SUNDRIES	\$ 800.00	? 126.80 OK
	<b>TOTAL SPARE PARTS CHARGES</b>	<b>\$ 36,389.00</b>	<b>36408</b>
	<b>TOTAL LABOUR CHARGES</b>	<b>\$ 16,912.00</b>	<b>16992</b>
	<b>GRAND TOTAL</b>	<b>\$ 53,301.00</b>	<b>53400</b>

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved  
Spare parts are Special Nett.

53495-26



# Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel: (65) 6366 2323 Fax: (65) 6841 1183

## Supplementary Estimate 1

GST Reg No. 19-9902271-W

**AIG Asia Pacific Insurance Pte Ltd**  
78 Shenton Way  
#07-16 AIG Building  
Singapore 079120  
Attn: Mr. Adrian Ling - Motor Claims Dept  
Tel: 6841 0055 - Fax: 6256 4315

Estimate No. PA/OD/1169/2019/GW  
Date 9-Oct-19  
Service Advisor Glory Tan  
Pages 1 of 1  
Regn No SMM 8660 U  
Model No Q2 1.0 TFSI S TRONIC

Quantity	Description	Unit Price	Amount
<b>Parts</b>			
1	Guide section	\$ 32.00	ck ✓ 25.60
2	Front fender top bracket rhs	\$ 21.00	ck ✓ 16.32
3	Sealing strip for radiator rhs	\$ 16.00	ck ✓ 12.48
4	Cover for air intake duct	\$ 27.00	ck ✓ 21.36
<b>TOTAL</b>		<b>\$</b>	<b>96.00</b>

For Premium Automobiles Pte Ltd

Authorized Signature

Additional 3 days  
e-mail to claims

# Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

WIP:13953

## Telefax

Estimate : Accident Repairs  
Workshop : Ubi Road 1  
Contact No : 6366 2323  
Fax No : 6841 1183  
Reference : PA/OD/1169/2019/GW  
Date : 28-Sep-19

Vehicle in workshop. Kindly arrange for survey.

### AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way  
#07-16 AIG Building  
Singapore 079120

Hi Adrian, Taufikh  
We took 14 days exclude 2 Sundays  
Jb - 4 Nov 19

Attn: Mr. Adrian Ling - Motor Claims Dept  
Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr. Feng ZePing  
Address : 12 Choa Chu Kang Grove  
: #06-28  
Singapore 688208  
Telephone : HP +65 96257185  
Type of Claim : Own Damage Claims  
Policy No. : 1900114594  
Vehicle No : **SMM 8660 U**  
Model Code : Q2 1.0 TFSI S TRONIC  
Model / Year : 29/9/2017  
Engine No : CHZ B23255  
Chassis No : WAUZZZGA2KA022513  
Mileage :  
Date In :  
Estimated By : Johnny Boo / Allan Wu  
Accident Date : 26-Sep-19  
Place of Accident : Junction from BoonLay Way to Jurong

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Estimated Labour Charges for Accident Vehicle SMM 8660 U

<u>S/n</u>	<u>Nature of Jobs</u>		<u>Estimated Charges</u>	<u>Surveyor's Recommendation</u>
1	To tow vehicle from accident scene.	S/N	\$ 280.00	na
2	To remove, check and reinstall front wire harness for headlights, horns, outside temperature sensor and headlight washer assy.	S/N	\$ 360.00	\$ 360.00
3	To remove and renew aircon condenser, radiator and additional radiator check electrical fans and control unit. Pressurise cooling system. To carry out vacuum and regas.	S/N	\$ 1,400.00	\$ 1,400.00
4	To dismantle rhs front door panel trim. To remove and reinstall rhs wing mirror assy.	S/N	\$ 300.00	\$ 300.00
5	To remove and renew front windscreen.	S/N	\$ 480.00	\$ 480.00
6	To install front windscreen solar film.	S/N	\$ 400.00	na
<b>TOTAL LABOUR CHARGES</b>			<b>\$ 3,220.00</b>	<b>\$ 2,540.00</b>

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Estimated Labour Charges for Accident Vehicle SMM 8660 U

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
			\$ 2,540.00
7	To dismantle and renew front bumper, both front fenders, bonnet and both headlights. To renew front lock carrier and align to position. Re-organise crash management components. Reinstall all parts removed. <i>(Added 3 days for lock carrier and checked items)</i>	\$ 7,200.00	\$ 4,000.00
8	To respray front bumper, bonnet, hinges, both front fenders, rhs upper A- pillar and rhs front door. <i>(Added \$100.00 for 2 bonnet hinges)</i>	\$ 6,300.00	\$ 2,850.00
9	To carry out diagnostic check.	S/N \$ 192.00	\$ 192.00
<b>TOTAL LABOUR CHARGES</b>		<b>: \$ 16,912.00</b>	<b>\$ 9,582.00</b>

# Premium Automobiles

55 Ubi Road 1, Singapore 408599  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	FRONT BUMPER	\$ 1,706.00	\$ 1,364.00
2	FRONT BUMPER FIXING PARTS	\$ 314.00	
3	FRONT BUMPER GRILLE -CENTER	\$ 179.00	\$ 143.20
4	FRONT BUMPER AIR GUIDE GRILLE-LH/RH	2 \$ 308.00	\$ 245.60
5	FRONT BUMPER END CAP-LH/RH	2 \$ 62.00	\$ 24.40
6	FRONT BUMPER SPOILER	\$ 273.00	\$ 218.00
7	FRONT BUMPER CLOSING ELEMENT	\$ 142.00	
8	FRONT BUMPER WHEEL SPOILER-LH/RH	\$ 62.00	
9	FRONT BUMPER ADAPTER-LH	\$ 32.00	
10	FRONT BUMPER ADAPTER-RH	\$ 38.00	
11	RADIATOR GRILLE	\$ 1,301.00	\$ 1,040.80
12	RADIATOR GRILLE STRIKER PLATE	\$ 114.00	\$ 91.20
13	FOAM FILLER PIECE	\$ 71.00	\$ 56.08
14	FRONT BUMPER CARRIER	\$ 625.00	
15	FRONT BUMPER TOP COVER	\$ 91.00	\$ 72.56
16	FRONT BUMPER GUIDE SECTION-RH	\$ 32.00	\$ 25.60
17	SIGN CAUTION	\$ 13.00	\$ 9.76
18	AIR CONDITIONER STICKER	\$ 7.00	\$ 5.12
19	SIGNAL HORN-RH	\$ 180.00	
20	SIGNAL HORN SPRING SHACKLE-RH	\$ 29.00	
<b>SUB-TOTAL SPARE PARTS CHARGES</b>		<b>\$ 5,579.00</b>	<b>\$ 3,296.32</b>

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved  
Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 3,296.32
21	FRONT FENDER-LH/RH	2	\$ 2,094.00	\$ 1,675.20
22	FRONT FENDER ATTACHMENT PARTS	2	\$ 72.00	
23	FRONT FENDER UPPER BRACKET-LH/RH	2	\$ 28.00	\$ 22.08
24	FRONT FENDER BRACKET-LH/RH	2	\$ 86.00	\$ 68.16
25	FRONT FENDER LOWER BRACKET-LH/RH	2	\$ 28.00	\$ 22.08
26	FRONT FENDER BRACE-LH/RH	2	\$ 58.00	\$ 46.08
27	FRONT FENDER CLOSING ELEMENT-LH/RH	2	\$ 60.00	
28	FRONT FENDER INSULATION-LH/RH	2	\$ 138.00	
29	FRONT WHEEL HOUSING LINER SEAL-UPPER	2	\$ 66.00	
30	FRONT WHEEL HOUSING LINER BRACKET-LH/RH	2	\$ 44.00	
31	FRONT WHEEL HOUSING LINER-LH/RH	2	\$ 366.00	
32	FRONT WHEEL HOUSING LINER ATTACHMENT PARTS	2	\$ 103.00	
33	BONNET		\$ 2,549.00	\$ 2,039.20
34	BONNET ATTACHMENT PARTS		\$ 149.00	
35	BONNET LID HINGE-LH/RH	2	\$ 112.00	\$ 88.48
36	BONNET GAS FILLED STRUT-RH		\$ 93.00	
37	BONNET GAS FILLED STURT BRACKET-RH		\$ 31.00	
38	BONNET STRIKER-LH/RH	2	\$ 200.00	\$ 159.04
39	BONNET SOUND ABSORBER		\$ 201.00	\$ 160.80
40	BONNET IMPACT PROTECTION- CENTER		\$ 27.00	\$ 21.20
<b>SUB- TOTAL SPARE PARTS CHARGES</b>			<b>\$ 6,505.00</b>	<b>\$ 7,598.64</b>

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved  
Spare parts are Special Nett

# Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description		Damaged Parts & Prices	
			S/Nett	Remark
		<i>c/f</i>		\$ 7,598.64
41	BONNET IMPACT PROTECTION-LH	\$	28.00	\$ 22.00
42	BONNET IMPACT PROTECTION-RH	\$	27.00	\$ 21.20
43	BONNET HINGE COVER	2 \$	74.00	
44	BONNET HINGE REAR COVER	2 \$	28.00	
45	PLENUM CHAMBER COVER	\$	144.00	\$ 114.80
46	WATER BOX	\$	124.00	
47	BONNET LID LOCK WITH MIRCRO	2 \$	367.00	\$ 293.60
48	BONNET FLAT CONNECTOR HOUSING	\$	12.00	
49	BONNET FLAT CONNECTOR HOUSING BRACKET	\$	6.00	
50	BONNET BOWDEN CABLE-CENTER	\$	53.00	\$ 41.68
51	BONNET LID LOCK CABLE	\$	67.00	
52	BONNET LID LOCK CABLE COVER	\$	9.00	
53	BONNET RELEASE ELEMENT	\$	53.00	\$ 41.68
54	BONNET BOWDEN CABLE-LH/RH	2 \$	106.00	\$ 83.36
55	BONNET RELEASE LEVER	\$	12.00	\$ 9.60
56	FRONT WHEEL COVER-LH/RH	2 \$	588.00	\$ 469.60
57	HEALDIGHT MOUNTING-LH/RH	2 \$	214.00	\$ 85.60
58	LED HEADLIGHT-LH/RH	2 \$	8,982.00	\$ 7,185.60
59	LED HEADLIGHT POWER MODULE	\$	693.00	
60	LED HEADLIGHT CONTROL UNIT	\$	508.00	
<b>SUB-TOTAL SPARE PARTS CHARGES</b>		:	<b>\$ 12,095.00</b>	<b>\$ 15,967.36</b>

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved  
 Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel: 6366 2323 Fax: 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 15,967.36
61	LED HEAT SINK-RH		\$ 666.00	
62	HEAD LIGHT VENTILATION HOSE-RH		\$ 26.00	\$ 20.72
63	HEADLIGHT COMPENSATING PIECE		\$ 44.00	
64	HEADLIGHT LIFT CYLINDER-RH		\$ 128.00	
65	HEADLIGHT WASHER HOSE PIPE		\$ 170.00	
66	LED HEADLIGHT WASHER T PIECE		\$ 27.00	
67	LOCK CARRIER		\$ 907.00	\$ 725.60
68	A/C CONDENSER		\$ 503.00	
69	A/C REFRIGERANT LINE		\$ 601.00	
70	A/C REFRIGERANT LINE FOR COMPRESSOR TO CONDENSOR		\$ 461.00	\$ 368.80
71	A/C REGRIGERANT LINE BRACKET		\$ 25.00	
72	RADIATOR		\$ 878.00	\$ 718.80
73	ADDITIONAL RADIATOR		\$ 837.00	\$ 686.00
74	RADIATOR BUSH LOWER	2	\$ 18.00	\$ 14.24
75	RADIATOR BRACKET UPPER	2	\$ 77.00	\$ 61.28
76	COOLANT		\$ 165.00	\$ 131.84
77	RADIATOR FAN WITH FAN RING		\$ 1,483.00	
78	RADIATOR AIR GUIDE-LH /RH	2	\$ 54.00	\$ 21.36
79	RADIATOR SEAL- RH OUTER		\$ 6.00	\$ 4.48
80	RADIATOR AIR GUIDE-UPPER CENTRE		\$ 19.00	\$ 15.20
<b>SUB-TOTAL SPARE PARTS CHARGES</b>			<b>\$ 7,076.00</b>	<b>\$ 18,735.68</b>

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved  
Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 18,735.68
81	AIR INTAKE FOR AIR GUDIE		\$ 53.00	
82	AID INTAKE HOSE		\$ 62.00	\$ 49.20
83	AIR INTAKE SEAL		\$ 13.00	
84	AIR INTAKE DUCT		\$ 19.00	
85	AIR INTAKE FOR WATER DRAINAGE HOSE		\$ 31.00	
86	AIR INTAKE MANIFOLD		\$ 129.00	
87	AIR INTAKE AIR FILTER		\$ 259.00	
88	AIR INTAKE INLET MANIFOLD		\$ 588.00	
89	AIR INTAKE GASKET		\$ 13.00	
90	CHARGE AIR COOLER		\$ 692.00	
91	CHARGE AIR COOLER GASKET		\$ 13.00	
92	CHARGE AIR COOLER SEAL		\$ 13.00	
93	FRONT WINDSCREEN		\$ 913.00	\$ 730.40
94	FRONT WINDSCREEN RAIN FOIL SENSOR		\$ 728.00	\$ 102.40
95	PRIMER		\$ 19.00	\$ 14.88
96	FRONT WINDOW APERTURE SEAL-RH OUTER		\$ 119.00	
97	FRONT WINDOW GUIDE-RH		\$ 377.00	
98	EXTERNAL TEMPERATURE SENSOR		\$ 53.00	
99	FRONT WINDSCREN SEALANT	S/N	\$ 200.00	\$ 200.00
100	FRONT NO. PLATE	S/N	\$ 40.00	\$ 40.00
101	SUPPLEMENTARY		\$ 96.00	\$ 75.76
103	SUNDRIES		\$ 800.00	\$ 126.80
	<b>TOTAL SPARE PARTS CHARGES</b>	:	<b>\$ 36,485.00</b>	<b>\$ 20,075.12</b>
	<b>TOTAL LABOUR CHARGES</b>		<b>\$ 16,912.00</b>	<b>\$ 9,582.00</b>
	<b>GRAND TOTAL</b>		<b>\$ 53,397.00</b>	<b>\$ 29,657.12</b>

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved  
Spare parts are Special Netf

# Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

## Supplementary Estimate 1

GST Reg No. 19-9902271-W

<b>AIG Asia Pacific Insurance Pte Ltd</b> 78 Shenton Way #07-16 AIG Building Singapore 079120 <b>Attn: Mr. Adrian Ling - Motor Claims Dept</b> <b>Tel: 6841 0055 - Fax: 6256 4315</b>		<b>Estimate No.</b> <b>Date</b> <b>Service Advisor</b> <b>Pages</b> <b>Regn No</b> <b>Model No</b>	PA/OD/1169/2019/GW 9-Oct-19 Glory Tan 1 of 1 SMM 8660 U Q2 1.0 TFSI S TRONIC
Quantity	Description	Unit Price	Amount
<u>Parts</u>			
1	Guide section	\$ 32.00	\$ 25.60
2	Front fender top bracket rhs	\$ 21.00	\$ 16.32
3	Sealing strip for radiator rhs	\$ 16.00	\$ 12.48
4	Cover for air intake duct	\$ 27.00	\$ 21.36
<b>TOTAL</b>		<b>\$ 96.00</b>	<b>\$ 75.76</b>

For Premium Automobiles Pte Ltd

\_\_\_\_\_  
Authorised Signature

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

**Name** :  
**Surveyed Date** :  
**Authorised Date** :  
**Excess Cost** :  
**Liability** :  
**Remarks** :

**Please Note** : This estimate is based on visual inspection of the affected vehicle.  
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.  
For inspection of vehicle, please refer to Ms Norah Khai at  
Tel:6768 9828 for appointment.

Yours faithfully,  
Premium Automobiles Pte Ltd

Johnny Boo  
Body Repair Manager

Allan Wu  
Claims Consultant

# Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel: (65) 6365 2323 Fax: (65) 6841 1183

## Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd  
78 Shenton Way  
#07-16 AIG Building  
Singapore 079120  
Attn: Mr. Adrian Ling - Motor Claims Dept  
Tel: 6841 0055 - Fax: 6256 4315

Estimate No. PA/00/1169/2019/GW  
Date 9-Oct-19  
Service Advisor Glory Tan  
Pages 1 of 1  
Regn No SMM 8660 U  
Model No Q2 1.0 TFSI S TRONIC

Quantity	Description	Unit Price	Amount
<u>Parts</u>			
1	Guide section ✓	\$ 32.00	de ✓
2	Front fender top bracket rhs ✓	\$ 21.00	bt ✓
3	Sealing strip for radiator rhs ✓	\$ 16.00	ms ✓
4	Cover for air intake duct ✓	\$ 27.00	cm ✓
<b>TOTAL</b>		<b>\$ 96.00</b>	

For Premium Automobiles Pte Ltd

\_\_\_\_\_  
Authorised Signature

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel: 6366 2323 Fax: 6841 1183

Telefax

## Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	FRONT BUMPER	\$ 1,706.00	de ✓
2	FRONT BUMPER FIXING PARTS	\$ 314.00	?
3	FRONT BUMPER GRILLE -CENTER	\$ 179.00	de ✓
4	FRONT BUMPER AIR GUIDE GRILLE-LH/RH . de ✓	2 \$ 308.00	LH-?, RH-mis ✓
5	FRONT BUMPER END CAP-LH/RH	2 \$ 62.00	LH-? 1 RH-mis ✓
6	FRONT BUMPER SPOILER . de ✓	\$ 273.00	?
7	FRONT BUMPER CLOSING ELEMENT	\$ 142.00	?
8	FRONT BUMPER WHEEL SPOILER-LH/RH	\$ 62.00	?
9	FRONT BUMPER ADAPTER-LH	\$ 32.00	?
10	FRONT BUMPER ADAPTER-RH	\$ 38.00	?
11	RADIATOR GRILLE	\$ 1,301.00	mis ✓
12	RADIATOR GRILLE STRIKER PLATE . de ✓	\$ 114.00	?
13	FOAM FILLER PIECE . de ✓	\$ 71.00	?
14	FRONT BUMPER CARRIER	\$ 625.00	?
15	FRONT BUMPER TOP COVER	\$ 91.00	de ✓
16	FRONT BUMPER GUIDE SECTION-RH . de ✓	\$ 32.00	de ✓
17	SIGN CAUTION	\$ 13.00	mis ✓
18	AIR CONDITIONER STICKER	\$ 7.00	mis ✓
19	SIGNAL HORN-RH	\$ 180.00	?
20	SIGNAL HORN SPRING SHACKLE-RH	\$ 29.00	?
SUB-TOTAL SPARE PARTS CHARGES		\$ 5,579.00	

Legend: Remarks (OC) = Approved, Remarks (N) = Not approved  
Spare parts are Special Net.

# Premium Automobiles

55 Ubi Road 1, Singapore 408009  
Tel: 6356 2323 Fax: 6041 1183

Telefax

## Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
21	FRONT FENDER-LH/RH	2 \$	2,094.00 <i>ht</i>
22	FRONT FENDER ATTACHMENT PARTS	2 \$	72.00 ?
23	FRONT FENDER UPPER BRACKET-LH/RH • <i>ht</i>	2 \$	28.00 <i>LH. ? RH. ht</i>
24	FRONT FENDER BRACKET-LH/RH • <i>x6 ht</i>	2 \$	86.00 ?
25	FRONT FENDER LOWER BRACKET-LH/RH <i>ht</i>	2 \$	28.00 ?
25	FRONT FENDER BRACE-LH/RH • <i>ht</i>	2 \$	58.00 ?
27	FRONT FENDER CLOSING ELEMENT-LH/RH	2 \$	60.00 ?
28	FRONT FENDER INSULATION-LH/RH	2 \$	138.00 ?
29	FRONT WHEEL HOUSING LINER SEAL-UPPER	2 \$	66.00 ?
30	FRONT WHEEL HOUSING LINER BRACKET-LH/RH	2 \$	44.00 ?
31	FRONT WHEEL HOUSING LINER-LH/RH	2 \$	366.00 X
32	FRONT WHEEL HOUSING LINER ATTACHMENT PARTS	2 \$	103.00 X
33	BONNET	\$	2,549.00 <i>ht</i>
34	BONNET ATTACHMENT PARTS	\$	149.00 X
35	BONNET LID HINGE-LH/RH	2 \$	112.00 <i>ht</i>
36	BONNET GAS FILLED STRUT-RH	\$	93.00 ?
37	BONNET GAS FILLED STURT BRACKET-RH	\$	31.00 ?
38	BONNET STRIKER-LH/RH • <i>ht</i>	2 \$	200.00 ?
39	BONNET SOUND ABSORBER	\$	201.00 ?
40	BONNET IMPACT PROTECTION- CENTER	\$	27.00 <i>de</i>
<b>SUB-TOTAL SPARE PARTS CHARGES</b>		<b>:</b>	<b>\$ 6,505.00</b>

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved  
Spare parts are Special Metts.

# Premium Automobiles

55 Ubi Road 1, Singapore 408599  
Tel: 6366 2323 Fax: 6361 1183

Telefax

## Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
41	BONNET IMPACT PROTECTION-LH	\$ 28.00	✓
42	BONNET IMPACT PROTECTION-RH	\$ 27.00	✓
43	BONNET HINGE COVER	2 \$ 74.00	?
44	BONNET HINGE REAR COVER	2 \$ 28.00	?
45	PLENUM CHAMBER COVER, dis ✓	\$ 144.00	?
46	WATER BOX	\$ 124.00	?
47	BONNET LID LOCK WITH MIRCRO, dis ✓	2 \$ 367.00	?
48	BONNET FLAT CONNECTOR HOUSING	\$ 12.00	?
49	BONNET FLAT CONNECTOR HOUSING BRACKET	\$ 6.00	?
50	BONNET BOWDEN CABLE-CENTER, dis ✓	\$ 53.00	?
51	BONNET LID LOCK CABLE	\$ 67.00	?
52	BONNET LID LOCK CABLE COVER, dis ✓	\$ 9.00	?
53	BONNET RELEASE ELEMENT, dis ✓	\$ 53.00	?
54	BONNET BOWDEN CABLE-LH/RH	2 \$ 106.00	?
55	BONNET RELEASE LEVER	\$ 12.00	?
56	FRONT WHEEL COVER-LH/RH	2 \$ 588.00	? plus
57	HEADLIGHT MOUNTING-LH/RH	2 \$ 214.00	LH-?, RH-dis ✓
58	LED HEADLIGHT-LH/RH	2 \$ 8,982.00	LH-?, RH-dis ✓
59	LED HEADLIGHT POWER MODULE	\$ 693.00	?
60	LED HEADLIGHT CONTROL UNIT	\$ 508.00	?
SUB-TOTAL SPARE PARTS CHARGES		<u>\$ 12,095.00</u>	

Legend: Remark (O) = Approved, Remark (X) = Not approved  
Some quantities Special Netts.

# Premium Automobiles

55 Ubi Road 1, Singapore 400699  
Tel: 6356 2223 Fax: 6043 1183

Telofax

## Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
61	LEFT HEAT SINK-RH	\$	666.00
62	HEAD LIGHT VENTILATION HOSE-RH • <i>to ✓</i>	\$	26.00
63	HEADLIGHT COMPENSATING PIECE	\$	44.00
64	HEADLIGHT LIFT CYLINDER-RH	\$	128.00
65	HEADLIGHT WASHER HOSE PIPE	\$	170.00
66	LED HEADLIGHT WASHER T PIECE	\$	27.00
67	LOCK CARRIER • <i>one ✓</i>	\$	907.00
68	A/C CONDENSER • <i>bt ✓</i>	\$	503.00
69	A/C REFRIGERANT LINE	\$	601.00
70	A/C REFRIGERANT LINE FOR COMPRESSOR TO CONDENSOR	\$	461.00
71	A/C REFRIGERANT LINE BRACKET	\$	25.00
72	RADIATOR • <i>bt ✓</i>	\$	878.00
73	ADDITIONAL RADIATOR • <i>bt ✓</i>	\$	837.00
74	RADIATOR BUSH LOWER • <i>ols ✓</i>	2 \$	18.00
75	RADIATOR BRACKET UPPER • <i>dl ✓</i>	2 \$	77.00
76	COOLANT • <i>dl ✓</i>	\$	165.00
77	RADIATOR FAN WITH FAN RING	\$	1,483.00
78	RADIATOR AIR GUIDE-LH (RH) • <i>de ✓</i>	2 \$	54.00
79	RADIATOR SENS - RH OUTER • <i>dl ✓</i>	\$	6.00
80	RADIATOR AIR GUIDE-UPPER CENTRE • <i>de ✓</i>	\$	19.00
<b>5 10-TOTAL SPARE PARTS CHARGES</b>		<b>\$</b>	<b>7,076.00</b>

14/02/21 Remarks (O) = Approved, Remarks (X) = Not approved  
Special parts are Special price.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel: 6366 2323 Fax: 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	FRONT BUMPER	S 1,706.00	de ✓
2	FRONT BUMPER FIXING PARTS	S 314.00	?
3	FRONT BUMPER GRILLE -CENTER	S 179.00	de ✓
4	FRONT BUMPER AIR GUIDE GRILLE-LH/RH . de ✓	2 S 308.00	LH-?, RH-mis ✓
5	FRONT BUMPER END CAP-LH/RH	2 S 62.00	LH-? 1 RH-mis ✓
6	FRONT BUMPER SPOILER . de ✓	S 273.00	?
7	FRONT BUMPER CLOSING ELEMENT	S 142.00	?
8	FRONT BUMPER WHEEL SPOILER-LH/RH	S 62.00	?
9	FRONT BUMPER ADAPTER-LH	S 32.00	?
10	FRONT BUMPER ADAPTER-RH	S 38.00	?
11	RADIATOR GRILLE	S 1,301.00	over ✓
12	RADIATOR GRILLE STRIKER PLATE . de ✓	S 114.00	?
13	FOAM FILLER PIECE . de ✓	S 71.00	?
14	FRONT BUMPER CARRIER	S 625.00	?
15	FRONT BUMPER TOP COVER	S 91.00	de ✓
16	FRONT BUMPER GUIDE SECTION-RH . de ✓	S 32.00	de ✓
17	SIGN CAUTION	S 13.00	de ✓
18	AIR CONDITIONER STICKER	S 7.00	de ✓
19	SIGNAL HORN-RH	S 180.00	?
20	SIGNAL HORN SPRING SHACKLE-RH	S 29.00	?
<b>SUB-TOTAL SPARE PARTS CHARGES</b>		<b>\$ 5,579.00</b>	

Legend: Remarks (OX) = Approved, Remarks (X) = Not approved  
Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel: 6366 2323 Fax: 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
21	FRONT FENDER-LH/RH	2 S	2,094.00 <i>ht ✓</i>
22	FRONT FENDER ATTACHMENT PARTS	2 S	72.00 ?
23	FRONT FENDER UPPER BRACKET-LH/RH <i>ht ✓</i>	2 S	28.00 <i>LH-? RH-bl ✓</i>
24	FRONT FENDER BRACKET-LH/RH <i>ht ✓</i>	2 S	86.00 ?
25	FRONT FENDER LOWER BRACKET-LH/RH <i>ht ✓</i>	2 S	28.00 ?
26	FRONT FENDER BRACE-LH/RH <i>ht ✓</i>	2 S	58.00 ?
27	FRONT FENDER CLOSING ELEMENT-LH/RH	2 S	60.00 ?
28	FRONT FENDER INSULATION-LH/RH	2 S	138.00 ?
29	FRONT WHEEL HOUSING LINER SEAL-UPPER	2 S	66.00 ?
30	FRONT WHEEL HOUSING LINER BRACKET-LH/RH	2 S	44.00 ?
31	FRONT WHEEL HOUSING LINER-LH/RH	2 S	366.00 X
32	FRONT WHEEL HOUSING LINER ATTACHMENT PARTS	2 S	103.00 X
33	BONNET	S	2,549.00 <i>ht ✓</i>
34	BONNET ATTACHMENT PARTS	S	149.00 X
35	BONNET LID HINGE-LH/RH	2 S	112.00 <i>ht ✓</i>
36	BONNET GAS FILLED STRUT-RH	S	93.00 ?
37	BONNET GAS FILLED STURT BRACKET-RH	S	31.00 ?
38	BONNET STRIKER-LH/RH <i>ht ✓</i>	2 S	200.00 ?
39	BONNET SOUND ABSORBER	S	201.00 ?
40	BONNET IMPACT PROTECTION- CENTER	S	27.00 <i>de ✓</i>
<b>SUB- TOTAL SPARE PARTS CHARGES</b>		<b>:</b>	<b>\$ 6,505.00</b>

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved  
Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel: 6366 2323 Fax: 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
41	BONNET IMPACT PROTECTION-LH	S	28.00 <i>OK ✓</i>
42	BONNET IMPACT PROTECTION-RH	S	27.00 <i>OK ✓</i>
43	BONNET HINGE COVER	2 S	74.00 ?
44	BONNET HINGE REAR COVER	2 S	28.00 ?
45	PLENUM CHAMBER COVER <i>dis ✓</i>	S	144.00 ?
46	WATER BOX	S	124.00 ?
47	BONNET LID LOCK WITH MIRCRO <i>dis ✓</i>	2 S	367.00 ?
48	BONNET FLAT CONNECTOR HOUSING	S	12.00 ?
49	BONNET FLAT CONNECTOR HOUSING BRACKET	S	6.00 ?
50	BONNET BOWDEN CABLE-CENTER <i>dis ✓</i>	S	53.00 ?
51	BONNET LID LOCK CABLE	S	67.00 ?
52	BONNET LID LOCK CABLE COVER <i>dis ✓</i>	S	9.00 ?
53	BONNET RELEASE ELEMENT <i>dis ✓</i>	S	53.00 ?
54	BONNET BOWDEN CABLE-LH/RH	2 S	106.00 ?
55	BONNET RELEASE LEVER	S	12.00 ?
56	FRONT WHEEL COVER-LH/RH	2 S	588.00 ? <i>photo</i>
57	HEALDIGHT MOUNTING-LH/RH	2 S	214.00 <i>LH-?, RH-dis ✓</i>
58	LED HEADLIGHT-LH/RH	2 S	8,982.00 <i>LH-out, RH/LH ✓</i>
59	LED HEADLIGHT POWER MODULE	S	693.00 ?
60	LED HEADLIGHT CONTROL UNIT	S	508.00 ?
<b>SUB-TOTAL SPARE PARTS CHARGES</b>			<b><u>\$ 12,095.00</u></b>

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved  
Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel: 6366 2323 Fax: 6841 1183

Telefax

## Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
61	LED HEAT SINK-RH	S	666.00
62	HEAD LIGHT VENTILATION HOSE-RH * <i>fn</i> ✓	S	26.00
63	HEADLIGHT COMPENSATING PIECE	S	44.00
64	HEADLIGHT LIFT CYLINDER-RH	S	128.00
65	HEADLIGHT WASHER HOSE PIPE	S	170.00
66	LED HEADLIGHT WASHER T PIECE	S	27.00
67	LOCK CARRIER * <i>cus</i> ✓	S	907.00
68	A/C CONDENSER * <i>bt</i> ✓	S	503.00
69	A/C REFRIGERANT LINE	S	601.00
70	A/C REFRIGERANT LINE FOR COMPRESSOR TO CONDENSOR	S	461.00
71	A/C REFRIGERANT LINE BRACKET	S	25.00
72	RADIATOR * <i>bt</i> ✓	S	878.00
73	ADDITIONAL RADIATOR * <i>bt</i> ✓	S	837.00
74	RADIATOR BUSH LOWER * <i>als</i> ✓	2 S	18.00
75	RADIATOR BRACKET UPPER * <i>als</i> ✓	2 S	77.00
76	COOLANT * <i>wt</i> ✓	S	165.00
77	RADIATOR FAN WITH FAN RING	S	1,483.00
78	RADIATOR AIR GUIDE-LH / RH * <i>als</i> ✓	2 S	54.00
79	RADIATOR SEAL- RH OUTER * <i>als</i> ✓	S	6.00
80	RADIATOR AIR GUIDE-UPPER CENTRE * <i>als</i> ✓	S	19.00
<b>SUB-TOTAL SPARE PARTS CHARGES</b>		<b>S</b>	<b>7,076.00</b>

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved  
Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

Telefax

## Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
81	AIR INTAKE FOR AIR GUIDIE	\$ 53.00	?
82	AIR INTAKE HOSE = <i>cur</i> ✓	\$ 62.00	?
83	AIR INTAKE SEAL	\$ 13.00	?
84	AIR INTAKE DUCT	\$ 19.00	?
85	AIR INTAKE FOR WATER DRAINAGE HOSE	\$ 31.00	?
86	AIR INTAKE MANIFOLD	\$ 129.00	?
87	AIR INTAKE AIR FILTER	\$ 259.00	?
88	AIR INTAKE INLET MANIFOLD	\$ 588.00	?
89	AIR INTAKE GASKET	\$ 13.00	?
90	CHARGE AIR COOLER	\$ 692.00	?
91	CHARGE AIR COOLER GASKET	\$ 13.00	?
92	CHARGE AIR COOLER SEAL	\$ 13.00	?
93	FRONT WINDSCREEN	\$ 913.00	<i>cur</i> ✓
94	FRONT WINDSCREEN RAIN FOIL SENSOR	\$ 728.00	?
95	PRIMER	\$ 19.00	<i>NE</i> ✓
96	FRONT WINDOW APERTURE SEAL-RH OUTER	\$ 119.00	X
97	FRONT WINDOW GUIDE-RH	\$ 377.00	X
98	EXTERNAL TEMPERATURE SENSOR	\$ 53.00	?
99	FRONT WINDSCREEN SEALANT	S/N \$ 200.00	<i>NE</i> ✓
100	<i>AW</i> FRONT NO. PLATE	S/N \$ 40.00	<i>NE</i> ✓
101	SUNDRIES	\$ 800.00	?
	TOTAL SPARE PARTS CHARGES	: \$ 36,389.00	
	TOTAL LABOUR CHARGES	\$ 16,912.00	
	GRAND TOTAL	<u>\$ 53,301.00</u>	

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved  
Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

Name : Tayllh 7741544  
Surveyed Date : Not the house  
Authorised Date : 30/9/19 @ 1030  
Excess Cost :  
Liability :  
Remarks : Recovery before paint.  
Siv P/Alkando.com.  
Excess to be advise  
08 days

**Please Note** : This estimate is based on visual inspection of the affected vehicle.  
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.  
For inspection of vehicle, please refer to Ms Norah Khai at  
Tel:6768 8828 for appointment.

Yours faithfully,  
Premium Automobiles Pte Ltd

Johnny Boo  
Body Repair Manager

Allan Wu  
Claims Consultant

# Premium Automobiles

55 Ubi Road 1, Singapore 408399  
Tel: 0300 2223 Fax: 0049 1103

Telefax

## Material List for Accident Vehicle Regn No. SMM 8660 U

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
81	AIR INTAKE FOR AIR CUDIE	\$ 53.00	?
82	AIR INTAKE HOSE ✓	\$ 62.00	?
83	AIR INTAKE SEAL	\$ 13.00	?
84	AIR INTAKE DUCT	\$ 19.00	?
85	AIR INTAKE FOR WATER DRAINAGE HOSE	\$ 31.00	?
86	AIR INTAKE MANIFOLD	\$ 129.00	?
87	AIR INTAKE AIR FILTER	\$ 259.00	?
88	AIR INTAKE INLET MANIFOLD	\$ 588.00	?
89	AIR INTAKE GASKET	\$ 13.00	?
90	CHARGE AIR COOLER	\$ 692.00	?
91	CHARGE AIR COOLER GASKET	\$ 13.00	?
92	CHARGE AIR COOLER SEAL	\$ 13.00	?
93	FRONT WINDSCREEN	\$ 913.00	✓
94	FRONT WINDSCREEN RAIN FOIL SENSOR	\$ 728.00	?
95	RUBBER	\$ 19.00	✓
96	FRONT WINDOW APERTURE SEAL-RH OUTER	\$ 119.00	X
97	FRONT WINDOW GUIDE-RH	\$ 377.00	X
98	EXTERNAL TEMPERATURE SENSOR	\$ 53.00	?
99	FRONT WINDSCREEN SEALANT	S/N \$ 200.00	✓
100	FRONT NO. PLATE	S/N \$ 40.00	✓
101	LABOUR	\$ 800.00	?
	VITAL SPARE PARTS CHARGES	\$ 36,389.00	
	TOTAL LABOUR CHARGES	\$ 16,912.00	
	<b>GRAND TOTAL</b>	<b>\$ 53,301.00</b>	

Notes: (X) = Approved, Remarks (X) = Not approved  
 (S/N) = Spare Parts / Labour / Material

# Premium Automobiles

55 Ubi Road 1, Singapore 408599  
Tel: 830 1323 Fax: 0641 1153

## Telefax:

Name :  
Surveyed Date :  
Authorised Date :  
Excess Cost :  
Liability :  
Remarks :

Taylor 7741544  
Not Musthouse  
30/9/19 @ 1030  
Removing before painted.  
See @ lkhands.com.  
Excess to be advise  
08 days

Please Note : This estimate is based on visual inspection of the affected vehicle.  
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.  
For inspection of vehicle, please refer to Ms Norah Khai at  
Tel: 6788 9828 for appointment.

Yours faithfully,  
Premium Automobiles Pte Ltd

John Neo  
Body Repair Manager

Allan Wu  
Claims Consultant

# Premium Automobiles

**AIG Asia Pacific Insurance Pte Ltd**  
78 Shenton Way  
#07-16 AIG Building  
Singapore 079120  
**Attn: Motor Claims Dept**  
**Yr Ref: SMM 8660 U**

Norah Khai  
6768 9911  
6841 1183  
Nora.khai@premiumauto.com.sg  
Body & Paint Dept  
PA/OD/1169/2019/NH

30<sup>th</sup> JAN 2020

from  
Telephone +65-  
Telefax +65-  
EMail  
Our department  
Our Ref  
Your Ref  
Date

Dear Sir,

**RE: INSURANCE CLAIM FOR SMM 8660 U, Audi Q2 1.0 TFSI S TRONIC.**

With reference to the above-mentioned vehicle, no. **SMM 8660 U**, claimant, **Mr. Feng ZePing**, please find the related document per attached.

1. A copy of the Original invoice no. 85014777 – S\$ 26,918.12.
2. A copy of the Discharge Voucher duly signed by client.

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai  
Claims Dept

Encl  
AIG – SMM 8660 U

total pages

Premium Automobiles Pte Ltd  
Showroom  
9 Leng Kee Road  
Singapore 159090  
Telephone (65) 6566 1111  
Telefax (65) 6471 3733

Service & Parts Centres  
55 Ubi Rd 1  
Singapore 408699  
Telephone (65) 6336 2323  
Telefax (65) 684 11183

# Premium Automobiles Pte Ltd



**Audi Centre Singapore**  
281 Alexandra Road  
Singapore 159938  
Main Telephone 6836 2223  
Main Telefax 6471 3733

**Alexandra Service Centre**  
281 Alexandra Road  
Singapore 159938  
Main Telephone 6388 2223  
Main Telefax 6475 1023

**Ubi Service Centre**  
55 Ubi Road 1  
Singapore 408699  
Main Telephone 6388 2323  
Main Telefax 6841 1183

**Customer Service**  
Service Appointment 6386 2323  
24-hour Breakdown Service 9828 1233  
Email: customer.care@premiumauto.com.sg

## INS TAX INVOICE

Page 1 15:09

Company Reg. No. 199902271W  
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014777	Account: A0006 (T 0)
	Date : 29/01/2020	AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
	Order : SMM8660U	
	Term : 30	

Regn No: SMM8660U (V 40882) Regn Date: 27/06/2019 Mileage: 2245 WIP No.: 13953

Model: Q2 1.0 TFSI S tronic GABANG Chassis: WAUZZZGA2KA022513 Engine: CHZ B23255 Dept: U

You have been assisted by :- UB-Tony Foong ( 33 )

		Details	Qty	Unit Price	Amount
S	SUBLET	M: TO SUPPLY VEHICLE NUMBER PLATE	40.00	1.00	40.00
Q	EXC	M: 8888 Insurance Excess/Liability	-4500.00	1.00	-4,500.00
S	BODYWORK	M: TO REMOVE,CHECK AND REINSTALL FRONT WIRE HARNES FOR HEADLIGHTS,HORNS,OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY	360.00	1.00	360.00
S	BODYWORK	M: TO REMOVE AND RENEW RADIATOR AND ADDITIONAL RADIATOR.CHECK ELECTRICAL FANS AND CONTROL UNIT.PRESSURISE COOLING SYSTEM.TO CARRY OUT VACUUM AND REGAS	1400.00	1.00	1,400.00
S	BODYWORK	M: TO DISMANTLE RHS FRONT DOOR PANEL TRIM. TO REMOVE AND REINSTALL RHS WING MIRROR	300.00	1.00	300.00
S	BODYWORK	M: TO REMOVE AND RENEW FRONT WINDSCREEN	480.00	1.00	480.00
S	BODYWORK	M: TO DISMANTLE AND RENEW FRONT BUMPER,BOTH FRONT FENDER,BONNET AND BOTH HEADLIGHT. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION.REORGANISE CRASH MANAGEMENT COMPONENTS.REINSTALL ALL PARTS REMOVED	4000.00	1.00	4,000.00
S	BODYWORK	M: TO RESPRAY FRONT BUMPER, BONNET, BOTH FRONT FENDER, RHS FRONT DOOR AND HINGES	2850.00	1.00	2,850.00
S	BODYWORK	M: TO CARRY OUT DIAGNOSTIC CHECK	192.00	1.00	192.00
S	BODYWORK	M: TO SUPPLY FRONT WINDSCREEN SEALANT	200.00	1.00	200.00
X	AB1A807107 GRU	COVER	Less 020%	1.00	785.50
X	AB1A807108 GRU	COVER	Less 020%	1.00	785.50

# Premium Automobiles Pte Ltd



**Audi Centre Singapore**  
281 Alexandra Road  
Singapore 159938  
Main Telephone 6836 2223  
Main Teletax 6471 3733

**Alexandra Service Centre**  
281 Alexandra Road  
Singapore 159938  
Main Telephone 6388 2223  
Main Teletax 6475 1023

**Ubi Service Centre**  
55 Ubi Road 1  
Singapore 408699  
Main Telephone 6388 2323  
Main Teletax 6841 1183

**Customer Service**  
Service Appointment 6366 2323  
24-hour Breakdown Service 6828 1233  
Email: customer.care@premiumauto.com.sg

## INS TAX INVOICE

Page 2 15:09

Company Reg. No. 199902271W  
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014777	Account: A0006 (T 0)
	Date : 29/01/2020	AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
	Order : SMH8660U	
	Term : 30	

Regn No: SMH8660U (V 40882)	Regn Date: 27/06/2019	Mileage: 2245	WIP No.: 13953
Model: Q3 1.0 TFSI S tronic GABANG	Chassis: WAUZZZGA2KA022513	Engine: CHZ B23255	Dept: U
You have been assisted by :- UB-Tony Foong ( 33 )			

		Details	Qty	Unit Price	Amount	
X	A81A807663	GRU CONN PIECE	Less 020%	1.00	134.00	107.20
X	A81A807647	4W3 GRILLE (LAST)	Less 020%	1.00	179.00	143.20
X	A81A807671	4W3 GRILL AP	Less 020%	1.00	153.50	122.80
X	A81A807672	4W3 GRILL (LAST)	Less 020%	1.00	153.50	122.80
X	A81A807152	989 COVER	Less 020%	1.00	30.50	24.40
X	A81A807110	4W3 SPOILER AP	Less 020%	1.00	272.50	218.00
X	A81A853651	MX3 GRILLE (LAST)	Less 020%	1.00	1301.00	1,040.80
X	A81A807550	FOAM INSER (LAST) AP	Less 020%	1.00	70.10	56.08
X	A81A807081	COVER	Less 020%	1.00	90.70	72.56
X	A81A807184	GUIDE	Less 020%	1.00	32.00	25.60
X	A8K0010520A	STICKER	Less 020%	1.00	12.20	9.76
X	A8V0010515A	STICKER	Less 020%	1.00	6.40	5.12
X	A81A821105	FENDER	Less 020%	1.00	1047.00	837.60
X	A81A821106	FENDER	Less 020%	1.00	1047.00	837.60
X	A81A821471	BRACKET AP	Less 020%	1.00	13.80	11.04
X	A81A821472	BRACKET	Less 020%	1.00	13.80	11.04
X	A81A821467	BRACKET AP	Less 020%	1.00	42.60	34.08
X	A81A821468	BRACKET AP	Less 020%	1.00	42.60	34.08
X	A81A821469	BRACKET AP	Less 020%	1.00	13.80	11.04
X	A81A821470	BRACKET AP	Less 020%	1.00	13.80	11.04
X	AN 0161857	POP-RIVET AP	Less 020%	12.00	3.00	28.80
X	A81A821135	SUPPORT AP	Less 020%	1.00	28.80	23.04
X	A81A821136	SUPPORT AP	Less 020%	1.00	28.80	23.04
X	A81A821184	(GER) BRACKET AP	Less 020%	1.00	20.40	16.32
X	A81A823029	(SK) HOOD	Less 020%	1.00	2549.00	2,039.20
X	A81A823301D	HINGE (LAST)	Less 020%	1.00	55.30	44.24
X	A81A823302D	HINGE (LAST)	Less 020%	1.00	55.30	44.24
X	A81A823359A	GASFILSTRU AP	Less 020%	1.00	92.40	73.92
X	A81A823185A	CATCH (LAST) AP	Less 020%	1.00	99.40	79.52
X	A81A823186A	CATCH (LAST) AP	Less 020%	1.00	99.40	79.52
X	A81A863825	007491/ (V) (SK) SILENC	Less 020%	1.00	201.00	160.80
X	A81A823124	PROTECTION	Less 020%	1.00	26.50	21.20
X	A81A823125	PROTECTION	Less 020%	1.00	27.50	22.00
X	A81A823126	PROTECTION	Less 020%	1.00	26.50	21.20

# Premium Automobiles Pte Ltd



**Audi Centre Singapore**  
281 Alexandra Road  
Singapore 159938  
Main Telephone 6836 2223  
Main Telefax 6471 3733

**Alexandra Service Centre**  
281 Alexandra Road  
Singapore 159938  
Main Telephone 6388 2223  
Main Telefax 6475 1023

**Ubi Service Centre**  
55 Ubi Road 1  
Singapore 408699  
Main Telephone 6386 2323  
Main Telefax 6841 1183

**Customer Service**  
Service Appointment 6066 2323  
24-hour Breakdown Service 9828 1233  
Email customer.care@premiumauto.com.sg

## INS TAX INVOICE

Page 3 15:09

Company Reg. No. 199902271W  
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014777	Account: A0006 (T 0)
	Date : 29/01/2020	AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
	Order : SMMS660U	
	Term : 30	

Regn No: SMMS660U (V 40882)	Regn Date: 27/06/2019	Mileage: 2245	WIP No.: 13953
Model: Q2 1.0 TFSI S tronic GABANG	Chassis: WAUZZZ8GA2KA022513	Engine: CHZ B23255	Dept: U
You have been assisted by :- UB-Tony Foong ( 33 )			

		Details	Qty	Unit Price	Amount	
X	A81C819403 9B9	COVER(LAST) AP	Less 020%	1.00	143.50	114.80
X	A81A823531	BOWD CABLE(LAST) AP	Less 020%	1.00	52.10	41.68
X	A4H0823543	COVER AP	Less 020%	1.00	8.90	7.12
X	A81A823529A	Release AP	Less 020%	1.00	52.10	41.68
X	A81A823655A	(SK)BOWD CABLE AP	Less 020%	1.00	52.10	41.68
X	A81A823656	BOWD CABLE(LAST) AP	Less 020%	1.00	52.10	41.68
X	ABW0823661D	LEVER AP	Less 020%	1.00	12.00	9.60
X	A81A853717 4W3	COVER	Less 020%	1.00	293.50	234.80
X	A81A853718 4W3	COVER	Less 020%	1.00	293.50	234.80
X	A81A805608C	MOUNTING	Less 020%	1.00	107.00	85.60
X	A81A941773A	HEADLIGHT AP	Less 020%	1.00	4491.00	3,592.80
X	A81A941774A	HEADLIGHT	Less 020%	1.00	4491.00	3,592.80
X	A81A941718	007478/(V) (GER)HOSE	Less 020%	1.00	25.90	20.72
X	A81A805594A	CARRIER(LAST) AP	Less 020%	1.00	907.00	725.60
X	A5Q0121251GD	RADIATOR AP	Less 020%	1.00	898.50	718.80
X	A5Q0121251HS	RADIATOR AP	Less 020%	1.00	857.50	686.00
X	AK0121367F	BUSHING AP	Less 020%	2.00	8.90	14.24
X	A5Q0121367F	BRACKET(LAST) AP	Less 020%	2.00	38.30	61.28
X	AG 12E040M2	COOLANT -25*C AP	Less 020%	4.00	41.20	131.84
X	A81A121284K	AIR DUCT(LAST) AP	Less 020%	1.00	26.70	21.36
X	A81A121230	SEAL AP	Less 020%	1.00	5.60	4.48
X	A81A121285	AIR DUCT AP	Less 020%	1.00	19.00	15.20
X	A5Q0129618J	AIR DUCT AP	Less 020%	1.00	61.50	49.20
X	A81A845099E NVB	WINDSHIELD	Less 020%	1.00	913.00	730.40
X	AD 00920002	PRIMER	Less 020%	1.00	18.60	14.88
X	ABU0955609	FILM	Less 020%	1.00	128.00	102.40
X	A81A807183	GUIDE AP	Less 020%	1.00	32.00	25.60
X	AN 0161857	POP-RIVET AP	Less 020%	3.00	3.00	7.20
X	A81A823509A	LOCK AP BORROW	Less 020%	2.00	183.50	293.60
X	AWHT001308	NUT AP	Less 020%	4.00	1.30	4.16
X	A81A853037	PLATE AP	Less 020%	1.00	114.00	91.20
X	A81A121332D	(A) (SK) SEAL STRIP 9/	Less 020%	1.00	15.60	12.48
X	A5Q0129954E	007478/(V) (GER)COVER	Less 020%	1.00	26.70	21.36
X	A5Q0620743K	(A) (SK) COOLANTPIP 9/	Less 020%	1.00	461.00	368.80

# Premium Automobiles Pte Ltd



**Audi Centre Singapore**  
281 Alexandra Road  
Singapore 159938  
Main Telephone 6836 2223  
Main Telefax 6471 3733

**Alexandra Service Centre**  
281 Alexandra Road  
Singapore 159938  
Main Telephone 6388 2223  
Main Telefax 6475 1023

**Ubi Service Centre**  
55 Ubi Road 1  
Singapore 408699  
Main Telephone 6386 2323  
Main Telefax 6841 1183

**Customer Service**  
Service Appointment 6066 2323  
24-hour Breakdown Service 9826 1233  
Email customer.care@premiumauto.com.sg

## INS TAX INVOICE

Page 4 15:09

Company Reg. No. 199902271W  
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120		Invoice No: 85014777 Date : 29/01/2020 Order : SMM8660U Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
Regn No: SMM8660U (V 40882) Model: Q2 1.0 TFSI S tronic GABANG You have been assisted by :- UB-Tony Foong ( 33 )	Regn Date: 27/06/2019 Chassis: WAUZZZGA2KA022513	Mileage: 2245 Engine: CHZ B23255	WIP No.: 13953 Dept: U

		Details		Qty	Unit Price	Amount
X	A3D0260749C	WASHER AP	Less 020%	1.00	4.00	3.20
X	A4D0260749B	WASHER AP	Less 020%	1.00	3.00	2.40

Parts 19,835.12  
Labour 0.00  
Sublet 9,822.00  
Menus 0.00  
Lubricant 0.00

Sub-Total	25,157.12
7% GST	1,761.00
<b>Grand Total</b>	<b>26,918.12</b>



Received by

For & on behalf of  
Premium Automobiles Pte Ltd

# Premium Automobiles

## Telefax

to **AIG Asia Pacific Insurance Pte Ltd**  
78 Shenton Way  
#07-16 AIG Building  
Singapore 079120  
**Motor Claims Dept**  
**Yr Ref: SMM 8660 U**

Norah Khai  
6768 9828  
6841 1183

Body Repair

PA/OD/1169/2019/TG  
22 October 2019

from  
Telephone +65-  
Telefax +65-  
Mobile +65-  
Our department  
Your Claim Ref  
Our Ref  
Date

total pages

**RE: CLAIM – OWNER'S SATISFACTION/DISCHARGE VOUCHER**

**Make & Model** : Audi Q2 1.0 TFSI S TRONIC  
**Vehicle Chassis No.** : WAUZZZGA2KA022513  
**Vehicle Regn No.** : **SMM 8660 U**  
**Vehicle Mileage** : **2245 KM**  
**Vehicle Owner** : Mr. Feng ZePing  
**Certificate No** : 1900114594  
**Own Damage Excess** : **SS 4815.00 (Inclusive GST)**  
**Accident Date** : 26/09/2019  
**Place** : Junction from Boon Lay Way to Jurong  
**Repair Cost** : \$ 26,918.12  
**WIP No.** : 13953  
**Repairer's Name** : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd  
Showroom  
9 Leng Kee Road  
Singapore 159090  
Telephone (65) 6566 1111  
Telefax (65) 6471 3733

Service & Parts Centres  
55 Ubi Road 1  
Singapore 408699  
Telephone (65) 6366 2323  
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

**Owner / Insured Signature** : 冯泽平  
**Time** : 8.50 pm  
**Date** : 22/10/2019

### ...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	01 Oct 2019 13:24		01 Oct 2019 10:13 <a href="#">Edit Adj Rpt</a>	<b>S\$29,657.12</b> <a href="#">Edit Estimates</a>	<b>S\$29,657.12</b> <a href="#">View Rpt</a>		<b>Pending for Survey Report</b> <a href="#">Cancel Case</a>

Main	Reference	Claim Details	Documents	Show All					
<b>CLAIM SUBFOLDER DETAILS</b>		<b>[Created by Insurer]</b>							
Insured:	<b>FENG ZEPING</b> , ID: S7467791F, Tel: +6596257185, Email: Kevin.fengzeping@gmail.com								
Vehicle Reg. No.:	<b>SMM8660U</b>	Date of Loss:	26/09/2019 18:00 - :59 [2 Months and 30 Days From LTA Reg Date (Man Yr)]						
Claim Type:	<b>OD / 9377473010SG</b>	Policy/Cover Note No.:	1900114594 (Comprehensive)						
		Excess:	S\$4,500.00						
Repairer:	<b>Premium Automobiles Pte Ltd (UBI)</b> 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911								
Handling Insurer:	<b>AIG Asia Pacific Insurance Pte. Ltd. (SG)</b> - Tel: 65-6419-3000 ... [Handled by <b>Chan, Yoke Shi</b> ] yokeshi.chan@aig.com								
Adjuster:	<b>LKK Auto Consultants Pte Ltd (HQ)</b> - Tel: 6256-3561 ... [Handled by <b>MOHD TAUFIKH BIN HAMID</b> ] ... [Final Rpt due 10/10/2019]								
Driver/Custodian:	<b>FENG ZEPING (45 / Male)</b> , NRIC: S7467791F, Tel: +6596257185 Email: Kevin.fengzeping@gmail.com								
<b>ASSOCIATED MAIL RECEIVED</b>		<a href="#">View All</a>	<a href="#">Compose Case Mail</a>						
<ul style="list-style-type: none"> <li>AIG_SG (18/12/2019): <b>Alert - Adj Mandate Approved (S\$29657.12) - SMM8660U - Claim Handler: Chan, Yoke...</b></li> <li>AIG_SG (18/10/2019): <b>Alert - Adj Mandate Approved (S\$20813.00) - SMM8660U - Claim Handler: Chan, Yoke...</b></li> <li>AIG_SG (02/10/2019): <b>Alert - Adj Mandate Approved (S\$20717.00) - SMM8660U - Claim Handler: Chan, Yoke...</b></li> <li>AIG_SG (02/10/2019): <b>Alert - Adj Mandate Maintained - SMM8660U - Claim Handler: Chan, Yoke Shi</b></li> </ul>									
<b>ALL ASSOCIATED TASKS</b>		<a href="#">View All</a>	<a href="#">Search Tasks</a>	<a href="#">Create New Task</a>	<a href="#">Complete</a>				
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

## Claim Documents

\*SMM8660U (9377473010SG)  
 OD  
 Sep 26 2019 6:10PM  
 [FENG ZEPING]  
 Premium Automobiles Pte Ltd

<a href="#">Upload Documents</a>		<a href="#">Upload Photos</a>	<a href="#">Compose New Letter</a>	<a href="#">Upload Video</a>	<a href="#">Upload Audio</a>	<b>View</b> <input type="button" value="View in Browser"/>
<b>Assessment Reports</b>						1 per page <input type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print	
1	01/10/19 14:36	<b>Adjuster Immediate Advice</b>		Load HTM	<input type="checkbox"/>	
2	18/10/19 12:58	<b>Adjuster Immediate Advice</b>		Load HTM	<input type="checkbox"/>	
<b>Photos/Images</b>						3 per page <input type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print	
1	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
2	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
3	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
4	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
5	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
6	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
7	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
8	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
9	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
10	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
11	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
12	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
13	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
14	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
15	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
16	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
17	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
18	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
19	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
20	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
21	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
22	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
23	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
24	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
25	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
26	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
27	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
28	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
29	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
30	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
31	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
32	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
33	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	
34	01/10/19 14:36	<b>General View</b>		Load JPG	<input checked="" type="checkbox"/>	

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
35	01/10/19 14:36	<b>General View</b>	 Load JPG	<input checked="" type="checkbox"/>
36	01/10/19 14:36	<b>General View</b>	 Load JPG	<input checked="" type="checkbox"/>
37	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
38	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
39	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
40	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
41	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
42	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
43	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
44	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
45	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
46	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
47	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
48	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
49	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
50	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
51	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
52	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
53	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
54	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
55	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
56	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
57	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
58	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
59	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
60	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
61	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
62	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
63	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
64	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
65	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
66	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
67	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
68	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
69	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
70	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
71	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
72	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
73	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
74	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
75	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
76	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
77	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
78	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
79	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
80	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
81	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
82	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
83	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>
84	18/10/19 12:51	<b>Reinspection Photo</b>	 Load JPG	<input checked="" type="checkbox"/>

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
85	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
86	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
87	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
88	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
89	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
90	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
91	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
92	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
93	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
94	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
95	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
96	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
97	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
98	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
99	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
100	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
101	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
102	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
103	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
104	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
105	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
106	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
107	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
108	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
109	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
110	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
111	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
112	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
113	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
114	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
115	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
116	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
117	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
118	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
119	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
120	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
121	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
122	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
123	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
124	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
125	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
126	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
127	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
128	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
129	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
130	18/10/19 12:51	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
131	18/10/19 12:51	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
132	18/10/19 12:51	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
133	18/10/19 12:51	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
134	18/10/19 12:51	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
135	18/10/19 12:51	Reinspection Photo		<input checked="" type="checkbox"/>
136	18/10/19 12:51	Reinspection Photo		<input checked="" type="checkbox"/>
137	18/10/19 12:51	Reinspection Photo		<input checked="" type="checkbox"/>
138	18/10/19 12:51	Reinspection Photo		<input checked="" type="checkbox"/>
139	18/10/19 12:51	Reinspection Photo		<input checked="" type="checkbox"/>
140	18/10/19 12:51	Reinspection Photo		<input checked="" type="checkbox"/>
141	18/10/19 12:51	Reinspection Photo		<input checked="" type="checkbox"/>
142	18/10/19 12:51	Reinspection Photo		<input checked="" type="checkbox"/>
143	18/10/19 12:51	Reinspection Photo		<input checked="" type="checkbox"/>
144	18/10/19 12:51	Reinspection Photo		<input checked="" type="checkbox"/>
145	18/10/19 12:51	Reinspection Photo		<input checked="" type="checkbox"/>
146	18/10/19 12:51	Reinspection Photo		<input checked="" type="checkbox"/>
147	18/10/19 12:51	Reinspection Photo		<input checked="" type="checkbox"/>
148	04/12/19 17:43	Replacement Part Photo		<input checked="" type="checkbox"/>
149	04/12/19 17:43	Replacement Part Photo		<input checked="" type="checkbox"/>
150	04/12/19 17:43	Replacement Part Photo		<input checked="" type="checkbox"/>
151	04/12/19 17:43	Replacement Part Photo		<input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	01/10/19 14:14	ESTIMATE		<input type="checkbox"/>
2	01/10/19 14:20	DRIVING LICENSE		<input type="checkbox"/>
3	01/10/19 14:20	Certificate of Insurance		<input type="checkbox"/>
4	01/10/19 14:20	UNDERTAKING AND INTERVIEW LETTER		<input type="checkbox"/>
5	01/10/19 14:20	Singapore Accident Statement		<input type="checkbox"/>
6	01/10/19 14:20	ESTIMATE		<input type="checkbox"/>
7	02/10/19 11:57	ESTIMATE REUPLOAD		<input type="checkbox"/>
8	18/10/19 12:52	SUPPLEMENTARY		<input type="checkbox"/>
9	05/12/19 17:32	ESTIMATE		<input type="checkbox"/>
10	05/12/19 17:32	SUPPLEMENTARY		<input type="checkbox"/>
11	06/02/20 10:39	Workshop Invoice		<input type="checkbox"/>
12	06/02/20 10:39	Discharge Voucher		<input type="checkbox"/>

### Linked Accident Report Documents

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	06/12/19 18:22	Accident Statement		<input type="checkbox"/>
Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
2	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
3	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
4	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
5	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
6	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
7	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
8	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
9	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
10	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
11	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
12	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
13	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
14	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
15	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
16	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
17	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
18	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
19	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
20	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
21	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
22	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
23	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
24	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
25	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
26	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
27	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>
28	27/09/19 15:53	Accident Photo		<input checked="" type="checkbox"/>

Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	27/09/19 15:58	Sketch Plan		<input checked="" type="checkbox"/>
2	27/09/19 15:58	Sketch Plan #2		<input checked="" type="checkbox"/>

## Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
<b>Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)</b>			
<div style="border: 1px solid black; min-height: 30px;"></div>			
<b>Show Remarks To:</b> <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small>			

## LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

### VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.  
AIG Building, 78 Shenton Way #08-16  
Singapore 079120

**Our File No:** CC3/AIG19017217/T1TF3E2

**Date:** 06/02/2020

#### REFERENCE

Insured/Claimant:	FENG ZEPING	Policy No:	1900114594	
Date of Loss:	26/09/2019	Nature of Claim:	OD	Claim No: 9377473010SG

#### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMM8660U		
Make & Model:	AUDI Q2, 999cc 1.0 TFSI S TRONIC (A)	Engine No:	CHZB23255
Reg. Date:	27/06/2019 (Man. Year: 2018)	Chassis No:	WAUZZZGA2KA022513
Colour:	Red	Odometer:	2243 km
Engine Capacity:	999 cc		
Market Value/New Car Price:	S\$120,000.00		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

#### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

#### CONDITION OF TYRES

Front Tyre Size:	215/55 R17	Rear Tyre Size:	215/55 R17
Front Left Side:	Pirelli 7 mm	Rear Left Side:	Pirelli 7 mm
Front Right Side:	Pirelli 7 mm	Rear Right Side:	Pirelli 7 mm

*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	36,483.76	20,075.12	16,408.64	44.98
Miscellaneous Items	0.00	0.00	0.00	
Labour	16,912.00	9,582.00	7,330.00	43.34
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (S\$)</b>	<b>53,395.76</b>	<b>29,657.12</b>	<b>23,738.64</b>	<b>44.46</b>
<b>- Excess (S\$)</b>	<b>4,500.00</b>	<b>4,500.00</b>	<b>0.00</b>	<b>0.00</b>
<b>(S\$)</b>	<b>48,895.76</b>	<b>25,157.12</b>	<b>23,738.64</b>	<b>48.55</b>
<b>+ GST 7.00/7.00% (S\$)</b>	<b>3,422.70</b>	<b>1,761.00</b>	<b>1,661.70</b>	<b>48.55</b>
<b>Nett Amount (S\$)</b>	<b>52,318.46</b>	<b>26,918.12</b>	<b>25,400.34</b>	<b>48.55</b>

#### INSPECTION

Date of Assignment:	01/10/2019		
Date Inspected:	30/09/2019	Inspected At:	Premium Automobiles Pte Ltd (UBI) 24 BENOI SECTOR SINGAPORE 629857
Estimated Period of Repair:	12.0 days		

**Adjuster:** MOHD TAUFIKH BIN HAMID

**Manager:** DENISE TAY KWEE CHENG

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

## Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed	1,706.00 FS	*1,364.00 FS
2	1		*FRONT BUMPER FIXING PARTS	Not Necessary	314.00 FS	*- FS
3	1		*FRONT BUMPER GRILLE - CENTER	Deformed	179.00 FS	*143.20 FS
4	2		*FRONT BUMPER AIR GUIDE GRILLE - LH / RH	N/S Deformed / O/S Missing	308.00 FS	*245.60 FS
5	2		*FRONT BUMPER END CAP - LH / RH	N/S Deformed / O/S Missing	62.00 FS	*24.40 FS
6	1		*FRONT BUMPER SPOILER	Deformed	273.00 FS	*218.00 FS
7	1		*FRONT BUMPER CLOSING ELEMENT	Not Necessary	142.00 FS	*- FS
8	1		*FRONT BUMPER WHEEL SPOILER - LH / RH	Not Necessary	62.00 FS	*- FS
9	1		*FRONT BUMPER ADAPTER - LH	Not Necessary	32.00 FS	*- FS
10	1		*FRONT BUMPER ADAPTER - RH	Not Necessary	38.00 FS	*- FS
11	1		*RADIATOR GRILLE	Cracked	1,301.00 FS	*1,040.80 FS
12	1		*RADIATOR GRILLE STRIKER PLATE	Bent	114.00 FS	*91.20 FS
13	1		*FOAM FILLER PIECE	Deformed	71.00 FS	*56.08 FS
14	1		*FRONT BUMPER CARRIER	Not Necessary	625.00 FS	*- FS
15	1		*FRONT BUMPER TOP COVER	Deformed	91.00 FS	*72.56 FS
16	1		*FRONT BUMPER GUIDE SECTION - RH	Deformed	32.00 FS	*25.60 FS
17	1		*SIGN CAUTION	Necessary	13.00 FS	*9.76 FS
18	1		*AIR CONDITIONER STICKER	Necessary	7.00 FS	*5.12 FS
19	1		*SIGNAL HORN - RH	Not Necessary	180.00 FS	*- FS
20	1		*SIGNAL HORN SPRING SHACKLE - RH	Not Necessary	29.00 FS	*- FS
21	2		*FRONT FENDER - LH / RH	Bent	2,094.00 FS	*1,675.20 FS
22	2		*FRONT FENDER ATTACHMENT PARTS	Not Necessary	72.00 FS	*- FS
23	2		*FRONT FENDER UPPER BRACKET - LH / RH	N/S Deformed / O/S Bent	28.00 FS	*22.08 FS
24	2		*FRONT FENDER BRACKET - LH / RH	Bent	86.00 FS	*68.16 FS
25	2		*FRONT FENDER LOWER BRACKET - LH / RH	Bent	28.00 FS	*22.08 FS
26	2		*FRONT FENDER BRACE - LH / RH	Bent	58.00 FS	*46.08 FS
27	2		*FRONT FENDER CLOSING ELEMENT - LH / RH	Not Necessary	60.00 FS	*- FS
28	2		*FRONT FENDER INSULATION - LH / RH	Not Necessary	138.00 FS	*- FS
29	2		*FRONT WHEEL HOUSING LINER SEAL - UPPER	Not Necessary	66.00 FS	*- FS
30	2		*FRONT WHEEL HOUSING LINER BRACKET - LH / RH	Not Necessary	44.00 FS	*- FS
31	2		*FRONT WHEEL HOUSING LINER - LH / RH	Not Necessary	366.00 FS	*- FS
32	2		*FRONT WHEEL HOUSING LINER ATTACHMENT PARTS	Not Necessary	103.00 FS	*- FS
33	1		*BONNET	Bent	2,549.00 FS	*2,039.20 FS
34	1		*BONNET ATTACHMENT PARTS	Not Necessary	149.00 FS	*- FS
35	2		*BONNET LID HINGE - LH / RH	Bent	112.00 FS	*88.48 FS
36	1		*BONNET GAS FILLED STRUT - RH	Not Necessary	93.00 FS	*- FS
37	1		*BONNET GAS FILLED STRUT BRACKET - RH	Not Necessary	31.00 FS	*- FS
38	2		*BONNET STRIKER - LH / RH	Bent	200.00 FS	*159.04 FS
39	1		*BONNET SOUND ABSORBER	Deformed	201.00 FS	*160.80 FS
40	1		*BONNET IMPACT PROTECTION - CENTER	Deformed	27.00 FS	*21.20 FS
41	1		*BONNET IMPACT PROTECTION - LH	Necessary	28.00 FS	*22.00 FS
42	1		*BONNET IMPACT PROTECTION - RH	Necessary	27.00 FS	*21.20 FS
43	2		*BONNET HINGE COVER	Not Necessary	74.00 FS	*- FS
44	2		*BONNET HINGE REAR COVER	Not Necessary	28.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
45	1		*PLENUM CHAMBER COVER	Deformed	144.00 FS	*114.80 FS
46	1		*WATER BOX	Not Necessary	124.00 FS	*- FS
47	2		*BONNET LID LOCK WITH MIRCRO	Bent	367.00 FS	*293.60 FS
48	1		*BONNET FLAT CONNECTOR HOUSING	Not Necessary	12.00 FS	*- FS
49	1		*BONNET FLAT CONNECTOR HOUSING BRACKET	Not Necessary	6.00 FS	*- FS
50	1		*BONNET BOWDEN CABLE - CENTER	Distorted	53.00 FS	*41.68 FS
51	1		*BONNET LID LOCK CABLE	Not Necessary	67.00 FS	*- FS
52	1		*BONNET LID LOCK CABLE COVER	Not Necessary	9.00 FS	*- FS
53	1		*BONNET RELEASE ELEMENT	Bent	53.00 FS	*41.68 FS
54	2		*BONNET BOWDEN CABLE - LH / RH	Distorted	106.00 FS	*83.36 FS
55	1		*BONNET RELEASE LEVER	Deformed	12.00 FS	*9.60 FS
56	2		*FRONT WHEEL COVER - LH / RH	Deformed	588.00 FS	*469.60 FS
57	2		*HEADLIGHT MOUNTING - LH / RH	N/S Deformed / O/S Distorted	214.00 FS	*85.60 FS
58	2		*LED HEADLIGHT - LH / RH	Cracked	8,982.00 FS	*7,185.60 FS
59	1		*LED HEADLIGHT POWER MODULE	Not Necessary	693.00 FS	*- FS
60	1		*LED HEADLIGHT CONTROL UNIT	Not Necessary	508.00 FS	*- FS
61	1		*LED HEAT SINK - RH	Not Necessary	666.00 FS	*- FS
62	1		*HEAD LIGHT VENTILATION HOSE - RH	Cut	26.00 FS	*20.72 FS
63	1		*HEADLIGHT COMPENSATING PIECE	Not Necessary	44.00 FS	*- FS
64	1		*HEADLIGHT LIFT CYLINDER - RH	Not Necessary	128.00 FS	*- FS
65	1		*HEADLIGHT WASHER HOSE PIPE	Not Necessary	170.00 FS	*- FS
66	1		*LED HEADLIGHT WASHER PIECE	Not Necessary	27.00 FS	*- FS
67	1		*LOCK CARRIER	Bent	907.00 FS	*725.60 FS
68	1		*A/C CONDENSER	Not Necessary	503.00 FS	*- FS
69	1		*A/C REFRIGERANT LINE	Not Necessary	601.00 FS	*- FS
70	1		*A/C REFRIGERANT LINE FOR COMPRESSOR TO CONDENSOR	Bent	461.00 FS	*368.80 FS
71	1		*A/C REFRIGERANT LINE BRACKET	Not Necessary	25.00 FS	*- FS
72	1		*RADIATOR	Bent	878.00 FS	*718.80 FS
73	1		*ADDITIONAL RADIATOR	Bent	837.00 FS	*686.00 FS
74	2		*RADIATOR BUSH LOWER	Deformed	18.00 FS	*14.24 FS
75	2		*RADIATOR BRACKET UPPER	Deformed	77.00 FS	*61.28 FS
76	1		*COOLANT	Necessary	165.00 FS	*131.84 FS
77	1		*RADIATOR FAN WITH FAN RING	Not Necessary	1,483.00 FS	*- FS
78	2		*RADIATOR AIR GUIDE - LH / RH	Deformed	54.00 FS	*21.36 FS
79	1		*RADIATOR SEAL - RH OUTER	Necessary	6.00 FS	*4.48 FS
80	1		*RADIATOR AIR GUIDE - UPPER CENTRE	Deformed	19.00 FS	*15.20 FS
81	1		*AIR INTAKE FOR AIR GUIDE	Not Necessary	53.00 FS	*- FS
82	1		*AIR INTAKE HOSE	Deformed	62.00 FS	*49.20 FS
83	1		*AIR INTAKE SEAL	Not Necessary	13.00 FS	*- FS
84	1		*AIR INTAKE DUCT	Not Necessary	19.00 FS	*- FS
85	1		*AIR INTAKE FOR WATER DRAINAGE HOSE	Not Necessary	31.00 FS	*- FS
86	1		*AIR INTAKE MANIFOLD	Not Necessary	129.00 FS	*- FS
87	1		*AIR INTAKE AIR FILTER	Not Necessary	259.00 FS	*- FS
88	1		*AIR INTAKE INLET MANIFOLD	Not Necessary	588.00 FS	*- FS
89	1		*AIR INTAKE GASKET	Not Necessary	13.00 FS	*- FS
90	1		*CHARGE AIR COOLER	Not Necessary	692.00 FS	*- FS
91	1		*CHARGE AIR COOLER GASKET	Not Necessary	13.00 FS	*- FS
92	1		*CHARGE AIR COOLER SEAL	Not Necessary	13.00 FS	*- FS
93	1		*FRONT WINDSCREEN	Cracked	913.00 FS	*730.40 FS
94	1		*FRONT WINDSCREEN RAIN FOIL SENSOR	Distorted	728.00 FS	*102.40 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
95	1		*PRIMER	Necessary	19.00 FS	*14.88 FS
96	1		*FRONT WINDOW APERTURE SEAL - RH OUTER	Not Necessary	119.00 FS	*- FS
97	1		*FRONT WINDOW GUIDE - RH	Not Necessary	377.00 FS	*- FS
98	1		*EXTERNAL TEMPERATURE SENSOR	Not Necessary	53.00 FS	*- FS
99	1		*FRONT WINDSCREEN SEALANT	Necessary	200.00 FS	*200.00 FS
100	1		*FRONT NO. PLATE	Necessary	40.00 FS	*40.00 FS
101	1		*SUNDRIES	Necessary	800.00 FS	*126.80 FS
102	1		*GUIDE SECTION	Deformed	25.60 FS	*25.60 FS
103	1		*FRONT FENDER TOP BRACKET RHS	Bent	16.32 FS	*16.32 FS
104	1		*SEALING STRIP FOR RADIATOR RHS	Torn	12.48 FS	*12.48 FS
105	1		*COVER FOR AIR INTAKE DUCT	Cracked	21.36 FS	*21.36 FS
<b>Total Parts (\$\$)</b>					<b>36,483.76</b>	<b>20,075.12</b>

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	TO TOW VEHICLE FROM ACCIDENT SCENE	New	280.00	0.00
2	TO REMOVE, CHECK AND REINSTALL FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY	New	360.00	360.00
3	TO REMOVE AND RENEW AIRCON CONDENSER, RADIATOR AND ADDITIONAL RADIATOR CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS	New	1,400.00	1,400.00
4	TO DISMANTLE RHS FRONT DOOR PANEL TRIM. TO REMOVE AND REINSTALL RHS WING MIRROR ASSY	New	300.00	300.00
5	TO REMOVE AND RENEW FRONT WINDSCREEN	New	480.00	480.00
6	TO INSTALL FRONT WINDSCREEN SOLAR FILM	New	400.00	0.00
7	TO DISMANTLE AND RENEW FRONT BUMPER, BOTH FRONT FENDERS, BONNET AND BOTH HEADLIGHTS. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	7,200.00	4,000.00
8	TO RESPRAY FRONT BUMPER, BONNET, HINGES, BOTH FRONT FENDERS, RHS UPPER A-PILLAR AND RHS FRONT DOOR	New	6,300.00	2,850.00
9	TO CARRY OUT DIAGNOSTIC CHECK	New	192.00	192.00
<b>Gross Labour Cost (S\$)</b>			<b>16,912.00</b>	<b>9,582.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >