

ASS. REC. BY:

REF: CS / C7219017760 / Hsf36 Special Instruction: etc

Surveyor: Hock Ann

ASSIGNMENT (Office)

From (Person): Tan Kah Leong of CT1 Date/Time: 8.10.19 16.51 p.m.

Estimated Cost: Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SMG 5503 S Insured: PC 643P

at Workshop m/s Teamwork Tel: 68442475

of 53 Wt Ave 1 # 01-24

Policy No: Claim No: SNM19D204648102

Sum Insured: Excess:

Make of Veh: D.O.A. 2. 10. 2019
(Client's Record)

CA / REV / REP. / REV 24 HRS

Date/Time: 8.10.19 5.14 p.m. Person Contacted: Damin

H.O.D. Endorsement:
Vehicle: IN / OUT

Date/Time	Action/Instruction (✓) Estimate
	PC 643P : NA / L1719017371 / 24 DON - 02/10/2019
	SMG 5503S : NA / L3719017371 / 24 DON - 02/10/2019
23/10/19	

ASSIGNED BY: H-ANN

REF: CPL

claim strip

ASSIGNMENT

From: _____ Date: 8.10.19

Estimated Cost: _____

OD ☒ TP ☐ WS ☐ TP RES ☐ OD RES ☐ EVA ☐ INV ☐ MV

To Inspect Vehicle No: SMG 5503 S

at Workshop n/s Teamwork Garage

of 53 Ws Ave 1 #01-24

Insured: _____

Policy No: _____

Claims No: _____

Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Pol

Rems

Shirley
case

N/S	O/S

Bal. o

IDAC

: Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

6

days

Res: Yes or No

Lum Sum:

20

%

3 Val: Yes or No

CA / REV / REP. / 24 HRS

my

Vehicle: IN / OUT

Date: _____

Person Contacted: _____

Veh No: SMG 5503 S Yr Regn: 24/12/2018

Type: ☒ M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: mazda 3 sedan cc 1496

Colour: Gray A/C: Insured / Std / NI / NA

Sp. Reading: 8279 / km T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JM6BN22A8/K0349422

Gen. Cond: ☒ Good / ☐ Poor / Burnt

Steering: ☒ Inorder / ☐ Jammed / ☐ Leaked / ☐ Burnt or

Brake: ☒ Inorder / ☐ Jammed / ☐ Leaked / ☐ Burnt or

Modi: ☒ Nil / ☐ S/Rim / ☐ STD A/Rim or

Tyre Size: F: 205/60/R16

R: 205/60/R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

5

mm

Rear

R/Bal.

5

mm

L/Bal.

5

mm

L/Bal.

5

mm

D.O.A

2/10/19

D.O.I

8/10/19

Survey held at

Team work

Des. of Damages: Frt / Rear / O/S / ☒ N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

MV - 21000

PV - 32438

NV - 38500

MV - 70-71K

RECEIVED 23 OCT 2019

* SMG 5503 S

have Estimated
NON completed

* SMG 5503 S Finalized cost \$5100
and DOR 6 days, Agree by workshop
(LETITIA) TEAMWORK.
(\$ 7,844.00 Red - 61%)

Date/Time, File Pass 1/2

23/10/19

1)

Typist

Date/Time, File Return 1/2

2)

☐

: Preli. Report

☒

: Final Report

Days Of Repair: 6

Resurvey No. of Trip: 2

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Inve (\$

☐

: Wheel end (\$

Survey Fee: 220

Transportation:

\$ + RS. \$

Photos

Others

TOTAL

220

Report Format:

Comp Sum / H.P. / \$ 5,100/- HS

Summer Lee (LKK Auto)

From: Tan Kah Leong <KahLeong.Tan@sg.cntaiping.com>
Sent: Tuesday, 8 October, 2019 4:45 PM
To: Darren; assignments
Subject: RE: OUR REF: SNM19D204648-PC643P-TLKL- OUR REF : 1910-03 // YOURREF : PC643P ACCIDENT INVOLVING PC643P AND SMG5503S

WITHOUT PREJUDICE

Dear Darren,

We refer to your email dated 08.10.2019.

We will be assigning M/s LKK Auto Consultants to survey your client's vehicle on a without prejudice basis.

Aside to LKK,

Please refer to the email below & proceed to survey the third party vehicle.

Thank you.

Regards

Tan Kah Leong
Assistant Executive
Claims Department

China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road #15-00 Springleaf Tower Singapore 079909
DID: (65) 6389 6193 | F: (65) 6222 1033

W: www.sg.cntaiping.com | **FB:** www.facebook.com/chinataipingsg/

Disclaimer: This e-mail and any files transmitted with it is intended only for the named recipients and may contain confidential information. Any unauthorized disclosure, use or dissemination of this message, either in whole or partial, is prohibited. If you are not the intended recipient, please notify the sender immediately. Please delete the e-mail and any copies of it thereafter.

From: Darren [mailto:claims@teamworkgarage.com]
Sent: Tuesday, October 8, 2019 4:30 PM
To: Tan Kah Leong <KahLeong.Tan@sg.cntaiping.com>
Subject: RE: OUR REF: SNM19D204648-PC643P-TLKL- OUR REF : 1910-03 // YOURREF : PC643P ACCIDENT INVOLVING PC643P AND SMG5503S

Hi Sir,

As spoken just now,

Please appoint LKK

Darren
Teamwork Garage Pte Ltd
53 Ubi Avenue 1
#01-24 Paya Ubi Industrial Park
Singapore 408934

Tel: 68442475
Fax: 68442474

From: Tan Kah Leong

Sent: Monday, 7 October 2019 5:52 PM

To: Teamwork Garage

Subject: RE: OUR REF: SNM19D204648-PC643P-TLKL- OUR REF : 1910-03 // YOURREF : PC643P ACCIDENT INVOLVING PC643P AND SMG5503S

Without Prejudice

Dear Sirs,

Please see attached and let us know if you agree with SJE.

Thank you.

Regards

Tan Kah Leong

Assistant Executive
Claims Department

China Taiping Insurance (Singapore) Pte. Ltd.

3 Anson Road #15-00 Springleaf Tower Singapore 079909
DID: (65) 6389 6193 | F: (65) 6222 1033

W: www.sg.cntaiping.com | FB: www.facebook.com/chinataipingsg/

Disclaimer: This e-mail and any files transmitted with it is intended only for the named recipients and may contain confidential information. Any unauthorized disclosure, use or dissemination of this message, either in whole or partial, is prohibited. If you are not the intended recipient, please notify the sender immediately. Please delete the e-mail and any copies of it thereafter.

From: Claims Dept of CTI

Sent: Monday, October 7, 2019 5:32 PM

To: Tan Kah Leong <KahLeong.Tan@sg.cntaiping.com>; Chee So Chow <sochow.chee@sg.cntaiping.com>;
Teamwork Garage <claims@teamworkgarage.com>

Subject: OUR REF: SNM19D204648-PC643P-TLKL- OUR REF : 1910-03 // YOUR REF : PC643P ACCIDENT INVOLVING PC643P AND SMG5503S

Dear Kah Leong,

Please conduct PRS for SMG5503S.

Note : officer in charge – Kah Leong 63896193.

Regards,

Claims Department

China Taiping Insurance (Singapore) Pte. Ltd.

3 Anson Road #15-00 Springleaf Tower Singapore 079909
T: (65) 63896116 | F: (65) 62247175

W: www.sg.cntaiping.com | FB: www.facebook.com/chinataipingsg/ | WeChat: 太平獅城 Taiping SG

Disclaimer: This e-mail and any files transmitted with it is intended only for the named recipients and may contain confidential information. Any unauthorized disclosure, use or dissemination of this message, either in whole or partial, is prohibited. If you are not the intended recipient, please notify the sender immediately. Please delete the e-mail and any copies of it thereafter.

From: TEAMWORK [mailto:claims@teamworkgarage.com]
Sent: Monday, 7 October, 2019 2:17 PM
To: Claims Dept of CTI <claimsdept@sg.cntaiping.com>
Cc: TEAMWORK <claims@teamworkgarage.com>
Subject: OUR REF : 1910-03 // YOUR REF : PC643P ACCIDENT INVOLVING PC643P AND SMG5503S

WITHOUT PREJUDICE

OUR REF : 1910-03
YOUR REF : PC643P

Dear Sir / Madam,
PRE-REPAIR INSPECTION FOR SMG5503S
ACCIDENT INVOLVING PC643P AND SMG5503S ON 02.10.2019.

We refer to the above matter and enclosed herewith our client's GIA report and notification of Pre-repair inspection for your attention.

We also enclosed herewith the State Court of the Republic of Singapore Practice Direction-Amendment No. 1 of 2016 of 2016 of Pre-repair Inspection for your attention.

Thank you and have a nice day.

Regards,

Shu Shan

Teamwork Garage Pte Ltd
Blk 53 Ubi Avenue 1
#01-24
Paya Ubi Industrial Park
Singapore 408934
Tel: 6844 2475
Fax: 6844 2474

This email has been scanned by the Symantec Email Security.cloud service.
For more information please visit <http://www.symanteccloud.com>

This email has been scanned by the Symantec Email Security.cloud service.
For more information please visit <http://www.symanteccloud.com>

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	07 Oct 2019		08 Oct 2019 16:51 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All
------	-----------	---------------	-----------	--------------------------

CLAIM SUBFOLDER DETAILS [Created by insurer]

Insured:	
Main Claimant:	ROSET LIMOUSINE SERVICES PTE LTD, Co. Reg. No.: 200406722Z
Vehicle Reg. No.:	SMG5503S
Claim Type:	TP / SNM19D204648C02
Vehicle Reg. No. (Insured):	PC643P
Date of Loss:	02/10/2019 09:00 - :59
Policy/Cover Note No.:	DMB1SN18258918000
Policy No. (Claimant):	SD18V12322/VPZ/R00
Excess:	S\$2,500.00
Repairer:	Teamwork Garage Pte Ltd (HQ) 53 Ubi Ave 1 #01-24, Paya Ubi Industrial Park, 408934 Ubi - Tel: 6844 2475
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Tan Kah Leong - 63896193]
Claimant's Insurer:	Liberty Insurance Pte Ltd (HQ) - Tel: (65) 6221 8611
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 17/10/2019]

ASSOCIATED MAIL RECEIVED [View All](#) [Compose Case Mail](#)

There are no mail for this case.

ALL ASSOCIATED TASKS [View All](#) [Search Tasks](#) [Create New Task](#) [Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	722Z
Vehicle Details	
Vehicle No.:	SMG5503S
Vehicle to be Exported:	No
Intended Deregistration Date:	09 Oct 2019
Vehicle Make:	MAZDA
Vehicle Model:	MAZDA3 SEDAN 1.5 AT EU6
Primary Colour:	Grey
Manufacturing Year:	2018
Engine No.:	P520547779
Chassis No.:	JM6BN22A8K0249422
Maximum Power Output:	88.0 kW (118 bhp)
Open Market Value:	\$14,329.00
Original Registration Date:	24 Dec 2018
First Registration Date:	24 Dec 2018
Transfer Count:	0
Actual ARF Paid:	\$14,329.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	23 Dec 2028
PARF Rebate Amount:	\$10,746.00
Intended COE Rebate Details	
COE Expiry Date:	23 Dec 2028
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$23,568.00
COE Rebate Amount:	\$21,692.00
Total Rebate Amount:	\$32,438.00

The information contained herein is correct as at 09 Oct 2019

DOA = 2/10/19

MV - 71000

PV - 32438

NV - 38500

MV - 70-7112

OK

Buane 9yr 2 month

Depreciation = 7000 per year

$7000 \div 12 = 583$ month

$63000 + 1166 + 7164$

$= 71330$

Enquire Vehicle Transfer Fee

Vehicle Details

Vehicle No.
SMG5503S

Make / Model
MAZDA / MAZDA3 SEDAN 1.5 AT EU6

Vehicle Type :
Z10 - Private Hire (Chauffeur) Motor Car

Vehicle Attachment 1 :
With Sun Roof

Vehicle Scheme :
Normal

Chassis No. :
JM6BN22A8K0249422

Propellant :
Petrol

Engine No. :
P520547779

Motor No. :
-

Engine Capacity :
1496 cc

Power Rating :
-

Maximum Power Output :
88.0 kW (118 bhp)

Maximum Laden Weight :

1835 kg

Unladen Weight :

1310 kg

Year Of Manufacture :

2018

Original Registration Date :

24 Dec 2018

Lifespan Expiry Date :

-

COE Category :

A - Car up to 1600cc & 97kW (130bhp)

Quota Premium :

\$23,568.00

COE Expiry Date :

23 Dec 2028

Road Tax Expiry Date :

23 Dec 2019

PARF Eligibility Expiry Date :

23 Dec 2028

Inspection Due Date :

23 Dec 2021

Intended Transfer Date :

09 Oct 2019

CO2 Emission :

128.00 (g/km)

CEV/VES Rebate Utilised Amount :

-

CO Emission :

0.051600 (g/km)


HC Emission :

0.023260 (g/km)

NOx Emission :

0.007150 (g/km)

PM Emission :



We're revving up our celebrations for our first-year milestone



Mazda 3

Price Range

Depreciation

2018

Vehicle Type

Advanced Search

Home » Used Cars » Thong Lee Trading Pte Ltd » Mazda 3 1.5A Sunroof

Mazda 3 1.5A Sunroof

Overview

Financial

Insurance

Accessories

Similar

Research

Photos

Map

Price \$78,800

Depreciation \$7,830 /yr
View models with similar depre

Reg Date 27-Nov-2018
(9yrs 1mth 16days COE left)

Mileage 12,173 km

Manufactured 2018

Road Tax \$682 /yr

Transmission Auto

Dereg Value \$13,692 as of today (change)

OHV \$14,466

COE \$25,000

ARF \$14,466

Engine Cap 1,496 cc

Power 88.0 kW (118 bhp)

Curb Weight 1,310 kg

No. of Owners 1

Type of Vehicle Mid-Size Sedan

Features

4 Cylinder Inline 16 Valve DOHC SkyActiv-G, 6 Speed(A) SkyActiv-Drive, Traction/Cruise Control, Sunroof, Keyless Entry/Start, Daytime Running Lights. View specs of the Mazda 3 Sedan (2014-2019)

Accessories

Sports Rims, Leather Seats, Built In Audio System With AUX/USB/Steering Controls, Reverse Sensors, Retractable Side Mirrors, Fog Lamp.

Description

Cheapest In Market. 100% Accident Free. Original Condition. View To Believe. 3 Years Warranty From Agent, Friendly Sales Executives Directly For Viewing Or Appointment.

Category

PAAP Car, Almost New Car

Status

Available

Resources



Vehicle Evaluation

Afraid of lemons? Request to have this car evaluated professionally. Find out more



Car Valuation - Free

Find out the market value of your existing car for free. Get started

Posted on: 07-Oct-2018 | Last Updated on: 08-Oct-2018

Upfront Payment

www.financial.sg

Transfer Fee \$25

Down Payment \$23,640 (1 charge)

Maximum 70% Loan

1st Instalment \$794

Standard 2.99% Interest Rate

Insurance \$1,149 onwards
Not at fault? No upfront payment required! (Get a quote)
Quote assumes a standard profile. "Get a quote" for exact figure.



Total Upfront Payment \$25,808

Check with seller for exact figure

Products and Services

View All



The Largest Car No. Plate market in SG




Customised Upholstery For Mazda 3 Fr \$580



LED Rear Bumper Reflector Lamp



Price Chart

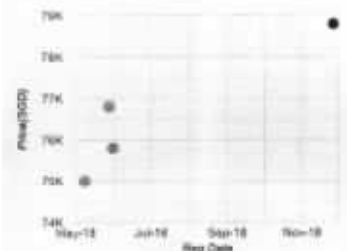

Click on the point to view the vehicle

Shortlist

Compare

Add note

Report Error

More Actions

Seller Information

Company

Thong Lee Trading Pte Ltd

• dealer's profile

• 93 vehs sold | 55 vehs available

Address

61 Ubi Avenue 2 #04-07/08

Search cars nearby this location

Location

Automobile Hegemart

Office No

68419655

Contact Person(s)

Hwee

96672777

Kevin Tan

90618082

Hock Ann (LKK Auto)

From: Hock Ann (LKK Auto)
Sent: Monday, 21 October, 2019 11:51 AM
To: claims@teamworkgarage.com; Darren
Cc: SUR
Subject: RE: SMG5503S MAZDA 3 FINALIZATION

'WITHOUT PREJUDICE'
SAVE AS TO COSTS

Dear letitia ,

Good day, o.k will be process base on finalized total amount COR \$ 5100 and DOR 6 days close.

Thanks.

Best Regards,
Hock Ann | Assistant Automotive Assessor
LKK Auto Consultants
Phone: 6741 3061 | Email: HockAnn@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: claims@teamworkgarage.com [mailto:claims@teamworkgarage.com]
Sent: Friday, 18 October, 2019 2:12 PM
To: Hock Ann (LKK Auto); Admin A
Cc: 'TEAMWORK GARAGE CLAIMS'
Subject: RE: SMG5503S MAZDA 3 FINALIZATION

Hi hock Ann,

We confirm COR @ \$5100 & DOR @ 6 Days

Thank you and have a nice day! ☺

Letitia
Teamwork Garage Pte Ltd
Blk 53 Ubi Avenue 1 #01-24 Paya Ubi Industrial Park
Singapore (408934)
Tel: 6844 2475 | Fax: 6844 2474

From: Hock Ann (LKK Auto) [mailto:HockAnn@lkkauto.com]
Sent: Tuesday, October 15, 2019 7:28 PM
To: Darren <claims@teamworkgarage.com>
Subject: RE: SMG5503S MAZDA 3 FINALIZATION

'WITHOUT PREJUDICE'
SAVE AS TO COSTS

Dear darren,

Good day,with thanks.

Best Regards,
Hock Ann | Assistant Automotive Assessor
LKK Auto Consultants
Phone: 6741 3061 | Email: HockAnn@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Darren [<mailto:claims@teamworkgarage.com>]
Sent: Monday, 14 October, 2019 11:27 AM
To: Hock Ann (LKK Auto)
Subject: RE: SMG5503S MAZDA 3 FINALIZATION

Hi Hock Ann,

Please see attached after repair and alignment slip.

Darren
Teamwork Garage Pte Ltd
53 Ubi Avenue 1
#01-24 Paya Ubi Industrial Park
Singapore 408934
Tel: 68442475
Fax: 68442474

From: Darren
Sent: Saturday, 12 October 2019 2:01 PM
To: HockAnn@lkkauto.com
Subject: SMG5503S MAZDA 3 FINALIZATION

Hi Hock Ann,

FYNA

Based on estimate calculation:

COR @ \$6850
DOR @ 6 Days

Please revise and get back to us so that we can close the case soonest

Darren
Teamwork Garage Pte Ltd
53 Ubi Avenue 1
#01-24 Paya Ubi Industrial Park
Singapore 408934
Tel: 68442475
Fax: 68442474

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	02/10/2019 17:07
Date Of Accident	02/10/2019 09:10
Exact Location Of Accident	CECIL ST TWDS CROSS ST
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMG5503S
Insured/Policyholder	
Name Of Registered Owner	ROSET LIMOUSINE SERVICES PTE LTD
Co Reg No	200406722Z
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-68445225

Vehicle Particulars

Manufacturer	MAZDA
Model	MAZDA3 SEDAN 1.5 AT EU6
Exact Purpose for which vehicle was being used at time of accident	COMMERCIAL USE
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE HIRE

Insurance Company

Name of Insurance Company	LIBERTY INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	SD18V12322/VPZ/R00
Cover Note Number	

Driver

Name of Driver	ONG SIEW KWEE PETER
NRIC No	S1363355Z
Date Of Birth	08/11/1959
Occupation	OUTDOOR
Date Of Driving Pass	18/01/1983
Driving Experience	36 YEARS AND 8 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-94885776
Fax Number	
Contact Number	OFFICE-94885776
Email Address	NOEMAIL

Address	BLK 84 LORONG 2 TOA PAYOH #10-315
Postcode	310084
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	SIDE SWIPE
Weather Conditions	CLEAR
Road Surface	DRY

Other information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO STATEMENT.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	PC643P	→ (SCANIA / 1618 4x2 mmm / 123)
Vehicle Make/Model/Colour		
Details Of Properties		
Vehicle Category	BUS	
Name of Driver		
NRIC/Passport Number		
Contact Number		
Address		
Postcode		
Insurance Company Name		
Nature Of Damage		
No. Of Passenger (Including Driver)		

Accident Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

- 1) Please report correctly on the details of the accident to speed up the claims process.
- 2) This form must be completed by the policy holder and/or the authorised driver.
- 3) Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
- 4) The issue and acceptance of this form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- 5) Any false reporting may be referred to the police for investigation.
- 6) The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
- 7) By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
- 8) **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in the [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such personal information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "insurers"), the insurers' lawyers/law firm, the Monetary Authority of Singapore and any relevant government agency/authority (such as police), for the purpose(s) of:
 - (i) Processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) Investigations the accident and/or my claims;
 - (iii) Carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) Administering my claims (including the mailing of correspondence, statement, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) Complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "purposes")
- (b) All insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyer/law firms, may/are permitted to collect, use, disclose and/or process my personal information for one or more of the above purposes; and
- (c) My personal information may/can be disclosed by any of the insurer and/or GIA to their third party service providers or agents (including their lawyer/law firms), which may be sited outside of Singapore, for one or more of the above purposes.
- (d) My personal information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) The information so collected under (d) above may be shared / disclosed:
 - (i) To all insurers and/or any other third parties that assist in evaluating, investigation, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) For complying with requirements under my regulations, laws or court orders.




Policy holder's signature
Date / time:

Driver's signature
(if driver is not policy holder)
Date / time:

reporting centre personnel's Signature
Date / time:

Accident Sketch Plan

SKETCH PLAN

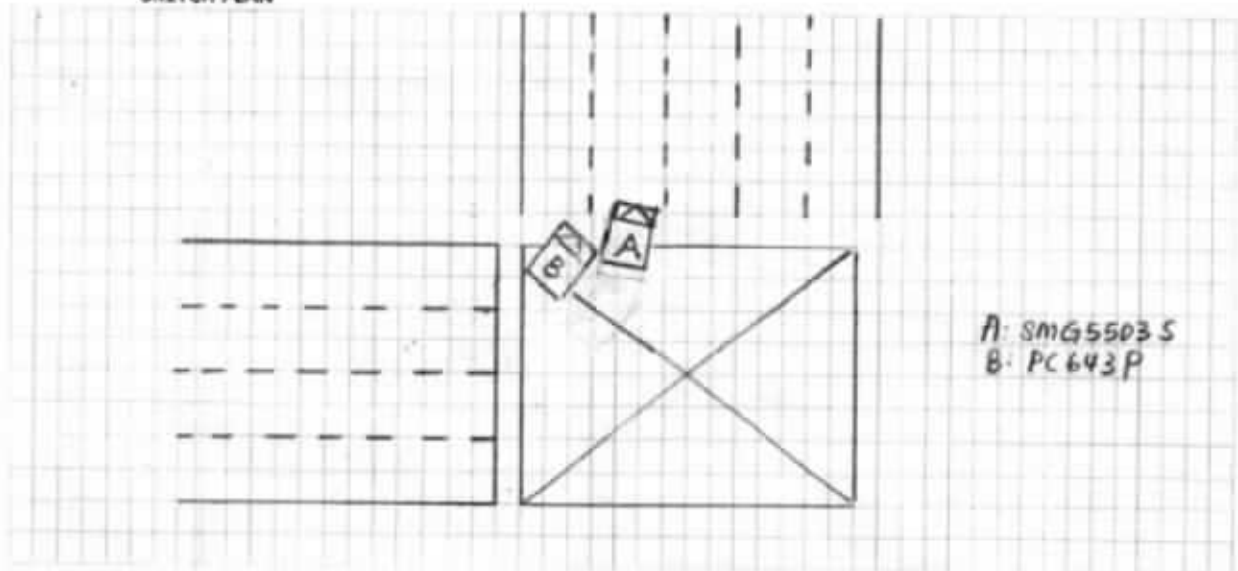

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I was travelling along Cecil Street turning to Cross Street passing by vehicle B which was beside me. When turning, I kept it on my lane. Out of sudden, I felt an impact from my left. Vehicle B which was turning misjudged and collided onto my vehicle.

DECLARATION

I/We declare the foregoing particulars are true in every respect.



Policy holder's signature
Date & time:

[Signature]

Driver's signature
(If driver is not policy holder)
Date & time:

[Signature]

reporting centre personnel's Signature
NRIC/FIN No.:

CHINA TAIPING INSURANCE

3 Anson Rd

#16-00 Springleaf Tower

Singapore 079909

TeamWork Garage Pte Ltd

53 Ubi Avenue 1 #01-23/24 Spore 408934

Paya Ubi Industrial Park

Tel : 6844 2475 Fax : 6844 2474

E-mail : claims@teamworkgarage.com

ROC number : 201015366H

3RD PARTY CLAIM ESTIMATION

Vehicle number	:	SMG5503S
Make / Model	:	MAZDA/3
Chassis number	:	JM6BN22A8K0249422
Accident date	:	02 October 2019
Reference	:	1910-03

Qty Particulars Unit Price - SGD \$

PARTS REPLACEMENT - LIST ITEMS		
1	REAR BUMPER ✓ CR4	1236.50 1010.50 ✓
1	REAR BUMPER RETAINER 2H only ✓ CR4	42.55 85.10 ✓ 235.50
2	REAR BUMPER BRACKET X SVC	105.80
1	REAR LH TAILLAMP X SVC	1052.25
1	REAR LH FENDER ✓ OT	1351.25 1150.50 ✓
1	REAR LH FENDER INNER TRIM X SVC	271.40
1	REAR LH FENDER INNER SHIELD ✓ CR4	119.40 87.80 ✓
1	REAR WINDSCREEN MOULDING ✓ nec	84.95 ✓
1	REAR LH DOOR PANEL ✓ OT	1290.40 998.40 ✓
1	REAR LH DOOR INNER TRIM ✓ CR4	712.50 320.80 ✓
1	REAR LH DOOR LOCK ASSY ✓ Jm	612.09 280.70 ✓
1	REAR LH DOOR REGULATOR MOTOR ASSY ✓ CR4	692.50 310.70 ✓
1	REAR LH DOOR FRAME STICKER brake ✓ nec	98.00 45 ✓
1	REAR LH SHOCK ABSORBER X SVC	709.10
1	REAR LH KNUCKLE ARM ✓ CR4	602.04 260.80 ✓
1	REAR LH KNUCKLE BEARING ✓ CR4	368.34 242.40 ✓
1	REAR LH LOWER ARM X SVC	609.63
		10001.25
Less 20 %		2000.25
Subtotal		8001.00
Balance C/F		8001.00
PARTS REPLACEMENT - SPECIAL NETT ITEMS		
1	RIM Rm 21H ✓ 16inch SCR	700.00 380.00 ✓
1 BOT	BRAKE FULID X SVC	60.00 X
1 SET	REAR BUMPER CLIP ✓ nec	40.00 30 ✓
1 SET	REAR FENDER INNER SHIELD CLIP ✓ nec 21H	30.00 15 ✓
1	WINDSCREEN SEALANT ✓ nec	150.00 40 ✓
1	JOINT SEALANT ✓ nec	150.00 20 ✓
Subtotal		1130.00
Balance C/F		9131.00
LABOUR AND MISCELLANEOUS CHARGES		
Balance B/F		9131.00

1	CHECK REAR WIRING AND LIGHTING SYSTEM	60.00	20	✓
2	REMOVE AND REFIT REAR LINING, TRIM AND GARNISH	150.00	50	✓
3	REMOVE AND REFIT REAR WINDSCREEN	150.00	100	✓
4	REMOVE AND REFIT FUEL TANK	150.00	60	✓
5	COMPUTERISED AND CHECK REAR WHEEL ALIGNMENT → (A10 + report)	150.00	60	✓
6	REMOVE AND REPLACE REAR UNDERCARRIAGE PARTS → (photo)	200.00	100	✓
7	TRANSFER PARTS, ATTACHMENT FROM OLD REAR DOOR TO NEW → (Bolt/4 door)	200.00	60	✓
8	PANEL BEATING ON AFFECTED AREAS 2.5 ps	1400.00	700	✓
9	SPRAY PAINTING ON AFFECTED AREAS 4 ps	1200.00	800	✓
10	APPLY ANTI RUST ON AFFECTED AREAS → (Per Fender 4/11)	150.00	30	✓
Subtotal		3810.00		
Grand total		12941.00		
Parts =		4855.10		
less		20%		
		3884.08		
spe nett =		485		
labour =		2030		
		6399.08		
L/s less		20%		
		5119.26		
Total				
L/s Amt =		\$ 5100		

[Signature]
10/10/19

Resurvey
9/10/19
11.20pm
H. ANN
rang after paint

TP
L/s repair
without prejudice
5.50pm
8/10/19
6 Days
resurvey after paint
Hock Ann @ LKK Auto.com
85311PPS

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature: _____
Date: _____



Chassis Measurement Chart

Subsidiary/Branch-Company no.

Customer:

C&Y AUTO PTE LTD

TEAM WORK

53 UBI AVE 1 #01-28 PAYA UBI INDUSTRIAL PARK
S'PORE 408934

Vehicle ident. no.

Repair order no.

Measurement made Name

Date:

WEI KEN

08/10/2019

Reg. N.:

First registration:

Type

Mileage: Km/miles

SMG 5503 S 1910-03

MAZDA 3 SKYACTIV 16" 2014 - (33843)

km

Complaint or reason for measurement

Tyres: make

Description

Mileage: Km/miles

		front LH	front RH	rear LH	rear RH
Pressure measured (cold) bar/psi/kPa		2.2	2.2	2.2	2.2
	external				
Tread depth (mm)	centre				
	internal				
		Before correction		After correction	
Vehicle level					
REAR AXLE	Camber +/- (")	LH	-00.47°	-00.77°/ +01.00°-01.00°	-00.47°
		RH	+00.01°	-00.77°/ +01.00°-01.00°	+00.01°
	total		-01.02° *	+00.20°/ +00.48°-00.48°	-01.02° *
	Toe +/- (")	LH	-00.86° *	+00.10°/ +00.24°-00.24°	-00.86° *
		RH	-00.16° *	+00.10°/ +00.24°-00.24°	-00.16° *
	Thrust angle		-00.35°		-00.35°
FRONT AXLE	Camber +/- (")	LH	-00.09°	+00.05°/ +01.00°-01.00°	-00.09°
		RH	-00.27°	+00.05°/ +01.00°-01.00°	-00.27°
	Caster (")	LH		+06.65°/ +01.00°-01.00°	
		RH		+06.65°/ +01.00°-01.00°	
	Lh steering lock lh wheel 20°				
	Rh steering lock rh wheel 20°				
Set Back			+00.22°		+00.22°
	total		-00.24°	+00.22°/ +00.48°-00.48°	-00.24°
Toe +/- (")	LH		+00.06°	+00.11°/ +00.24°-00.24°	+00.06°
	RH		-00.30° *	+00.11°/ +00.24°-00.24°	-00.30° *
Maximum steering angle on wheel side on inside of bend (")	LH				
	RH				



Chassis Measurement Chart

Subsidiary/Branch-Company no.

Customer:

C&Y AUTO PTE LTD

TEAM WORK

53 UBI AVE 1 #01-28 PAYA UBI INDUSTRIAL PARK

S'PORE 408934

Vehicle ident. no.

Repair order no.

Measurement made Name

Date:

WEI KEN

10/11/2019

Reg. N:

First registration:

Type

Mileage Km/miles

SMG 5503 S

1910-03

MAZDA 3 SKYACTIV 16"

2014 - (33843)

km

Complaint or reason for measurement

Tyres:make

Description

Mileage:Km/miles

		front LH	front RH	rear LH	rear RH
Pressure measured (cold) bar/psi/kPa		2.2	2.2	2.2	2.2
	external				
Tread depth (mm)	centre				
	internal				
		Before correction		After correction	
Vehicle level					
REAR AXLE	Camber +/- (")	LH	-00.47°	-00.77° / +01.00°-01.00°	-00.54°
		RH	+00.01°	-00.77° / +01.00°-01.00°	-00.09°
	total		-01.02° *	+00.20° / +00.48°-00.48°	+00.20°
	Toe +/- (")	LH	-00.86° *	+00.10° / +00.24°-00.24°	+00.03°
		RH	-00.16° *	+00.10° / +00.24°-00.24°	+00.17°
	Thrust angle		-00.35°		-00.07°
FRONT AXLE	Camber +/- (")	LH	-00.09°	+00.05° / +01.00°-01.00°	+00.05°
		RH	-00.27°	+00.05° / +01.00°-01.00°	-00.19°
	Caster (")	LH		+06.65° / +01.00°-01.00°	
		RH		+06.65° / +01.00°-01.00°	
	Lh steering lock lh wheel 20°				
	Rh steering lock rh wheel 20°				
	Set Back		+00.22°		-00.03°
	total		-00.24°	+00.22° / +00.48°-00.48°	+00.14°
Toe +/- (")		LH	+00.06°	+00.11° / +00.24°-00.24°	+00.11°
		RH	-00.30° *	+00.11° / +00.24°-00.24°	+00.03°
	Maximum steering angle on wheel side on inside of bend (")	LH			
		RH			



Chassis Measurement Chart

Subsidiary/Branch-Company no.

Customer:

C&Y AUTO PTE LTD

TEAM WORK

53 UBI AVE 1 #01-28 PAYA UBI INDUSTRIAL PARK

S'PORE 408934

Vehicle ident. no.

Repair order no.

Measurement made: Name

Date: 11-10-2019

WEI KEN

10/11/2019

Reg. N:

First registration:

Type

Mileage: Km/miles

SMG 5503 S

1910-03.

MAZDA 3 SKYACTIV 16" 2014 - (33843)

km

Complaint or reason for measurement

Tyres: make

Description

Mileage: Km/miles

		front LH	front RH	rear LH	rear RH
Pressure measured (cold) bar/psi/kPa		2.2	2.2	2.2	2.2
	external				
Tread depth (mm)	centre				
	internal				
		Before correction		After correction	
Vehicle level					
Camber +/- (°)	LH	-00.47°	-00.77°/ +01.00°-01.00°	-00.54°	
	RH	+00.01°	-00.77°/ +01.00°-01.00°	-00.09°	
REAR AXLE	total	-01.02° *	+00.20°/ +00.48°-00.48°	+00.20°	
Toe +/- (°)	LH	-00.86° *	+00.10°/ +00.24°-00.24°	+00.03°	
	RH	-00.16° *	+00.10°/ +00.24°-00.24°	+00.17°	
Thrust angle		-00.35°		-00.07°	
Camber +/- (°)	LH	-00.09°	+00.05°/ +01.00°-01.00°	+00.05°	
	RH	-00.27°	+00.05°/ +01.00°-01.00°	-00.19°	
Caster (°)	LH		+06.65°/ +01.00°-01.00°		
	RH		+06.65°/ +01.00°-01.00°		
FRONT AXLE	Lh steering lock lh wheel 20°				
	Rh steering lock rh wheel 20°				
Set Back		+00.22°		-00.03°	
	total	-00.24°	+00.22°/ +00.48°-00.48°	+00.14°	
Toe +/- (°)	LH	+00.06°	+00.11°/ +00.24°-00.24°	+00.11°	
	RH	-00.30° *	+00.11°/ +00.24°-00.24°	+00.03°	
Maximum steering angle on wheel side on inside of bend (°)	LH				
	RH				

8/10 check only & print result is
11/10 4 wheel alignment \$50

#65

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	07 Oct 2019		08 Oct 2019 16:51 Edit Adj Rpt	\$55,100.00 Edit Estimates	\$55,100.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by Insurer]									
Insured: -, Co. Reg. No.: -									
Main Claimant: ROSET LIMOUSINE SERVICES PTE LTD, Co. Reg. No.: 2004067222									
Vehicle Reg. No.: SMG5503S		Date of Loss: 02/10/2019 09:00 - :59 [9 Months and 8 Days From LTA Reg Date (Man Yr)]							
Claim Type: TP / SNM19D204648C02		Policy/Cover Note No.: DMB1SN18258918000							
Vehicle Reg. No. (Insured): PC643P		Policy No. (Claimant): SD18V12322/VPZ/R00							
		Excess: \$2,500.00							
Repairer: Teamwork Garage Pte Ltd (HQ) 53 Ubi Ave 1 #01-24, Paya Ubi Industrial Park, 408934 Ubi - Tel: 6844 2475									
Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Tan Kah Leong - 63896193]									
Claimant's Insurer: Liberty Insurance Pte Ltd (HQ) - Tel: (65) 6221 8611									
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by LEE HOCK ANN] ... [Final Rpt due 17/10/2019]									
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
There are no mail for this case.									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SMG5503S (SNM19D204648C02)
[PC643P]
TP
ROSET LIMOUSINE SERVICES PTE LTD
Oct 2 2019 9:00AM
[-]
Teamwork Garage Pte Ltd

Upload Documents			Upload Photos			Compose New Letter			View			View in Browser		
Photos/Images									3 per page			☒		
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)							Thumbnail			Print		
1	10/10/19 09:52	Odometer Reading										Load JPG ☒		
2	10/10/19 09:53	Chassis Number										Load JPG ☒		
3	10/10/19 09:53	General View										Load JPG ☒		
4	10/10/19 09:53	General View										Load JPG ☒		
5	10/10/19 09:53	General View										Load JPG ☒		
6	10/10/19 09:53	General View										Load JPG ☒		
7	10/10/19 09:53	General View										Load JPG ☒		
8	10/10/19 09:53	General View										Load JPG ☒		
9	10/10/19 09:53	General View										Load JPG ☒		
10	10/10/19 09:53	General View										Load JPG ☒		
11	10/10/19 09:53	General View										Load JPG ☒		
12	10/10/19 09:53	General View										Load JPG ☒		
13	10/10/19 09:53	General View										Load JPG ☒		
14	10/10/19 09:53	General View										Load JPG ☒		
15	10/10/19 09:53	General View										Load JPG ☒		
16	10/10/19 09:53	General View										Load JPG ☒		
17	10/10/19 09:53	General View										Load JPG ☒		
18	10/10/19 09:53	General View										Load JPG ☒		
19	10/10/19 09:53	General View										Load JPG ☒		
20	10/10/19 09:53	General View										Load JPG ☒		
21	10/10/19 09:53	General View										Load JPG ☒		
22	10/10/19 09:54	General View										Load JPG ☒		
23	10/10/19 09:54	General View										Load JPG ☒		
24	10/10/19 09:54	General View										Load JPG ☒		
25	10/10/19 09:54	General View										Load JPG ☒		
26	10/10/19 09:54	General View										Load JPG ☒		
27	10/10/19 09:54	General View										Load JPG ☒		
28	10/10/19 09:54	General View										Load JPG ☒		
29	10/10/19 09:54	General View										Load JPG ☒		
30	10/10/19 09:54	General View										Load JPG ☒		
31	10/10/19 09:54	General View										Load JPG ☒		
32	10/10/19 09:54	General View										Load JPG ☒		
33	10/10/19 09:54	General View										Load JPG ☒		
34	10/10/19 09:54	General View										Load JPG ☒		
35	10/10/19 09:54	General View										Load JPG ☒		
36	10/10/19 09:54	General View										Load JPG ☒		
37	10/10/19 09:54	General View										Load JPG ☒		
38	10/10/19 09:54	General View										Load JPG ☒		
39	10/10/19 09:54	General View										Load JPG ☒		
40	10/10/19 09:54	General View										Load JPG ☒		
41	10/10/19 09:54	General View										Load JPG ☒		
42	10/10/19 09:54	General View										Load JPG ☒		
43	10/10/19 09:54	General View										Load JPG ☒		

Photos/Images			3 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
44	10/10/19 09:54	General View	 Load JPG	☒
45	10/10/19 09:54	General View	 Load JPG	☒
46	10/10/19 09:54	General View	 Load JPG	☒
47	10/10/19 09:54	General View	 Load JPG	☒
48	10/10/19 09:54	General View	 Load JPG	☒
49	10/10/19 09:54	General View	 Load JPG	☒
50	10/10/19 09:54	General View	 Load JPG	☒
51	10/10/19 09:54	General View	 Load JPG	☒
52	10/10/19 09:54	General View	 Load JPG	☒
53	10/10/19 09:54	General View	 Load JPG	☒
54	10/10/19 09:54	General View	 Load JPG	☒
55	10/10/19 09:56	Reinspection Photo	 Load JPG	☒
56	10/10/19 09:56	Reinspection Photo	 Load JPG	☒
57	10/10/19 09:56	Reinspection Photo	 Load JPG	☒
58	10/10/19 09:56	Reinspection Photo	 Load JPG	☒
59	10/10/19 09:56	Reinspection Photo	 Load JPG	☒
60	10/10/19 09:56	Reinspection Photo	 Load JPG	☒
61	10/10/19 09:56	Reinspection Photo	 Load JPG	☒
62	10/10/19 09:56	Reinspection Photo	 Load JPG	☒
63	10/10/19 09:56	Reinspection Photo	 Load JPG	☒
64	10/10/19 09:56	Reinspection Photo	 Load JPG	☒
65	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
66	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
67	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
68	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
69	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
70	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
71	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
72	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
73	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
74	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
75	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
76	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
77	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
78	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
79	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
80	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
81	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
82	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
83	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
84	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
85	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
86	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
87	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
88	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
89	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
90	10/10/19 09:57	Reinspection Photo	 Load JPG	☒
91	16/10/19 08:43	After Repair Photo	 Load JPG	☒
92	16/10/19 08:43	After Repair Photo	 Load JPG	☒
93	16/10/19 08:43	After Repair Photo	 Load JPG	☒
94	16/10/19 08:43	After Repair Photo	 Load JPG	☒
95	16/10/19 08:43	After Repair Photo	 Load JPG	☒
96	16/10/19 08:43	After Repair Photo	 Load JPG	☒

Linked Accident Report Documents

				View	view in Browser
Assessment Reports				1 per page	☒
No	Finalized On	National Assessment Centre Services (Ubi)		Thumbnail	Print
1	02/10/19 17:15	Accident Statement		Load HTM	
Photos/Images				3 per page	☒
No	Finalized On	National Assessment Centre Services (Ubi)		Thumbnail	Print
1	02/10/19 17:14	Accident Photo		Load JPG	☒
2	02/10/19 17:14	Accident Photo		Load JPG	☒
3	02/10/19 17:14	Accident Photo		Load JPG	☒
4	02/10/19 17:14	Accident Photo		Load JPG	☒
5	02/10/19 17:14	Accident Photo		Load JPG	☒
6	02/10/19 17:14	Accident Photo		Load JPG	☒
7	02/10/19 17:14	Accident Photo		Load JPG	☒
8	02/10/19 17:14	Accident Photo		Load JPG	☒
9	02/10/19 17:14	Accident Photo		Load JPG	☒
10	02/10/19 17:14	Accident Photo		Load JPG	☒
11	02/10/19 17:14	Accident Photo		Load JPG	☒
12	02/10/19 17:14	Accident Photo		Load JPG	☒
Documentation				1 per page	☒
No	Finalized On	National Assessment Centre Services (Ubi)		Thumbnail	Print
1	02/10/19 17:14	Accident Sketch Plan		Load JPG	☒
2	02/10/19 17:14	Accident Sketch Plan		Load JPG	☒

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)			
Show Remarks To: ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.			

LKK Auto Consultants Pte Ltd (Co. Reg. No: 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CTI19017760/HSF3E2

Date: 29/10/2019

REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMB1SN18258918000
Claimant Vehicle No :	SMG5503S	Insured Vehicle No :	PC643P
Date of Loss:	02/10/2019	Nature of Claim: TP	Claim No: SNM19D204648C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMG5503S	Engine No:	P520547779
Make & Model:	MAZDA 3, 1.5 SEDAN EU6 (A)	Chassis No:	JM6BN22A8K0249422
Reg. Date:	24/12/2018 (Man. Year: 2018)	Odometer:	82791 km
Colour:	Grey		
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/60 R16	Rear Tyre Size:	205/60 R16
Front Left Side:	Bridgestone 5 mm	Rear Left Side:	Falken 5 mm
Front Right Side:	Bridgestone 5 mm	Rear Right Side:	Falken 5 mm

The above values represent the remaining tyre treads depth.

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	9,131.00	4,369.08	4,761.92	52.15
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,810.00	2,030.00	1,780.00	46.72
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	12,941.00	6,399.08	6,541.92	50.55
Approved Total (Overridden) (S\$)		5,100.00		
(S\$)	12,941.00	5,100.00	7,841.00	60.59
+ GST 7.00/7.00% (S\$)	905.87	357.00	548.87	60.59
Nett Amount (S\$)	13,846.87	5,457.00	8,389.87	60.59

INSPECTION

Date of Assignment:	08/10/2019	
Date Inspected:	08/10/2019 Inspected At:	Teamwork Garage Pte Ltd (HQ) 53 Ubi Ave 1 #01-24, Paya Ubi Industrial Park Singapore 408934
Estimated Period of Repair:	6.0 days	

Adjuster: LEE HOCK ANN

Manager: Hiew May Fung

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 29 Oct 2019)
Parts:	143	MAZDA 3 1.5 SEDAN EU6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMG5503S)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Crushed	1,236.50 FL	*1,030.50 FL
2	1		*REAR BUMPER RETAINER	N/S Crushed	85.10 FL	*42.55 FL
3	2		*REAR BUMPER BRACKET	Serviceable	105.80 FL	*- FL
4	1		*REAR LH TAILLAMP	Serviceable	1,052.25 FL	*- FL
5	1		*REAR LH FENDER	Bent	1,351.25 FL	*1,150.50 FL
6	1		*REAR LH FENDER INNER TRIM	Serviceable	271.40 FL	*- FL
7	1		*REAR LH FENDER INNER SHIELD	Crushed	119.40 FL	*87.80 FL
8	1		*REAR WINDSCREEN MOULDING	Necessary	84.95 FL	*84.95 FL
9	1		*REAR LH DOOR	Bent	1,290.40 FL	*998.40 FL
10	1		*REAR LH DOOR INNER TRIM	Crushed	712.50 FL	*320.80 FL
11	1		*REAR LH DOOR LOCK ASSY	Jammed	612.09 FL	*280.70 FL
12	1		*REAR LH DOOR REGULATOR MOTOR ASSY	Crushed	692.50 FL	*310.70 FL
13	1		*REAR LH DOOR FRAME STICKER	Necessary	98.00 FL	*45.00 FL
14	1		*REAR LH SHOCK ABSORBER	Serviceable	709.10 FL	*- FL
15	1		*REAR LH KNUCKLE ARM	Crushed	602.04 FL	*260.80 FL
16	1		*REAR LH KNUCKLE BEARING	Crushed	368.34 FL	*242.40 FL
17	1		*REAR LH LOWER ARM	Serviceable	609.63 FL	*- FL
18	1		*BOT BRAKE FLUID	Serviceable	60.00 FS	*- FS
19	1		*SET REAR BUMPER CLIP	Necessary	40.00 FS	*30.00 FS
20	1		*SET REAR FENDER INNER SHIELD CLIP	N/S Necessary	30.00 FS	*15.00 FS
21	1		*WINDSCREEN SEALANT	Necessary	150.00 FS	*40.00 FS
22	1		*JOINT SEALANT	Necessary	150.00 FS	*20.00 FS
23	1		*RIM REAR L/H	Scratched	700.00 FS	*380.00 FS
					Sub Total (S\$)	11,131.25 5,340.10
					- List Item Discount on L Items 20.00/20.00% (S\$)	2,000.25 971.02
					Total Parts (S\$)	9,131.00 4,369.08

F=Franchise part. S=SpcNett. L=ListItemDisc.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	CHECK REAR WIRING AND LIGHTING SYSTEM	New	60.00	20.00
2	REMOVE AND REFIT REAR LINING, TRIM AND GARNISH	New	150.00	50.00
3	REMOVE AND REFIT REAR WINDSCREEN	New	150.00	100.00
4	REMOVE AND REFIT FUEL TANK	New	150.00	60.00
5	COMPUTERISED AND CHECK REAR WHEEL ALIGNMENT	New	150.00	60.00
6	REMOVE AND REPLACE REAR UNDERCARRIAGE PARTS	New	200.00	100.00
7	TRANSFER PARTS, ATTACHMENT FROM OLD REAR DOOR TO NEW	New	200.00	60.00
8	PANEL BEATING ON AFFECTED AREAS	New	1,400.00	700.00
9	SPRAY PAINTING ON AFFECTED AREAS	New	1,200.00	850.00
10	APPLY ANTI RUST ON AFFECTED AREAS	New	150.00	30.00
Gross Labour Cost (S\$)			3,810.00	2,030.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >