

REF: AIG (C3) AIG 19017879 / A9f302

ASS. REC. BY:

Minimum

ASSIGNMENT

From: _____ Date: 10.10.2019

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: E7 2882T

at Workshop n/s: Premium

at 55 ubi road 1

Insured:

Policy No. 1800070984

Claims No. 986321817956

Sum Insured: _____ Excess: 1100 14/10/19

(Client's Record)

Make of Veh: 11300m owner waby

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 95K.

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 07/10/19 days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: ET2882T. Yr Regn: 2018 / June

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Audi A3 Sedan. c.c. 999

Colour: Black. A/C: Insured / Std / NI / NA

Sp. Reading: 18271 T/Radio: Insured / Std / NI / NA

Eng/No:

C/No: WAU2228V4J1067307.

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/55R16.

R: 205/55R16.

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 06 mm

R/Bal. 06 mm

L/Bal. 06 mm

L/Bal. 06 mm

D.O.A.

D.O.L. 10/10/19.

Survey held at

Premium.

Des. of Damages: Frt / Rear / O/S (N/S) / U/C / Rooftop or +.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

OD AIG.

ET 2882T - NA/INC 1200 2445/K -

D.O.A. - 16/10/2012.

16/10/19 @ 3.37pm report to Victor via Messenger.

14/10/19 @ 11.23am Victor informed c/a via Messenger.

14/10/19 @ 1.24pm informed Troy c/a & ex: \$100 by email.

10/11/19 @ 5.20pm confirmed with Mr Hor final fig \$10817.20, 7 days.

(Red \$73514.80, 68%)

RECEIVED 21 JAN 2020

Date/Time, File Pass 107

☐ : Prel. Report

Days Of Repair: 7

11/11/19

☐ : Final Report

Resurvey No. of Trip:

Date/Time, File Return 107

Add Fee: ☐ : Site Insp (\$)

Survey Fee:

Transportation:

S + RS \$1

Phone

Other

TOTAL

Rep. Form: MEX-00

Lump Sum / I.P.R. 10817.20

211

Note: This document has not been finalised.**LKK Auto Consultants Pte Ltd** (Co.Reg.No: 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Gan, Hunchung

Date: 10 Oct 2019

Preliminary Advice

Vehicle No	: ET2882T	Accident Date	: 03/10/2019
Make	: AUDI A3	Policy No.	: 1800070984
Assignment Date	: 10/10/2019	Excess	: S\$0.00
Date of Inspection	: 10/10/2019	Est. Duration of Repair	: 7.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (UBI) 55 UBI ROAD 1 SINGAPORE 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages n/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	34,332.00
Revised Amount	:S\$	12,107.00
Check Items (Estimated)	:S\$	1,155.00
Total	:S\$	13,262.00

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	95,000.00
COE / PARF Rebate	:S\$	51,597.00
Salvage Value	:S\$	
Margin for Repair	:S\$	43,403.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Monday, 14 October 2019 1:24 PM
To: Claims; SUR
Subject: RE: OD CLAIM FOR ET 2882 T ON 3/10/2019

Dear TRoy,

As instructed by our client, please proceed to repair the insured vehicle **ET 2882T (Excess \$ 1,100/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Shiau Chan (LKKAUTO) <siewsc@lkkauto.com>
Sent: Friday, 11 October 2019 9:21 AM
To: Claims <claims@premiumauto.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: OD CLAIM FOR ET 2882 T ON 3/10/2019

Dear TRoy,

Not yet. We still pending for insurance's approval. Once approve, we will send you an email.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims <claims@premiumauto.com.sg>
Sent: Friday, 11 October 2019 8:57 AM
To: Shiau Chan (LKKAUTO) <siewsc@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: 'Claims' <claims@premiumauto.com.sg>
Subject: RE: OD CLAIM FOR ET 2882 T ON 3/10/2019

Dear Shiau Chan,

Please let me know if the claims is approval by AIG.

Thanks

Claim Audit

AUDIT TRAIL				
No.	On	Audit	Remarks	By
1	04 Oct 2019 15:15	Cim Veh Model Changed		[I] Merimen Administrator
2	04 Oct 2019 15:15	Cim Created	Reg No: ET2882T, Policy No: 1800070984, Acct Date: 2019/10/03, Claim Type: S C, Insurer: AIG Asia Pacific Insurance Pte. Ltd. (SG), Ins.Status => Notification, Created from SAS:MPA119131553	[I] Merimen Administrator
3	10 Oct 2019 14:50	Cim Registration Modified	Setl.Type:3->0, Claim Type:SC->OD.	[I] LEE SU THING
4	10 Oct 2019 14:50	Adj Cim Retrieved	Adj: LKK Auto Consultants Pte Ltd (HQ)	[I] LEE SU THING
5	10 Oct 2019 14:50	Adj Co Assigned	LKK Auto Consultants Pte Ltd (HQ):	[A] LEE SU THING
6	10 Oct 2019 14:50	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2019/10/21	[A] LEE SU THING
7	10 Oct 2019 14:50	Adj Mandate Set	Approved:8000.00,Reinsp:Adj decides.	[A] LEE SU THING
8	10 Oct 2019 14:50	Cim Registration Modified	Rep:1137->200611.	[A] LEE SU THING
9	10 Oct 2019 14:50	Cim Veh Model Changed	(206113) AUDI A3 999cc SEDAN TFSI (A).	[A] LEE SU THING
10	10 Oct 2019 14:50	Adj Adjuster Assigned	[None] -> ADRIAN LING	[A] LEE SU THING
11	10 Oct 2019 15:25	Adj Rpt Initiated		[A] SHIAU CHAN
12	10 Oct 2019 15:25	Cim Dtl Modified	JPJ Reg, Date: -> 2018/06/19.	[A] SHIAU CHAN
13	10 Oct 2019 15:25	Cim Details Notified		[A] SHIAU CHAN
14	10 Oct 2019 15:32	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2019/10/21	[A] SHIAU CHAN
15	10 Oct 2019 15:32	Adj Mandate Request	Cur.Req:13262.00:DAMAGES CONSISTENT, REPAIR COST ECONOMICAL. WE HAVE NOT AUTHORISE REPAIR.	[A] SHIAU CHAN
16	11 Oct 2019 15:09	Cim Registration Modified	Init.Est.:>5,000 - 6,000, Excess: -> 1100.00, 2F Remarks: -> Not Applicable, GST: -> 7.00.	[I] Mithoo Singh, Aashweenjeet Kaur
17	11 Oct 2019 17:00	Label Added	(20226):Coverage Confirmed.	[A] Merimen Administrator
18	14 Oct 2019 11:23	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2019/10/21, Mandate Remarks: Re-inspection to be done for damage check and supplementary items / labour.	[I] Koh, Victor-CK
19	14 Oct 2019 11:23	Adj Mandate Set	Approved:12107.00:Re-inspection to be done for damage check and supplementary items / labour. Reinsp:Yes.	[I] Koh, Victor-CK

Date From



Date To



Audit Type None

Go

ACTIVITY

No record

Merimen Billing for this case - Transaction History

Bill Ref No	Bill Date	Bill Type	Acc Type	Acc Name	Co Name (Branch)	Ref 1	Ref 2	Amount
2308934	10 Oct 2019 15:25:42	OD/TP Case (Adjuster)	Motor	LKK Auto Consultants Pte Ltd	LKK Auto Consultants Pte Ltd (HQ)	ET2882T		11.77

Shiau Chan (LKKAuto)

From: Shiau Chan (LKKAuto)
Sent: Tuesday, 10 December 2019 5:20 PM
To: Boo seng yak; SUR; Carrine Leong; Chang Chee Sing;
jiayee.yap@premiumauto.com.sg
Subject: RE: FINAL REVISION - ET2882T - OD AIG - SURVEYED 10 OCT 19

Dear Mr Boo,

WITHOUT PREJUDICE

Confirm final fig \$10,817.20 before excess \$1,100.00 & GST and 7 repair days.

Kindly expedite the discharge voucher and tax invoice to us for close case.

Best Wishes for Merry Christmas & Happy New Year 2020

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Boo seng yak <boojohnny@gmail.com>
Sent: Thursday, 28 November 2019 5:16 PM
To: Adrian Ling (LKKAuto) <adrianling@lkkauto.com>; Shiau Chan (LKKAuto) <siewsc@lkkauto.com>; SUR <sur@lkkauto.com>; Carrine Leong <carrine.leong@premiumauto.com.sg>; Chang Chee Sing <claims@premiumauto.com.sg>; jiayee.yap@premiumauto.com.sg
Subject: FINAL REVISION - ET2882T - OD AIG - SURVEYED 10 OCT 19

Hi Adrian and all,

Revised estimate is attached.

Please confirm repair cost of \$10,817.20 @ 7 days of repairs exclude 1 Sunday.

Your early closure is well appreciated.

Best regards - jb

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	554A
Vehicle Details	
Vehicle No.:	ET2882T
Vehicle to be Exported:	No
Intended Deregistration Date:	10 Oct 2019
Vehicle Make:	AUDI
Vehicle Model:	A3 SEDAN 1.0 TFSI S TRONIC (LED)
Primary Colour:	Black
Manufacturing Year:	2018
Engine No.:	CHZ462545
Chassis No.:	WAUZZZ8V4J1067307
Maximum Power Output:	85.0 kW (113 bhp)
Open Market Value:	\$24,711.00
Original Registration Date:	19 Jun 2018
First Registration Date:	19 Jun 2018
Transfer Count:	0
Actual ARF Paid:	\$26,596.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	18 Jun 2028
PARF Rebate Amount:	\$19,947.00
Intended COE Rebate Details	
COE Expiry Date:	18 Jun 2028
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$36,426.00
COE Rebate Amount:	\$31,650.00
Total Rebate Amount:	\$51,597.00

The information contained herein is correct as at 10 Oct 2019

OK



CERTIFICATE OF INSURANCE

AUDI AUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder : ONG BOO HONG(WANG WUHONG)
Period of Insurance : 19 Jun 2018 To 18 Jun 2020
Engine No. : CHZ 462545
Chassis No. : WAUZZZ8V4J1067307

Vehicle No. : ET2862T
Policy No. : 1800070984
Endorsement No. :
Issued Date : 02 Jul 2018

ABOUT THE COVER

Make/Model : AUDI A3 Sedan 1.0 TFSI S tronic
Engine Capacity/Tonnage : 999.00 CC
Driver Restriction : NA
Sum Insured : Market Value
Off Peak Car : No
First Year of Registration : 2018
Insuring with COE/PARF : Yes

Person or Classes of Persons Entitled to Drive* :

- a) The Policyholder
b) Any other person who is driving on the Policyholder's order or with his/her permission.
This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDR") if You are or Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition

Limitation as to use* :

Use only for social, domestic and pleasure purposes and for the Policyholder's business.

This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1800cc - 2000cc Optional

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

EXCESS

Section 1

Fire - \$0 Own Damage - \$1100 Theft - \$0 Flood Cover - \$0

Section 2

Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

ONG BOO HONG(WANG WUHONG) - \$1100 (Own Damage)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

1. Audi Customer Service Center Add: 55 Ubi Road 1 Singapore 408689 63662323

For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.com.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: DBS BANK LTD

We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles(Third Party Risks and Compensation) Act (Cap. 189), Part IV of the Road Transport Act, 1987 (Malaysia) and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia).

0504125250

PREMIUM LEASING -JY

281 ALEXANDRA ROAD AUDI CUSTOMER SERVICE CENTRE

SINGAPORE 159938

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

AIG Asia Pacific Insurance Pte. Ltd.

AUTHORISED REPRESENTATIVE

Staffany Loh



AIG Asia Pacific Insurance Pte. Ltd
AIG Building
78 Shenton Way
#07-15

MOTOR ACCIDENT INTERVIEW FORM

NAME : ONG BOO HONG
VEHICLE NUMBER : ET 2882 T
DATE/ TIME OF ACCIDENT : 03-10-2019 / 17:40
PLACE OF ACCIDENT : NEAR HOUSE 86, CLUB STREET
THIRD PARTY VEHICLE (IF ANY) :

WHERE DID YOU START YOUR JOURNEY AND WHERE WAS THE INTENDED DESTINATION BEFORE THE ACCIDENT?

ALONG CLUB STREET

DID YOU DRINK ANY ALCOHOLIC DRINKS BEFORE YOU DRIVE ON THE DAY OF THE ACCIDENT? IF YES, DID THE TRAFFIC POLICE CONDUCT ANY BREATHE-ANALYSER TEST ON YOU? IF YES, WHAT WAS THE RESULTS?

NO

WHAT IS THE TYPE OF COLLISION AND THE EXTENSIVENESS OF THE DAMAGES TO ALL VEHICLES INVOLVED?

SIDE SWIPE

WERE YOU OR YOUR PASSENGER/S INJURED? IF INJURED, WHICH HOSPITAL? WERE YOU TAKEN TO THE TRAFFIC POLICE FOR INVESTIGATION?

NO

NAME: ONG BOO HONG

I AFFIRMED THE ABOVE INFORMATION IS GIVEN TO MY BEST KNOWLEDGE

UNDERTAKING

I, ONG BOO HONG, (NRIC No. SXXXX 554A), hereby confirm that the Singapore Accident Statement lodged by me on 04-10-2019 at 11-40 hours pertaining to the accident involving motor car Reg. No: ET28827, in which I was the driver are true and accurate to the best of my knowledge, information and belief.

I acknowledge that my insurers are not liable under the contract of insurance if there is a breach of policy terms and conditions.

In the event that an unrelated/unreported third party property or injury claim arises or there is evidence emerges that there is a breach of policy terms and conditions, I irrevocably undertake to absolve my insurer from all liability under the contract of insurance and I undertake to re-pay any sums paid by my insurers pursuant to the contract of insurance upon receipt of written demand by my insurers.

Signature

: 

Name of Insured / Driver

: ONG BOO HONG

Nric No.

: SXXXX 554A

Date

: 04-10-19

Signature

: 

Name of Policyholder

: ONG BOO HONG

Nric No.

: SXXXX 554A

Date

:

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

WIP : 14777

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/1191/2019/NS
Date : 5-Oct-19

Vehicle NOT IN workshop. Please arrange for survey

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr Ong Boo Hong
Address : 34 Tanah Merah Kechil Road
#10-30
Singapore 465560
Telephone : HP +65 96629332
Type of Claim : Own Damage Claims
Policy No. : 1800070984
Vehicle No : **ET 2882 T**
Model Code : Audi A3 Sedan 1.0 TFSI 8V
Model / Year : Jun-18
Engine No : CHZ 462545
Chassis No : WAUZZZ8V4J1067307
Mileage :
Date In :
Estimated By : Johnny Boo / Allan Wu
Accident Date : 3-Oct-19
Place of Accident : Along Club Street

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle ET 2882 T

S/N	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To remove and transfer rear parking aid. Check function	S/N	\$ 280.00	✓
2	To renew rear windscreen and lhs 1/4 glass to facilitate fender renewal.	S/N	\$ 600.00	✗
3	To install rear windscreen solar film.	S/N	\$ 400.00	✗
4	To dislodge and reinstall rear wire harness for lights, battery manager, fuse and relay trayss, electrical and audio aquipment.	S/N	\$ 1,400.00	✗
5	To remover and reinstall rear seat, back rest, hat tray, abcd pillar trims, luggage compartment trims. Dislodge roof liner and disengage curtain airbag etc.	S/N	\$ 1,400.00	✗
SUB TOTAL LABOUR CHARGES		:	\$ 4,080.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle ET 2882 T

S/N	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
6	To remove and transfer lhs front door and lhs rear door's multi-lock system and power window devices. Inspect for damages.	S/N \$ 560.00	✓
7	To dismantle and reinstall lhs front door panel trim. To remove and renew lhs wing mirror assy.	S/N \$ 300.00 250	
8	To dismantle rear bumper, rear lid and, lhs front door and lhs rear door. Cut out and weld lhs rear fender. To renew rear bumper, lhs front and rear door. To repair lhs sill panel. Re-organise crash management components. Reinstall all parts removed.	\$ 7,350.00 1750	
9	To respray rear bumper, lhs rear fender, lhs front door, lhs rear door, door handle, lhs wing mirror cover, lhs sill panel, door entrances, roof channel, drain pannel and end panelling. To carry out stone chip treatment and joint sealer works.	\$ 6,800.00 2350	4 x 550 = 2200 Mirror = 150 <u>2350</u>
10	To renew lhs rear rim and carry out wheel alignmen	S/N \$ 280.00	✓
11	To conduct diagnostic checks.	S/N \$ 192.00	✓
TOTAL LABOUR CHARGES		: \$ <u>19,562.00</u>	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. ET 2882 T

S/N	Parts Description	Damage Parts & Prices	
		S/Nett	Remarks
1	SIDE PANEL <i>Regris</i>	S 2,110.00	X
2	REAR WINDSCREEN <i>Regris</i>	S 742.00	X
3	PRIMER <i>Regris</i>	S 19.00	X
4	SIDE WINDOW - LH <i>Regris</i>	S 520.00	X
5	FRONT DOOR - LH <i>Dented</i>	S 2,279.00	✓ 1823.20
6	FRONT DOOR OUTER SEAL - LH <i>Regris</i>	NEC S 146.00	✓ 116.80
7	BONDING AGENT <i>Regris</i>	NEC S 45.00	? X
8	CLEANING SOLUTION <i>Regris</i>	NEC S 65.00	? X
9	FRONT DOOR ATTACHMENT PARTS <i>Regris</i>	S 117.00	? X
10	FRONT DOOR CATCH <i>Regris</i>	S 85.00	X
11	FRONT DOOR INNER SEAL <i>Regris</i>	S 174.00	X
12	REAR DOOR - LH <i>Dented</i>	S 2,279.00	✓ 1823.20
13	REAR DOOR OUTER SEAL <i>Regris</i>	NEC S 146.00	✓ 116.80
14	BONDING AGENT <i>Regris</i>	NEC S 45.00	? X
15	CLEANING SOLUTION <i>Regris</i>	NEC S 65.00	? X
16	REAR DOOR ATTACHMENT PARTS <i>Regris</i>	S 218.00	? X
17	REAR DOOR INNER SEAL <i>Regris</i>	S 146.00	X
18	REAR DOOR CATCH <i>Regris</i>	S 96.00	✓
19	EXTERIOR MIRROR MOUNTING - LH <i>Regris</i>	S 929.00	✓ 742.50
20	MIRROR CAP - LH <i>Regris</i>	S 136.00	X
SUB TOTAL SPARE PARTS		\$ 10,362.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. ET 2882 T

S/N	Parts Description	Damage Parts & Prices	
		S/Nett	Remarks
21	REAR ALUMINIUM RIM - LH <i>cut</i>	\$ 666.00	— <i>532-40</i>
22	ALUMINIUM RIM RUBBER VALVE <i>Neu</i>	4 \$ 13.00	<i>x</i>
23	REAR BUMPER <i>Reis</i>	\$ 1,793.00	<i>x</i>
24	REAR BUMPER STICKY PAD	4 \$ 21.00	<i>x</i>
25	REAR BUMPER FIXING PARTS	\$ 175.00	<i>+</i>
26	REAR BUMPER GUIDE SECTION - LH	\$ 60.00	<i>+</i>
27	STONE CHIP	S/N \$ 180.00	<i>+</i>
28	ACRYLIC SEALANT	S/N \$ 180.00	<i>x</i>
29	CAVITY WAX	S/N \$ 140.00	<i>+</i>
30	METAL FILLER POWDER	S/N \$ 280.00	<i>+</i>
31	REAR WINDSCREEN SEALANT	S/N \$ 200.00	<i>x</i>
32	1/4 GLASS SEALANT	S/N \$ 100.00	<i>+</i>
33	SUNDRIES <i>Not Neu</i>	\$ 600.00	<i>? x</i>
TOTAL SPARE PARTS		: \$ 14,770.00	
TOTAL LABOUR CHARGES		: \$ 19,562.00	
GRAND TOTAL		: \$ 34,332.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Name : Adrian King
Surveyed Date : 10/10/19.
Authorised Date :
Excess Cost :
Liability :
Remarks : Not Authorised, 07 Days.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and subject to final approval from Insurance Company

Authorised by Repairer
Signature:

Please Note : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly. For inspection of vehicle, please refer to Ms Norah Khai at Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle ET 2882 T

S/N	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
6	To remove and transfer lhs front door and lhs rear door's multi-lock system and power window devices. Inspect for damages.	S/N \$ 560.00	✓
7	To dismantle and reinstall lhs front door panel trim. To remove and renew lhs wing mirror assy.	S/N \$ 300.00 x. 250	
8	To dismantle rear bumper, rear lid and, lhs front door and lhs rear door. Cut out and weld lhs rear fender. To renew rear bumper, lhs front and rear door. To repair lhs sill panel. Re-organise crash management components. Reinstall all parts removed.	\$ 7,350.00 1750	
9	To respray rear bumper, lhs rear fender, lhs front door, lhs rear door, door handle, lhs wing mirror cover, lhs sill panel, door entrances, roof channel, drain pannel and end panelling. To carry out stone chip treatment and joint sealer works.	2900 2350 \$ 6,800.00	4 x 550 = 2200. Mirror = 150 <u>2350.</u>
10	To renew lhs rear rim and carry out wheel alignmen	S/N \$ 280.00	✓
11	To conduct diagnostic checks.	S/N \$ 192.00	✓
TOTAL LABOUR CHARGES		\$ 19,562.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel: 6366 2323 Fax: 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

WIP : 14777

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/1191/2019/NS
Date : 5-Oct-19

Vehicle NOT IN workshop. Please arrange for survey

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way
#07-16 AIG Building
Singapore 079120

Hi Adrian

7 days exclude 1 Sunday - jb

28-Nov-19

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr Ong Boo Hong
Address : 34 Tanah Merah Kechil Road
#10-30
Singapore 465560
Telephone : HP +65 96629332
Type of Claim : Own Damage Claims
Policy No. : 1800070984
Vehicle No : **ET 2882 T**
Model Code : Audi A3 Sedan 1.0 TFSI 8V
Model / Year : Jun-18
Engine No : CHZ 462545
Chassis No : WAUZZZ8V4J1067307
Mileage :
Date In :
Estimated By : Johnny Boo / Allan Wu
Accident Date : 3-Oct-19
Place of Accident : Along Club Street

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle ET 2882 T

S/N	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To remove and transfer rear parking aid. Check function	S/N	\$ 280.00	\$ 280.00
2	To renew rear windscreen and lhs 1/4 glass to facilitate fender renewal.	S/N	\$ 600.00	
3	To install rear windscreen solar film.	S/N	\$ 400.00	
4	To dislodge and reinstall rear wire harness for lights, battery manager, fuse and relay trayss, electrical and audio aquipment.	S/N	\$ 1,400.00	
5	To remover and reinstall rear seat, back rest, hat tray, abcd pillar trims, luggage compartment trims. Dislodge roof liner and disengage curtain airbag etc.	S/N	\$ 1,400.00	
SUB TOTAL LABOUR CHARGES		:	\$ 4,080.00	\$ 280.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle ET 2882 T

S/N	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
		<i>c/f</i>		\$ 280.00
6	To remove and transfer lhs front door and lhs rear door's multi-lock system and power window devices. Inspect for damages.	S/N	\$ 560.00	\$ 560.00
7	To dismantle and reinstall lhs front door panel trim. To remove and renew lhs wing mirror assy.	S/N	\$ 300.00	\$ 250.00
8	To dismantle rear bumper, rear lid and, lhs front door and lhs rear door. Cut out and weld lhs rear fender. To renew rear bumper, lhs front and rear door. To repair lhs sill panel. Re-organise crash management components. Reinstall all parts removed.		\$ 7,350.00	\$ 1,750.00
9	To respray rear bumper, lhs rear fender, lhs front door, lhs rear door, door handle, lhs wing mirror cover, lhs sill panel, door entrances, roof channel, drain pannel and end panelling. To carry out stone chip treatment and joint sealer works.		\$ 6,800.00	\$ 2,350.00
10	To renew lhs rear rim and carry out wheel alignment.	S/N	\$ 280.00	\$ 280.00
11	To conduct diagnostic checks.	S/N	\$ 192.00	\$ 192.00
	TOTAL LABOUR CHARGES	:	\$ 19,562.00	\$ 5,662.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. ET 2882 T

S/N	Parts Description	<u>Damage Parts & Prices</u>	
		S/Nett	Remarks
1	SIDE PANEL	\$ 2,110.00	
2	REAR WINDSCREEN	\$ 742.00	
3	PRIMER	\$ 19.00	
4	SIDE WINDOW - LH	\$ 520.00	
5	FRONT DOOR - LH	\$ 2,279.00	\$ 1,823.20
6	FRONT DOOR OUTER SEAL - LH	NEC \$ 146.00	\$ 116.80
7	BONDING AGENT	NEC \$ 45.00	
8	CLEANING SOLUTION	NEC \$ 65.00	
9	FRONT DOOR ATTACHMENT PARTS	\$ 117.00	
10	FRONT DOOR CATCH	\$ 85.00	
11	FRONT DOOR INNER SEAL	\$ 174.00	
12	REAR DOOR - LH	\$ 2,279.00	\$ 1,823.20
13	REAR DOOR OUTER SEAL	NEC \$ 146.00	\$ 116.80
14	BONDING AGENT	NEC \$ 45.00	
15	CLEANING SOLUTION	NEC \$ 65.00	
16	REAR DOOR ATTACHMENT PARTS	\$ 218.00	
17	REAR DOOR INNER SEAL	\$ 146.00	
18	REAR DOOR CATCH	\$ 96.00	
19	EXTERIOR MIRROR MOUNTING - LH	\$ 929.00	\$ 742.80
20	MIRROR CAP - LH	\$ 136.00	
SUB TOTAL SPARE PARTS		\$ 10,362.00	\$ 4,622.80

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. ET 2882 T

S/N	Parts Description		Damage Parts & Prices	
			S/Nett	Remarks
		<i>c/f</i>		\$ 4,622.80
21	REAR ALUMINIUM RIM - LH		\$ 666.00	\$ 532.40
22	ALUMINIUM RIM RUBBER VALVE	4	\$ 13.00	
23	REAR BUMPER		\$ 1,793.00	
24	REAR BUMPER STICKY PAD	4	\$ 21.00	
25	REAR BUMPER FIXING PARTS		\$ 175.00	
26	REAR BUMPER GUIDE SECTION - LH		\$ 60.00	
27	STONE CHIP	S/N	\$ 180.00	
28	ACRYLIC SEALANT	S/N	\$ 180.00	
29	CAVITY WAX	S/N	\$ 140.00	
30	METAL FILLER POWDER	S/N	\$ 280.00	
31	REAR WINDSCREEN SEALANT	S/N	\$ 200.00	
32	1/4 GLASS SEALANT	S/N	\$ 100.00	
33	SUNDRIES		\$ 600.00	
TOTAL SPARE PARTS		:	\$ 14,770.00	\$ 5,155.20
TOTAL LABOUR CHARGES		:	\$ 19,562.00	\$ 5,662.00
GRAND TOTAL		:	\$ 34,332.00	\$ 10,817.20

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the
progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: ET 2882 T

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/1191/2019/NH

20TH JAN 2020

from:
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

RE: INSURANCE CLAIM FOR ET 2882 T, Audi A3 SEDAN 1.0 TFSI.

With reference to the above-mentioned vehicle, no. **ET 2882 T**, claimant, **Mr. Ong Boo Hong**, please find the related document per attached.

1. A copy of the Original invoice no. 85014757 – S\$ 10,397.40.
2. A copy of the Discharge Voucher duly signed by client.

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept

Encl
AIG – ET 2882 T

total pages

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6366 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 1 16:40

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120		Invoice No: 85014757	Account: A0006 IT 01		AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120	
		Date : 17/01/2020				
		Order : ET2882T				
		Term : 30				
Regn No: ET2882T (V 38156)		Regn Date: 19/06/2018	Mileage: 18780	WIP No.: 14777		
Model: A3 SEDAN 1.0 TFSI 8VMANG		Chassis: WAUZZZ8V4J1067307	Engine: CH2 462545	Dept: U		
You have been assisted by :- UB-Tony Foong (33)						
		Details	Qty	Unit Price	Amount	
Q	EXC	M: 8888 Insurance Excess/Liability	-1100.00	1.00	-1,100.00	
S	BODYWORK	M: TO REMOVE AND TRANSFER REAR PARKING AID. CHECK FUNCTION.	280.00	1.00	280.00	
S	BODYWORK	M: TO REMOVE AND TRANSFER LHS FRONT DOOR AND LHS REAR DOOR'S MULTI LOCK SYSTEM AND POWER WINDOW DEVICES.INSPECT FOR DAMAGES	560.00	1.00	560.00	
S	BODYWORK	M: TO DISMANTLE REAR BUMPER,REAR LID AND LHS FRONT DOOR AND LHS REAR DOOR.CUT OUT AND WELD LHS REAR FENDER.TO RENEW LHS FRONT AND REAR DOOR.TO REPAIR LHS SILL PANEL. REORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	1750.00	1.00	1,750.00	
S	BODYWORK	M: TO RESPRAY REAR BUMPER,LHS REAR FENDER,LHS FRONT DOOR,LHS REAR DOOR AND LHS WING MIRROR. TO CARRY OUT STONE CHIP TREATMENT AND JOINT SEALER WORK	2350.00	1.00	2,350.00	
S	BODYWORK	M: TO RENEW LHS REAR RIM AND CARRY OUT WHEEL ALIGNMENT	280.00	1.00	280.00	
S	BODYWORK	M: TO CARRY OUT DIAGNOSTIC CHECK	192.00	1.00	192.00	
S	BODYWORK	M: TO REMOVE AND REINSTALL LHS DOOR PANEL TRIM.TO REMOVE AND RENEW LHS WING MIRROR ASSY	250.00	1.00	250.00	
X	A8V5833051C	DOOR(LAST)	Less 020%	1.00	2279.00	1,823.20
X	A8V5839911C	SEAL(LAST)	Less 020%	1.00	146.00	116.80
X	A8V5831051D	DOOR	Less 020%	1.00	2279.00	1,823.20
X	A8V5837911C	SEAL	Less 020%	1.00	146.00	116.80

Premium Automobiles Pte Ltd



Audi Centre Singapore
261 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
261 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6388 2323
Main Telefax 6641 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9826 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 2 16:40

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014757 Date : 17/01/2020 Order : ET2882T Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120	
Regn No: ET2882T (V 38156)	Regn Date: 19/06/2018	Mileage: 18780	WIP No.: 14777
Model: A3 SEDAN 1.0 TFSI 8VMANG	Chassis: WAU2Z28V4J1067307	Engine: CHZ 462545	Dept: U
You have been assisted by :- UB-Tony Foong (33)			

		Details		Qty	Unit Price	Amount
X	A8V5857409M 9B9	MOUNTING	Less 020%	1.00	928.50	742.80
X	A8V0601025DC	(A) (SK) WHEEL 16/10/1	Less 020%	1.00	665.50	532.40

Parts 5,155.20
Labour 0.00
Sublet 5,662.00
Merus 0.00
Lubricant 0.00

Sub-Total 9,717.20

7% GST 680.20

Grand Total 10,397.40



17/

Received by

For & on behalf of
Premium Automobiles Pte Ltd

Premium Automobiles

Telefax

to AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: ET 2882 T

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/1191/2019/TG
01 November 2019

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

total pages

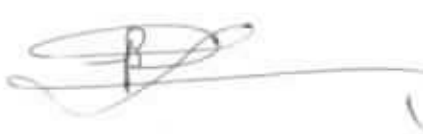
RE: CLAIM – OWNER'S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi A3 SEDAN 1.0 TFSI 8V
Vehicle Chassis No. : WAUZZZ8V4J1067307
Vehicle Regn No. : ET 2882 T
Vehicle Mileage : 18780 KM
Vehicle Owner : Mr. Ong Boo Hong
Certificate No : 1800070984
Own Damage Excess : S\$ 1,177.00 (Inclusive 7% GST)
Accident Date : 03/10/2019
Place : Along Club Street
Repair Cost : \$ 10,397.40
WIP No. : 14777
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature : 
Time : 11.30 am
Date : 1/11/2019

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	11 Oct 2019		10 Oct 2019 14:50 Edit Adj Rpt	S\$10,817.20 Edit Estimates	S\$10,817.20 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
------	-----------	---------------	-----------	--------------------------

CLAIM SUBFOLDER DETAILS [Created by insurer]

Insured:	ONG BOO HONG, ID: S0364554A, Tel: +6596629332, Email: ONG_BOOHONG@YAHOO.COM.SG			
Vehicle Reg. No.:	ET2882T	Date of Loss:	03/10/2019 17:00 - :59 [15 Months and 14 Days From LTA Reg Date (Man Yr)]	
Claim Type:	OD / 9863218179SG	Policy/Cover Note No.:	1800070984 (Comprehensive)	
		Excess:	S\$1,100.00	
Repairer:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911			
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Mithoo Singh, Aashweenjeet Kaur] Aashweenjeetkaur.Mithoosingh@aig.com			
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 21/10/2019]			
Driver/Custodian:	ONG BOO HONG (74 / Male) , NRIC: S0364554A, Tel: +6596629332 Email: ONG_BOOHONG@YAHOO.COM.SG			

ASSOCIATED MAIL RECEIVED [View All](#) [Compose Case Mail](#)

- AIG_SG (14/10/2019): Alert - Adj Mandate Approved (S\$12107.00) - ET2882T - Claim Handler: Mithoo Sing...
- AIG_SG (11/10/2019): ET2882T / OD / 03/10/2019 / Coverage & Excess update

ALL ASSOCIATED TASKS [View All](#) [Search Tasks](#) [Create New Task](#) [Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

***ET2882T (9863218179SG)**

OD

Oct 3 2019 5:40PM

[ONG BOO HONG]

Premium Automobiles Pte Ltd

Upload Documents Upload Photos Compose New Letter Upload Video Upload Audio			View View in Browser ▼	
Assessment Reports			1 per page ▼	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	10/10/19 15:32	Adjuster Immediate Advice	Load HTM	
Photos/Images			3 per page ▼	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	10/10/19 15:22	General View	Load JPG	
2	10/10/19 15:22	Chassis Number	Load JPG	
3	10/10/19 15:22	General View	Load JPG	
4	10/10/19 15:22	General View	Load JPG	
5	10/10/19 15:22	General View	Load JPG	
6	10/10/19 15:22	General View	Load JPG	
7	10/10/19 15:22	General View	Load JPG	
8	10/10/19 15:22	General View	Load JPG	
9	10/10/19 15:22	General View	Load JPG	
10	10/10/19 15:22	General View	Load JPG	
11	10/10/19 15:22	General View	Load JPG	
12	10/10/19 15:22	General View	Load JPG	
13	10/10/19 15:22	General View	Load JPG	
14	10/10/19 15:22	General View	Load JPG	
15	10/10/19 15:22	General View	Load JPG	
16	10/10/19 15:22	General View	Load JPG	
17	10/10/19 15:22	General View	Load JPG	
18	10/10/19 15:22	General View	Load JPG	
19	10/10/19 15:22	General View	Load JPG	
20	10/10/19 15:22	General View	Load JPG	
21	10/10/19 15:22	General View	Load JPG	
22	10/10/19 15:22	General View	Load JPG	
23	10/10/19 15:22	General View	Load JPG	
24	10/10/19 15:22	General View	Load JPG	
Documentation			1 per page ▼	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	10/10/19 15:21	Singapore Accident Statement	Load PDF	
2	10/10/19 15:21	Certificate of Insurance	Load PDF	
3	10/10/19 15:21	INTERVIEW FORM	Load PDF	
4	10/10/19 15:21	UNDERTAKING FORM	Load PDF	
5	10/10/19 15:21	ESTIMATE	Load PDF	
6	10/10/19 17:16	Driver's Driving License	Load PDF	
7	22/01/20 09:09	WORKSHOP INVOICE	Load PDF	
8	22/01/20 09:10	DISCHARGE VOUCHER	Load PDF	

Linked Accident Report Documents

Upload Documents Upload Photos Compose New Letter Upload Video Upload Audio			View View in Browser ▼	
Assessment Reports			1 per page ▼	

Assessment Reports		Premium Automobiles Pte Ltd (UBI)	1 per page	Thumbnail	Print
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	06/12/19 18:51	Accident Statement	1	Load HTM	
2	06/12/19 18:52	Accident Statement	1	Load HTM	
3	06/12/19 18:53	Accident Statement	1	Load HTM	
4	06/12/19 18:54	Accident Statement	1	Load HTM	
Photos/Images					
			3 per page		
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	04/10/19 15:11	Accident Photo	1	Load JPG	
2	04/10/19 15:11	Accident Photo	1	Load JPG	
3	04/10/19 15:11	Accident Photo	1	Load JPG	
4	04/10/19 15:11	Accident Photo	1	Load JPG	
5	04/10/19 15:11	Accident Photo	1	Load JPG	
6	04/10/19 15:11	Accident Photo	1	Load JPG	
7	04/10/19 15:11	Accident Photo	1	Load JPG	
8	04/10/19 15:11	Accident Photo	1	Load JPG	
9	04/10/19 15:11	Accident Photo	1	Load JPG	
10	04/10/19 15:11	Accident Photo	1	Load JPG	
11	04/10/19 15:11	Accident Photo	1	Load JPG	
12	04/10/19 15:11	Accident Photo	1	Load JPG	
13	04/10/19 15:11	Accident Photo	1	Load JPG	
14	04/10/19 15:11	Accident Photo	1	Load JPG	
15	04/10/19 15:11	Accident Photo	1	Load JPG	
16	04/10/19 15:11	Accident Photo	1	Load JPG	
17	04/10/19 15:11	Accident Photo	1	Load JPG	
18	04/10/19 15:11	Accident Photo	1	Load JPG	
19	04/10/19 15:11	Accident Photo	1	Load JPG	
20	04/10/19 15:11	Accident Photo	1	Load JPG	
21	04/10/19 15:11	Accident Photo	1	Load JPG	
22	04/10/19 15:11	Accident Photo	1	Load JPG	
23	04/10/19 15:11	Accident Photo	1	Load JPG	
24	04/10/19 15:11	Accident Photo	1	Load JPG	
25	04/10/19 15:11	Accident Photo	1	Load JPG	
26	04/10/19 15:11	Accident Photo	1	Load JPG	
Documentation					
			1 per page		
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	04/10/19 15:12	Sketch Plan	1	Load JPG	
2	04/10/19 15:13	Sketch Plan #2	1	Load JPG	

Documents Checklist

DOCUMENTS CHECKLIST

ResetSavePrint

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: ☐ Handling Insurer
Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #08-16
Singapore 079120

Our File No: CC3/AIG19017879/AQF3N2

Date: 22/01/2020

REFERENCE

Insured/Claimant:	ONG BOO HONG	Policy No:	1800070984	
Date of Loss:	03/10/2019	Nature of Claim:	OD	Claim No: 9863218179SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	ET2882T	Engine No:	CHZ462545
Make & Model:	AUDI A3, 999cc SEDAN TFSI (A)	Chassis No:	WAUZZZ8V4J1067307
Reg. Date:	19/06/2018 (Man. Year: 2018)	Odometer:	18271 km
Colour:	Black		
Engine Capacity:	999 cc		
Market Value/New Car Price:	S\$95,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	14,770.00	5,155.20	9,614.80	65.10
Miscellaneous Items	0.00	0.00	0.00	
Labour	19,562.00	5,662.00	13,900.00	71.06
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	34,332.00	10,817.20	23,514.80	68.49
- Excess (S\$)	1,100.00	1,100.00	0.00	0.00
(S\$)	33,232.00	9,717.20	23,514.80	70.76
+ GST 7.00/7.00% (S\$)	2,326.24	680.20	1,646.04	70.76
Nett Amount (S\$)	35,558.24	10,397.40	25,160.84	70.76

INSPECTION

Date of Assignment:	10/10/2019		
Date Inspected:	10/10/2019	Inspected At:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699
Estimated Period of Repair:	7.0 days		

Adjuster: ADRIAN LING

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*SIDE PANEL	Repair	2,110.00 FS	*- FS
2	1		*REAR WINDSCREEN	Not Necessary	742.00 FS	*- FS
3	1		*PRIMER	Not Necessary	19.00 FS	*- FS
4	1		*SIDE WINDOW-LH	Not Necessary	520.00 FS	*- FS
5	1		*FRONT DOOR-LH	Dented	2,279.00 FS	*1,823.20 FS
6	1		*FRONT DOOR OUTER SEAL-LH	Necessary	146.00 FS	*116.80 FS
7	1		*BONDING AGENT	Not Necessary	45.00 FS	*- FS
8	1		*CLEANING SOLUTION	Not Necessary	65.00 FS	*- FS
9	1		*FRONT DOOR ATTACHMENT PARTS	Not Necessary	117.00 FS	*- FS
10	1		*FRONT DOOR CATCH	Not Necessary	85.00 FS	*- FS
11	1		*FRONT DOOR INNER SEAL	Not Necessary	174.00 FS	*- FS
12	1		*REAR DOOR-LH	Dented	2,279.00 FS	*1,823.20 FS
13	1		*REAR DOOR OUTER SEAL	Necessary	146.00 FS	*116.80 FS
14	1		*BONDING AGENT	Not Necessary	45.00 FS	*- FS
15	1		*CLEANING SOLUTION	Not Necessary	65.00 FS	*- FS
16	1		*REAR DOOR ATTACHMENT PARTS	Not Necessary	218.00 FS	*- FS
17	1		*REAR DOOR INNER SEAL	Not Necessary	146.00 FS	*- FS
18	1		*REAR DOOR CATCH	Not Necessary	96.00 FS	*- FS
19	1		*EXTERIOR MIRROR MOUNTING-LH	Cut	929.00 FS	*742.80 FS
20	1		*MIRROR CAP-LH	Not Necessary	136.00 FS	*- FS
21	1		*REAR ALUMINIUM RIM-LH	Cut	666.00 FS	*532.40 FS
22	4		*ALUMINIUM RIM RUBBER VALVE	Not Necessary	13.00 FS	*- FS
23	1		*REAR BUMPER	Repair	1,793.00 FS	*- FS
24	4		*REAR BUMPER STICKY PAD	Not Necessary	21.00 FS	*- FS
25	1		*REAR BUMPER FIXING PARTS	Not Necessary	175.00 FS	*- FS
26	1		*REAR BUMPER GUIDE SECTION-LH	Not Necessary	60.00 FS	*- FS
27	1		*STONE CHIP	Not Necessary	180.00 FS	*- FS
28	1		*ACRYLIC SEALANT	Not Necessary	180.00 FS	*- FS
29	1		*CAVITY WAX	Not Necessary	140.00 FS	*- FS
30	1		*METAL FILLER POWDER	Not Necessary	280.00 FS	*- FS
31	1		*REAR WINDSCREEN SEALANT	Not Necessary	200.00 FS	*- FS
32	1		*1/4 GLASS SEALANT	Not Necessary	100.00 FS	*- FS
33	1		*SUNDRIES	Not Necessary	600.00 FS	*- FS

F=Franchise part. S=SpcNetl.

Total Parts (S\$)	14,770.00	5,155.20
-------------------	-----------	----------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND TRANSFER REAR PARKING AID.CHECK FUNCTION	New	280.00	280.00
2	TO RENEW REAR WINDSCREEN AND LHS 1/4 GLASS TO FACILITATE FENDER RENEWAL	New	600.00	0.00
3	TO INSTALL REAR WINDSCREEN SOLAR FILM	New	400.00	0.00
4	TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS,BATTERY MANAGER,FUSE AND RELAY TRAYSS,ELECTRICAL AND AUDIO EQUIPMENT	New	1,400.00	0.00
5	TO REMOVER AND REINSTALL REAR SEAT,BACK REST,HAT TRAY,ABCD PILLAR TRIMS,LUGGAGE COMPARTMENT TRIMS,DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAG ETC	New	1,400.00	0.00
6	TO REMOVE AND TRANSFER LHS FRONT DOOR AND LHS REAR DOORS MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES.INSPECT FOR DAMAGES	New	560.00	560.00
7	TO DISMANTLE AND REINSTALL LHS FRONT DOOR PANEL TRIM.TO REMOVE AND RENEW LHS WING MIRROR ASSY	New	300.00	250.00
8	TO DISMANTLE REAR BUMPER,REAR LID AND LHS FRONT DOOR AND LHS REAR DOOR.CUT OUT AND WELD LHS REAR FENDER.TO RENEW REAR BUMPER,LHS FRONT AND REAR DOOR.TO REPAIR LHS SILL PANEL.RE-ORGANISE CRASH MANAGEMENT COMPONENTS.REINSTALL ALL PARTS REMOVED	New	7,350.00	1,750.00
9	TO RESPRAY REAR BUMPER,LHS REAR FENDER,LHS FRONT DOOR,LHS REAR DOOR,DOOR HANDLE,LHS WING MIRROR COVER,LHS SILL PANEL,DOOR ENTRANCES,ROOF CHANNEL,DRAIN PANNEL AND END PANELLING.TO CARRY OUT STONE CHIP TREATMENT AND JOINT SEALER WORKS	New	6,800.00	2,350.00
10	TO RENEW LHS REAR RIM AND CARRY OUT WHEEL ALIGNMENT	New	280.00	280.00
11	TO CONDUCT DIAGNOSTIC CHECKS	New	192.00	192.00
Gross Labour Cost (\$\$)			19,562.00	5,662.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >