

ASS. REC. BY:

REF:

CS/MSG19018285/K2qd352

Special Instruction:

Survey: Kevin

ASSIGNMENT (Office)

From (Person): Crystal Lee of MSIG Date/Time: 16/10/19 @ 10:45am

Estimated Cost: _____ Bill to: _____

OD / PD / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No.: SHC 6932K Insured: SLQ 1028H

at Workshop m/s Premier Automotive Tel: 6544 6689

of 23 Chengi South Ave 2 # 01-02

Policy No: 29114756 Claim No: 608665

Sum Insured: _____ Excess: _____

Make of Veh: _____ D.O.A. 15/10/19
(Client's Record)

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement: _____

Date/Time: 11:25am @ 16/10/19 Person Contacted: Vineat Vehicle IN OUT

Date/Time	Action/Instruction	Exchange
	SLQ 1028H : X	
	SHC 6932K: CC3/CT3 18006538/K2EE1322 FCA: 25/04/2018	
	17/10/19 @ 10:45am revised to crystal lee by email.	

108/11/13

Surveyor: Kalvin

REF:

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspected Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

Veh No: SHC 6932K Yr Regn: 30 Oct, 2015
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or _____
 Make: KIA optima c.c. 1.685
 Colour: Silver A/C: Insured / Std / Nil / NA
 Sp. Reading: 522864 T/Radio: Insured / Std / Nil / NA
 Eng/No: _____
 C/No: KNAGM414MF5639410
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: Inorder / Jammed / Leaked / Burnt or Altered
 Brake: Inorder / Jammed / Leaked / Burnt or _____
 Modi: Nil / S/Rim / STD/Rim or _____
 Tyre Size: F: 205/65R16
 R: _____

(Policy Condition)
 Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

 Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent?: Yes or No
 GIA / PR Seen: _____ Consistent?: Yes or No
 Est. Repairs: 4 days Res.: Yes or No
 Lum Sum: _____ % 3 Val.: Yes or No
 CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____ Vehicle: IN / OUT

BS / DUN / EXNOVA / QY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Achilla

Front	Rear
R/Bal. <u>7</u> mm	R/Bal. <u>7</u> mm
L/Bal. <u>7</u> mm	L/Bal. <u>7</u> mm
D.O.A. <u>15/10/19</u>	D.O.I. <u>16/10/19</u>

 Survey held at Premier
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
O/S Front / u/c
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
<u>1/11/19</u>	<u>Colud 4/5 \$3550/ 4 Rp. (Red \$1164.79, 35%)</u> <u>MSA</u> <u>4s.</u>

RECEIVED 04 NOV 2019

[Signature]
11/11/2019

Date/Time, File Pass to? : Prel. Report
 : Final Report
11/11/19
 Date/Time, File Return to?
2)
 Report Format: MEK-TP
 Lump Sum / I.B.I: (\$) 3550

Days Of Repair: 4
 Resurvey No. of Trip: 1
 Add Fee: : Site Insp (\$ _____)
 : Interview (\$ _____)
 : Tech. Invs (\$ _____)
 : Weekend (\$ _____)
 Survey Fee: 150
 Transportation: _____
 S + RS: _____
 Photos: _____
 Others: _____
 TOTAL: _____

Nivitha (LKK Auto)

From: Crystal Lee <crystal_lee@sg.msig-asia.com>
Sent: Wednesday, 16 October 2019 10:48 AM
To: Admin-D (LKKAuto); assignments; Winnie Chua; Helene Phua
Cc: Ong Zi Hui
Subject: Survey Request - Manual Assigned
Attachments: 15102019173256-0001.pdf; IMG_20191015_152231.jpg; IMG_20191015_152246_HDR.jpg; IMG_20191015_152259.jpg; IMG_20191015_152313.jpg; IMG_20191015_152324.jpg; IMG_20191015_152343.jpg; IMG_20191015_152403.jpg

Importance: High

Pre-inspection/Accident involving SHC6932K and SLQ1028H (GRAB) on 15.10.19

Manual Assigned

Dear LKK,

Refer to the email below, please arrange survey the vehicle.

We'll assign via Merimen once we receive the assignment from Motor Team.

Please contact us ASAP if you cannot attend this assignment

Thank you & Best regards,
Crystal Lee
Admin Officer, Claims Services (In-House Survey)
D: +65 6594 2535 | F: +65 6643 1349 | crystal_lee@sg.msig-asia.com



MSIG

MSIG Insurance (Singapore) Pte Ltd 16 Raffles Quay, #24-01 Hong Leong Building, Singapore 048581 | T: +65 6220 9644 | F: +65 6225 6371 | Co. Reg. No. 200412212G | msig.com.sg



A Member of **MS&AD** INSURANCE GROUP

From: Motor Survey
Sent: Wednesday, 16 October, 2019 8:53 AM
To: Priscilla Liou Shi Hui <priscilla_liou@sg.msig-asia.com>; Ng Chen How <ChenHow_Ng@sg.msig-asia.com>
Cc: Helene Phua <helene_phua@sg.msig-asia.com>; Crystal Lee <crystal_lee@sg.msig-asia.com>; Ong Zi Hui <zihui_ong@sg.msig-asia.com>
Subject: FW: Pre-inspection/Accident involving SHC6932K and SLQ1028H (GRAB) on 15.10.19 (Car in, please outsource to LKK Tks.)

Liab: clear

@ Crystal, car in, please outsource to LKK as requested as IHS is unable to attend (claim sharing). Tks.

Best Regards

Winnie Chua

Senior Admin Officer, Claims Services (In-House Survey)
Direct line +65 6594 2556 | Direct fax +65 6225 7402 | pingping_chua@sg.msig-asia.com



MSIG Insurance (Singapore) Pte Ltd 16 Raffles Quay, #24-01 Hong Leong Building, Singapore 048581 | T: +65 6220 9644 | F: +65 6225 6371 | Co. Reg. No. 200412212G | msig.com.sg



A Member of **MS&AD** INSURANCE GROUP

From: Vincent Chua [<mailto:vincent.chua@premiertaxi.com>]
Sent: Tuesday, 15 October 2019 5:38 PM
To: Motor Survey <motorsurvey@sg.msig-asia.com>
Cc: Goh Wee Dek <weedek.goh@premiertaxi.com>; Liew Hai Leong <haileong.liew@premiertaxi.com>; Winnie Chua <pingping_chua@sg.msig-asia.com>; Crystal Lee <crystal_lee@sg.msig-asia.com>; Ong Zi Hui <zihui_ong@sg.msig-asia.com>
Subject: Pre-inspection/Accident involving SHC6932K and SLQ1028H (MSIG) on 15.10.19

EXTERNAL EMAIL: Be careful when you click any links or open any attachment(s).

Dear all,

We refer to the vehicles mentioned above.

Vehicle to be Surveyed: SHC6932K
Insured Vehicle: SLQ1028H
Date of Accident: 15/10/2019
Name of Workshop: Premier Automotive Services Pte Ltd
Address of Survey Location: 23 Changi South Avenue 2, #01-02, S (486443)
Name of Contact Person: Mr Chua
Contact Number: 65446689
Email Address of Contact Person: vincent.chua@premiertaxi.com

We prefer LKK Auto as the SJE for this PRS.

Vehicle available for survey at any time

Please kindly arrange for survey.

Thank you.

Regards

Vincent Chua
Operations Assistant
Premier Automotive Services Pte Ltd

Address: 23 Changi South Ave 2, #01-02 Singapore 486443
Tel: 6214 8880 Ext 066 | DID: 6544 6689 | Fax: 6214 1511
Visit us at: www.premiertaxi.com.sg

Confidentiality Notice | This e-mail message, including any attachments, is for the sole use of the intended recipient(s) and may contain confidential or proprietary information. Any unauthorized review, use, disclosure or distribution is prohibited. If you are not the intended recipient, immediately contact the sender by reply e-mail and destroy all copies of the original message.

CONFIDENTIALITY NOTICE

This e-mail (including any attachments) may contain information that is privileged or confidential. The sending of this e-mail to any person other than the intended recipient is not a waiver of the privilege or confidentiality that attaches to it. If you are not the intended recipient, please notify the sender immediately, delete the email and do not copy, distribute or disclose its contents.

Shiau Chan (LKKAuto)

From: Shiau Chan (LKKAuto)
Sent: Thursday, 17 October 2019 10:45 AM
To: 'Crystal Lee'; assignments; 'Winnie Chua'; 'Helene Phua'
Cc: 'Ong Zi Hui'; SUR
Subject: RE: Survey Request - Manual Assigned
Attachments: CSMSG19018285K1qd3.pdf

Dear Crystal,

Enclosed herewith preliminary advice of SHC 6932K.

Kindly assist to create the claim in Merimen.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAuto) <admin-d@lkkauto.com>
Sent: Wednesday, 16 October 2019 1:04 PM
To: 'Crystal Lee' <crystal_lee@sg.msig-asia.com>; assignments <assignments@lkkauto.com>; 'Winnie Chua' <pingping_chua@sg.msig-asia.com>; 'Helene Phua' <helene_phua@sg.msig-asia.com>
Cc: 'Ong Zi Hui' <zihui_ong@sg.msig-asia.com>; SUR <sur@lkkauto.com>
Subject: RE: Survey Request - Manual Assigned

Dear Sir/Mdm,

Thank you for the assignment.

Best Regards

G.NIVITHA

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Crystal Lee [mailto:crystal_lee@sg.msig-asia.com]
Sent: Wednesday, 16 October 2019 10:48 AM
To: Admin-D (LKKAuto) <admin-d@lkkauto.com>; assignments <assignments@lkkauto.com>; Winnie Chua <pingping_chua@sg.msig-asia.com>; Helene Phua <helene_phua@sg.msig-asia.com>
Cc: Ong Zi Hui <zihui_ong@sg.msig-asia.com>
Subject: Survey Request - Manual Assigned
Importance: High



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: TBA

Date: 17th October 2019

Our Ref: CS/MSG19018285/K1qd3

The Motor Claims Department
MSIG Insurance

Attn: Crystal

Dear Sirs/Mdm

PRELIMINARY ADVICE OF VEHICLE NO. SHC 6932K


We thank you for the instruction on 16/10/2019.

Please be informed that we had conducted the inspection of the abovementioned vehicle on 16/10/2019 at the premises of M/s PREMIER AUTOMOTIVE and have the following to report:-

Workshop Estimate Amount	: S\$	<u>4,714.79</u>
Revised Estimate Amount	: S\$	<u>3,718.74</u>
"Check" Items Amount	: S\$	<u>843.05</u>
Market Value	: S\$	<u>-</u>
LTA Reimbursement Value	: S\$	<u>-</u>
Nett Value	: S\$	<u>-</u>

Description of Damage:

The vehicle sustained damages at the o/s front & undercarriage.

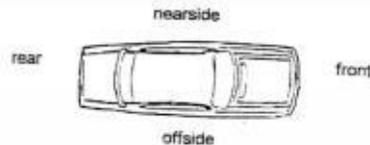

Comments/ Present Status:

Damages consistent.

We have not authorized repair.

Yours faithfully

Kalvin Ang
Automotive Assessor

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	15/10/2019 14:58
Date Of Accident	15/10/2019 13:20
Exact Location Of Accident	CANTONMENT ROAD // CANTONMENT LINK
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHC6932K
Insured/Policyholder	
Name Of Registered Owner	PREMIER TAXIS PTE LTD
Co Reg No	200304975H
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-62148880

Vehicle Particulars

Manufacturer	KIA
Model	OPTIMA-1.7 D (A)
Exact Purpose for which vehicle was being used at time of accident	HIRED & REWARDS
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	NTUC INCOME INSURANCE CO-OPERATIVE LTD
Type Of Coverage	THIRD PARTY
Fleet Policy	YES
Policy Number	5107202885
Cover Note Number	

Driver

Name of Driver	LEE KOK SIANG
NRIC No	S0162531D
Date Of Birth	28/04/1951
Occupation	OUTDOOR
Date Of Driving Pass	12/01/1970
Driving Experience	49 YEARS AND 9 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-96967164
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	BLK 414 #08-139 PANDAN GARDENS
Postcode	600414
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - MAJOR/MINOR RD
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : PAX IN THE REAR SEAT - FOREIGNER GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

BOTH VEHICLES - 1 PAX

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SLQ1028H
Vehicle Make/Model/Colour	TOYOTA /WHITE
Details Of Properties	VEH. B
Vehicle Category	PRIVATE HIRE
Name of Driver	LOW KIM GUAN
NRIC/Passport Number	S6831070I
Contact Number	96412820
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	

No. Of Passenger (Including Driver)

2

SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any wilful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.



15 OCT 2019

Policyholder's Signature
Date & Time:

Driver's Signature
(if driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

0162531D
SHC 6932K

Describe Circumstance of the Accident.


ON 15/10/2019 @ 1320HRS, I WAS DRIVING MY TAXI (SHC 6932 K) TRAVELLING ALONG CANTONMENT ROAD TOWARDS THE TRAFFIC JUNCTION OF CANTONMENT LINK, WITH A PASSENGER ONBOARD, IN THE RIGHT LANE.

TRAFFIC LIGHT AHEAD - WAS GREEN ON MY ROUTE FAVOUR & I PROCEED STRAIGHT AHEAD BUT SUDDENLY VEHICLE B (SLQ 1028 H - TOYOTA/WHITE) WHICH WAS EXITING FROM THE SLIP ROAD OF CANTONMENT LINK (ON MY RIGHT) - FAILED TO KEEP FOR PROPER LOOK OUT & FAILED TO OBSERVE FOR CLEARANCE FROM MY ROUTE - HAD ENCROACHED ONTO MY PATH ON MY RIGHT ABRUPTLY & COLLIDED ONTO THE RIGHT PORTION OF MY TAXI.

DUE TO THE IMPACT, MY TAXI HAD DAMAGES ON THE RIGHT PORTION & VEHICLE B HAD DAMAGES ON THE FRONT PORTION.

NO INJURY INVOLVED.
VEHICLE HAD A PASSENGER ONBOARD.

*SCENE PHOTOS & VIDEO FOOTAGE CAPTURED.

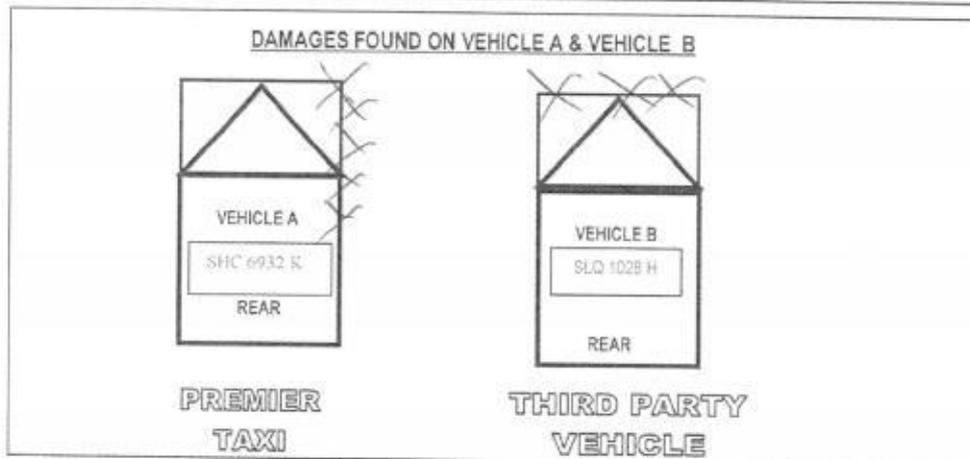

 01625311

Driver's Signature & NRIC Number
Tuesday, October 15, 2019 @ 3:11:09 PM

(attended by )

Text size + -

Enquire Transaction History**Transaction History Details**

Log Date/Time:	30 Oct 2015 / 08:22:51	Receipt No.:	AACCK001-AX239-151030-000002
Asset Type:	Vehicle	Transaction Amount:	\$69,044.00
Asset ID:	SHC6932K	Channel:	AA Counterless - CYCLE & CARRIAGE KIA PTE LTD
Transaction Type:	01.02 Register New Vehicle (AA)		
Business Transaction Reference No.:	20151030082251965871		
Vehicle No.:	SHC6932K		
Vehicle Type:	H10 - Public Transport Taxi (Motor Car)		
Vehicle Attachment 1:	Air-Con (Taxi)		
Vehicle Attachment 2:	-		
Vehicle Attachment 3:	-		
Vehicle Scheme:	Taxi (Company)		
First Registration Date:	30 Oct 2015		
Original Registration Date:	30 Oct 2015		
Vehicle Make:	KIA		
Vehicle Model:	OPTIMA 1.7(A) DIESEL		
Chassis No.:	KNAGM414MF5639410		
Engine No.:	D4FDEH313536		
Motor No.:	-		
Trailer Chassis No.:	-		
Propellant:	Diesel		
Passenger Capacity:	4		
Engine Capacity:	1685		
Power Rating:	-		
Unladen Weight:	1584		
Maximum Laden Weight:	2050		
Primary Color:	Silver		
Secondary Color:	-		
Manufacturing Year:	2015		
Open Market Value:	\$22,475.00		
Minimum PARF Benefit:	\$14,079.00		
PARF Eligibility:	Y		
No. of Transfer:	0		
Effective Ownership Date/Time:	30 Oct 2015 08:22:51		
COE No.:	2015103001003838M		
COE Expiry Date:	29 Oct 2023		
COE Bid Category:	-		
Actual QP/PQP Paid Amount:	\$45,439.00		
Lifespan Expiry Date:	29 Oct 2023		



Victory Recovery (Business Reg No.: 53096358B)

65 Teban Gardens Rd #23-617. Singapore 600065.

Mobile: 9618 0311 Fax: 6267 8996

CASH /
W.O. No. 103439

TOW JOB WORKS ORDER

M Primer Taxi Svc Date 15/10/19
 Car Make/Model _____ Vehicle No. SHC 6932K
 M'ship/NRIC No./Card No. _____ Contact No. _____
 Time - Rec'd 1355 Arrived 1430 Completed 1500
 Amount Charge S\$ _____ Tow Truck No Y48128
 Destination (from) Hoe Chang Rd (to) _____
 Remark (if any) _____

Tow Driver's Signature Member's Signature _____

- | | | |
|---|---|--|
| <input type="checkbox"/> Change Tyres & Towing | <input type="checkbox"/> Using King Dolley | <input type="checkbox"/> Use Car Carrier |
| <input type="checkbox"/> Basement / Multi Carpark | <input type="checkbox"/> Low Spoiler / Low Oil Sump | <input type="checkbox"/> Release Brake / Shaft |
| <input type="checkbox"/> Causeway / 2nd Link | <input type="checkbox"/> Accident / Over-turn | <input type="checkbox"/> Loaded |

Note : The owner or his representative is required to follow along to the towing destination, failing which the tow operator shall not be liable for any alleged damages to the car nor missing items from the same. Vehicle is towed at owner's risk. The tow operator accepts no responsibility for any damages to the owner's vehicle whilst being towed.

Premier Automotive Services Pte Ltd
#01-02, 23 Changi Sth Ave 2
486443

Insurer Reference:
Repairer Reference: 019215
Date calculated: 16/10/2019 1:45 PM

Full Report
Registration: SHC6932K
Printed: 16/10/2019 1:45 PM

Summary Information

Claim
Location: Singapore (SG) Work Provider: MSIG Insurance
Printed by: WEEDEK GOH Currency: (Singapore) Pte Ltd
Claim Reference: Date of Incident: SGD
Estimated Repair Time: Hire Car Start: 15/10/19
Actual Repair Days: Hire Car End:

Vehicle Details


Vehicle
Manufacturer: KIA
Model: OPTIMA (TF)
Sub Model: 2 LUXE
Model Sheet Number: 28 36 38
Registration: SHC6932K
VIN number:
Odometer:

Vehicle Condition

Vehicle Status
Pre-Accident Damage:
Date of Inspection:

Damage Areas

All
Underbody

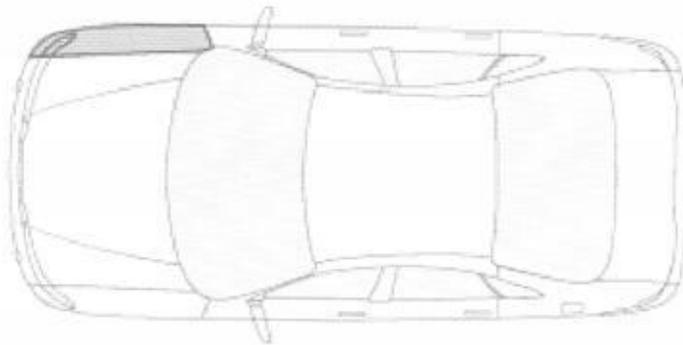

Labour

Code	Description	Time Base 10 WU/h	Price = 50.00 SGD/h	
			WU	Price SGD
66300R00)	RENEW R/FRT WING		6.0	30.00

Code	Description	WU	Price SGD
86512R00)	(BUMPER REMOVED) INCLUDE: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS IN REPAIR AREA R + R RENEW FRONT BUMPER	7.0	35.00
92000R0R)	(BUMPER REMOVED) INCLUDES: R + R NECESSARY ATTACHED PARTS R + R RIGHT HEADLAMP	1.0	5.00
87755R00	R + R R/SILL TRIM	3.0	15.00
56810R00)	R + R RIGHT TIE ROD END	1.0	5.00
56810R0B)	DETACH + REFIT TIE ROD END	1.0	5.00
52951R00)	R + R RIGHT FRONT WHEEL	1.0	5.00
51715R00)	R + R R/F STEERING KNUCKLE INCLUDES: R + R FRONT BRAKE DISC, FRONT SPLASH SHIELD AND FRONT ABS SENSOR	2.0	10.00
51715R00)	RENEW R/F AXLE RADIUS ARM (REMOVED)	5.0	25.00
54509R00)	R + R RIGHT FRONT LOWER CONTROL ARM	3.0	15.00
49500R00)	R + R RIGHT FRONT DRIVE SHAFT	1.0	5.00
54650R00)	R + R R/F SPRING STRUT (WHEEL REMOVED) INCLUDES: R + R COIL SPRING	2.0	10.00
54650R00)	DISS/ASS R/F SUSPENSION STRUT	3.0	15.00
52910R00)	R + R R/F TYRE (WHEEL REMOVED) INCLUDES: BALANCE WHEEL	1.0	5.00
52910R0C)	R + R TYRE/WHEEL (ADD/WORK)	1.0	5.00
56800A00	ALIGN FRONT TOE	4.0	20.00
56100A00	SET UP STEERING WHEEL SPOKE	3.0	15.00
0471	BONNET REPAIR	20.0*	100.00
1118	R/F WHEELHOUSE REPAIR	40.0*	200.00
1482	RIGHT FRONT DOOR REPAIR	20.0*	100.00
7202	R/F WHEEL CHECK	16.0*	80.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		14.10	141.0
Total of Labour			705.00

Paint

Code	Description	WU	Price SGD
Paint Work		Time Basis 10 WU/h	
SYSTEM AZT			
	R/F WING NEW PART PAINTING	9.0	
	FRONT BUMPER NEW PART PAINT K1R	11.0	
	R/SILL PANELLING NEW PART PAINT K1R	6.0	
	BONNET REPAIR PAINTING <50%	24.0	
	RIGHT FRONT DOOR REPAIR PAINTING <50%	15.0	
	R/F WHEELHOUSE SURFACE PAINT	6.0	

Paint Material Per Part

Code	Description	Price SGD
0742	R/F WING NEW PART PAINTING	12.90
0283	FRONT BUMPER NEW PART PAINT K1R	47.12
2208	R/SILL PANELLING NEW PART PAINT K1R	20.24

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET REPAIR PAINTING <50%	42.50
1482	RIGHT FRONT DOOR REPAIR PAINTING <50%	21.75
1118	R/F WHEELHOUSE SURFACE PAINT	9.68

Labour Cost - Paint

Factor	50.00 SGD/h	Hrs	WU	Price SGD
Time Paint			71.0	
Preparation Main Work Metal		1.70	17.0	85.00
Preparation Comp. Work Plastic		0.30	3.0	15.00
Total	10 WU/h	9.10	91.0	455.00

Material Cost - Paint

	Price SGD
New Part Painting	12.90
New Part Painting - Plastic K1R	67.36
Repair Painting	64.25
Surface-/Blend Paint	9.68
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	181.29

Spare Parts

Code	Description	Part Number	Supplier	prices as at 2015-06-01	Price SGD
0283	FRONT BUMPER	865112T500	—	—	531.00
0296	R/F BUMPER MOULDING	865642T500	—	—	51.00
0298	R/F BUMPER COVER	865522T510	X	—	66.00
0318	R/F INN BUMPER BRKT	865842T500	X	—	16.00
0321	L/F OUT BUMPER BRKT	865812T500	—	—	16.00
0322	R/F OUT BUMPER BRKT	865822T500	—	—	16.00
0431	GRILLE BADGE	863183R500	—	—	0.00
0562	RIGHT HEADLAMP ASSY	921022T573	—	—	1,028.00
0742	R/F WING	663212T000	—	—	384.00
0784	R/F WING MOULDING	877722T000	X	—	34.00
0842	R/F WHEELHOUSE COVER	868122T500	—	—	120.00
2208	R/SILL PANELLING	877522T000	—	—	286.00
7054	R/F LWR CONTROL ARM	545014C000	—	—	439.00
7078	R/F STRUT	546612T230	—	—	430.00
7082	R/F STEERING KNUCKLE	517163S100	—	—	547.00
7118	R/F WHEEL BEARING	517203S100	—	—	157.00
7202	R/F WHEEL	529102T100	—	—	246.00
7212	R/F WHEEL COVER	529602T100	—	—	116.00
7228	R/F TYRE	205/65 R 16 .. H	—	50% purchased	200.00
7278	R/F STABI LINKAGE	548402T000	—	—	86.00
7312	R/TIE ROD BALL JOINT	568202T500	—	—	61.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	4,830.00
Subtotal Discount(+35.00%)	-1,690.50

Total

3,139.50

3165.50

Extras

Code	Description	Price SGD
1000	Front bumper clips	48.00*
1001	RH Wing sticker	30.00*
1002	RH door stickers	100.00*
1003	RH sill panel clips	28.00*
1004	RH wheel cover clips	28.00*
7228	[E]: R/F TYRE: TYRE BRAND: ACHILLES	0.00*
Total Extras		234.00

Final Calculation

	SGD	SGD
Parts		
Total Discount(+35.00%)	4,830.00	
Total Parts	-1,690.50	3,139.50
Labour Time Base 10 WU/h		
Total 141.0 WU X 50.00 SGD/h	705.00	
Total of Labour		705.00
Total Of Extras		234.00
Paint Work Time Base 10 WU/h		
Labour Cost 91.0 WU X 50.00 SGD/h	455.00	
Material Cost	181.29	
Total Paint Including Material		636.29
Repair Cost Excludes GST		4,714.79
GST (+7.0%)		330.04
Repair Cost Included GST		5,044.83

[Signature]
17/10/19

Kahin CKK

16/10/19 1705h

4 hrs

4s

After Repair photo

4740.79

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Assessment Note

the Repairer must follow the following:

- To resurvey before spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Approved by Repairer

Premier Automotive Services Pte Ltd
#01-02, 23 Changi Sth Ave 2
486443

Insurer Reference:
Repairer Reference: SHC6932K
Date calculated: 01/11/2019 9:23 AM

Full Report
Registration: SHC6932K
Printed: 01/11/2019 9:24 AM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	MSIG Insurance (Singapore) Pte Ltd
Printed by:	WEEDEK GOH	Currency:	SGD
Claim Reference:		Date of Incident:	15/10/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	KIA
Model:	OPTIMA (TF)
Sub Model:	2 LUXE
Model Sheet Number:	28 36 38
Registration:	SHC6932K
VIN number:	
Odometer:	


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All
Underbody

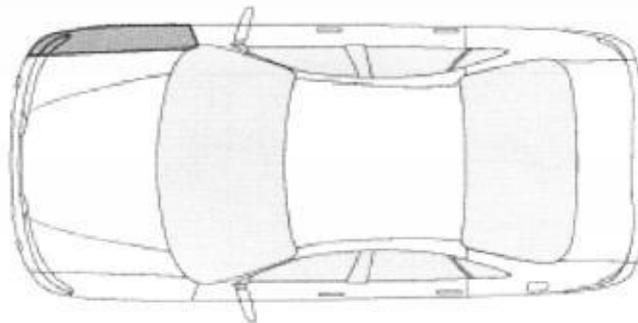

Labour

Code	Description	Time Base 10 WU/h	Price = 50.00 SGD/h	
			WU	Price SGD
66300R00)	RENEW R/FRT WING		6.0	30.00

Code	Description	WU	Price SGD
	(BUMPER REMOVED) INCLUDE: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS IN REPAIR AREA R + R		
86512R00)	RENEW FRONT BUMPER (BUMPER REMOVED) INCLUDES: R + R NECESSARY ATTACHED PARTS	7.0	35.00
92000R0R)	R + R RIGHT HEADLAMP	1.0	5.00
87755R00	R + R R/SILL TRIM	3.0	15.00
56810R00)	R + R RIGHT TIE ROD END	1.0	5.00
56810R0B)	DETACH + REFIT TIE ROD END	1.0	5.00
52951R00)	R + R RIGHT FRONT WHEEL	1.0	5.00
51715R00)	R + R R/F STEERING KNUCKLE INCLUDES: R + R FRONT BRAKE DISC, FRONT SPLASH SHIELD AND FRONT ABS SENSOR	2.0	10.00
51715R00)	RENEW R/F AXLE RADIUS ARM (REMOVED)	5.0	25.00
54509R00)	R + R RIGHT FRONT LOWER CONTROL ARM	3.0	15.00
49500R00)	R + R RIGHT FRONT DRIVE SHAFT	1.0	5.00
54650R00)	R + R R/F SPRING STRUT (WHEEL REMOVED) INCLUDES: R + R COIL SPRING	2.0	10.00
54650R00)	DISS/ASS R/F SUSPENSION STRUT	3.0	15.00
52910R00)	R + R R/F TYRE (WHEEL REMOVED) INCLUDES: BALANCE WHEEL	1.0	5.00
52910R0C)	R + R TYRE/WHEEL (ADD/WORK)	1.0	5.00
56800A00	ALIGN FRONT TOE	4.0	20.00
56100A00	SET UP STEERING WHEEL SPOKE	3.0	15.00
0471	BONNET REPAIR	20.0*	100.00
1118	R/F WHEELHOUSE REPAIR	40.0*	200.00
1482	RIGHT FRONT DOOR REPAIR	20.0*	100.00
7202	R/F WHEEL CHECK	16.0*	80.00
	Labour Cost	Hrs	WU
	Panel / Mechanical Labour	14.10	141.0
	Total of Labour		705.00

Paint

Code	Description	WU	Price SGD
	Paint Work		
	SYSTEM AZT		
	Time Basis 10 WU/h		
	R/F WING NEW PART PAINTING	9.0	
	FRONT BUMPER NEW PART PAINT K1R	11.0	
	R/SILL PANELLING NEW PART PAINT K1R	6.0	
	BONNET REPAIR PAINTING <50%	24.0	
	RIGHT FRONT DOOR REPAIR PAINTING <50%	15.0	
	R/F WHEELHOUSE SURFACE PAINT	6.0	

Paint Material Per Part

Code	Description	Price SGD
0742	R/F WING NEW PART PAINTING	12.90
0283	FRONT BUMPER NEW PART PAINT K1R	47.12
2208	R/SILL PANELLING NEW PART PAINT K1R	20.24

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET REPAIR PAINTING <50%	42.50
1482	RIGHT FRONT DOOR REPAIR PAINTING <50%	21.75
1118	R/F WHEELHOUSE SURFACE PAINT	9.68

Labour Cost - Paint

	50.00 SGD/h	Hrs	WU	Price SGD
Factor				
Time Paint			71.0	
Preparation Main Work Metal		1.70	17.0	85.00
Preparation Comp. Work Plastic		0.30	3.0	15.00
Total	10 WU/h	9.10	91.0	455.00

Material Cost - Paint

	Price SGD
New Part Painting	12.90
New Part Painting - Plastic K1R	67.36
Repair Painting	64.25
Surface-/Blend Paint	9.68
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	181.29

Spare Parts

Code	Description	Part Number	Supplier	prices as at 2015-06-01	Price SGD
0283	FRONT BUMPER	865112T500			531.00
0296	R/F BUMPER MOULDING	865642T500			51.00
0318	R/F INN BUMPER BRKT	865842T500			16.00
0321	L/F OUT BUMPER BRKT	865812T500			16.00
0431	GRILLE BADGE	863183R500			40.00
0562	RIGHT HEADLAMP ASSY	921022T573			1,028.00
0742	R/F WING	663212T000			384.00
0842	R/F WHEELHOUSE COVER	868122T500			120.00
2208	R/SILL PANELLING	877522T000			286.00
7054	R/F LWR CONTROL ARM	545014C000			439.00
7078	R/F STRUT	546612T230			430.00
7082	R/F STEERING KNUCKLE	517163S100			547.00
7118	R/F WHEEL BEARING	517203S100			157.00
7202	R/F WHEEL	529102T100			246.00
7212	R/F WHEEL COVER	529602T100			116.00
7228	R/F TYRE	205/65 R 16 .. H			100.00
7312	R/TIE ROD BALL JOINT	568202T500			61.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	4,568.00
Subtotal Discount(+35.00%)	-1,598.80
Total	2,969.20

Extras

Code	Description	Price SGD
1000	Front bumper clips	48.00*
1002	RH door stickers	100.00*
1003	RH sill panel clips	28.00*
7228	[E]: R/F TYRE: TYRE BRAND: ACHILLES	0.00*
Total Extras		176.00

Final Calculation

	SGD	SGD
Parts	4,568.00	
Total Discount(+35.00%)	-1,598.80	
Total Parts		2,969.20
Labour Time Base 10 WU/h		
Total 141.0 WU X 50.00 SGD/h	705.00	
Total of Labour		705.00
Total Of Extras		176.00
Paint Work Time Base 10 WU/h		
Labour Cost 91.0 WU X 50.00 SGD/h	455.00	
Material Cost	181.29	
Total Paint Including Material		636.29
Repair Cost Excludes GST		4,486.49
GST (+7.0%)		314.05
Repair Cost Included GST		4,800.54

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park, 51
Ubi Avenue 1
408933

Insurer Reference:
Repairer Reference: 019215
Date calculated: 01/11/2019 10:16 AM

Full Report
Registration: SHC6932K
Printed: 01/11/2019 10:16 AM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	MSIG Insurance (Singapore) Pte Ltd
Printed by:	KK LAU	Currency:	SGD
Claim Reference:		Date of Incident:	15/10/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	KIA
Model:	OPTIMA (TF)
Sub Model:	2 LUXE
Model Sheet Number:	28 36 38
Registration:	SHC6932K
VIN number:	
Odometer:	


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All
Underbody

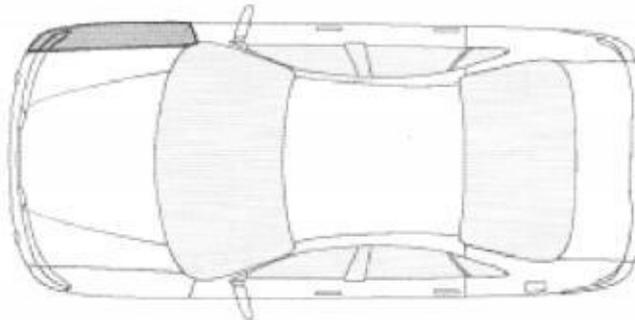

Labour

Time Base 10 WU/h

Price = 50.00 SGD/h

Code	Description	WU	Price SGD
66300R00)	RENEW R/FRT WING (BUMPER REMOVED) INCLUDE: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS IN REPAIR AREA R + R	6.0	30.00
86512R00)	RENEW FRONT BUMPER (BUMPER REMOVED) INCLUDES: R + R NECESSARY ATTACHED PARTS	7.0	35.00
92000R0R)	R + R RIGHT HEADLAMP	1.0	5.00
87755R00	R + R R/SILL TRIM	3.0	15.00
56810R00)	R + R RIGHT TIE ROD END	1.0	5.00
56810R0B)	DETACH + REFIT TIE ROD END	1.0	5.00
52951R00)	R + R RIGHT FRONT WHEEL	1.0	5.00
51715R00)	R + R R/F STEERING KNUCKLE INCLUDES: R + R FRONT BRAKE DISC, FRONT SPLASH SHIELD AND FRONT ABS SENSOR	2.0	10.00
51715R00)	RENEW R/F AXLE RADIUS ARM (REMOVED)	5.0	25.00
54509R00)	R + R RIGHT FRONT LOWER CONTROL ARM	3.0	15.00
49500R00)	R + R RIGHT FRONT DRIVE SHAFT	1.0	5.00
54650R00)	R + R R/F SPRING STRUT (WHEEL REMOVED) INCLUDES: R + R COIL SPRING	2.0	10.00
54650R00)	DISS/ASS R/F SUSPENSION STRUT	3.0	15.00
52910R00)	R + R R/F TYRE (WHEEL REMOVED) INCLUDES: BALANCE WHEEL	1.0	5.00
52910R0C)	R + R TYRE/WHEEL (ADD/WORK)	1.0	5.00
56800A00	ALIGN FRONT TOE	4.0	20.00
56100A00	SET UP STEERING WHEEL SPOKE	3.0	15.00
0471	BONNET REPAIR	20.0*	100.00
1118	R/F WHEELHOUSE REPAIR	40.0*	200.00
1482	RIGHT FRONT DOOR REPAIR	20.0*	100.00
7202	R/F WHEEL CHECK	16.0*	80.00

Labour Cost	Hrs	WU	Price SGD
Panel / Mechanical Labour	14.10	141.0	705.00
Total of Labour			705.00

Paint

Code	Description	WU	Price SGD
Paint Work			
SYSTEM AZT			
Time Basis 10 WU/h			
R/F WING NEW PART PAINTING		9.0	
FRONT BUMPER NEW PART PAINT K1R		11.0	
R/SILL PANELLING NEW PART PAINT K1R		6.0	
BONNET REPAIR PAINTING <50%		24.0	
RIGHT FRONT DOOR REPAIR PAINTING <50%		15.0	
R/F WHEELHOUSE SURFACE PAINT		6.0	

Paint Material Per Part

Code	Description	Price SGD
0742	R/F WING NEW PART PAINTING	12.90
0283	FRONT BUMPER NEW PART PAINT K1R	47.12

Paint Material Per Part

Code	Description	Price SGD
2208	R/SILL PANELLING NEW PART PAINT K1R	20.24
0471	BONNET REPAIR PAINTING <50%	42.50
1482	RIGHT FRONT DOOR REPAIR PAINTING <50%	21.75
1118	R/F WHEELHOUSE SURFACE PAINT	9.68

Labour Cost - Paint

	50.00 SGD/h	Hrs	WU	Price SGD
Factor				
Time Paint			71.0	
Preparation Main Work Metal		1.70	17.0	85.00
Preparation Comp. Work Plastic		0.30	3.0	15.00
Total	10 WU/h	9.10	91.0	455.00

Material Cost - Paint

	Price SGD
New Part Painting	12.90
New Part Painting - Plastic K1R	67.36
Repair Painting	64.25
Surface-/Blend Paint	9.68
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	181.29

Spare Parts

Code	Description	Part Number	Supplier	prices as at 2015-06-01 Price SGD
0283	FRONT BUMPER	865112T500		531.00
0296	R/F BUMPER MOULDING	865642T500		51.00
0321	L/F OUT BUMPER BRKT	865812T500		16.00
0322	R/F OUT BUMPER BRKT	865822T500		16.00
0431	GRILLE BADGE	863183R500		40.00
0562	RIGHT HEADLAMP ASSY	921022T573		1,028.00
0742	R/F WING	663212T000		384.00
0842	R/F WHEELHOUSE COVER	868122T500		120.00
2208	R/SILL PANELLING	877522T000		286.00
7054	R/F LWR CONTROL ARM	545014C000		439.00
7078	R/F STRUT	546612T230		430.00
7082	R/F STEERING KNUCKLE	517163S100		547.00
7118	R/F WHEEL BEARING	517203S100		157.00
7202	R/F WHEEL	529102T100		246.00
7212	R/F WHEEL COVER	529602T100		116.00
7228	R/F TYRE	205/65 R 16 .. H		100.00
7312	R/TIE ROD BALL JOINT	568202T500		61.00

f: OEM Parts	Savings	0.00
n: Non-OEM Parts	Subtotal	4,568.00
u: Used parts	Subtotal Discount(+35.00%)	-1,598.80
	Total	2,969.20

Extras

Code	Description	Price SGD
1000	Front bumper clips	48.00*
1002	RH door stickers	100.00*
1003	RH sill panel clips	28.00*
Total Extras		176.00

Final Calculation

	SGD	SGD
Parts	4,568.00	
Total Discount(+35.00%)	-1,598.80	
Total Parts		2,969.20
Labour Time Base 10 WU/h		
Total 141.0 WU X 50.00 SGD/h	705.00	
Total of Labour		705.00
Total Of Extras		176.00
Paint Work Time Base 10 WU/h		
Labour Cost 91.0 WU X 50.00 SGD/h	455.00	
Material Cost	181.29	
Total Paint Including Material		636.29
Repair Cost Excludes GST		4,486.49
GST (+7.0%)		314.05
Repair Cost Included GST		4,800.54

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	17 Oct 2019 19:13		18 Oct 2019 11:01 Edit Adj Rpt	S\$3,550.00 Edit Estimates	S\$3,550.00 View Rpt		Pending for Survey Report Cancel Case

Main

Reference

Claim Details

Documents

[Show All](#)

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	GRAB RENTALS PTE LTD , Co. Reg. No.: 201617200G		
Main Claimant:	PREMIER TAXIS PTE LTD , Co. Reg. No.: 200304975H		
Vehicle Reg. No.:	SHC6932K	Date of Loss:	15/10/2019 13:00 - :59 [47 Months and 15 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP / 608665	Policy/Cover Note No.:	29114756 (Comprehensive) Coverage: 01/02/2019 - 31/01/2020
Vehicle Reg. No. (Insured):	SLQ1028H	Policy No. (Claimant):	5107202885
		Excess:	
Repairer:	Premier Automotive Services Pte Ltd (HQ) 23 Changi South Ave 2, #01-02, 486443 Changi - Tel: 62148880		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by NG CHEN HOW - 6643 1391]		
Claimant's Insurer:	NTUC Income Insurance Co-operative Ltd (HQ) - Tel:		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by KALVIN ANG WEI KUN] ... [Imm.Advice due 19/10/2019]		
Driver/Custodian (Insured):	LOW KIM GUAN (51 / Male), NRIC: S68310701, Tel: +6596412820 Email:		
Adj Asg. Remarks:	on WP. Manual assigned to LKK via email on 16/10/19. Liab: clear Manual assigned to LKK.		

ASSOCIATED MAIL RECEIVED

There are no mail for this case.

[View All](#)[Compose Case Mail](#)

ALL ASSOCIATED TASKS

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

***SHC6932K (608665)**
[SLQ1028H]
TP
PREMIER TAXIS PTE LTD
Oct 15 2019 1:00PM
[GRAB RENTALS PTE LTD]
Premier Automotive Services Pte Ltd

[Upload Documents](#) |
 [Upload Photos](#) |
 [Compose New Letter](#)

View [View in Browser](#) ▼

Assessment Reports

No	Finalized On		1 per page ▼	<input checked="" type="checkbox"/>
		MSIG Insurance (Singapore) Pte. Ltd. (HQ)		
1	17/10/19 19:13	Accident Statement From:SC - Reg. No: SLQ1028H, Claimant: GRAB RENTALS PTE LTD		Thumbnail Print Load HTM
		Premier Automotive Services Pte Ltd (HQ)		
1	15/10/19 16:34	Accident Statement		Thumbnail Print Load HTM

Photos/Images

No	Finalized On		3 per page ▼	<input checked="" type="checkbox"/>
		Premier Automotive Services Pte Ltd (HQ)		
1	15/10/19 16:25	Accident Photo [Linked Accident Report Documents]		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
2	15/10/19 16:25	Accident Photo [Linked Accident Report Documents]		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
3	15/10/19 16:25	Accident Photo [Linked Accident Report Documents]		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
4	15/10/19 16:25	Accident Photo [Linked Accident Report Documents]		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
5	15/10/19 16:25	Accident Photo [Linked Accident Report Documents]		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
6	15/10/19 16:25	Accident Photo [Linked Accident Report Documents]		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
7	15/10/19 16:25	Accident Photo [Linked Accident Report Documents]		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
8	15/10/19 16:25	Accident Photo [Linked Accident Report Documents]		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
		LKK Auto Consultants Pte Ltd (HQ)		
No	Relabel/Reorder			
1	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
2	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
3	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
4	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
5	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
6	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
7	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
8	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
9	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
10	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
11	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
12	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
13	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
14	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
15	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
16	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
17	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
18	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
19	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
20	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
21	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
22	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
23	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>
24	21/10/19 08:47	General View		Thumbnail Print Load JPG <input checked="" type="checkbox"/>

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
25	21/10/19 08:47	General View		<input checked="" type="checkbox"/>
26	21/10/19 08:47	General View		<input checked="" type="checkbox"/>
27	21/10/19 08:47	General View		<input checked="" type="checkbox"/>
28	21/10/19 08:47	General View		<input checked="" type="checkbox"/>
29	21/10/19 08:47	General View		<input checked="" type="checkbox"/>
30	21/10/19 08:47	General View		<input checked="" type="checkbox"/>
31	21/10/19 08:47	General View		<input checked="" type="checkbox"/>
32	21/10/19 08:47	General View		<input checked="" type="checkbox"/>
33	21/10/19 08:47	General View		<input checked="" type="checkbox"/>
34	21/10/19 08:47	General View		<input checked="" type="checkbox"/>
35	21/10/19 08:47	General View		<input checked="" type="checkbox"/>
36	21/10/19 08:47	General View		<input checked="" type="checkbox"/>
37	21/10/19 08:47	General View		<input checked="" type="checkbox"/>
38	01/11/19 09:34	Reinspection Photo		<input checked="" type="checkbox"/>
39	01/11/19 09:34	Reinspection Photo		<input checked="" type="checkbox"/>
40	01/11/19 09:34	Reinspection Photo		<input checked="" type="checkbox"/>
41	01/11/19 09:34	Reinspection Photo		<input checked="" type="checkbox"/>
42	01/11/19 09:34	Reinspection Photo		<input checked="" type="checkbox"/>
43	01/11/19 09:34	Reinspection Photo		<input checked="" type="checkbox"/>
44	01/11/19 09:34	Reinspection Photo		<input checked="" type="checkbox"/>
45	01/11/19 09:34	Reinspection Photo		<input checked="" type="checkbox"/>

Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	17/10/19 19:15	TP GIA		<input checked="" type="checkbox"/>
2	17/10/19 19:15	TP Vehicle Photo (Part 1)		<input checked="" type="checkbox"/>
3	17/10/19 19:15	TP Vehicle Photo (Part 2)		<input checked="" type="checkbox"/>
4	17/10/19 19:15	TP Vehicle Photo (Part 3)		<input checked="" type="checkbox"/>
5	17/10/19 19:15	TP Vehicle Photo (Part 4)		<input checked="" type="checkbox"/>
6	17/10/19 19:15	TP Vehicle Photo (Part 5)		<input checked="" type="checkbox"/>
7	17/10/19 19:15	TP Vehicle Photo (Part 6)		<input checked="" type="checkbox"/>
8	17/10/19 19:15	TP Vehicle Photo (Part 7)		<input checked="" type="checkbox"/>
9	18/10/19 08:32	Notification to GRAB		<input checked="" type="checkbox"/>
10	18/10/19 09:34	email from opts		<input checked="" type="checkbox"/>
11	21/10/19 09:29	Manual Assign to LKK		<input checked="" type="checkbox"/>

No	Finalized On	Premier Automotive Services Pte Ltd (HQ)	Thumbnail	Print
1	15/10/19 15:30	Sketch Plan <small>[Linked Accident Report Documents]</small>		<input checked="" type="checkbox"/>

No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (Internal Surveyor)	Thumbnail	Print
1	18/10/19 10:59	Survey Request - Manual Assigned		<input checked="" type="checkbox"/>

Linked Accident Report Documents

Assessment Reports			View	View in Browser
No	Finalized On	Premier Automotive Services Pte Ltd (HQ)	1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premier Automotive Services Pte Ltd (HQ)	Thumbnail	Print
1	15/10/19 16:34	Accident Statement		<input checked="" type="checkbox"/>

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premier Automotive Services Pte Ltd (HQ)	Thumbnail	Print
1	15/10/19 16:25	Accident Photo		<input checked="" type="checkbox"/>
2	15/10/19 16:25	Accident Photo		<input checked="" type="checkbox"/>
3	15/10/19 16:25	Accident Photo		<input checked="" type="checkbox"/>
4	15/10/19 16:25	Accident Photo		<input checked="" type="checkbox"/>
5	15/10/19 16:25	Accident Photo		<input checked="" type="checkbox"/>
6	15/10/19 16:25	Accident Photo		<input checked="" type="checkbox"/>

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/MSG19018285/K1QD3S2
Date: 04/11/2019

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd. Policy No: 29114756
Claimant Vehicle No : SHC6932K **Insured Vehicle No :** SLQ1028H
 Date of Loss: 15/10/2019 Nature of Claim: TP Claim No: 608665

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SHC6932K**
 Make & Model: KIA OPTIMA, 1.7 D (A) Engine No: D4FDEH313536
 Reg. Date: 30/10/2015 (Man. Year: 2015) Chassis No: KNAGM414MF5639410
 Colour: Silver Odometer: 522864 km
 Engine Capacity: 1685 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Fair Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 205/65 R16 Rear Tyre Size: 205/65 R16
 Front Left Side: Achilles 7 mm Rear Left Side: Achilles 7 mm
 Front Right Side: Achilles 7 mm Rear Right Side: Achilles 7 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	3,399.50	3,145.20	254.30	7.48
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,341.29	1,341.29	0.00	0.00
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	4,740.79	4,486.49	254.30	5.36
Approved Total (Overridden) (S\$)		3,550.00		
(S\$)	4,740.79	3,550.00	1,190.79	25.12
+ GST 7.00/7.00% (S\$)	331.86	248.50	83.36	25.12
Nett Amount (S\$)	5,072.65	3,798.50	1,274.15	25.12

INSPECTION

Date of Assignment: 18/10/2019
 Date Inspected: 16/10/2019 Inspected At: Premier Automotive Services Pte Ltd (HQ)
 23 Changi South Ave 2, #01-02
 Singapore 486443
 Estimated Period of Repair: 4.0 days

Adjuster: KALVIN ANG WEI KUN

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 04 Nov 2019)
Parts: 143	KIA OPTIMA 1.7 D (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SHC6932K)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Cracked	531.00 FL	*531.00 FL
2	1		*R/F BUMPER MOULDING	Cut	51.00 FL	*51.00 FL
3	1		*R/F BUMPER COVER	Serviceable	66.00 FL	*- FL
4	1		*R/F INN BUMPER BRKT	Serviceable	16.00 FL	*- FL
5	1		*L/F OUT BUMPER BRKT	Cracked	16.00 FL	*16.00 FL
6	1		*R/F OUT BUMPER BRKT	Cracked	16.00 FL	*16.00 FL
7	1		*GRILLE BADGE	Necessary	40.00 FL	*40.00 FL
8	1		*RIGHT HEADLAMP ASSY	Cracked	1,028.00 FL	*1,028.00 FL
9	1		*R/F WING	Buckled	384.00 FL	*384.00 FL
10	1		*R/F WING MOULDING	Serviceable	34.00 FL	*- FL
11	1		*R/F WHEELHOUSE COVER	Buckled	120.00 FL	*120.00 FL
12	1		*R/SILL PANELLING	Cracked	286.00 FL	*286.00 FL
13	1		*R/F LWR CONTROL ARM	Bent	439.00 FL	*439.00 FL
14	1		*R/F STRUT	Bent	430.00 FL	*430.00 FL
15	1		*R/F STEERING KNUCKLE	Bent	547.00 FL	*547.00 FL
16	1		*R/F WHEEL BEARING	Bent	157.00 FL	*157.00 FL
17	1		*R/F WHEEL	Bent	246.00 FL	*246.00 FL
18	1		*R/F WHEEL COVER	Cracked	116.00 FL	*116.00 FL
19	1		*R/F STABI LINKAGE	Serviceable	86.00 FL	*- FL
20	1		*R/TIE ROD BALL JOINT	Bent	61.00 FL	*61.00 FL
21	1		*R/F TYRE (@ \$200.00 DISC 50%)	Punctured	200.00 FL	*100.00 FL
22	1		*FRONT BUMPER CLIPS	Necessary	48.00 FS	*48.00 FS
23	1		*RH WING STICKER	Not Necessary	30.00 FS	*- FS
24	1		*RH DOOR STICKERS	Necessary	100.00 FS	*100.00 FS
25	1		*RH SILL PANEL CLIPS	Necessary	28.00 FS	*28.00 FS
26	1		*RH WHEEL COVER CLIPS	Not Necessary	28.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$)	5,104.00	4,744.00
- List Item Discount on L Items 35.00/35.00% (S\$)	1,704.50	1,598.80
Total Parts (S\$)	3,399.50	3,145.20

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TOTAL LABOUR.	New	705.00	705.00
2	PAINT WORK: LABOUR COST.	New	455.00	455.00
3	PAINT WORK: MATERIAL COST.	New	181.29	181.29
			Gross Labour Cost (S\$)	1,341.29
				1,341.29

Report was unsubmitted during this print-out.

< END OF ESTIMATES >