

ASS. REC. BY:

REF: CS/AWA 19019827 / Avf3

Special Instruction:

Surveyor: Adrian

## ASSIGNMENT (Office)

From (Person): Sella Goh

of

AWACDate/Time: 8.11.19 1.30pm

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SJL 1919L

Insured:

GBD 9718Jat Workshop m/s SM Automobile

Tel:

67479241of Bik C 1 Kats Bukit Ave 6 #01-43

Policy No:

Claim No:

NSV 1900551/KW

Sum Insured:

Excess:

Make of Veh:

D.O.A. 7.11.2019

(Client's Record)

CA / REV / REP. / REV 24 HRS

Date/Time: 8.11.19 1.35pm

Person Contacted:

Sukhyi

H.O.D. Endorsement:

Vehicle IN/OUT

Date/Time

Action/Instruction ( ☒ ) EstimateSJL 1919L - XGBD 9718J - X14/1/2020Adrian confirmed LS \$ 14,200 (Red 59, 57.22, 81%)

ASS. REQ. BY:

REP:

# ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_  
 Estimated Cost: \_\_\_\_\_  
OD / TP / WS / TP RES / OD RES / EVA / INV / MV  
 To Inspect Vehicle No: \_\_\_\_\_  
 at Workshop m/s \_\_\_\_\_  
 of \_\_\_\_\_  
 Insured: \_\_\_\_\_  
 Policy No. \_\_\_\_\_  
 Claims No. \_\_\_\_\_  
 Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_  
 (Client's Record)  
 Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its  
 repair at the time of inspection.

N/S	O/S

Bal. or Market Value: \_\_\_\_\_  
 IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No  
 GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No  
 Est. Repairs: \_\_\_\_\_ days Res.: Yes or No  
 Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Veh No: SJL1919L Yr Regr: 2008 / Oct.  
 Type: Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toyota Estima C.C. 2362  
 Colour: white A/C: Insured / Std / NI / NA  
 Sp. Reading: 276124 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_  
 C/No: ACR500075920

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 245/40R19  
 R: 245/40R19

BS / DUN / EXNOVA / GY / FS / LIZA MIC / OHTSU / PIR / SUMI /  
 TOYO / YOKO or

Front	Rear
R/Bal. <u>06</u> mm	R/Bal. <u>06</u> mm
L/Bal. <u>06</u> mm	L/Bal. <u>06</u> mm
D.O.A. _____	D.O.I. <u>08/11/19</u>

\*Survey held at SM

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

TP Ailed world

COE Expiry: 21/10/28.

MV: 601K  
PV: 28-9K  
Nett: 31.1K

RECEIVED 14 JAN 2020

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

2) 14/1 -typist

Days Of Repair: 9

Resurvey No. of Trip: 3

Add Fee:

☐

: Site Insp (\$)

☐

: Interview (\$)

☐

: Tech. Invs (\$)

☐

: Weekend (\$)

Survey Fee:

Transportation:

3 + PS. \$

Folio:

Other:

TOTAL

350

Report Format:

TP

Lump Sum / L.R. (\$)

14,200k

**Summer Lee (LKK Auto)**

**From:** Goh, Stella <stella.goh@awac.com> on behalf of Motorsurvey  
<Motorsurvey@awac.com>  
**Sent:** Friday, 8 November, 2019 1:30 PM  
**To:** 'assignments@lkkauto.com'  
**Cc:** 'sur@lkkauto.com'; 'sm automotive'  
**Subject:** TP Survey assignment for SJL 1919 L DOA: 07/11/2019 Our ref: NSV1900551/KW

The above captioned accident refers.

Pursuant to the Practice Directions Amendment No. 1 of 2016 which was effective on 1 April 2016, we like to advise that the third party claimant and us do have consensus in the appointment of Mr Mohammad Taufikh as the Single Joint Expert to conduct the pre-repair survey of the third party claimant's vehicle.

Please conduct "THIRD PARTY" survey on without prejudice basis. The information as are follows:

3 <sup>rd</sup> Party Vehicle	:	SJL 1919 L
Insured Vehicle	:	GBD 9718 J
Policy Number	:	AVCPSB0082661903
Name of Workshop	:	SM AUTOMOTIVE
Contact Number	:	67479241
Person to Contact	:	Sukyi Chong
Estimated Cost of repairs	:	\$ NA

Regards,  
Claims Division

Copy to SM Automotive (Your Ref: SJL 1919 L) via Email.

Note -

- ( X )
1. This is to keep you informed that we have appointed surveyors to conduct inspection to your client's damaged vehicle on a without prejudice basis.
  2. **Please keep our motor surveyor and us informed so as to enable the surveyor to conduct a post repair inspection once your client's vehicle has been repaired and before returning the repaired vehicle to your customer.**
  3. Please quantify your client's claim with all relevant supporting documents once your client's vehicle has been repaired.
  4. Please do not construe this appointment of surveyor and our above request as an admission of liability.

Regards  
Motor Claims  
Claims Group

---

The information contained in this e-mail and any attachments hereto is confidential. If you are not the intended recipient, you must not use or disseminate any of this information. If you have received this e-mail in error, please immediately notify the sender by reply e-mail and permanently delete the original e-mail (and any attachments hereto) and any copies or printouts thereof. Although this e-mail and any attachments hereto are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by Allied World Assurance Company Holdings, Ltd or its subsidiaries or affiliates, either jointly or severally, for any loss or damage arising in any way from its use.



(COE till 11/2027)

Fuel Type: Petrol-Electric

Full Loan Avail. \$1006 Monthly Only With Low Interest 3.99%. New Hybrid Change Travel Less Than 8k Km. A Car Worth To Keep Or Use For Rental. Call Us For A Viewing Now!

PREMIUM AD

Allmotoring.sg

Posted: 05-Nov-2019 Tags: 2008 Toyota Estima, 2008 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota



☐ Toyota Estima 2.4A Aeras Premium Moonroof (COE till 06/2028)

\$62,800

\$7,300 /yr

12-Jun-2008

2,362 cc

-

MPV

Available

Very Well Maintained By Previous Owner. Full Loan Available Subject To Approval. Feel Free To Contact Us For More Information. Buy With A Peace Of Mind From Us. All Wear And Tear Parts Will Replaced. Call Today To Make Appointment For Test Drive.

PREMIUM AD

Posted: 13-Oct-2019 Tags: 2008 Toyota Estima, 2008 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota



☐ Toyota Estima 2.4A X (COE till 06/2028)

\$62,888

\$7,290 /yr

24-Jun-2008

2,362 cc

-

MPV

Available

Very Well Maintained Unit By Owner. Service Regularly With 100% No Repairs Needed. Very Low Depreciation In The Market! Don't Miss This Good Condition Estima! High Loan/Trade-In All Available. Wheels Singapore Your Consignment, Polishing Hub.

CONSIGNMENT

Posted: 04-Oct-2019 Tags: 2008 Toyota Estima, 2008 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota



☐ Toyota Estima 2.4A Aeras G (COE till 06/2028)

\$58,800

\$6,800 /yr

30-Jun-2008

2,362 cc

160,000 km

MPV

Available

Nice Plate Number. 6 Months Gearbox And Engine Warranty. Additional Ownership Transfers Is Due To COE Renewal With Loan.

DIRECT OWNER

Posted: 04-Oct-2019 Tags: 2008 Toyota Estima, 2008 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota



Find the right car through consignment.

Purchase pre-loved, owner consigned cars at affordable prices through our dedicated consignment agents. Arrange a test drive today.

Find out more!



☐ Toyota Estima 2.4A X (COE till 06/2028)

\$65,888

\$7,620 /yr

28-Jul-2008

2,362 cc

146,000 km

MPV

Available

Full Servicing Done, New Battery, Tyre Just Replaced On May, Road Tax Just Renewed, Worn Parts Replaced At Workshop With Receipts.

DIRECT OWNER

Posted: 08-Oct-2019 Tags: 2008 Toyota Estima, 2008 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota



☐ Toyota Estima 2.4A X Moonroof (COE till 08/2028)

\$59,800

\$6,830 /yr

08-Aug-2008

2,362 cc

180,000 km

MPV

Available

Comfortable 8 Seater For Your Big Family, Beautiful Elegant Silver With Very Clean And Well Maintain Beige Leather Interior, Non Smoker, Power Sliding Door / Moonroof / Keyless Push Start, New Road Tax, Shelter Parking, 100% No Repair Needed, Welcome Own Workshop...

Posted: 07-Nov-2019 Tags: 2008 Toyota Estima, 2008 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota



☐ Toyota Estima 3.5A Aeras Premium Moonroof (COE till 08/2028)

\$71,500

\$8,160 /yr

13-Aug-2008

3,456 cc

127,800 km

MPV

Available

CF Steering Wheel And Shift Knob. New Coat Of Paint With Premium QMI Toughguard Ceramic Nano Coated On Aug 18. Free Maintenance Worth \$200 Till Jul 20. TRD Suspensions And Performance Dampers Added For Stability, Handling While Still Achieving A C...

DIRECT OWNER

Posted: 24-Oct-2019 Tags: 2008 Toyota Estima, 2008 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota



☐ Toyota Estima 2.4A Aeras (COE till 08/2028)

\$56,800

\$6,460 /yr

22-Aug-2008

2,362 cc

126,000 km

MPV

Available

Cheapest Depreciation! Well Maintained. Dont Miss It.

Posted: 11-Nov-2019 Tags: 2008 Toyota Estima, 2008 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota



☐ Toyota Estima 2.4A Aeras (COE till 10/2028)

\$61,800

\$6,920 /yr

13-Oct-2008

2,362 cc

-

MPV

Available

100% Loan Available, Toyota Estima (7 Seater), Like New Condition, No Repair Needed, Feel Free To Contact Me For More Information, Wear And Tear Parts Will Be Replaced View To Believe! Call Me To Arrange For A Viewing Now.

DIRECT OWNER

Posted: 28-Oct-2019 Tags: 2008 Toyota Estima, 2008 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota



☐ Toyota Estima 2.4A Aeras (COE till 10/2028)

\$60,800

\$6,770 /yr

30-Oct-2008

2,362 cc

-

MPV

Available

Full Loan Available At \$1092 Monthly. 1 Year Free Servicing & Brand New Battery, Interest From 3.18%. Bank Loan And In House Loan Available. Vehicle Serviced & Checked By In House Workshop. Trade In Welcome.

Posted: 25-Nov-2019 Tags: 2008 Toyota Estima, 2008 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota

SHORTLISTED HISTORY

Compare



☐ Toyota Estima 2.4A Aeras  
(COE till 10/2028)

\$93,000

\$10,360 /yr

30-Oct-2008

2,362 cc

-

MPV

Available

You Are Probably Wondering Why Such A High Price/Depreciation For My Car? Answer Is Simple, You Might Be Able To Find A Much Lower Priced Car In The Market But Might End Up Spending Thousands Of Dollars To Repair It. Come And See It And Be Convinced.

**DIRECT OWNER**

★ Posted: 20-Oct-2019

Tags: 2008 Toyota Estima, 2008 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota



☐ Toyota Estima 2.4A Aeras  
Premium Moonroof (COE till 11/2028)

\$72,800

\$8,060 /yr

18-Nov-2008

2,362 cc

-

MPV

Available

100% Loan Approval! 2015 Facelift! New 6 Months Road Tax. The Perfect Choice Of MPV For Your Family. Comfortable And Spacious! Very Well Maintained. Drive With A Peace Of Mind. Please Call For Viewing.

★ Posted: 16-Sep-2019

Tags: 2008 Toyota Estima, 2008 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota



☐ Toyota Estima 2.4A Aeras  
(COE till 05/2023)

\$40,000

\$11,230 /yr

20-Jan-2009

2,362 cc

183,000 km

MPV

Available

A006 Consignment Unit. Loan Available To Choose From. High Trade In Value For Your Car! No Hidden Cost. For Further Information Or If You Have Any Questions, Please Do Not Hesitate To Contact Us. Schedule A Test Drive Today. Viewing Is Strictly By Appointment Only.

**CONSIGNMENT**

★ Posted: 13-Oct-2019

Tags: 2009 Toyota Estima, 2009 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota



☐ Toyota Estima 2.4A Aeras  
(COE till 09/2023)

\$43,800

\$11,240 /yr

23-Jan-2009

2,362 cc

-

MPV

Available

New Arrival Estima Aeras Up For Sale, Well Maintained With Wear And Tear All Replaced, So Call For Appointment To View.

★ Posted: 06-Nov-2019

Tags: 2009 Toyota Estima, 2009 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota

Save this search criteria, to get email alerts whenever a match is found.

**Save Search**

Make ▼ Model ▼ Price ▼ Depreciation ▼ Reg Date ▼ Eng Cap ▼ Mileage ▼ Veh Type ▼ Status ▼

For old advertisements, view Expired ads

« Back ( 1 2 3 4 ) Next »

20 ▼ results/page

[Home](#) | [New Cars](#) | [Used Cars](#) | [Sell My Car](#) | [Directory](#) | [Products](#) | [Insurance](#) | [Article](#) | [Forum](#) | [Resources](#)

sgCarMart is the number one car classifieds for parallel import cars, Toyota, Honda, Nissan, Mitsubishi & BMW. There are plenty of cars for sale, from vans, trucks, sedan cars, luxury cars, sports cars or stationwagons, SUV, MPV, hatchback, to COE cars & OPC cars. You can also buy from a car auction, look up car loans, financial services, low mileage cars, car brands, carpark rates & car insurance. Find buy used Estima, Estima Singapore, used Estima Singapore, used Estima, used vehicles Singapore or even buy used Estima Singapore. We have new car dealers comprising parallel importers, authorized car dealers, and used car dealers on our site. Find new car price lists, new car launches and new car promotions. Visit our partner sites for job openings for Singapore jobs, real-estate properties for sale, motor, car performance parts, car discussion, forum discussion, commercial vehicle leasing & COE results.

All prices and other information displayed on sgCarMart.com are gathered from sources and based on algorithms that are believed by sgCarMart.com to be reliable, but no assurance can be given that this information is accurate, complete or current. sgCarMart.com does not assume any responsibility for errors or omissions or warrant the accuracy of this information.

Follow **sgCarMart.com**



[About Us](#) | [Careers](#) | [Contact Us](#) | [Sitemap](#) | [Terms of Service](#) | [Privacy Policy](#) | [Personal Data Protection Statement](#)

©2004-2019 sgCarMart. All rights reserved.

SHORTLISTED HISTORY

Compare

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle****Vehicle Owner Particulars**

Owner ID Type: Singapore NRIC  
Owner ID: 036J

**Vehicle Details**

Vehicle No.: SJL1919L  
Vehicle to be Exported: No  
Intended Deregistration Date: 07 Nov 2019  
Vehicle Make: TOYOTA  
Vehicle Model: ESTIMA AERAS 2.4 A  
Primary Colour: White  
Manufacturing Year: 2008  
Engine No.: 2AZC461451  
Chassis No.: ACR500075920  
Maximum Power Output: 125.0 kW (167 bhp)  
Open Market Value: \$29,707.00  
Original Registration Date: 22 Oct 2008  
First Registration Date: 22 Oct 2008  
Transfer Count: 4  
Actual ARF Paid: \$25,385.00

**Intended PARF Rebate Details**

PARF Eligibility: Forfeited  
PARF Eligibility Expiry Date: -  
PARF Rebate Amount: \$0.00

**Intended COE Rebate Details**

COE Expiry Date: 21 Oct 2028  
COE Category: B - Car (1601cc & above)  
COE Period(Years): 10  
PQP Paid: \$32,279.00  
COE Rebate Amount: \$28,903.00  
**Total Rebate Amount: \$28,903.00**

The information contained herein is correct as at 07 Nov 2019

OK

MSME19147612 / SME Motor Pte Ltd - Kaki Bukit  
 ENTRY DATE & TIME: 07/11/2019 15:49  
 SUBMITTED BY: Chia Pei Ying

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report 07/11/2019 15:49  
 Date Of Accident 07/11/2019 11:40  
 Exact Location Of Accident AMK AVE 3 SLIP RD TWDS CTE  
 Country/State of Loss SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number SJL1919L  
**Insured/Policyholder**  
 Name Of Registered Owner CHAN YOONG YUAN  
 NRIC No S7070036J  
 Email Address NOEMAIL  
 Mobile Phone No (LOCAL) +65-92741919  
 Alternative Phone No OFFICE-92741919  
**Vehicle Particulars**  
 Manufacturer TOYOTA  
 Model ESTIMA  
 Exact Purpose for which vehicle was being used at time of accident  
 Are you claiming under your own insurance policy for repair to your vehicle? NO  
 If No, Please state action to be taken THIRD PARTY  
 Vehicle Category PRIVATE CAR  
**Insurance Company**  
 Name of Insurance Company NTUC INCOME INSURANCE CO-OPERATIVE LTD  
 Type Of Coverage COMPREHENSIVE  
 Fleet Policy NO  
 Policy Number 5094495776-02  
 Cover Note Number  
**Driver**  
 Name of Driver CHAN YOONG YUAN  
 NRIC No S7070036J  
 Date Of Birth 01/01/1970  
 Occupation INDOOR  
 Date Of Driving Pass 03/03/1993  
 Driving Experience 26 YEARS AND 8 MONTHS  
 Gender MALE  
 Mobile Number (LOCAL) +65-92741919  
 Fax Number  
 Contact Number OFFICE-92741919  
 Email Address NOEMAIL



Address BLK 326 YISHUN RING ROAD #02-1344  
 Postcode 760326  
 Was driver an employee of the Insured's Company NO  
 If No, Relationship of the Driver with the Insured OWNER  
 Vehicle Registration Number of Driver's Own Vehicle -  
 -  
 -  
 Insurance Company of Driver's Own Vehicle -  
 -  
 -

**General Information of the Accident**

Type Of Accident COLLISION - HEAD TO REAR  
 Weather Conditions CLEAR  
 Road Surface DRY

**Other Information**

Was any foreign vehicle involved in this accident? NO  
 Number of vehicles (including own vehicle) involved in the accident 2  
 Was any body injured in the Accident? YES  
 Was any injured conveyed to hospital by ambulance? NO  
 Was any other material or property damaged? YES  
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO  
 Number of Passengers (Including Driver) 3  
 Passenger 1 NAME: : ONG YOKE TAN  
 GENDER: : FEMALE  
 Passenger 2 NAME: : CHAN TZE KIEN DARIUS  
 GENDER: : MALE

**Details of Police Action**

Was the accident reported to the police? NO  
 If Yes, Please state which Police Station  
 Was notice of intended Prosecution given? NO  
 If Yes, against whom?

**Circumstances of Accident**

I WAS DRIVING STRAIGHT ALONG AMK AVE 3 SLIP ROAD TOWARDS CTE. AS THE CAR IN FRONT OF ME STOPPED. I ALSO CAME TO A STOP AT A SAFE DISTANCE. ABOUT 1 SECOND AFTER BEING STATIONARY. SUDDENLY, I FELT A HUGE IMPACT COMING FROM THE REAR. VEHICLE B COLLIDED ONTO REAR PORTION OF MY VEHICLE AND CAUSED DAMAGES. WE EXCHANGED PARTICULARS AND TOOK PHOTOS AND LEFT THE SCENE.

**Attachment(s)**

Are accident photos available for attachment? YES  
 Was there any video captured by Car Camera? NO  
 Was there any audio recorded? NO

**DETAILS OF OTHER VEHICLE PROPERTY 1**

Vehicle Registration Number GBD9718J  
 Vehicle Make/Model/Colour  
 Details Of Properties VEHICLE B  
 Vehicle Category COMMERCIAL VEHICLE  
 Name of Driver  
 NRIC/Passport Number  
 Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

**DETAILS OF INJURED PERSON 1**

Name CHAN YOONG YUAN

Approximate Age

Injuries Sustain

Injured person in which vehicle? SJL1919L

Were seat belts worn?

Was this injured conveyed to hospital by ambulance?

Address

Postcode

**DETAILS OF INJURED PERSON 2**

Name CHAN TZE KIAN DARIUS

Approximate Age

Injuries Sustain

Injured person in which vehicle? SJL1919L

Were seat belts worn?

Was this injured conveyed to hospital by ambulance?

Address

Postcode

**DETAILS OF INJURED PERSON 3**

Name ONG YOKE YEN

Approximate Age

Injuries Sustain

Injured person in which vehicle? SJL1919L

Were seat belts worn?

Was this injured conveyed to hospital by ambulance?

Address

Postcode

## Sketch Plan Pg. 1

**SKETCH PLAN****IMPORTANT NOTICE**

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
  - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature  
Date & Time:

Driver's Signature  
(If driver is not the policyholder)  
Date & Time:


Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:

2019/07/11 17:22 FAX

SM AUTO

## Sketch Plan #2 Pg. 1

## SKETCH PLAN

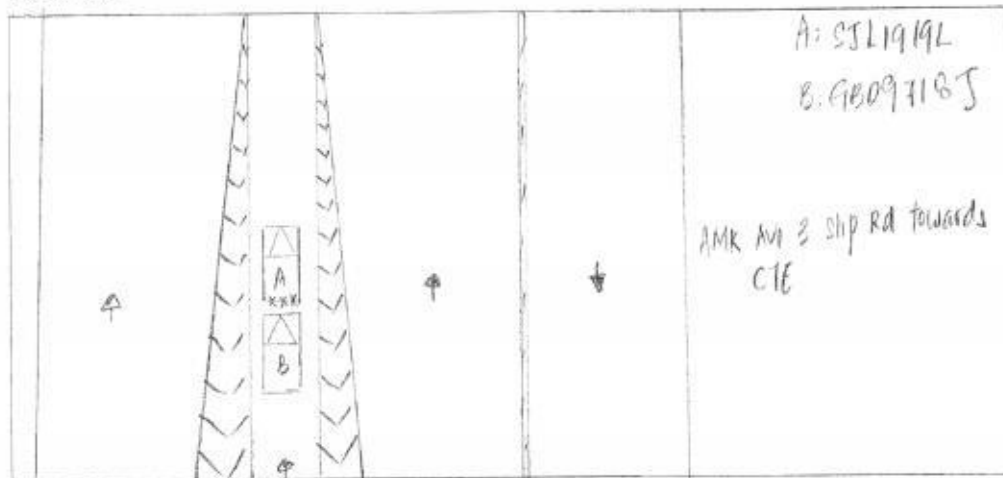

## DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I was driving straight along AMK Ave 3 slip road towards CTE.

As the car in front of me has stopped, I also came to a stop at a safe distance. About 1 seconds after being stationary, I suddenly felt a huge impact coming from the rear. Ven "B" collided onto rear portion of my veh & caused damage.

We exchanged particulars and took photos and left the scene.

*[Signature]*

## DECLARATION

I/We declare the foregoing particulars are true in every respect.

*[Signature]*  
Policyholder's Signature  
Date & Time

*[Signature]*  
Driver's Signature  
(If driver is not the policyholder)  
Date & Time

*[Signature]*  
Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:

# SM AUTOMOTIVE

Block C, 1 Kaki Bukit Avenue 6 #01-43 Singapore 417883

Email: SM\_AUTOMOTIVE@HOTMAIL.COM

Tel: (65) 6747 9241 Fax: (65) 6741 7276

RCB No.: 53231488C

CHAN YOONG YUAN

07/11/2019

Blk 1 Kaki Bukit Ave 6

# 01-43

Singapore

TPAWA

Veron

Accident date: 07/11/2019

Estimated repair cost for vehicle no: SJL1919L TOYOTA ESTIMA AERAS 2.4A '08

S/N	QTY	ITEMS	U/PRICE	AMOUNT
1	1	Rear Boot Lid <i>Distorted.</i>		\$1,592.50 ✓
2	2	Rear Boot Lid Hinge <i>Not new</i>	\$181.90	\$363.80 ✗
3	2	Rear Boot Lid Shock Absorber <i>Not new</i>	\$209.10	\$418.20 ✗
4	1	Rear Boot Lid Emblem Logo		\$66.10 ✓
5	1	Rear Boot Lid Estima Logo <i>Free</i>		\$70.10 ✓
6	1	Rear Boot Lid Aeras Logo		\$68.80 ✓
7	1	Rear Boot Lid Center Moulding <i>Cracked</i>		\$289.10 ✓
8	6	Rear Boot Lid Center Moulding Clips <i>new</i>	\$6.50	\$39.00 <sup>10</sup> ✓
9	1	Rear Boot Lid Number Plate <i>Not new</i>		\$50.00 ✗
10	2	Rear Boot Lid Number Plate Lamp <i>Not new</i>	\$121.10	\$242.20 ✗
11	2	Rear Boot lid Side Reflector <i>Cracked</i>	\$287.70	\$575.40 ✓
12	1	Rear Boot Lid Center Reflector <i>Cracked</i>		\$281.90 ✓
13	1	Rear Boot Lid Wiper <i>ut</i>		\$122.25 ✓
14	1	Rear Boot Lid Wiper Arm <i>ut</i>		\$181.90 ✓
15	1	Rear Boot Lid Wiper Arm Cover <i>ut</i>		\$122.35 <sup>35</sup> ✓
16	1	Rear Boot Lid Wiper Motor <i>Damaged</i>		\$581.95 ✓
17	1	Rear Boot Lid Inner Lock <i>Damaged.</i>		<del>\$588.90</del> 398 ✓
18	1	Rear Boot Lid Inner Lock Motor <i>Not new</i>		\$581.85 ✗
19	1	Rear boot Lid Outer Handle Switch (Nett) <i>Not new</i>		\$561.72 ✗
20	1	Rear Boot Lid Inner Trime Board <i>Cracked</i>		\$781.90 <sup>645</sup> ✓
21	1	Rear Boot Lid Inner Rubber <i>ut</i>		\$374.90 ✓
22	2	Rear Boot Lid Top Side Trime Board <i>Not new</i>	\$643.00	\$1,286.00 ✗
23	1	Rear Boot Lid Top Center Trime Board <i>Not new</i>		\$220.60 ✗
24	1	Rear Boot Lid Top Spoiler (Nett) <i>Cracked</i>		\$1,800.00 <sup>750(SN)</sup> ✓
25	1	Rear Boot Lid Windscreen <i>Shattered</i>		\$911.80 ✓
26	1	Rear Boot Lid Windscreen Moulding Top <i>Free</i>		\$181.40 ✓
27	1	Rear Boot Lid Windscreen Moulding Lower		\$172.40 ✓

28	2	Rear Boot Lid Windscreen Moulding Side	new	\$172.45	\$344.90	✓
29	1	Rear Boot Lid Inner Handle Cover	3 new		\$132.25	+
30	2	Rear Boot Lid Inner Side Stopper Rubber	new	\$28.50	\$57.00	+
31	1	Rear Boot Lid Reverse Camera (S.Nett)	damaged		\$680.00	350(SN)
32	2	Rear Tail Lamp	LH out, RH cracked	\$408.10	\$816.20	✓
33	2	Rear Tail Lamp Panel	RH Dented	\$372.75	\$745.50	372.75
34	2	Rear Tail Lamp Inner Panel Lower	3 new	\$591.60	\$1,183.20	+
35	2	Rear Tail Lamp Inner Panel Upper	3 new	\$289.10	\$578.20	+
36	1	Rear Bumper	Distorted		\$1,077.10	822
37	2	Rear Bumper Side Retainer Outer	3 new	\$182.20	\$364.40	✓
38	2	Rear Bumper Side Retainer Inner	3 new	\$131.35	\$262.70	✓
39	10	Rear Bumper Clips	new	\$6.50	\$65.00	30
40	4	Rear Bumper Reverse Sensor (S.Nett)	damaged	\$480.00	\$1,920.00	350(SN)
41	2	Rear bumper LED Light (S.Nett)	new	\$107.00	\$214.00	120(SN)
42	2	Rear Bumper LED Side Reflector	cracked	\$181.40	\$362.80	✓
43	2	Rear Bumper Mud Shield	3 new	\$181.40	\$362.80	+
44	8	Rear Bumper Mud Shield Clips	new	\$6.50	\$52.00	+
45	1	Rear End Panel	Distorted		\$972.40	685
46	1	Rear End Panel Top Garnish	2 new		\$374.75	✓
47	1	Rear Floor Panel	Repair		\$1,218.75	+
48	1	Rear Floor Panel Top Cover (Nett)	cracked		\$980.00	380(SN)
49	1	Rear Floor Panel Top Trime	new		\$589.90	+
50	1	Rear Floor Panel Inner Garnish	2 new		\$371.85	✓
51	1	Rear Floor Panel Sealant	new		\$450.00	+
52	1	Rear Seat Cushion Assy	new		\$3,500.00	+
53	2	Rear Fender	Repair	\$972.40	\$1,944.80	+
54	2	Rear Fender Inner Trime Board	2 new	\$784.40	\$1,568.80	✓
55	2	Rear Fender Inner Top Trime Board	new	\$781.40	\$1,562.80	+
56	2	Rear Fender Inner Panel	Repair	\$581.90	\$1,163.80	+
57	2	Rear Fender Housing	Repair	\$972.45	\$1,944.90	+
58	2	Rear Fender Inner Seat Belt	3 new	\$58.40	\$116.80	+
59	2	Rear Fender Glass Assy	3 new	\$972.80	\$1,945.60	+
60	2	Rear Fender Air-Duct	new	\$181.85	\$363.70	+
61	1	Rear Roof Top	Repair		\$1,712.45	+
62	1	Rear Roof Top Cushion	new		\$3,500.00	+
63	2	Rear Roof Top Side Moulding	new	\$281.90	\$563.80	+
64	1	Rear Exhaust	3 new		\$1,081.45	+
65	1	Rear Center Exhaust	new		\$740.60	+
66	1	Rear In-Car Video Camera (S.Nett)	damaged		\$800.00	380(SN)

1293465 SN: 2330 Subtotal:- \$49,212.22

8700.98

Labour charges

To remove &amp; refit cushion

~~\$380.00~~ 80

To wash cushion

~~\$300.00~~ X

To remove &amp; refit reverse sensor

~~\$120.00~~ 60

To remove &amp; refit petrol tank

~~\$280.00~~ X

To remove &amp; refit rear windscreen

~~\$120.00~~ ✓

Gum

~~\$50.00~~ ✓

To remove &amp; refit fender glass

~~\$240.00~~ X

Gum

~~\$100.00~~ X

To remove &amp; refit roof top glass

~~\$240.00~~ X

Gum

~~\$100.00~~ X

To remove &amp; refit rear &amp; center exhaust

~~\$380.00~~ X

To check wiring

~~\$150.00~~ 30

To reset computer

~~\$280.00~~ X

Tuff kote

~~\$150.00~~ 80

Towing fee

~~\$100.00~~ 60

Panel beating

~~\$3,000.00~~ 1200

Spray painting

~~\$3,500.00~~ 1000

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Subtotal:- \$9,490.00Total:- \$58,702.22 73,470.22

Supplementary: 1819.50

Total: 17822.23

H/S: 14.21K

09 Days

14.21K



# SM AUTOMOTIVE

Block C, 1 Kaki Bukit Avenue 6 #01-43 Singapore 417883

Email: SM\_AUTOMOTIVE@HOTMAIL.COM

Tel: (65) 6747 9241 Fax: (65) 6741 7276

RCB No.: 53231488C

CHAN YOONG YUAN

07/11/2019

Blk 1 Kaki Bukit Ave 6

# 01-43

Singapore

Accident date: 07/11/2019

Supplementary cost for vehicle no: SJL1919L TOYOTA ESTIMA AERAS 2.4A '08

S/N	Qty	Items	U/price	Amount
1	1	Rear Seat Bracket <i>Bent.</i>		\$986.00 ✓
2	1	Rear Seat Cover		\$329.00 +
3	2	Mosconi 100.4	\$1,650.00	\$3,300.00 +
4	1	Mosconi 200.2 <i>new</i>		\$1,588.00 +
5	1	D2 Processor		\$1,788.00 +
6	1	Ciare M		\$880.00 +
7	1	Sub Woofer		\$600.00 +
8	1	Sub Woofer Box		\$480.00 +
9	1	Audio Cable Set		\$550.00 +
10	1	Air Con Blower, <i>canceled</i>		
Subtotal:-				\$10,501.00

2975  
2231.25

1989 ✓

## Labour charges

To remove & refit rear seat assy

880 ~~\$280.00~~ 180

To remove & refit audio assembly

~~\$500.00~~ 200

To perform audio setting & tuning system

~~\$1,500.00~~ 500

Subtotal:- \$2,280.00

Total:- \$12,781.00

Supplementary: 3111.25





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

ALLIED WORLD ASSURANCE COMPANY LTD

Ref : CS/AWA19019827/Avf3n2

(SINGAPORE BRANCH)  
60 ANSON ROAD #08-01 (8th FLOOR)  
MAPLETREE ANSON  
SINGAPORE 079914

Date : 15-01-2020



Code : AWA

### 1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBD 9718J	Veh. Inspected	SJL 1919L
Policy No.	AVCPSPB0082661903	Coverage (\$)	0.00
Claim No.	NSV1900551/KW	Excess (\$)	0.00
Assign From	STELLA GOH	Assign Date	08/11/2019

### 2. Vehicle Particulars & Condition

Make & Model	TOYOTA ESTIMA	c.c	2362
Engine No.	HIDDEN	Year of Reg.	2008
Chassis No.	ACR500075920	Colour	WHITE
Odometer	276124	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

### 3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	245/40 R19	MICHELIN	6 mm
L/H Front Tyre	245/40 R19	MICHELIN	6 mm
R/H Rear Tyre	245/40 R19	MICHELIN	6 mm
L/H Rear Tyre	245/40 R19	MICHELIN	6 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--

### 5. General Information

Accident Date	07/11/2019	Inspection Date	08/11/2019
Survey held at	SM AUTOMOTIVE BLK C, 1 KAKI BUKIT AVENUE 6 #01-43 SINGAPORE 417883		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	9 Working Days
-------------------------------------	----------------



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJL 1919L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>REPLACEMENT OF PARTS</b>			
1	REAR BOOT LID	DISTORTED	1,592.50	1,592.50
2	REAR BOOT LID HINGE @\$181.90	NOT NECESSARY	363.80	-
2	REAR BOOT LID SHOCK ABSORBER @\$209.10	NOT NECESSARY	418.20	-
1	REAR BOOT LID EMBLEM LOGO	NECESSARY	66.10	66.10
1	REAR BOOT LID ESTIMA LOGO	NECESSARY	70.10	70.10
1	REAR BOOT LID AERAS LOGO	NECESSARY	68.80	68.80
1	REAR BOOT LID CENTER MOULDING	CRACKED	289.10	289.10
6	REAR BOOT LID CENTER MOULDING CLIPS @\$6.50	NECESSARY	39.00	10.00
1	REAR BOOT LID NUMBER PLATE	NOT NECESSARY	50.00	-
2	REAR BOOT LID NUMBER PLATE LAMP @\$121.10	NOT NECESSARY	242.20	-
2	REAR BOOT LID SIDE REFLECTOR @\$287.70	CRACKED	575.40	575.40
1	REAR BOOT LID CENTER REFLECTOR	CRACKED	281.90	281.90
1	REAR BOOT LID WIPER	CUT	122.25	122.25
1	REAR BOOT LID WIPER ARM	CUT	181.90	181.90
1	REAR BOOT LID WIPER ARM COVER	CUT	122.35	35.00
1	REAR BOOT LID WIPER MOTOR	DAMAGED	581.95	581.95
1	REAR BOOT LID INNER LOCK	DAMAGED	588.90	398.00
1	REAR BOOT LID INNER LOCK MOTOR	NOT NECESSARY	581.85	-
1	REAR BOOT LID INNER TRIM BOARD	CRACKED	781.90	645.00
1	REAR BOOT LID INNER RUBBER	CUT	374.90	374.90
2	REAR BOOT LID TOP SIDE TRIM BOARD @\$643.00	NOT NECESSARY	1,286.00	-
1	REAR BOOT LID TOP CENTER TRIM BOARD	NOT NECESSARY	220.60	-
1	REAR BOOT LID WINDSCREEN	SHATTERED	911.80	911.80
1	REAR BOOT LID WINDSCREEN MOULDING TOP	NECESSARY	181.40	181.40
1	REAR BOOT LID WINDSCREEN MOULDING LOWER	NECESSARY	172.40	172.40
2	REAR BOOT LID WINDSCREEN MOULDING SIDE @\$172.45	NECESSARY	344.90	344.90
1	REAR BOOT LID INNER HANDLE COVER	NOT NECESSARY	132.25	-
2	REAR BOOT LID INNER SIDE STOPPER RUBBER @\$28.50	NOT NECESSARY	57.00	-
2	REAR TAIL LAMP @\$408.10	N/S CUT / O/S CRACKED	816.20	816.20
2	REAR TAIL LAMP PANEL @\$372.75	O/S DENTED	745.50	372.75
2	REAR TAIL LAMP INNER PANEL LOWER @\$591.60	TO REPAIR SEE LABOUR	1,183.20	-

Report Ref No. CS/AWA19019827/Avf3n2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR TAIL LAMP INNER PANEL UPPER @\$289.10	TO REPAIR SEE LABOUR	578.20	-
1	REAR BUMPER	DISTORTED	1,077.10	822.00
2	REAR BUMPER SIDE RETAINER OUTER @\$182.20	NECESSARY	364.40	364.40
2	REAR BUMPER SIDE RETAINER INNER @\$131.35	NECESSARY	262.70	262.70
10	REAR BUMPER CLIPS @\$6.50	NECESSARY	65.00	30.00
2	REAR BUMPER LED SIDE REFLECTOR @\$181.40	CRACKED	362.80	362.80
2	REAR BUMPER MUD SHIELD @\$181.40	NOT NECESSARY	362.80	-
8	REAR BUMPER MUD SHIELD CLIPS @\$6.50	NOT NECESSARY	52.00	-
1	REAR END PANEL	DISTORTED	972.40	685.00
1	REAR END PANEL TOP GARNISH	DEFORMED	374.75	374.75
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	1,218.75	-
1	REAR FLOOR PANEL TOP TRIME	NOT NECESSARY	589.90	-
1	REAR FLOOR PANEL INNER GARNISH	DEFORMED	371.85	371.85
1	REAR FLOOR PANEL SEALANT	NOT NECESSARY	450.00	-
1	REAR SEAT CUSHION ASSY	NOT NECESSARY	3,500.00	-
2	REAR FENDER @\$972.40	TO REPAIR SEE LABOUR	1,944.80	-
2	REAR FENDER INNER TRIME BOARD @\$784.40	DEFORMED	1,568.80	1,568.80
2	REAR FENDER INNER TOP TRIME BOARD @\$781.40	NOT NECESSARY	1,562.80	-
2	REAR FENDER INNER PANEL @\$581.90	TO REPAIR SEE LABOUR	1,163.80	-
2	REAR FENDER HOUSING @\$972.45	TO REPAIR SEE LABOUR	1,944.90	-
2	REAR FENDER INNER SEAT BELT @\$58.40	NOT NECESSARY	116.80	-
2	REAR FENDER GLASS ASSY @\$972.80	NOT NECESSARY	1,945.60	-
2	REAR FENDER AIR-DUCT @\$181.85	NOT NECESSARY	363.70	-
1	REAR ROOF TOP	TO REPAIR SEE LABOUR	1,712.45	-
1	REAR ROOF TOP CUSHION	NOT NECESSARY	3,500.00	-
2	REAR ROOF TOP SIDE MOULDING @\$281.90	NOT NECESSARY	563.80	-
1	REAR EXHAUST	NOT NECESSARY	1,081.45	-
1	REAR CENTER EXHAUST	NOT NECESSARY	740.60	-
1	REAR SEAT BRACKET (ADDITIONAL)	BENT	986.00	986.00
1	REAR SEAT COVER (ADDITIONAL)	NOT NECESSARY	329.00	-
2	MOSCONI 100.4 @\$1650.00 (ADDITIONAL)	NOT NECESSARY	3,300.00	-
1	MOSCONI 200.2 (ADDITIONAL)	NOT NECESSARY	1,588.00	-

Report Ref No. CS/AWA19019827/Avf3n2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	D2 PROCESSOR (ADDITIONAL)	NOT NECESSARY	1,788.00	-
1	CIARE M (ADDITIONAL)	NOT NECESSARY	880.00	-
1	SUB WOOFER (ADDITIONAL)	NOT NECESSARY	600.00	-
1	SUB WOOFER BOX (ADDITIONAL)	NOT NECESSARY	480.00	-
1	AUDIO CABLE SET (ADDITIONAL)	NOT NECESSARY	550.00	-
1	AIR CON BLOWER (ADDITIONAL)	CRACKED	1,989.00	1,989.00
	LESS 25% DISCOUNT		-	-3,977.41
			54,746.50	11,932.24
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	REAR BOOT LID OUTER HANDLE SWITCH (SN)	NOT NECESSARY	561.72	-
1	REAR BOOT LID TOP SPOILER (SN)	CRACKED	1,800.00	750.00
1	REAR BOOT LID REVERSE CAMERA (SN)	DAMAGED	680.00	350.00
4	REAR BUMPER REVERSE SENSOR (SN)	DAMAGED	1,920.00	350.00
2	REAR BUMPER LED LIGHT @\$107.00 (SN)	NECESSARY	214.00	120.00
1	REAR FLOOR PANEL TOP COVER (SN)	CRACKED	980.00	380.00
1	REAR IN-CAR VIDEO CAMERA (SN)	DAMAGED	800.00	380.00
1	GUM (SN)	NECESSARY	250.00	50.00
			7,205.72	2,380.00
	<b><u>LABOUR</u></b>			
	TO REMOVE & REFIT CUSHION.		380.00	80.00
	TO WASH CUSHION.	NOT NECESSARY	300.00	-
	TO REMOVE & REFIT REVERSE SENSOR.		120.00	60.00
	TO REMOVE & REFIT PETROL TANK.	NOT NECESSARY	280.00	-
	TO REMOVE & REFIT REAR WINDSCREEN.		120.00	120.00
	TO REMOVE & REFIT FENDER GLASS.	NOT NECESSARY	240.00	-
	TO REMOVE & REFIT ROOF TOP GLASS.	NOT NECESSARY	240.00	-
	TO REMOVE & REFIT REAR & CENTER EXHAUST.	NOT NECESSARY	380.00	-
	TO CHECK WIRING.		150.00	30.00
	TO RESET COMPUTER.	NOT NECESSARY	280.00	-
	TUFF KOTE.		150.00	80.00
	TOWING FEE.		100.00	60.00
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR TAIL LAMP INNER PANEL LOWER,REAR TAIL LAMP INNER PANEL UPPER,REAR FLOOR PANEL,REAR FENDER,REAR FENDER INNER PANEL,REAR FENDER HOUSING AND REAR ROOF TOP.		3,000.00	1,200.00

Report Ref No. CS/AWA19019827/Avf3n2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	SPRAY PAINTING.		3,500.00	1,000.00
	TO REMOVE & REFIT REAR SEAT ASSY (ADDITIONAL).		280.00	180.00
	TO REMOVE & REFIT AUDIO ASSEMBLY (ADDITIONAL).		500.00	200.00
	TO PERFORM AUDIO SETTING & TUNNING SYSTEM (ADDITIONAL).		1,500.00	500.00
			11,520.00	3,510.00
<b>GRAND TOTAL</b>			<b>73,472.22</b>	<b>17,822.24</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>14,200.00</b>

Report Ref No. CS/AWA19019827/Avf3n2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.