

ASS. REC. BY:

Surveyor: Kenneth

REP:

08/INC19020495/Ky d3 ⁿ²

Special Instructions:

ASSIGNMENT (Office)

From (Person): Haroldysa Bt Bonhim

of INC

Date/Time: 9:50am 3/19/11/19

Estimated Cost: _____ Bill to: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SLK 7414T

Insured: SHD 2002R

at Workshop n/a: Estem Performance

Tel: 879m 0066

of 385 Bin Ming Drive

Policy No: _____ Claim No: MT/1071763-001

Sum Insured: _____ Excess: _____

Make of Veh: _____ D.O.A. 15/11/2019
(Client's Record)

CA / REV / REP. / REV 24 HRS H.O.D. Endorsement: _____

Date/Time: 10:06am 14/11/19 Person Contacted: Carman

Vehicle IN / OUT

Date/Time	Action/Instruction
	<u>SLK 7414T - X</u>
	<u>SHD 2002R - 003/11/11/3015852/KSA302</u>
	<u>D.O.A. 26/05/2013</u>

ASS. REC. BY:

REF: INC /

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

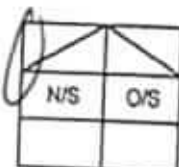

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

04 days

Res.: Yes or No

Lum Sum:

1.31 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SLK 7414T

Yr Regn:

01, 17

Type: M.Cat / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Prius

c.c.

1798

Colour:

M. Silver

A/C:

Insured / Std / NI / NA

Sp. Reading

222.885

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

JTDKB3FU 703540507

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F:

195/65R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal.

9

mm

R/Bal.

9

mm

L/Bal.

9

mm

L/Bal.

9

mm

D.O.A.

13/11/18

D.O.I.

19/11/19

Survey held at

10.37

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S 15m

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1 File pass to

29/11/19 PIP \$ 4770-33 (Red \$ 4396-69, 47%)

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

29/11/19 Typist

Days Of Repair:

4

Resurvey No. of Trip:

1

Survey Fee:

Transportation:

\$ - P.S. - SI

Fuel

Others

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

Lump Sum / I.B.I. (\$

PIP \$ 4770-33

TOTAL

250

Nivitha (LKK Auto)

From: Hazalya Binte Ibrahim <hazalya.ibrahim@income.com.sg>
Sent: Tuesday, 19 November 2019 3:26 PM
To: Admin-D (LKKAuto); assignments
Cc: Hazalya Binte Ibrahim
Subject: RE: TP CASES FARMED OUT TO LKK ON 19/11/2019

Dear LKK,

Re-send with details.

Thank you.

Warmest Regards

Hazalya Bte Ibrahim
Admin Assistant
Operations, Motor & Personal Lines (PL)
www.income.com.sg

income
made different



At Income, we are 'In with You' on Performance, Growth, Innovation and Impact. These attributes reflect what we promise as an employer and what we want our people to exemplify.
Find out more at income.com.sg/careers

in with you

From: Hazalya Binte Ibrahim
Sent: Tuesday, 19 November 2019 9:52 AM
To: Admin-D (LKKAuto) <admin-d@lkkauto.com>; assignments <assignments@lkkauto.com>
Cc: Alice Low <alice.lowkc@income.com.sg>
Subject: TP CASES FARMED OUT TO LKK ON 19/11/2019

Dear LKK,

Please assist to survey the following vehicles as per Mr Teng's instruction :-

SN	OIC	Claim No.	Vehicle	WorkShop Name	WorkShop Address	WorkShop Contact	Survey Time	QI VEH	DOA	Additional Remarks
1	Serene Lim	MT/1071694-002	SLR1040R	LION CITY RENTALS PTE LTD	60 JALAN LAM HUAT #04-01 CARROS CENTRE SINGAPORE 737869	S.T.Sim / 97422188		SLP73441	16/11/19	
2	Eng Huey Huey	MT/1071605-001	SLD8452M	LION CITY RENTALS PTE LTD	60 JALAN LAM HUAT #04-01 CARROS CENTRE SINGAPORE 737869	S.T.Sim / 97422188		SJN69858	15/11/19	
3	Serene Lim	MT/1071721-001	SLF9471R	LION CITY RENTALS PTE LTD	60 JALAN LAM HUAT #04-01 CARROS CENTRE SINGAPORE 737869	S.T.Sim / 97422188		PC601K	15/11/19	
4	Azhari	MT/1071695-002	SLL3057L	LION CITY RENTALS PTE LTD	60 JALAN LAM HUAT #04-01 CARROS CENTRE SINGAPORE 737869	S.T.Sim / 97422188		SLZ3659B	15/11/19	
5	Eng Huey Huey	MT/1071993-001	SLA1405J	OPTIMA WERKZ PTE LTD	9A SERANGOON NORTH AVE 5	Sharon Tan / 6481 1522		SJLJ5625K	17/11/19	avoid 1PM - 2PM
6	Wo Jessie	MT/1071949-001	SHC3281A	SOON HOCK MOTOR PTE LTD	10 ANG MO KIO IND PK 2-A #01-05/06 AMK AUTOPOINT SINGAPORE 568047	Lynn or Ms Irene / 65425119		SLN9343K	16/11/19	65425119 or 6542 7162
7	Quek Swee Keng	MT/1071863-002	SHD3009R	SOON HOCK MOTOR PTE LTD	10 ANG MO KIO IND PK 2-A #01-05/06 AMK AUTOPOINT SINGAPORE 568047	Lynn or Ms Irene / 65425119		SMK5648L	16/11/19	65425119 or 6542 7162
8	Quek Swee Keng	MT/1071765-002	SHA7757D	SOON HOCK MOTOR PTE LTD	10 ANG MO KIO IND PK 2-A #01-05/06 AMK AUTOPOINT SINGAPORE 568047	Lynn or Ms Irene / 65425119		SJN48232	16/11/19	65425119 or 6542 7162
9	Serene Lim	MT/1070016-002	EW3366U	TROPICAL SUCCESS AUTO CARE	BLK 5032 #01-299/303 ANG MO KIO INDUSTRIAL PARK 2 SINGAPORE 569535	Calvin / 64817773		SLG4655E	05/11/19	
10	Muhammad Airwan	MT/1071969-001	YP9666P	WENG KEE MOTOR	BLK 1019 #01-366 YISHUN INDUSTRIAL PARK A	Victor Wong Qi Zhi / 6854 1273 / 8182 1895		SJL9527G	07/11/19	
11	Jeff Lin	MT/1071637-002	SGK775G	AT AUTO CONSULTANT	BLK 01 SIN MING INDUSTRIAL ESTATE	Alan Tan / 8386989		SKD8863Y	15/11/19	

Warmest Regards

Hazalya Bte Ibrahim
Admin Assistant
Motor Department
T +65 6430 7902
www.income.com.sg



in with
you

At Income, we are 'In with You' on Performance, Growth, Innovation and Impact. These attributes reflect what we promise as an employer and what we want our people to exemplify.

Find out more at Income.com.sg/careers

PLEASE CONSIDER OUR ENVIRONMENT BEFORE YOU PRINT THIS EMAIL...

Disclaimer

This e-mail contains privileged or confidential information which is intended only for the use of the recipient(s) named above. If you have received this message in error, please notify the sender immediately and delete all copies of it. Thank you.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	16/11/2019 14:20
Date Of Accident	15/11/2019 22:35
Exact Location Of Accident	ALONG STILL ROAD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLK7414T
Insured/Policyholder	
Name Of Registered Owner	GRAB RENTALS PTE LTD
Co Reg No	201617200G
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-31388644
Vehicle Particulars	
Manufacturer	TOYOTA
Model	PRIUS-1.8 HYBRID CVT (A)
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE HIRE

Insurance Company

Name of Insurance Company	MSIG INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	YES
Policy Number	A29114756MKF
Cover Note Number	

Driver

Name of Driver	PHUA YONG SENG
NRIC No	S0174328G
Date Of Birth	02/08/1954
Occupation	OUTDOOR
Date Of Driving Pass	17/12/1980
Driving Experience	38 YEARS AND 10 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-97933302
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address BLK 736 YISHUN ST 72 #05-63
 Postcode 760736
 Was driver an employee of the Insured's Company NO
 If No, Relationship of the Driver with the Insured OTHER - LESSEE
 Vehicle Registration Number of Driver's Own Vehicle -
 -
 -
 Insurance Company of Driver's Own Vehicle -
 -
 -

General Information of the Accident

Type Of Accident COLLISION - CHANGE/CROSS LANE
 Weather Conditions CLEAR
 Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO
 Number of vehicles (including own vehicle) Involved in the accident 2
 Was any body injured in the Accident? NO
 Was any injured conveyed to hospital by ambulance?
 Was any other material or property damaged? YES
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
 Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? YES
 If Yes, Please state which Police Station
 Police Station Name YISHUN NORTH NEIGHBOURHOOD POLICE CENTRE
 Police Station Address ROAD: 31 YISHUN CENTRAL , POSTCODE: 768827 , COUNTRY: SINGAPORE
 Police Station Contact TEL NO: 1800-8529999 - FAX NO: 68522299
 Was notice of intended Prosecution given? NO
 If Yes, against whom?

Circumstances of Accident

REFER TO POLICE REPORT NO. T/20191116/2027

Attachment(s)

Are accident photos available for attachment? YES
 Was there any video captured by Car Camera? NO
 Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SHD2002R
 Vehicle Make/Model/Colour
 Details Of Properties VEH B
 Vehicle Category TAXI
 Name of Driver TAN KAI HUAT
 NRIC/Passport Number
 Contact Number 96972727
 Address
 Postcode
 Insurance Company Name
 Nature Of Damage

No. Of Passenger (Including Driver)

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
- (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature
Date & Time:

✓ *AK*
Driver's Signature
(If driver is not the policyholder)
Date & Time:


16/11/19 11am

Hay
Reporting Centre Personnel's Signature
Name:
NRIC/PIN No.:

Jerry Ng

Sketch Plan #2

SKETCH PLAN

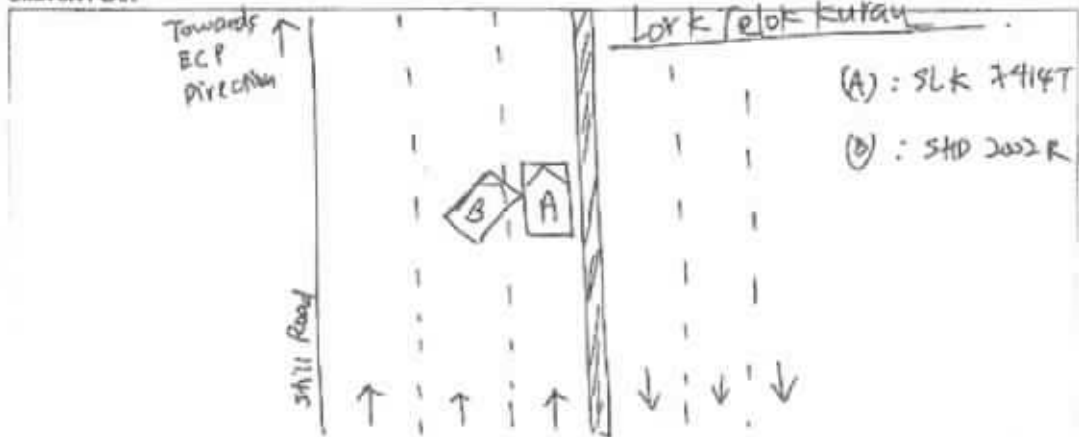

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Please refer to police Report : T/2019.1116/2027

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(if driver is not the policyholder)
Date & Time:

Date & Time: 16/11/19 11am.

Reporting Centre Personnel's Signature
Name: Jenny Ng
NRIC/PIN No.:

Police Report



**SINGAPORE
POLICE FORCE**



T/20191116/2027

1 of 3

Report No. T/20191116/2027

Police Station Of Origin:
Yishun North N.P.C
31 Yishun Central SINGAPORE 768827
Tel No: 1800-8529999

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 16/11/2019 09:38		Vide Report No.:		Station Diary No.: 21	
Informant's Particulars					
Name of Informant: PHUA YONG SENG			Address: APT BLK 736 YISHUN STREET 72 #05-63 SINGAPORE 780736		
ID Type / ID No.: NRIC NO / S0174328G			Contact No.: Home/Office:		Mobile: 97933302
Nationality: SINGAPORE CITIZEN			Email:		
Sex: Male	Age: 65	Date of Birth: 02/08/1954	Type of Informant: Driver		
Race: Chinese			Language:		Institution / School Name:
Occupation: GRAB DRIVER			Driving Licence Information: Class: 2B,3		Date of Expiry:

General Information of the Accident

Type of Accident:	Non-Injury Others	Drink Drive: No	Date/Time of Accident: 15/11/2019 22:35	Type of Location: Straight Road
Location: Junction of Road 1 and Road 2 STILL ROAD LORONG K TELOK KURAU Travelling Along Still Rd Towards ECP before junction of Lorong K Telok Kurau				
Weather: Clear		Road Surface: Dry	Road Speed Limit:	
Traffic Flow: One Way		Traffic Control: Not Controlled	Traffic Volume: Light	
Type of Collision: Between Moving Vehicles - Side Swipe - Same Direction			Anyone conveyed by ambulance: No	

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
SHD2002R	Car				Slightly Damaged	0
SLK7414T	Car				Seriously Damaged	0

Details of Person Involved

Any Pedestrian Involved: No	
No. of Pedestrians Injured: NIL	Use of Pedestrian Crossing: NA

Police Report



**SINGAPORE
POLICE FORCE**



T/20191116/2027

2 of 3

Report No. T/20191116/2027

Police Station Of Origin:
Yishun North N.P.C
31 Yishun Central SINGAPORE 768827
Tel No: 1800-8529999

CONTINUATION OF REPORT

Driver				
Name	TAN KAI HUAT		ID No.	NIL
Related Vehicle	SHD2002R (Car)		Contact No.	96972727
Hospital/Clinic	NIL		Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL	
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL	
Driver				
Name	PHUA YONG SENG		ID No.	S0174328G
Related Vehicle	SLK7414T (Car)		Contact No.	97933302
Hospital/Clinic	NIL		Class of Driving Licence & Expiry Date	Class: 2B,3 Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL	
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL	

Brief Details.

On 15/11/2019 at about 2235hrs, I was driving the vehicle SLK7414T as a Grab Driver along Still Road towards the direction of ECP. I was travelling in Lane 1 and before the junction of Lorong K Telok Kurau and then the vehicle SHD2002R (Prime Taxi) suddenly cut in from lane 2 to lane 1 in front of me. While cutting in, the right rear of SHD2002R hit into the left front part of my vehicle SLK7414T. After hitting my vehicle, the vehicle SHD2002R quickly returned back to lane 2. No one was injured. My vehicle SLK7414T suffered dents and scratches to its left front bumper and left front side with the chassis at this area opened up which I used tape to put back into place later on. I think the other vehicle SHD2002R suffered scratches to its right rear side and bumper.

I am lodging this report to submit to my company for insurance purpose.

Police Report



SINGAPORE
POLICE FORCE

Police Station Of Origin:
Yishun North N.P.C
31 Yishun Central SINGAPORE 768827
Tel No: 1800-8529999



7/20191116/2027

3 of 3

Report No. 7/20191116/2027

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording This Report:

L /
SI LIM KAI SHEN, LUCIUS

Signature Of Interpreter:
Not applicable

Officer In Charge Of Case:
TP / GIA /
Staff Sgt WONG SIEU LUI
Contact No.: 65476151

Signature Of Informant:

Date/Time:
16/11/2019 09:38

Classification Of Case

Authentication Stamp
NP158



Signature

ST-001

Singapore Police Force



ESTEEM PERFORMANCE PTE LTD

Blk 5033 Ang Mo Kio, Ind Park 2 #01-251/ 259, 569536.
Tel: +65-6484 1221 Fax: +65-6484 7829 Website: www.esteemperf.com.sg

Repair Estimates

SLK 7414 T

*Not Authorized
Running Repair*

LKK Auto Consultants hereby notify the Repairer of the following:

- To resurvey before start spray painting
- To display damaged portion using resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Final Pre-paint" basis
- No illegal modification is allowed
- Supplementary items must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature: _____
Date: _____

Parts	(a) Cost / List Price Items	\$	8,596.03
	Plus/Less 25%	\$	2,149.01
	Total of Cost / List	\$	6,447.02
	(b) Nett Price Items		
	Less		
	Total of Nett Item		
	(c) Special Nett Items		
Total Parts Cost		\$	6,447.02
Labour		\$	2,720.00
Total		\$	9,167.02

The above total will be subjected to 7% G.S.T.

Name of Surveyor

:

Kenneth

Company

:

LKK

Survey conducted on

:

19/11/19

at

10:40 -

Remarks By Surveyor

(a) The repair of this vehicle is *authorized* / is not authorized until further notice.

(b) Recommended Days of Repair : *04* day(s)

(c) Resurvey : Required / *Not Required*

(d) Excess : \$ _____

(e) Signature of surveyor

:

Sc

Date:

19/11/19



ESTEEM PERFORMANCE PTE LTD

Blk 5033 Ang Mo Kio, Ind Park 2 #01-251/ 259, 569536.
Tel: +65-6484 1221 Fax: +65-6484 7829 Website: www.esteemperf.com.sg

Spare Parts

Vehicle No. : **SLK 7414 T**
Make & Model : **TOYOTA PRIUS**
Chassis No. : **JTDKB3FU703540507**

Submit By : **JENNY**
Year Manufacture : **2016**
Engine No. :

Cost / List

S/No.	Part Description	Qty	Unit Price	Price	Disposition by Surveyor
1	Front support panel centre R	1	\$338.50		X
2	Front support panel LH R	1	\$213.50		X
3	Headlamp panel LH	1	\$89.20		?
4	Headlamp LH CM	1	\$2,531.60		✓
5	Front bumper BULLUM	1	\$450.80		✓
6	Front bumper clip M	10	\$40.00		✓
7	Front bumper reinforcement - upper R	1	\$711.50		X
8	Front bumper side retainer RH S	1	\$107.20		X
9	Front bumper side retainer LH CM	1	\$107.20		✓
10	Front bumper upper grille S	1	\$321.90		X
11	Front bumper lower grille S	1	\$148.60		X
12	Front bumper tow cover LH S	1	\$25.70		X
13	Front bumper sponge - upper S	1	\$89.81		X
14	Fog lamp LH M3 CM	1	\$910.70		✓
15	LH front fender R	1	\$868.70		✓
16	LH front fender undershield CM	1	\$195.60		✓
17	LH front fender undershield clip M	10	\$25.00		✓
18	LHF fender wording "HYBRID" M	1	\$44.17		✓
19	LH front fender quarter garnish	1	\$122.70		?
20	LH front hub cab S	1	\$195.65		X
21	Bonnet R	1	\$812.40		X
22	Bonnet lock R	1	\$130.00		X
23	Bonnet hinge LH R	1	\$57.80		X

Note: If any of the quoted parts are recommended to be repaired, then an additional labour charge will be charged accordingly under supplementary.

Spare Parts

Vehicle No. :	SLK 7414 T	Submit By :	Carmen Lim
Make & Model :	TOYOTA PRIUS	Year Manufacture :	2016
Chassis No. :	JTDKB3FU703540507	Engine No. :	

Cost / List

S/No.	Part Description	Qty	Unit Price	Price	Disposition by Surveyor
24	Bonnet hinge RH	1	\$57.80		X
25					
26					
27					
28					
29					
30					
31					
32					
33					
34					
35					
36					
37					
38					
39					
40					
41					
42					
43					
44					
45					
46					

Note: If any of the quoted parts are recommended to be repaired, then an additional labour charge will be charged accordingly under supplementary.

Note: The above estimate of repair is based on visual assessment of the external affected areas. Any additional damages observed during the course of repair will be quote accordingly as a supplementary.



ESTEEM PERFORMANCE PTE LTD

Blk 5033 Ang Mo Kio, Ind Park 2 #01-251/250, 569536.
Tel: +65-6484 1221 Fax: +65-6484 7829 Website: www.esteemperf.com.sg

Repair Estimates

SLK 7414 T

Finalised

Parts (a) Cost / List Price Items	\$ 5173.77	8,596.03
Plus/Less 25%	\$ 1293.44	2,149.01
Total of Cost / List	\$ 3780.33	6,447.02
(b) Nett Price Items		
Less		
Total of Nett Item		
(c) Special Nett Items		
al Parts Cost	\$	6,447.02
our	\$ 890.00	2,720.00
il	\$ 4770.33	9,167.02

Not authorized
Paying B4pain

above total will be subjected to 7% G.S.T.

Name of Surveyor : Kenneth
Company : C14C
Survey conducted on : 19/11/19 at 10:40 ~

Remarks By Surveyor

The repair of this vehicle is ☒ authorized / is not authorized until further notice.

Recommended Days of Repair : 04 day(s)

Resurvey : Required / Not Required ☒

Excess \$

Signature of surveyor : [Signature] Date: 19/11/19



ESTEEM PERFORMANCE PTE LTD

Blk 5033 Ang Mo Kio, Ind Park 2 #01-251/ 259, 569536.
Tel: +65-6484 1221 Fax: +65-6484 7829 Website: www.esteemperf.com.sg

ipare Parts

Vehicle No. : SLK 7414 T
Make & Model : TOYOTA PRIUS
Chassis No. : JTDKB3FU703540507

Submit By : JENNY
Year Manufacture : 2016
Engine No. :

Cost / List

/No.	Part Description	Qty	Unit Price	Price	Disposition by Surveyor
1	Front support panel centre R	1	\$338.50		X
2	Front support panel LH R	1	\$213.50		X
3	Headlamp panel LH R	1	\$89.20		X
4	Headlamp LH CM	1	\$2,531.60		✓
5	Front bumper Bumper	1	\$450.80		✓
6	Front bumper clip M	10	\$40.00		✓
7	Front bumper reinforcement - upper R	1	\$711.50		X
8	Front bumper side retainer RH L	1	\$107.20		X
9	Front bumper side retainer LH CM	1	\$107.20		✓
10	Front bumper upper grille L	1	\$321.90		X
11	Front bumper lower grille L	1	\$148.60		X
12	Front bumper tow cover LH L	1	\$25.70		X
13	Front bumper sponge - upper L	1	\$89.81		X
14	Fog lamp LH M & M	1	\$910.70		✓
15	LH front fender R	1	\$868.70		✓
16	LH front fender undershield CM	1	\$195.60		✓
17	LH front fender undershield clip M	10	\$25.00		✓
18	LHF fender wording "HYBRID" R	1	\$44.17		✓
19	LH front fender quarter garnish L	1	\$122.70		X
20	LH front hub cap L	1	\$195.65		X
21	Bonnet R	1	\$312.40		X
22	Bonnet lock R	1	\$130.00		X
23	Bonnet hinge LH R	1	\$57.80		X

te: If any of the quoted parts are recommended to be repaired, then an additional labour charge
be charged accordingly under supplementary.

5033 Ang Mo Kio Industrial Park 2 #01-259 Singapore 569536 Tel: 64841221 Fax: 64847829
Company Reg No. 200005485N / GST No. 20-0005485-N

5173.77

Car Parts

Vehicle No. :

SLK 7414 T

Submit By :

Carmen Lim

Make & Model :

TOYOTA PRIUS

Year Manufacture :

2016

Chassis No. :


JTDKB3FU703540507

Engine No. :

Cost / List

No.	Part Description	Qty	Unit Price	Price	Disposition by Surveyor
24	Bonnet hinge RH	1	\$57.80		X
25					
26					
27					
28					
29					
30					
31					
32					
33					
34					
35					
36					
37					
38					
39					
40					
41					
42					
43					
44					
45					
46					

If any of the quoted parts are recommended to be repaired, then an additional labour charge be charged accordingly under supplementary.



Vehicle No. : SLK 7414 T Submit By : Carmen Lim
Make & Model : TOYOTA PRIUS Year of Manufacture : 2016

Note: The above estimate of repair is based on visual assessment of the external affected areas. Any additional damages observed during the course of repair will be quote accordingly as a supplementary.

Scanned with CamScanner



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

DAMAGE ASSESSMENT REPORT

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: CS/INC19020495/Kyd3n2

73 BRAS BASAH ROAD
#05-01 NTUC TRADE UNION HOUSESINGAPORE
189556

Date: 02-12-2019



ATTN: HELENA TAN

Code: INC

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHD 2002R	Veh. Inspected	SLK 7414T
Policy No.		Coverage (\$)	0.00
Claim No.	MT/1071763-001	Excess (\$)	0.00
Assign From	HAZALYSA BINTI IBRAHIM	Assign Date	19/11/2019

2. Vehicle Particulars & Condition

Make & Model	TOYOTA PRIUS (A)	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	JTDKB3FU703540507	Colour	METALLIC SILVER
Odometer	222885 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	BRIDGESTONE	9 mm
L/H Front Tyre	195/65 R15	BRIDGESTONE	9 mm
R/H Rear Tyre	195/65 R15	BRIDGESTONE	9 mm
L/H Rear Tyre	195/65 R15	BRIDGESTONE	9 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION. DAMAGES SEE DETAILS.

5. General Information

Accident Date	15/11/2019	Inspect Date / Time	19/11/2019 (10:37 AM)
Survey held at	385 SIN MING DRIVE		
Repairer	ESTEEM PERFORMANCE PTE LTD		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	4 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLK 7414T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	FRONT SUPPORT PANEL CENTRE	TO REPAIR SEE LABOUR	338.50	-
1	FRONT SUPPORT PANEL LH	TO REPAIR SEE LABOUR	213.50	-
1	HEADLAMP PANEL LH	TO REPAIR SEE LABOUR	89.20	-
1	HEADLAMP LH	CRACKED	2,531.60	2,531.60
1	FRONT BUMPER	BUCKLED / CRACKED	450.80	450.80
10	FRONT BUMPER CLIP	NECESSARY	40.00	40.00
1	FRONT BUMPER REINFORCEMENT-UPPER	TO REPAIR SEE LABOUR	711.50	-
1	FRONT BUMPER SIDE RETAINER RH	SERVICEABLE	107.20	-
1	FRONT BUMPER SIDE RETAINER LH	CRACKED	107.20	107.20
1	FRONT BUMPER UPPER GRILLE	SERVICEABLE	321.90	-
1	FRONT BUMPER LOWER GRILLE	SERVICEABLE	148.60	-
1	FRONT BUMPER TOW COVER LH	SERVICEABLE	25.70	-
1	FRONT BUMPER SPONGE-UPPER	SERVICEABLE	89.81	-
1	FOG LAMP LH	MTG CRACKED	910.70	910.70
1	LH FRONT FENDER	BENT	868.70	868.70
1	LH FRONT FENDER UNDERSHIELD	CRACKED	195.60	195.60
10	LH FRONT FENDER UNDERSHIELD CLIP	NECESSARY	25.00	25.00
1	LHF FENDER WORDING "HYBRID"	NECESSARY	44.17	44.17
1	LH FRONT FENDER QUARTER GARNISH	SERVICEABLE	122.70	-
1	LH FRONT HUB CAB	SERVICEABLE	195.65	-
1	BONNET	TO REPAIR SEE LABOUR	812.40	-
1	BONNET LOCK	TO REPAIR SEE LABOUR	130.00	-
1	BONNET HINGE LH	TO REPAIR SEE LABOUR	57.80	-
1	BONNET HINGE RH	TO REPAIR SEE LABOUR	57.80	-

Report Ref No. CS/INC19020495/Kyd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 25% DISCOUNT		-2,149.01	-1,293.44
			6,447.02	3,880.33
	LABOUR			
	TO RENEW DAMAGED PARTS & KNOCK OUT ACCIDENT REPAIR AREA.(FRONT BUMPER,LHF FENDER,LH FRONT DOOR,BONNET,SUPPORT PANEL).INCLUSIVE OF THE REPAIR OF FRONT SUPPORT PANEL CENTRE,FRONT SUPPORT PANEL LH,HEADLAMP PANEL LH,FRONT BUMPER REINFORCEMENT-UPPER,BONNET,BONNET LOCK,BONNET HINGE LH AND BONNET HINGE RH.		1,000.00	400.00
	TO PUTTY,RESPRAY PAINT FOR AFFECTED ACCIDENT REPAIR AREA.(FRONT BUMPER,LHF FENDER,LH FRONT DOOR,BONNET,SUPPORT PANEL).		1,200.00	440.00
	TO CHECK WIRING & FOCUS HEADLAMP.		50.00	20.00
	TO REMOVE & REFIT RADIATOR,CONDENSER TO ASSIST WORK LOAD,TO TOP UP A/C GAS.	NOT NECESSARY	150.00	-
	TO DO WHEEL ALIGNMENT.	NOT NECESSARY	120.00	-
	TO TUFF COAT.		200.00	30.00
			2,720.00	890.00
	GRAND TOTAL		9,167.02	4,770.33
RECOMMENDED COST OF REPAIRS (CONFIRMED)				4,770.33

Report Ref No. CS/INC19020495/Kyd3n2

KONG SENG CHEONG

Licensed Appraiser

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,
MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.