



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

QBE INSURANCE (SINGAPORE) PTE LTD
1 RAFFLES QUAY #29-10 SOUTH TOWER
SINGAPORE 048583

INV No. AC2006529
INV Date 22/09/2020
Reference CC6/QBE19020956/Ada3q2
Code QBE



PROFESSIONAL SERVICE FEE

Vehicle No. GZ 2918U
Insured Veh. SKG 3427R
Claim No. VC013211
Policy No. 8-V0023551-MVA
Accident Date 20/11/2019
Inspection Date 25/11/2019

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
QBE INSURANCE (SINGAPORE) PTE LTD		Ref : CC6/QBE19020956/Ada3q2		
1 RAFFLES QUAY #29-10 SOUTH TOWERSINGAPORE 048583		Date : 22-09-2020		
		Code : QBE		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SKG 3427R	Veh. Inspected	GZ 2918U	
Policy No.	8-V0023551-MVA	Coverage (\$)	0.00	
Claim No.	VC013211	Excess (\$)	0.00	
Assign From		Assign Date	25/11/2019	
2. Vehicle Particulars & Condition				
Make & Model	SSANGYONG MUSSO	c.c	2874	
Engine No.	HIDDEN	Year of Reg.	2006	
Chassis No.	KPAWA2EDS6P414056	Colour	BLACK	
Odometer	351026	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	235/70 R16	YOKOHAMA	6 mm	
L/H Front Tyre	235/70 R16	YOKOHAMA	6 mm	
R/H Rear Tyre	235/70 R16	YOKOHAMA	6 mm	
L/H Rear Tyre	235/70 R16	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.				
DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	20/11/2019	Inspection Date	25/11/2019	
Survey held at	MG SOLUTION PTE LTD 23 KAKI BUKIT AVE 4 (SOUTH WING) #02-03B VICOM INSPECTION CENTRE, SINGAPORE 415933			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GZ 2918U

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	TAILGATE	DENTED	1,890.40	1,890.40
1	TAILGATE LOGO	NECESSARY	90.00	90.00
1	TAILGATE EMBLEM 'MUSSO'	NECESSARY	58.00	58.00
1	TAILGATE EMBLEM 'SPORT'	NECESSARY	60.30	60.30
1	TAILGATE LOCK	NOT NECESSARY	280.00	-
1	TAILGATE INNER TRIM	NOT NECESSARY	630.00	-
1	TAILGATE WEATHER STRIP	NOT NECESSARY	154.60	-
1	REAR BUMPER	DISTORTED	1,245.80	1,245.80
2	REAR BUMPER SIDE GARNISH @\$372.20	O/S DEFORMED	744.40	372.20
2	REAR BUMPER REFLECTOR @\$56.60	O/S CUT	113.20	56.60
1	REAR BUMPER STEP GARNISH	DEFORMED	295.80	295.80
1	REAR BUMPER STEP GARNISH TOP CHROME	BENT	379.40	379.40
1	TAILLAMP RH	CRACKED	420.00	420.00
1	TAILLAMP PANEL RH	TO REPAIR SEE LABOUR	152.30	-
1	TAILLAMP LOWER BRACKET	NOT NECESSARY	99.60	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	1,477.10	-
	LESS 10% DISCOUNT		-809.09	-486.85
			7,281.81	4,381.65
<u>SPECIAL NETT ITEMS</u>				
1	SET TAIL GATE INNER TRIM CLIPS (SN)	NOT NECESSARY	20.00	-
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	20.00	20.00
1	SET REAR BUMPER SIDE GARNISH CLIP (SN)	NECESSARY	20.00	20.00
1	SET REAR BUMPER STEP GARNISH CLIP (SN)	NECESSARY	20.00	20.00
1	SET REAR BUMPER STEP GARNISH TOP CHROME CLIP (SN)	NOT NECESSARY	20.00	-
1	TAIL LAMP CLIP (SN)	NECESSARY	20.00	20.00
1	REAR END PANEL SEALANT (SN)	NOT NECESSARY	100.00	-
1	REVERSE SENSOR (SN)	NOT NECESSARY	220.00	-
			440.00	80.00

Report Ref No. CC6/QBE19020956/Ada3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	PANEL BEATING, REMOVAL AND REPLACING PARTS. INCLUSIVE OF THE REPAIR OF TAILLAMP PANEL RH AND REAR END PANEL.		1,800.00	700.00
	TO SPRAY PAINT AFFECTED AREA.		1,600.00	700.00
	TUFF COAT.		250.00	60.00
	WIRING CHECK.		100.00	30.00
	REMOVE AND REFIX UPHOLSTRY AND ROOF LINNING TO FACILITATE REPAIR.		180.00	50.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.	NOT NECESSARY	80.00	-
	TRANFER TAILGATE MECHANISM.		80.00	80.00
	REMOVE AND REFIX CABIN BACK GLASS.	NOT NECESSARY	100.00	-
			4,190.00	1,620.00
	GRAND TOTAL		11,911.81	6,081.65
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			2,000.00

Report Ref No. CC6/QBE19020956/Ada3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



PHOTOGRAPHS FOR VEHICLE NO. GZ 2918U





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

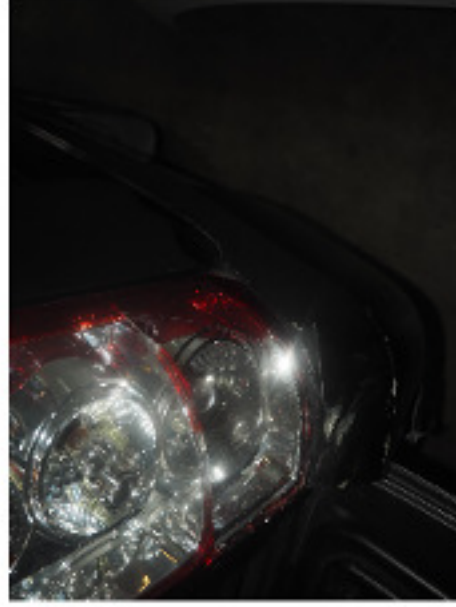



LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GZ 2918U

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

