



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD  
36 ROBINSON ROAD  
#16-01 CITY HOUSE  
SINGAPORE 068877

INV No. AC2006520  
INV Date 22/09/2020  
Reference CC4/FCI19022190/T1ba3q2  
Code FCI2



#### PROFESSIONAL SERVICE FEE

Vehicle No. XD 6901E  
Insured Veh. SHA 9775M  
Claim No. D19007903MFSH  
Policy No. D-18088937MFSH  
Accident Date 15/12/2019  
Inspection Date 17/12/2019

Description	Total
Third Party Express Settlement	600.00
<b>Subtotal</b>	<b>600.00</b>
<b>GST (7%)</b>	<b>42.00</b>
<b>Grand Total</b>	<b>642.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

**Affiliated to Federation Internationale Des Experts En Automobile**

MS FIRST CAPITAL INSURANCE LTD	Ref : CC4/FCI19022190/T1ba3q2
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877	Date : 22-09-2020
	Code : FCI2



**1. Policy Particulars :- THIRD PARTY CLAIM**

<b>Insured Veh.</b>	SHA 9775M	<b>Veh. Inspected</b>	XD 6901E
<b>Policy No.</b>	D-18088937MFSH	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	D19007903MFSH	<b>Excess (\$)</b>	0.00
<b>Assign From</b>	MERINA	<b>Assign Date</b>	17/12/2019

**2. Vehicle Particulars & Condition**

<b>Make &amp; Model</b>	VOLVO FMX420	<b>c.c</b>	12777
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2013
<b>Chassis No.</b>	YV2JG10G9DA740266	<b>Colour</b>	WHITE
<b>Odometer</b>	615692	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	NIL
<b>General</b>	GOOD		

**3. Conditions of Tyres**

	Size	Make	Balance
<b>R/H Front Tyre</b>	315/80 R22.5	TRIANGLE	8 mm
<b>L/H Front Tyre</b>	315/80 R22.5	TRIANGLE	8 mm
<b>R/H Rear Tyre</b>	315/80 R22.5 (D)	TRIANGLE	8/8 mm
<b>L/H Rear Tyre</b>	315/80 R22.5 (D)	TRIANGLE	8/8 mm

**4. Description of Damages**

	THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S PORTION. DAMAGES SEE DETAILS.
--	--

**5. General Information**

<b>Accident Date</b>	15/12/2019	<b>Inspection Date</b>	17/12/2019
<b>Survey held at</b>	VFIX AUTO SERVICE PTE LTD 26 CHIA PING ROAD SINGAPORE 619977		

**5a. Remarks**

	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--	--

**5b. Estimate Days of Repair**

	ESTIMATED NORMAL PERIOD FOR REPAIR:	<b>7 Working Days</b>
--	-------------------------------------	-----------------------



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. XD 6901E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	REAR MUDGUARD RH	BENT	877.50	877.50
4	REAR MUDGUARD BRACKET RH @\$150.00	BENT	600.00	600.00
2	TAIL LAMP @\$650.00	NOT NECESSARY	1,300.00	-
2	REAR ABSORBER RH @\$300.00	BENT	600.00	600.00
2	REAR AIR BALLON RH @\$400.00	BENT	800.00	800.00
6	REAR TOP ROD WITH BUSH RH @\$500.00	BENT	3,000.00	1,500.00
1	REAR EXTENTION AXLE	BENT	22,000.00	8,500.00
4	REAR EXTENTION AXLE MOUNTING @\$120.00	BENT	480.00	480.00
1	REAR EXTENTION AXLE TROJAN CARRIER	BENT	3,500.00	3,500.00
2	REAR LEAF SPRING @\$1200.00	NOT NECESSARY	2,400.00	-
2	REAR LEAF SPRING TOP MOUNTING @\$450.00	NOT NECESSARY	900.00	-
4	REAR LEAF SPRING BRACKET @\$200.00	NOT NECESSARY	800.00	-
2	REAR LEAF SPRING CENTER BOLT @\$100.00	NOT NECESSARY	200.00	-
1	REAR CARRIER ARM	BENT	790.00	790.00
2	REAR BRAKE CAMBER @\$890.00	NOT NECESSARY	1,780.00	-
4	REAR BRAKE HOSE @\$120.00	NOT NECESSARY	480.00	-
	LESS 10% DISCOUNT		-4,050.75	-1,764.75
			36,456.75	15,882.75
<b><u>SPECIAL NETT ITEMS</u></b>				
1	REAR TYRE (80%) (SN)	CUT	600.00	480.00
1	REAR RIM (SN)	BENT	750.00	750.00
1	REAR MUDGUARD (SN)	DEFORMED	450.00	450.00
1	BRAKE OIL (SN)	NECESSARY	60.00	60.00
			1,860.00	1,740.00



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>LABOUR</b>			
	TO REMOVE DAMAGED BODY PANEL WITH ALL NECESSARY COMPONENTS /ATTACHMENTS APPLY HOT-WORKS WHERE NECESSARY STRAIGHTEN FRONT DOOR PILLAR ,REPAIR /RESHAPE BODY DENTED PANELS IN ACCORDANCE WITH FACTORY SPECIFICATIONS REPLACE NEW PARTS REFIT AND ALIGN INTO POSITION REFIT ALL NECESSARY COMPONENTS /ATTACHMENTS.		2,000.00	1,200.00
	TO SPRAY PAINT REPLACED/ REPAIRED BODY PANELS INCLUSIVE OF PREPARATORY WORKS AND PAINTING MATERIALS.		1,500.00	800.00
	TO REMOVE, REFIT REAR UNDERCARRIAGE.		2,000.00	1,000.00
	TO CHECK AND RECONNECT WIRING .		600.00	60.00
	TO CHECK FOUR WHEEL ALIGNMENT .		300.00	200.00
			6,400.00	3,260.00
	<b>GRAND TOTAL</b>		<b>44,716.75</b>	<b>20,882.75</b>
	<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>16,500.00</b>

Report Ref No. CC4/FCI19022190/T1ba3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. XD 6901E

INSPECTION

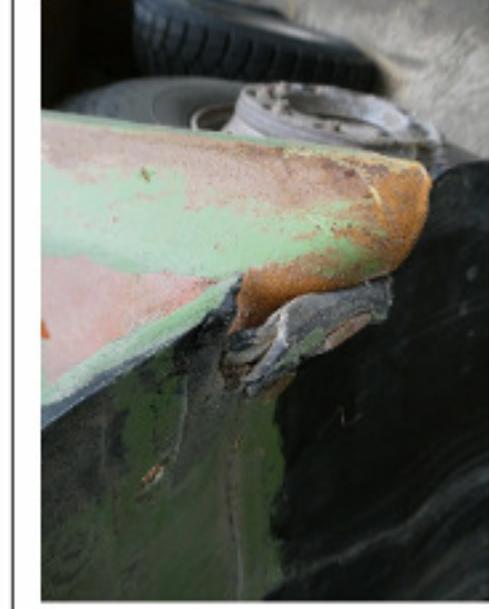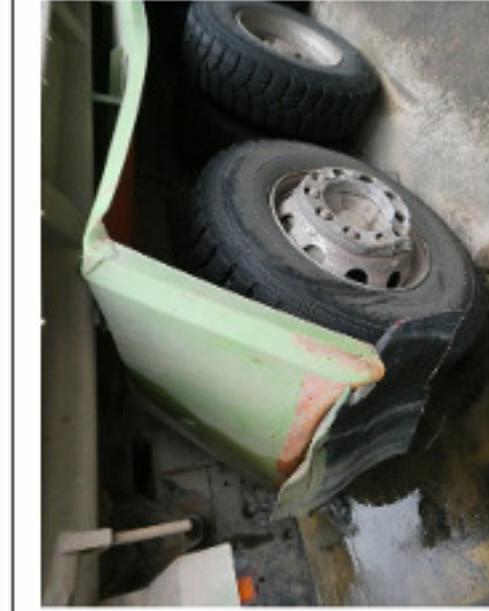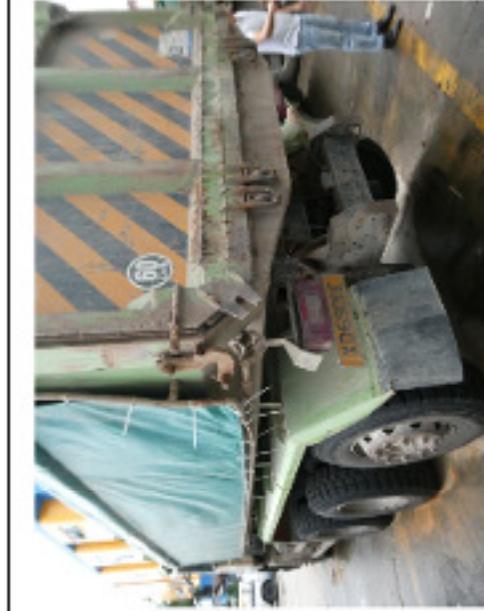



**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. XD 6901E

RE-INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. XD 6901E

RE-INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

