



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

SOMPO INSURANCE SINGAPORE PL
50 RAFFLES PLACE
#05-01/06
SINGAPORE LAND TOWER
SINGAPORE 048623

INV No. AC2003638
INV Date 04/05/2020
Reference CS/SMO20000517/Etf3n2
Code SMO



PROFESSIONAL SERVICE FEE

Vehicle No. SKZ 2670K
Insured Veh. SKS 7157E
Claim No. CMTD2000049/SYH
Policy No.
Accident Date 31/12/2019
Inspection Date 14/01/2020

Description	Total
Survey Inspection	250.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	250.00
GST (7%)	17.50
Grand Total	267.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
SOMPO INSURANCE SINGAPORE PL		Ref : CS/SMO20000517/Etf3n2		
50 RAFFLES PLACE #05-01/06 SINGAPORE LAND TOWERSINGAPORE 048623		Date : 04-05-2020		
		Code : SMO		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SKS 7157E	Veh. Inspected	SKZ 2670K	
Policy No.		Coverage (\$)	0.00	
Claim No.	CMTD2000049/SYH	Excess (\$)	0.00	
Assign From	GRACE TEO	Assign Date	08/01/2020	
2. Vehicle Particulars & Condition				
Make & Model	NISSAN TEANA	c.c	1997	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	MNTBBAL33Z0005524	Colour	WHITE	
Odometer	67845	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/55 R17	MICHELIN	5 mm	
L/H Front Tyre	215/55 R17	MICHELIN	5 mm	
R/H Rear Tyre	215/55 R17	MICHELIN	5 mm	
L/H Rear Tyre	215/55 R17	MICHELIN	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	31/12/2019	Inspection Date	14/01/2020	
Survey held at	MOVA AUTOMOTIVE PTE LTD BLK 1008 BUKIT MERAH LANE 3 #01-04/06/08 SINGAPORE 159722			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKZ 2670K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BOOTLID (N)	DENTED	798.00	798.00
1	BOOTLID LOGO (N)	NECESSARY	59.00	59.00
1	BOOTLID EMBLEM-TEANA (N)	NECESSARY	89.00	89.00
1	BOOTLID EMBLEM-2.0XL (N)	NECESSARY	86.00	86.00
1	BOOTLID EMBLEM PLATE-EXTRONIC CVT (N)	NECESSARY	59.00	59.00
1	BOOTLID LOCK (N)	BENT	155.00	155.00
1	BOOTLID RUBBER (N)	NOT NECESSARY	142.00	-
1	REAR BUMPER (N)	DENTED	849.00	849.00
1	REAR PARKING SENSOR CTR LH (N)	SHORTED	220.00	220.00
1	REAR PARKING SENSOR CTR RH (N)	SHORTED	220.00	220.00
10	REAR BUMPER CLIPS @\$4.00 (N)	NECESSARY	40.00	30.00
1	REAR BUMPER SIDE RETAINER LH (N)	BROKEN	53.00	53.00
1	REAR BUMPER SIDE RETAINER RH (N)	BROKEN	53.00	53.00
1	REAR BUMPER SPONGE (N)	NOT NECESSARY	245.00	-
1	REAR BUMPER REINFORCEMENT (N)	DENTED	534.00	534.00
1	ELECTRICAL ANTENNA (N)	NOT NECESSARY	264.00	-
1	END PANEL TOP GARNISH (N)	CRUSHED	148.00	148.00
1	END PANEL (N)	DEFORMED	464.00	464.00
1	TAILLAMP LH (N)	NOT NECESSARY	402.00	-
1	TAILLAMP RH (N)	NOT NECESSARY	402.00	-
2	BOOTLID HINGE LH +RH (NPA)(N)	TO REPAIR SEE LABOUR	-	-
1	SPARE TYRE PANEL (NPA)(N)	NOT NECESSARY	-	-
2	REAR BUMPER REINFORCEMENT STAY-LH & RH @\$115.00 (N)(ADDITIONAL)	DENTED (1 PC ONLY)	230.00	115.00
	LESS 10% DISCOUNT		-551.20	-393.20
			4,960.80	3,538.80
	<u>LABOUR</u>			
	TO INSPECT REAR LIGHTING MECHANISM.		80.00	30.00
	TO CUT OFF END PANEL TO REPLACE DAMAGED ITEM REALIGN CONNECTION.INCLUSIVE OF THE REPAIR OF BOOTLID HINGE LH +RH.		600.00	600.00

Report Ref No. CS/SMO20000517/Etf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE & REFIT REAR COMPARTMENT ATTACHMENT.		150.00	30.00
	TO APPLY BODY JOINT SEALANT.		80.00	30.00
	TO RUST PROOF ON REPAIRED AREAS.		80.00	30.00
	TO SPRAY PAINT ON REPAIRED AREAS.		800.00	700.00
			1,790.00	1,420.00
GRAND TOTAL			6,750.80	4,958.80
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,950.00

Report Ref No. CS/SMO20000517/Etf3n2

CHEN TSUE YEE

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKZ 2670K

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

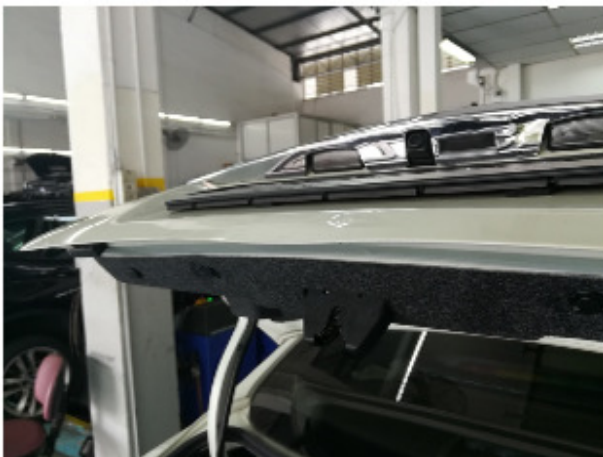



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKZ 2670K

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

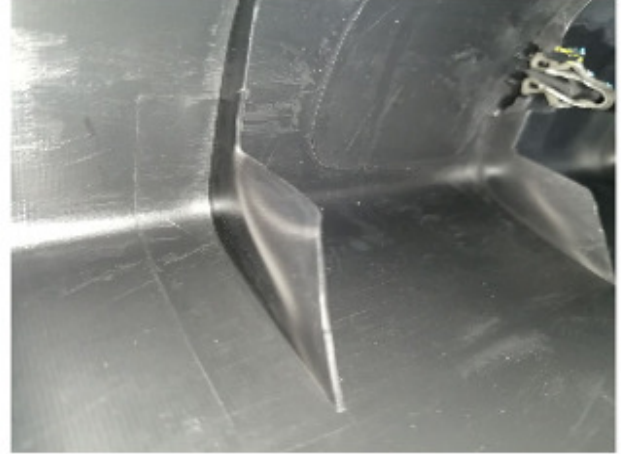



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKZ 2670K

RE-INSPECTION

