



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2101364

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 05/03/2021
Reference CC4/FCI20000688/Kba3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLZ 5942U
Insured Veh. SHC 8389R
Claim No. D20000164MFSH
Policy No. D-20094922MFSH
Accident Date 04/01/2020
Inspection Date 09/01/2020

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Ref: CC4/FCI20000688/Kba3q2

Date: 05/03/2021

Code: FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHC 8389R	Veh. Inspected	SLZ 5942U
Policy No.	D-20094922MFSH	Coverage (\$)	0.00
Claim No.	D20000164MFSH	Excess (\$)	0.00
Assign From	VIC	Assign Date	08/01/2020

2. Vehicle Particulars & Condition

Make & Model	HONDA CITY (A)	c.c	1497
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	MRHGM6660KT000108	Colour	RED
Odometer	23656 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	185/55 R16	BRIDGESTONE	8 mm
L/H Front Tyre	185/55 R16	BRIDGESTONE	8 mm
R/H Rear Tyre	185/55 R16	BRIDGESTONE	8 mm
L/H Rear Tyre	185/55 R16	BRIDGESTONE	8 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	04/01/2020	Inspection Date	09/01/2020
Survey held at	CHEW GOON MOTOR BLK 10 ANG MO KIO IND PARK 2A #01-15/16/17, AVE 5, AMK AUTOPOINT SINGAPORE 568047		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **7 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLZ 5942U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR DOOR LH	BENT	828.19	828.19
1	REAR DOOR STICKER	NECESSARY	34.20	34.20
1	REAR DOOR WEATHERSTRIP	NECESSARY	95.52	95.52
1	REAR DOOR LOWER RUBBER SEAL	CUT	29.40	29.40
12	REAR DOOR INNER TRIM BOARD CLIPS @\$5.70	NOT NECESSARY	68.40	-
1	REAR FENDER LH	BENT	1,109.20	1,109.20
1	ROCKER PANEL LH	TO REPAIR SEE LABOUR	496.00	-
1	REAR BUMPER	MTG CRACKED	555.84	483.70
10	REAR BUMPER CLIPS @\$5.50	NECESSARY	55.00	55.00
1	REAR BUMPER CORNER RETAINER LH	SERVICEABLE	23.90	-
1	REAR BUMPER REFLECTION OUTER COVER LH	CUT	42.90	42.90
1	REAR WINDSCREEN MOULDING	NECESSARY	149.20	149.20
1	REAR WHEEL BEARING	BENT	281.90	281.90
	LESS 20% DISCOUNT		-753.93	-621.84
			3,015.72	2,487.37
<u>SPECIAL NETT ITEMS</u>				
1	REAR WHEEL RIM (SN)	DENTED	690.20	500.00
1	REAR DOOR INNER INSULATION (SN)	NOT NECESSARY	120.00	-
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00
1	REAR WINDSCREEN SEALER (SN)	NECESSARY	30.00	30.00
1	REAR WINDSCREEN FASTENER (SN)	NECESSARY	50.00	30.00
1	ROCKER PANEL CHIP RESISTANT PRIMER (SN)	NECESSARY	180.00	120.00
			1,120.20	720.00
<u>LABOUR</u>				
	TO DISMANTLE/TRANSFER DOOR FITTINGS/ANCILLARY ACCESSORIES.		120.00	60.00
	TO DISMANTLE/REFIT REAR WINDSCREEN GLASS.		160.00	120.00
	TO DISMANTLE/REFIT ROOF LINING }.		150.00	100.00
	TO DISMANTLE/REFIT TRUNK COMPARTMENT BOARDS & TRIMS }.		80.00	-

Report Ref No. CC4/FCI20000688/Kba3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CONDUCT COMPUTERIZE WHEEL ALIGNMENT TEST.		80.00	60.00
	TO SUPPLY REAR FENDER BODY SEALANT.		60.00	30.00
	TO APPLY RUST PROOFING/RESEAL TUFF COATING TREATMENT TO RESPRAY/REPLACED/REPAIR PANEL.		100.00	60.00
	TO CONDUCT COMPUTERIZE WHEEL ALIGNMENT TEST.	REPEATED	80.00	-
	TO DISMANTLE/REFIT FUEL TANK INLET HOSES & PIPING.		100.00	60.00
	LABOUR CHARGES-PANEL BEATING,REPAIRING OF FENDER INNER PANEL,ROCKER PANEL,FRONT DOOR ETC.CNT,WELD REAR FENDER AND PARTS REPLACEMENT.INCLUSIVE OF THE REPAIR OF ROCKER PANEL LH.		1,400.00	900.00
	TO RESPRAY AFFECTED AREAS.		1,200.00	800.00
			3,530.00	2,190.00
GRAND TOTAL			7,665.92	5,397.37
RECOMMENDED COST OF REPAIRS				5,397.37

Report Ref No. CC4/FCI20000688/Kba3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd






51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLZ 5942U

INSPECTION

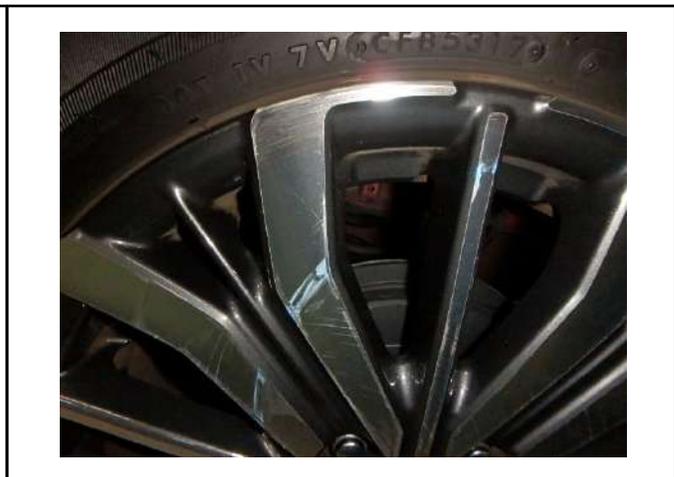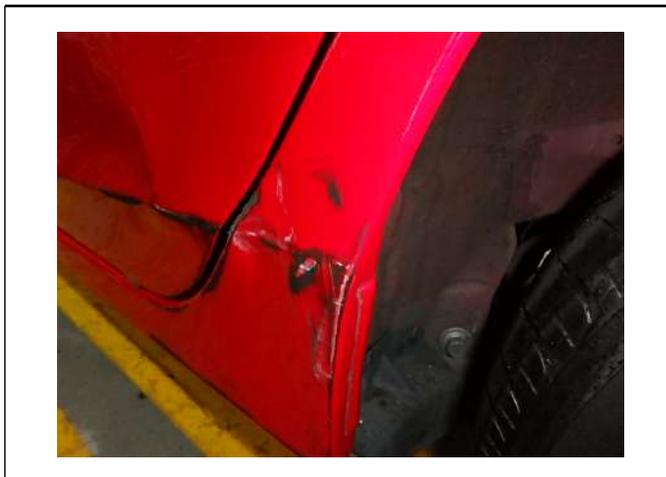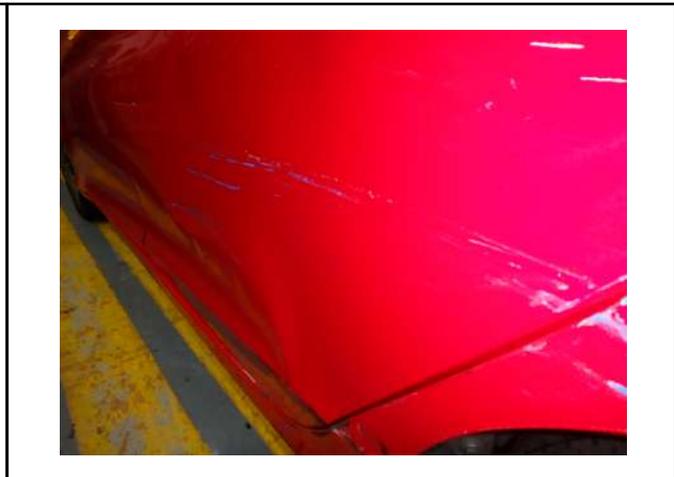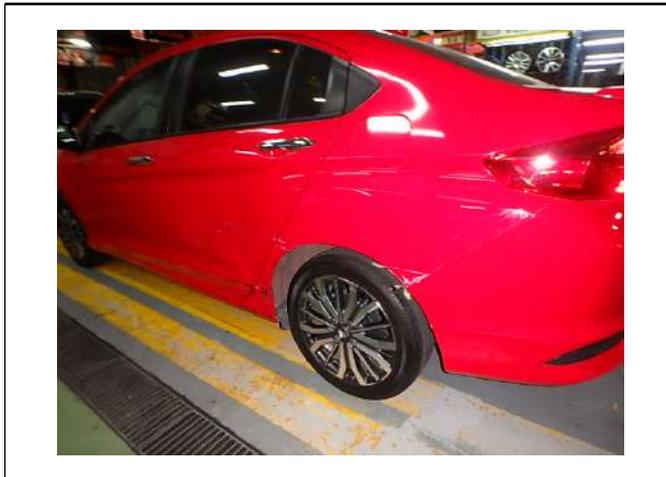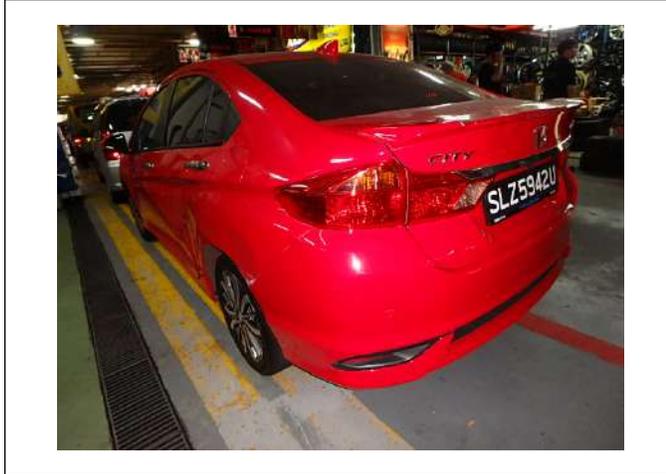




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

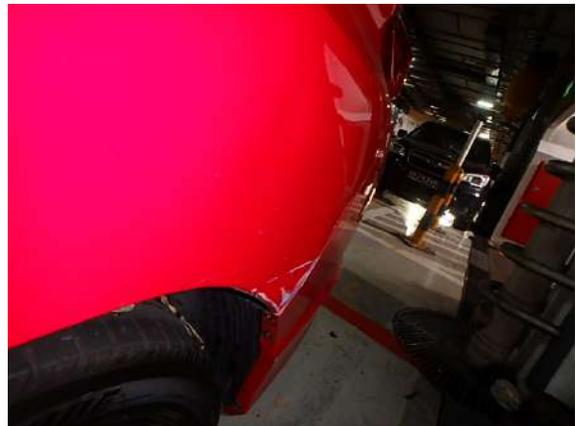



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

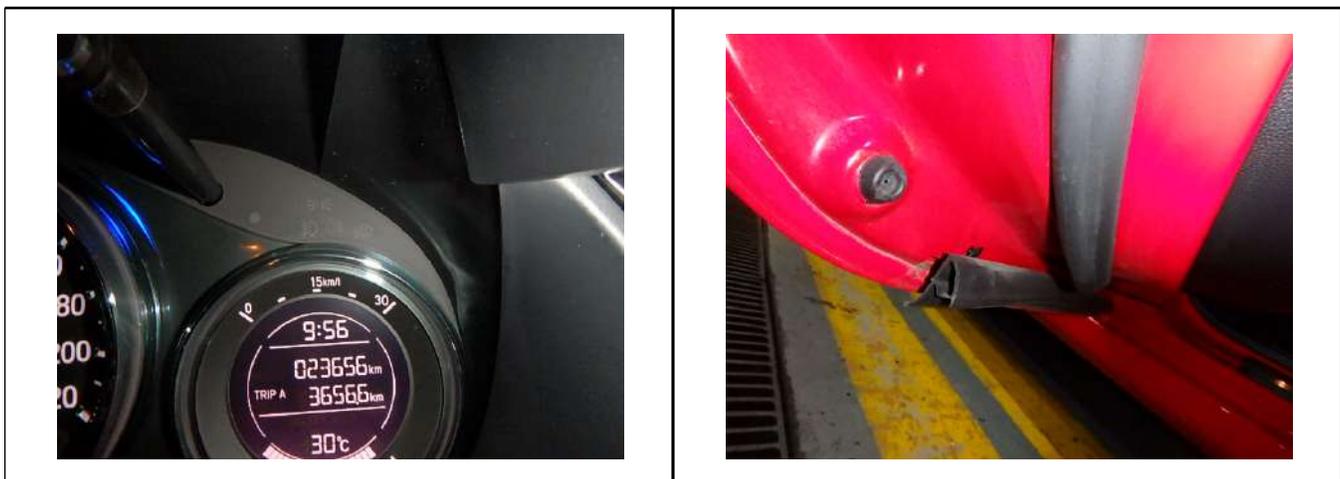



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLZ 5942U

RE-INSPECTION

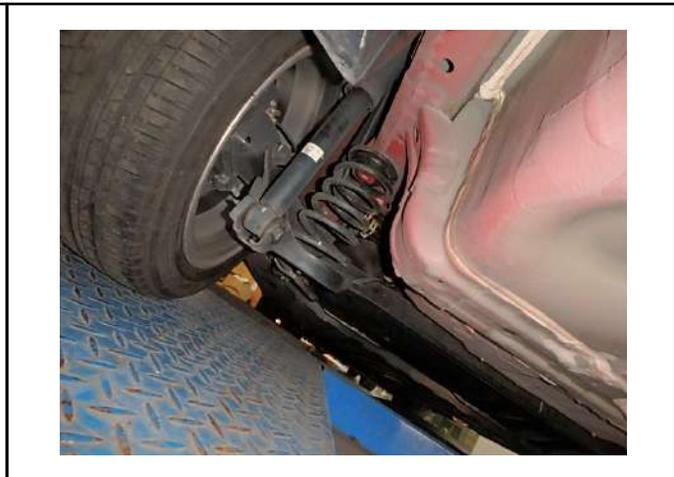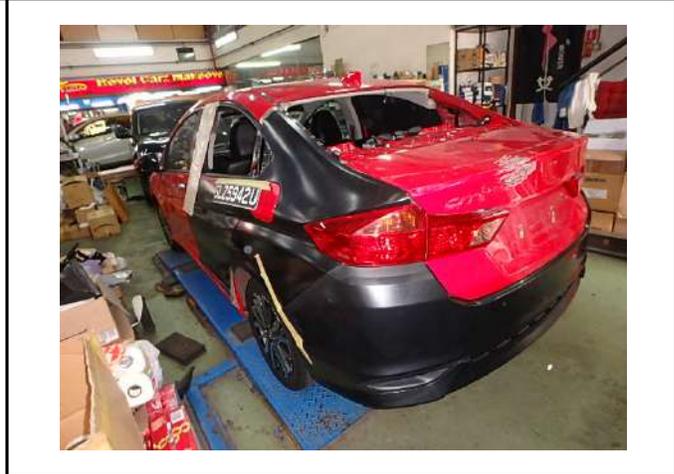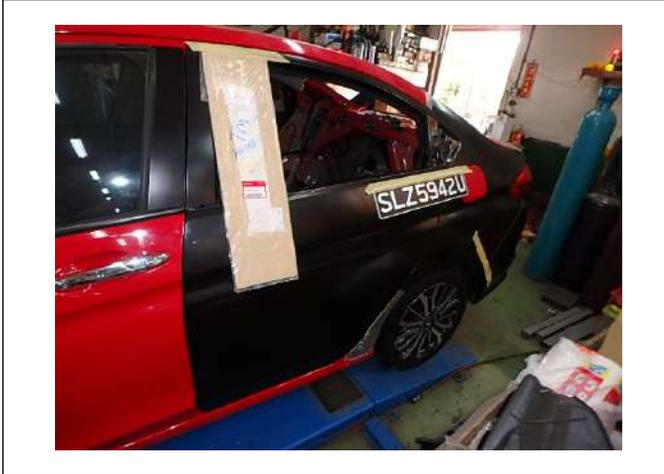



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

