

ASS. REC. BY: Sun Pin

REF:

NTUC NS/INC20000903/Qgd327

010

ASSIGNMENT

From: Date: 14/01/2020

Estimated Cost:

OD ☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SHB 382 S

at Workshop m/s SMRT
of woodlands Depot

Insured: FBM 1731 A

Policy No. 5093456855-02 (14/8/19-13/8/2020)

Claims No. MT/1081527-001


Sum Insured: Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

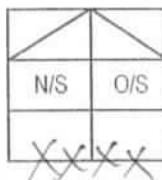

Bal. or Market Value:

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 2 days Res.: Yes or No

Lum Sum: % 3 Val: Yes or No

CA / REV / REP. / 24 HRS 1up

Vehicle: IN / OUT

Date: Person Contacted:

Veh No: SHB382S Yr Regn: 08/09/2014

Type: M.Car / M.Cycle / Bus / Van / Lorry ☒ Taxi / Prime Mover /

Truck / Trailer or

Make: Toyota Prius c.c 1798

Colour: Maroon A/C: Insured / Std / NI / NA

Sp. Reading: 740040 T/Radio: Insured / Std / NI / NA

Eng/No: -

Vin No: JTDKN36U405748503

Gen. Cond: Good ☒ Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195 / 65 R15

R: 195 / 65 R15

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Nantun

Front

Rear

R/Bal. 5 mm R/Bal. 5 mm

L/Bal. 5 mm L/Bal. 5 mm

D.O.A. 11/01/2020. D.O.I. 14/01/2020.

Survey held at

Des. of Damages: Frt ☒ Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

SHB 382S - NS/INC19017077 / Eq 322
FBM 1731A - X

DoA: 26/01/2019 TP.

TAX / 01/20/2055
FBM 1731A

RECEIVED 23 JAN 2020

Confirm with Poh Suan

Finalize \$ 550 @ 2 days (L/S) (Red \$4603.40, 84%.)

Date/Time, File Pass to?

☐ : Preli. Report

Days Of Repair: 2

1) 23/1 train

☐ : Final Report

Resurvey No. of Trip: 1

Date/Time, File Return to?

Survey Fee:

160

Transportation:

S + RS. \$

Photos

Others

TOTAL

160

Add Fee: ☐ : Site Insp (\$)

☐ : Interview (\$)

☐ : Tech. Insp (\$)

☐ : Weekend (\$)

Report Format: TP

Lump Sum / L/S: 550

Oi Sun Pin (LKK Auto)

From: Oi Sun Pin (LKK Auto)
Sent: Thursday, 23 January, 2020 10:13 AM
To: 'Yeo Poh Suan (Auto Svcs/ARC/ARC/Taxis)'
Subject: RE: SHB382S

Dear Poh Suan,

Confirm the finalize amount \$550. Repair day 2 days under lump sum repair.

Thank you.

Best Regards,
Oi Sun Pin | Assistant Automotive Assessor

LKK Auto Consultants

Phone: 6256 3561 | Email: Sunpin@lkkauto.com | fax: 6256-4315 Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

-----Original Message-----

From: Yeo Poh Suan (Auto Svcs/ARC/ARC/Taxis) [<mailto:YeoPohsuan@smrt.com.sg>]
Sent: Sunday, 19 January, 2020 12:57 PM
To: Oi Sun Pin (LKK Auto)
Cc: SUR; CS A Team; Leong Chee kwong
Subject: SHB382S

Hi Sun Pin,

Attached herewith the repair estimate of SHB 382S having Case No: TAX/01/20/2055.

There is no change to the approved amount of \$550 @ 2 working days under lump sum repair.

Cost of Repair invoice will be generated as approved.

Please finalize with me within 7 working day, thanks.

Aside Kwong,

Please provide the before / after paint photos as per surveyor's request.

Thanks & Regards
Poh Suan

-----Original Message-----

From: Yeo Poh Suan (Auto Svcs/ARC/ARC/Taxis)
Sent: Sunday, 19 January 2020 12:57 PM
To: Yeo Poh Suan (Auto Svcs/ARC/ARC/Taxis)
Subject: Scan Data from FX-D421D6

Shiau Chan (LKKAUTO)

From: MTCL@income.com.sg
Sent: Thursday, 23 January 2020 1:00 PM
To: Shiau Chan (LKKAUTO)
Subject: FW: REQUEST CLAIM NUMBER

Dear Sir/Mdm,

For your attention

S/No	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle No.	D
1	MT/1081527-001	COMFORT TRANSPORTATION PTE LTD	SHB 382S	FBM 1731A	

Thank you

With Regards

Joreen Ang
Senior Admin Assistant
Motor Insurance
www.income.com.sg



At Income, we are 'In with You' on Performance, Growth, Innovation and Impact. These attributes reflect what we promise as an employer and what we want our people to exemplify. Find out more at income.com.sg/careers

in with you

From: Shiau Chan (LKKAUTO) [mailto:siewsc@lkkauto.com]
Sent: Thursday, 23 January 2020 10:35 AM
To: MTCL@income.com.sg
Subject: REQUEST CLAIM NUMBER

Dear Sir/Madam,

Please refer to the below:

TP Claims against NTUC Income: Follow-Through Survey

Date : 23/01/2020

S/No	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle No.	D
1	MT/1081527-001	COMFORT TRANSPORTATION PTE LTD	SHB 382S	FBM 1731A	

"Wishing you a Happy and Prosperous Lunar New Year"

Hello, NAC_PAYA_UBI_800601

[Change Language](#)[Change Password](#)[Log Out](#)[My Desktop](#)[Notice of Loss](#)

Policy Query

Policy No.	<input type="text"/>	Date of Accident	<input type="text" value="11/01/2020 09:41"/>
Vehicle No.(For Motor)	<input type="text" value="FBM1731A"/>	Certificate Number	<input type="text"/>

Select	Policy No.	Certificate Number	Policyholder Name	Policyholder NRIC	Product	Cover Type	Vehicle No.	Insured Object	Commence Date	Expiry Date
<input type="radio"/>	5093456855-02		MOHD SHAHEEZAM B MOHD SAHID	S7311570A	GMC	Third Party, Fire & Theft	FBM1731A	FBM1731A	14/08/2019	13/08/2020

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Company
Owner ID:	369K

Vehicle Details

Vehicle No.:	SHB382S
Vehicle to be Exported:	No
Intended Deregistration Date:	15 Jan 2020
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS TAXI (SMRT)
Primary Colour:	Maroon
Manufacturing Year:	2014
Engine No.:	2ZR6085325
Chassis No.:	JTDKN36U405748503
Maximum Power Output:	100.0 kW (134 bhp)
Open Market Value:	\$32,920.00
Original Registration Date:	08 Sep 2014
First Registration Date:	08 Sep 2014
Transfer Count:	0
Actual ARF Paid:	\$8,088.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	07 Sep 2022
PARF Rebate Amount:	\$5,661.00

Intended COE Rebate Details

COE Expiry Date:	07 Sep 2022
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$50,704.00
COE Rebate Amount:	\$16,769.00
Total Rebate Amount:	\$22,430.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 15 Jan 2020

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	13/01/2020 11:10
Date Of Accident	11/01/2020 17:00
Exact Location Of Accident	BUKIT BATOK EAST AVE 2
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB382S
Insured/Policyholder	
Name Of Registered Owner	SMRT TAXIS PTE LTD
Co Reg No	1XXXXX369K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-80000000

Vehicle Particulars

Manufacturer	TOYOTA
Model	PRIUS TAXI-1.8 (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	MS FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-19093197MFSH
Cover Note Number	

Driver

Name of Driver	ABDUL JALEEL BIN KADER MYDIN
NRIC No	SXXXX383C
Date Of Birth	03/03/1969
Occupation	OUTDOOR
Date Of Driving Pass	01/06/2007
Driving Experience	12 YEARS AND 7 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-80000000
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	484
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : UNKNOWN GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

MY TAXI WAS STOPPING ALONG BUKIT BATOK EAST AVE 2 AT THE RIGHT LANE WITH RIGHT SIGNAL LIGHT 'ON' TO LOOK OUT FOR ONCOMING TRAFFIC AS I WANTED TO TURN RIGHT INTO HILLVIEW REGENCY WHEN THE MOTORCYCLE FBM1731A FROM BEHIND FAILED TO STOP AND HIT ONTO THE REAR PORTION OF MY TAXI.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	FBM1731A
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	MOTORCYCLE
Name of Driver	MOHAMED SHAHEEZAM BIN MOHAMED SAHID
NRIC/Passport Number	SXXXX570A
Contact Number	
Address	
Postcode	
Insurance Company Name	

Nature Of Damage

No. Of Passenger (Including Driver)

1

Sketch Plan Pg. 1

SKETCH PLAN

Bukit Batok East Ave 2



HILLVIEW REGENCY

A-SHB382S

B-FBM 1731A

[illegible]

DECLARATION

I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature _____
Date & Time: _____

School

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Ch 13/1/2-20

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by Insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.



Policyholder's Signature
Date & Time:

Shel

Driver's Signature
(If driver is not the policyholder)
Date & Time:

ah 13/1/2020

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Case Details

Case Reference Number :

TAX/01/20/2055

Type of Repair : Accident Repair

Vehicle Registration Number : SHB382S

Company Type : SMRT Taxis Pte Ltd

Estimation ID : EST-10131-ID

Assigned By : Taxi Claims Manager
Team

Insurance Company Name : NTUC Income Insurance Co-operative Ltd

Accident Date and Time : 11/01/2020 09:00 AM

Vehicle Age(In Months) : 64

Documents / Photographs

[View Documents / Photographs](#)

Total Documents: 1

Estimation Details

Spare Part's Cost Detail

BOM Type	Costing Type	Portion	Material Number	SMRT Recommendation					Surveyor Approval					Remarks
				Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	
One Time Key In	Main			ANTENNA,ELECTRICAL LOWER REAR	1	157.40	157.40	10.00	141.66	Replace	0	0	Check	* X Svc
One Time Key In	Main			SENSOR REVERSE	1	180.00	180.00	0.00	180.00	Replace	0	0	Not Give	* X Svc
One Time Key In	Main			BUMPER SIDE RETAINER RR/LH	1	94.80	94.80	25.00	71.10	Replace	0	0	Not Give	* X Svc
One Time Key In	Main			BUMPER SIDE RETAINER RR/RH	1	94.80	94.80	25.00	71.10	Replace	0	0	Not Give	* X Svc
One Time Key In	Main			BUMPER SEAL, RR LH	1	88.90	88.90	25.00	66.68	Replace	0	0	Not Give	* X Svc
One Time Key In	Main			BUMPER SEAL, RR RH	1	65.70	65.70	25.00	49.28	Replace	0	0	Not Give	* X Svc
One Time Key In	Main			BUMPER LIP COVER RR/LH	1	72.20	72.20	25.00	54.15	Replace	0	0	Not Give	* X Svc
One Time Key In	Main			BUMPER LIP COVER RR/RH	1	118.10	118.10	25.00	88.57	Replace	0	0	Not Give	* X Svc
One Time Key In	Main			BUMPER LIP REAR	1	228.90	228.90	25.00	171.68	Replace	1	171.68	Replace	* / CR4.
One Time Key In	Main			UNDER COVER SUB-ASSY, RR FLOOR	1	514.50	514.50	25.00	385.88	Replace	0	0	Not Give	* X Svc

Total Spare Part Cost 2,886.67

Lump Sum Discount (%) 20.00

Final Spare Part Cost 1,170.78

Surveyor Total 291.68

Lump Sum Dis (%) 20

Final Sur Total 233.34

SMRT Recommendation										Surveyor Approval				
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			UNDER COVER RR SHIELD	1	63.90	63.90	25.00	47.92	Replace	0	0	Not Give	* X SVC
One Time Key In	Main			SPOILER REAR	1	953.70	953.70	25.00	715.28	Replace	1	0	Repair	* X R
One Time Key In	Main			BUMPER REAR	1	458.60	458.60	25.00	343.95	Replace	1	0	Repair	* X R
One Time Key In	Main			BUMPER CLIPS	10	2.10	21.00	25.00	15.75	Replace	0	0	Not Give	* X SVC
One Time Key In	Main			PIXEL STICKER	2	60.00	120.00	0.00	120.00	Replace	2	120.00	Replace	* / Nec.
One Time Key In	Main			BUMPER REINFORCEMENT REAR	1	205.70	205.70	25.00	154.27	Replace	0	0	Check	* X SVC
One Time Key In	Main			ARM SUB-ASSY. RR BUMPER RH	1	139.60	139.60	25.00	104.70	Replace	0	0	Check	* X SVC
One Time Key In	Main			ARM SUB-ASSY. RR BUMPER LH	1	139.60	139.60	25.00	104.70	Replace	0	0	Check	* X SVC
Total Spare Part Cost									2,886.67	Surveyor Total		291.68		
Lump Sum Discount (%)									20.00	Lump Sum Dis (%)		20		
Final Spare Part Cost									1,170.78	Final Sur Total		233.34		

Labour's Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPAIR REAR PORTION	338.00	100	
Total:			338.00	100.00	

Spray Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO RESPRAY REAR BUMPER	378.00	200	
2	Main	TO RESPRAY REAR SPOILER	180.00	100	
3	Main	TO RESPRAY BUMPER BEAM	180.00	0	
Total:			738.00	300.00	

Other Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPLACE SUNDRY PARTS	100.00	0	
2	Main	TO CHECK WIRING AND SYSTEM FUNCTION	80.00	20	
3	Main	TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	0	
4	Main	TO WASH AND VACUUM	60.00	0	
Total:			360.00	20.00	

Summary

	Estimator Assesment(\$)	Surveyor Assesment(\$)
Total Spare Part Detail	1,170.78	233.34
Total Labour Cost	338.00	100.00
Total Spray Painting	738.00	300.00
Other	360.00	20.00
Overall Total	2,606.78	653.34
Lump Sum Repair Option		
Lump Sum Total	2,600.00	650.00
Surveyor Approved Amount		650.00
No of Repair Days*	5	2 2 days.
Remarks		Lump Sum Repair, after paint photo
Surveyor Name		Sun Pin (LKK)
Signature		
Survey Date	14/01/2020	

Save Clear

- LKK Auto Consultants hence notify the Repairer of the following:
- To resurvey before/after spray painting
 - To display damaged part(s) during resurvey
 - Parts prices are subject to confirmation
 - Third party survey is on a "Without Prejudice" basis
 - No illegal modification(s) is allowed
 - Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer



Signature:

Date:

Section A - Accident Details

Registration Number	SHB382S
Case Reference Number	TAX/01/20/2055
Registration Date	8/9/2014
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS
Name of Driver	ABDUL JALEEL BIN KADER MYDIN
Type of Accident	Head to Rear
Accident Date and Time	11/1/2020 5:00 PM
Accident Reported Date and Time	13/1/2020 11:14 AM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24105296
Special Instruction to ARC, if any	DROVE IN
Prepared Date and Time	13/1/2020 3:03 PM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

Section B - Summary of Repair Estimates

Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$338.00	\$100.00
Total Spray Cost	\$738.00	\$300.00
Total Spare Part Cost	\$2,886.67	\$291.68
Total Other Cost	\$360.00	(\$141.68)
TOTAL COST	\$4,322.67	\$550.00 (L/S)
Lump Sum Total	\$4,300.00	\$0.00
Number of Repair Days	5.0	2.0
Prepared / Adjusted By	Fong Soon Loh	Sun Pin (LKK) / NTUC
ARC / Surveyor Sign Off Date	15/01/2020 10:23 AM	14/01/2020 3:42 PM
Signature		
Remarks		Lump Sum Repair, after paint photo

Section C - Quotation and Accident Invoice Details

Quotation Number	QN-2001-0274	Invoice Number	
Quotation Date	18.01.2020	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION	\$338.00	\$100.00
Total Labour	\$338.00	\$100.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY REAR BUMPER	\$378.00	\$200.00
TO RESPRAY REAR SPOILER	\$180.00	\$100.00
TO RESPRAY BUMPER BEAM	\$180.00	\$0.00
Total Spray Painting & Panel Beating	\$738.00	\$300.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$20.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00	\$0.00
TO WASH AND VACUUM	\$60.00	\$0.00
Lump Sum Adjustment by Surveyor	\$0.00	(\$161.68)
Total Other Costs	\$360.00	(\$141.68)

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		89997-30070	ANTENNA, ELECTRICAL LOWER REAR	0.00	\$157.40	0.00	\$0.00	Replace	Check X
			SENSOR REVERSE	0.00	\$180.00	0.00	\$0.00	Replace	Not Given X
		52576-47020	BUMPER SIDE RETAINER RR/LH	0.00	\$94.80	0.00	\$0.00	Replace	Not Given X
		52575-47020	BUMPER SIDE RETAINER RR/RH	0.00	\$94.80	0.00	\$0.00	Replace	Not Given X
		52592-47021	BUMPER SEAL, RR LH	0.00	\$88.90	0.00	\$0.00	Replace	Not Given X
		52591-47021	BUMPER SEAL, RR RH	0.00	\$65.70	0.00	\$0.00	Replace	Not Given X
		76088-47020	BUMPER LIP COVER RR/LH	0.00	\$72.20	0.00	\$0.00	Replace	Not Given X
		76087-47020	BUMPER LIP COVER RR/RH	0.00	\$118.10	0.00	\$0.00	Replace	Not Given X
		76891-47020	BUMPER LIP REAR	1.00	\$228.90	25.00	\$171.68	Replace	Replace
		58308-47011	UNDER COVER SUB-ASSY, RR FLOOR	0.00	\$514.50	0.00	\$0.00	Replace	Not Given X
		51442-12210	UNDER COVER RR SHIELD	0.00	\$63.90	0.00	\$0.00	Replace	Not Given X
		76085-47910	SPOILER REAR	1.00	\$953.70	100.00	\$0.00	Replace	Repair
		52159-47905	BUMPER REAR	1.00	\$458.60	100.00	\$0.00	Replace	Repair
		90467-07211	BUMPER CLIPS	0.00	\$2.10	0.00	\$0.00	Replace	Not Given X

			PIXEL STICKER	2.00	\$60.00	0.00	\$120.00	Replace	Replace	✓
		52023-12240	BUMPER REINFORCEMENT REAR	0.00	\$205.70	0.00	\$0.00	Replace	Check	✗
		52015-47050	ARM SUB-ASSY. RR BUMPER RH	0.00	\$139.60	0.00	\$0.00	Replace	Check	✗
		52016-47030	ARM SUB-ASSY. RR BUMPER LH	0.00	\$139.60	0.00	\$0.00	Replace	Check	✗
Total					\$3,638.50		\$291.68			

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
Total									

$$\begin{array}{r}
 291.68 \\
 + 100.00 \\
 + 320.00 \\
 \hline
 711.68
 \end{array}$$

$$\begin{array}{r}
 - 202 \\
 \hline
 \end{array}$$

$$\begin{array}{r}
 569.34 \\
 \hline
 \end{array}$$

$$\begin{array}{r}
 4 \text{ @ } \$550/- \\
 \hline
 \end{array}$$

2 days



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC20000903/Qqd3e2

73 BRAS BASAH ROAD

#05-01 NTUC TRADE UNION HOUSESINGAPORE Date: 05-02-2020

189556



Code: INC4

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	FBM 1731A	Veh. Inspected	SHB 382S
Policy No.	5093456855-02	Coverage (\$)	0.00
Claim No.	MT/1081527-001	Excess (\$)	0.00
Assign From		Assign Date	14/01/2020

2. Vehicle Particulars & Condition

Make & Model	TOYOTA PRIUS	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2014
Chassis No.	JTDKN36U405748503	Colour	MAROON
Odometer	740040	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	FAIR		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	NEUTON	5 mm
L/H Front Tyre	195/65 R15	NEUTON	5 mm
R/H Rear Tyre	195/65 R15	NEUTON	5 mm
L/H Rear Tyre	195/65 R15	NEUTON	5 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	11/01/2020	Inspection Date	14/01/2020
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	2 Working Days
-------------------------------------	----------------

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 382S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BUMPER LIP REAR (DISC 25%)	CRUMPLED	228.90	171.68
2	PIXEL STICKER @\$60.00 (SN)	NECESSARY	120.00	120.00
1	ANTENNA, ELECTRICAL LOWER REAR	SERVICEABLE	157.40	-
1	SENSOR REVERSE	SERVICEABLE	180.00	-
1	BUMPER SIDE RETAINER RR/LH	SERVICEABLE	94.80	-
1	BUMPER SIDE RETAINER RR/RH	SERVICEABLE	94.80	-
1	BUMPER SEAL, RR LH	SERVICEABLE	88.90	-
1	BUMPER SEAL, RR RH	SERVICEABLE	65.70	-
1	BUMPER LIP COVER RR/LH	SERVICEABLE	72.20	-
1	BUMPER LIP COVER RR/RH	SERVICEABLE	118.10	-
1	UNDER COVER SUB-ASSY, RR FLOOR	SERVICEABLE	514.50	-
1	UNDER COVER RR SHIELD	SERVICEABLE	63.90	-
10	BUMPER CLIPS @\$2.10	SERVICEABLE	21.00	-
1	BUMPER REINFORCEMENT	SERVICEABLE	205.70	-
1	ARM SUB-ASSY, RR BUMPER RH	SERVICEABLE	139.60	-
1	ARM SUB-ASSY, RR BUMPER LH	SERVICEABLE	139.60	-
1	SPOILER REAR	TO REPAIR SEE LABOUR	953.70	-
1	BUMPER REAR	TO REPAIR SEE LABOUR	458.60	-
			3,717.40	291.68
<u>LABOUR</u>				
PANEL BEATING & BODY WORK. INCLUSIVE OF THE REPAIR OF SPOILER REAR AND BUMPER REAR.			338.00	100.00
SPRAY PAINT.			738.00	300.00
TO REPLACE SUNDRY PARTS.		NOT NECESSARY	100.00	-
TO CHECK WIRING AND SYSTEM FUNCTION.			80.00	20.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM.		NOT NECESSARY	120.00	-
TO WASH AND VACUUM.		NOT NECESSARY	60.00	-
			1,436.00	420.00

Report Ref No. NS/INC20000903/Qqd3e2

GRAND TOTAL		5,153.40	711.68
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)			550.00

Report Ref No. NS/INC20000903/Qqd3e2

OI SUN PIN

Asst. Automotive Assessor



K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,
MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.