

ASS. REC. BY:

REF:

TM1 / (C3) TM1 20000910 / kyf3n2

## ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

05

days

Res.: Yes or No

Lum Sum:

1.13.1

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SHB 7514H

Yr Regn:

05, 19.

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Prius

c.c

1798

Colour

M.B. White / Red

A/C:

Insured / Std / NI / NA

Sp. Reading

121433

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

JTDKB31F4803080810

Gen. Cond:

Good / Fair / Poor / Burnt

Steering:

In order / Jammed / Leaked / Burnt or

Brake:

In order / Jammed / Leaked / Burnt or

Modl:

NII / S/Rim / STD / Rim or

Tyre Size:

F:

195/65R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
TOYO / YOKO or

Giti

Front

Rear

R/Bal.

7

mm

R/Bal.

5

mm

L/Bal.

7

mm

L/Bal.

5

mm

D.O.A.

12/1/20

D.O.I.

14/1/2020

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

5478-65 (Red \$37,824-53,87%)

SHB 7514 H - (C3) / AIG 09026020 / b191

SDB 5533M - X

DOA - 17/11/2009

7/2 Revert Preli by email

RECEIVED 10 FEB 2020

Date/Time, File Pass to?

☐

Preli. Report

1)

☐

Final Report

Date/Time, File Return to?

2)

18/2/20 Typist

Days Of Repair:

5

Resurvey No. of Trip:

2

Survey Fee:

Transportation:

250

Fuel:

Others:

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

TOTAL

261

Report Format:

Lump Sum / I.B.I. (\$

PIP \$5478-65



Auto  
Consultants  
Pte Ltd

51 UBI AVE I, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref:

Date: 07 Feb 2020

Our Ref: CC3/TMI20000910/Kyf3

The Motor Claims Department  
TOKIO MARINE INSURANCE SINGAPORE LTD

Dear Sir/Madam,


**INITIAL INSPECTION REPORT OF VEHICLE NO. SHB7514H .**

Please be informed that we had conducted the inspection of the abovementioned vehicle on 14/01/2020 at the premises of M/s TRANS-CAB AUTO SERVICES PTE LTD. and have the following to report:-

Workshop Estimate Amount	: S\$ <u>43,303.18</u> .
Revised Estimate Amount	: S\$ <u>5,478.65</u> .
"Check" Items Amount	: S\$ <u>-</u> .
Market Value	: S\$ <u>-</u> .
LTA Reimbursement Value	: S\$ <u>-</u> .
Nett Value	: S\$ <u>-</u> .

**Description of Damage:**

The vehicle sustained damages at the rear.

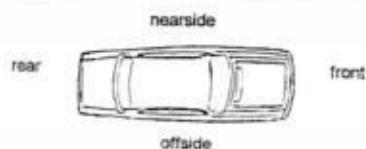

Yours faithfully

KENNETH KONG SENG CHEONG  
Licensed Appraiser

**Yvonne Wong (LKK Auto)**

---

**From:** Yvonne Wong (LKK Auto)  
**Sent:** Friday, February 07, 2020 5:20 PM  
**To:** Motor Claims  
**Subject:** DIRECT SURVEY INSPECTION ON WORKSHOP - TRANS-CAB AUTO SERVICES PTE LTD,  
DOA: 12/01/2020 , SHB7514H (TP VEHICLE), SDB5533M (OI VEHICLE)  
**Attachments:** SHB7514H ESTIMATE.pdf; SHB7514H GIA.pdf; SHB7514H DOA 12012020.pdf

Dear Sir/Madam,

Please be informed that we had inspected the vehicle SHB 7514H at M/s: TRANS-CAB AUTO SERVICES PTE LTD, NO.2 ANG MO KIO ST 63 SINGAPORE 569111 on 14/01/2020.

Enclosed herewith a copy of TP's GIA report and estimated cost of repair will forward to you shortly.

Meanwhile, kindly provide us the claim reference number for our necessary action.

Thank you.

Best Regards,

**Yvonne Wong (Ms) | Case Handler**

**LKK Auto Consultants Pte Ltd**

Phone: 6256-3561 | email: [yvonne.wong@lkkauto.com](mailto:yvonne.wong@lkkauto.com) | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

> Back to OneMotoring

### Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	878K
Vehicle Details	
Vehicle No.:	SHB7514H
Vehicle to be Exported:	Yes
Intended Deregistration Date:	13 Jan 2020
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS 5DR HATCHBACK (AUTO)
Primary Colour:	Red
Manufacturing Year:	2018
Engine No.:	2ZR2C20513
Chassis No.:	JTDKB3FU803080810
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$26,605.00
Original Registration Date:	31 May 2019
First Registration Date:	31 May 2019
Transfer Count:	0
Actual ARF Paid:	\$14,247.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	30 May 2027
PARF Rebate Amount:	\$10,685.00
Intended COE Rebate Details	
COE Expiry Date:	30 May 2027
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$22,309.00
COE Rebate Amount:	\$17,847.00
<b>Total Rebate Amount:</b>	<b>\$28,532.00</b>
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 13 Jan 2020

OK

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	13/01/2020 15:50
Date Of Accident	12/01/2020 13:40
Exact Location Of Accident	THOMSON ROAD TOWARDS UNITED SQUARE OFFICE TOWERS
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB7514H
<b>Insured/Policyholder</b>	
Name Of Registered Owner	TRANS-CAB SERVICES PTE LTD
Co Reg No	2XXXXX878K
Email Address	CLAIMS@TRANSCAB.COM.SG
Mobile Phone No	
Alternative Phone No	OFFICE-62876666

### Vehicle Particulars

Manufacturer	TOYOTA
Model	PRIUS-1.8 HYBRID CVT (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

### Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	THIRD PARTY
Fleet Policy	YES
Policy Number	VFX/P2203857
Cover Note Number	

### Driver

Name of Driver	TAN KIM SAN
NRIC No	SXXXX064J
Date Of Birth	21/01/1959
Occupation	OUTDOOR
Date Of Driving Pass	03/06/1982
Driving Experience	37 YEARS AND 7 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-96335055
Fax Number	
Contact Number	
EEmail Address	NOEMAIL

Address	BLK 525 WOODLANDS DRIVE 14 #11-449
Postcode	730525
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

#### General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

#### Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	3
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	3
Passenger 1	NAME: : JOHN PAN GENDER: : MALE
Passenger 2	NAME: : PAN XU GENDER: : MALE

#### Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Police Station Name	ANG MO KIO NORTH NEIGHBOURHOOD POLICE CENTRE
Police Station Address	ROAD: 51 ANG MO KIO AVE 9 , POSTCODE: 569784 , COUNTRY: SINGAPORE
Police Station Contact	TEL NO: 1800-4849999 - FAX NO: 62181399
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

REFER TO POLICE REPORT T/20200113/2101

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SDB5533M
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	

NRIC/Passport Number  
Contact Number  
Address  
Postcode  
Insurance Company Name  
Nature Of Damage  
No. Of Passenger (Including Driver)

#### DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number SKG1249B  
Vehicle Make/Model/Colour  
Details Of Properties  
Vehicle Category PRIVATE CAR  
Name of Driver  
NRIC/Passport Number  
Contact Number  
Address  
Postcode  
Insurance Company Name  
Nature Of Damage  
No. Of Passenger (Including Driver)

#### DETAILS OF INJURED PERSON 1

Name TAN KIM SAN  
Approximate Age  
Injuries Sustain  
Injured person in which vehicle? SHB7514H  
Were seat belts worn? YES  
Was this injured conveyed to hospital by ambulance? NO  
Address  
Postcode

#### DETAILS OF INJURED PERSON 2

Name PAN XU  
Approximate Age  
Injuries Sustain  
Injured person in which vehicle? SHB7514H  
Were seat belts worn? YES  
Was this injured conveyed to hospital by ambulance? NO  
Address  
Postcode

**SKETCH PLAN**


**IMPORTANT NOTICE**

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims. (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
  - (ii) for complying with requirements under any regulations, laws or court orders.

\_\_\_\_\_  
Policyholder's Signature  
Date & Time:

  
\_\_\_\_\_  
Driver's Signature  
(If driver is not the policyholder)  
Date & Time:

  
\_\_\_\_\_  
Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:



### SKETCH PLAN

**SKETCH PLAN**

THOMSON MEDICAL CTR

Thomson Rd towards United States  
A: SHB 7514H  
B: SDR 5533m  
C: SKG 1249B.

← [A] ← [B] ← [C] ←  
- - - - -  
- - - - -  
- - - - -

THOMSON RD

NOVENA

SHELL

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Refer to Police Report T/20200113/2101

## DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature  
Date & Time:

Driver's Signature  
(If driver is not the policyholder)  
Date & Time:

Zhai  
Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:



# SINGAPORE POLICE FORCE



T/20200113/2101

1 of 3

Police Station Of Origin:  
Ang Mo Kio North N.P.C  
51 Ang Mo Kio Avenue 9 SINGAPORE  
569784  
Tel No: 1800-4849999

Report No. T/20200113/2101

**REPORT OF A TRAFFIC ACCIDENT**

Date/Time Report Made: 13/01/2020 15:15	Vide Report No.:	Station Diary No.: 64
--	------------------	--------------------------

**Informant's Particulars**

Name of Informant: TAN KIM SAN			Address: APT BLK 525 WOODLANDS DRIVE 14 #11-449 SINGAPORE 730525		
ID Type / ID No.: NRIC NO / S1343064J			Contact No.: Home/Office: Mobile: 96335055		
Nationality: SINGAPORE CITIZEN			Email:		
Sex: Male	Age: 60	Date of Birth: 21/01/1959	Type of Informant: Driver		
Race: Chinese			Language:		Institution / School Name:
Occupation: Taxi driver			Driving Licence Information: Class: 3 Date of Expiry:		

**General Information of the Accident**

General Information of the Accident:				
Type of Accident:	Injury Others	Drink Drive: No	Date/Time of Accident: 12/01/2020 13:40	Type of Location: Straight Road
Location: Along Road 1 THOMSON ROAD				
Thomson road towards United Square office towers near Shell.				
Weather: Clear		Road Surface: Dry		Road Speed Limit:
Traffic Flow:		Traffic Control:		Traffic Volume: Moderate
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: No

**Details of Vehicle Involved**

Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
SDB5533M	Car					0
SHB7514H	Taxi				Slightly Damaged	2
SKG1249B	Car					0



# SINGAPORE POLICE FORCE



T/20200113/2101

2 of 3

Police Station Of Origin:  
Ang Mo Kio North N.P.C  
51 Ang Mo Kio Avenue 9 SINGAPORE  
569784  
Tel No: 1800-4849999

Report No. T/20200113/2101

## CONTINUATION OF REPORT

Details of Person Involved			
Any Pedestrian Involved: No			
No. of Pedestrians Injured: NIL		Use of Pedestrian Crossing: NA	
Driver			
Name	TAN KIM SAN	ID No.	S1343064J
Related Vehicle	SHB7514H (Taxi)	Contact No.	96335055
Hospital/Clinic	MEDIPOINT MEDICAL CENTRE (WOODLANDS BRANCH)	Class of Driving Licence & Expiry Date	Class: 3 Date of Expiry: NIL
Date Treatment	13/01/2020	Date Discharge	13/01/2020
No. of Days granted Medical Leave	03	Degree of Injury	Slight

### Brief Details.

On 12/1/2020 at about 1340hrs, I was driving Transcab of plate number SHB7514H with two passengers (Pan Xu - HP:98239419 and John Pan) on board from Thomson Road towards United Square office towers, somewhere near to Shell station. I was travelling on the extreme right lane. As the car in front of mine was slowing down, I was also slowing down to prepare to stop. Before my taxi stopped, a vehicle of plate number SDB5533M knocked onto the rear of my taxi. The vehicle SKG1249B which was behind vehicle SDB5533M also knocked onto her vehicle. I made a check of my passengers and they informed that they were fine. After exchanging particulars, the vehicle SKG1249B left the scene. The driver of vehicle SDB5533M and myself with my passengers then proceed to the nearby Shell as the driver called her daughter down to speak with me. After we settled about the settlement through Insurance claiming, my passenger John Pan informed that his son was not feeling well. As such, I fetched them to Tan Tock Seng hospital as requested by him.

On 13/1/2020, as I felt numb on my neck and both legs, I went to Medipoint Medical centre to see a doctor and was given three days medical certificate (MC) from 13/1/2020 to 15/1/2020.

I am lodging this traffic report for assistance.



**SINGAPORE  
POLICE FORCE**



T/20200113/2101

3 of 3

Police Station Of Origin:  
Ang Mo Kio North N.P.C  
51 Ang Mo Kio Avenue 9 SINGAPORE  
569784  
Tel No: 1800-4849999

Report No. T/20200113/2101

**CONTINUATION OF REPORT**

**Sketch Plan**

Informant is not able to provide sketch plan

**IMPORTANT:** Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the **report number** as reference.

Signature Of Officer Recording The Report:

F /

Sgt 2 TAN CHING LIN

Signature Of Interpreter:

Not applicable

Officer In Charge Of Case:

TP / AEIT /

SSI 2 JUREMAH BINTE AHMAD

Contact No.: 65476219

Signature Of Informant:

Date/Time:

13/01/2020 15:15

Classification Of Case:

Authentication Stamp

NP168

**Trans-cab Auto Services Pte Ltd**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHB 7514H**

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration:

**PART**

- 1 REAR BUMPER
- 1 REAR BUMPER RE-INFORCEMENT
- 1 REAR BUMPER TOWING COVER
- 1 REAR BUMPER UNDER COVER (BLACK)
- 1 REAR BUMPER SIDE RETAINER LH
- 1 REAR BUMPER SIDE RETAINER RH
- 1 SEAL, REAR BUMPER SIDE, LH
- 1 SEAL, REAR BUMPER SIDE, RH
- 1 REAR TAILGATE
- 1 REAR TAILGATE OUTER GARNISH
- 1 ANTENNA, ELECTRICAL KEY
- 1 GARNISH, BACK DOOR SIDE, LH
- 1 GARNISH, BACK DOOR SIDE, RH
- 1 MOULDING, BACK DOOR OUTSIDE GARNISH, LOWER RH
- 1 MOULDING, BACK DOOR OUTSIDE GARNISH, LOWER LH
- 1 BOARD ASSY, BACK DOOR TRIM
- 1 REAR TAILGATE WEATHERSTRIP
- 1 COVER, BACK DOOR LOCK
- 1 LOCK ASSY, BACK DOOR, W/COURTESY LAMP SWITCH
- 1 SWITCH ASSY, BACK DOOR OPENER
- 1 SPOILER, SUB ASSY, REAR
- 1 STRIKER ASSY, BACK DOOR LOCK
- 1 PANEL SUB-ASSY, BODY LOWER BACK
- 1 TAILLAMP LOWER RH
- 1 TAILLAMP UPPER RH
- 1 REAR BUMPER SIDE RH
- 1 REAR BUMPER SIDE LH
- 1 TAILLAMP LOWER LH

**AAD2001-112**

*Not Authorise  
Resony B4 pain*

**SHB 7514H**

JTDKB3FU803080810

TOYOTA

PRIUS

12.1.2020

**TOKIO MARINE**

31/5/2019

**LIST**

\$	<i>B</i>	442.60	✓
\$	<i>B</i>	332.70	✓
\$	<i>SL</i>	15.40	X
\$	<i>B</i>	576.30	✓
\$	<i>SL</i>	116.50	X
\$	<i>SL</i>	117.70	X
\$	<i>SL</i>	88.50	X
\$	<i>SL</i>	88.50	X
\$	<i>Bu</i>	1,147.80	✓
\$	<i>CM</i>	925.60	✓
\$	<i>SL</i>	72.00	} X
\$	<i>SL</i>	95.60	
\$	<i>SL</i>	95.60	
\$	<i>SL</i>	56.50	
\$	<i>SL</i>	56.50	
\$	<i>SL</i>	259.20	
\$	<i>SL</i>	372.30	
\$	<i>SL</i>	30.20	
\$	<i>SL</i>	467.00	
\$	<i>SL</i>	179.10	
\$	<i>SL</i>	1,575.40	}
\$	<i>R</i>	25.80	
\$	<i>B</i>	650.30	✓
\$	<i>SL</i>	502.00	X
\$	<i>SL</i>	451.80	X
\$	<i>SL</i>	123.70	X
\$	<i>myent</i>	123.70	✓
\$	<i>SL</i>	502.00	X

**Trans-cab Auto Services Pte Ltd****AAD2001-112**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHB 7514H**

1	TAILLAMP UPPER LH	\$	Su	443.30
1	REAR FENDER LH	\$	N	871.50
1	LINER, REAR WHEEL HOUSE, LH	\$	Su	139.80
1	DUCT ASSY, QUARTER VENT, LH	\$	Su	67.00
1	DUCT ASSY, QUARTER VENT, RH	\$	Su	67.00
1	REAR FENDER RH	\$	N	871.50
1	LINER, REAR WHEEL HOUSE, RH	\$	N	139.80
1	BOARD, BACK DOOR TRIM	\$	Su	225.20
1	PANEL ASSY, DECK TRIM SIDE, RH	\$	Su	355.90
1	PANEL ASSY, DECK TRIM SIDE, LH	\$	Su	355.90
1	COVER, FLOOR UNDER, NO.1	\$	Su	175.10
1	COVER, FLOOR UNDER, NO.2	\$	Su	241.90
1	COVER, REAR FLOOR	\$	Su	229.90
1	COVER, DECK TRIM, REAR	\$	Su	126.70
1	BOARD, REAR FLOOR, NO.1	\$	N	519.00
1	BOX, DECK FLOOR, RH	\$	N	313.60
1	BOX, DECK FLOOR, LH	\$	N	313.00
1	BOX, DECK FLOOR, REAR	\$	Su	105.80
1	PAN, REAR FLOOR	\$	N	583.40
1	EXTENSION, REAR FLOOR SIDE PANEL, RH	\$	N	78.30
1	EXTENSION, REAR FLOOR PAN TO QUARTER PANEL, RH	\$	Su	196.50
1	EXTENSION, REAR FLOOR SIDE PANEL, LH	\$	Su	78.30
1	EXTENSION, REAR FLOOR PAN TO QUARTER PANEL, LH	\$	Su	196.50
1	PIPE ASSY, EXHAUST, TAIL	\$	N	1,655.40
1	TROUGH, BACK DOOR OPENING, LH	\$	Su	103.40
1	STAY ASSY, BACK DOOR, LH	\$	Su	242.50
1	STAY ASSY, BACK DOOR, RH	\$	Su	242.50
1	WIRE, BACK DOOR, NO.2	\$	Su	294.40
1	WIRE, LUGGAGE ROOM, NO.3	\$	Su	170.70
1	WIRE, BACK DOOR, NO.1	\$	Su	247.40
1	SOCKET & WIRE SUB ASSY, REAR COMBINATION LAMP, LH	\$	Su	63.30
1	SOCKET & WIRE SUB ASSY, REAR COMBINATION LAMP, RH	\$	Su	63.30

<b>TOTAL</b>	<b>\$</b>	<b>19,268.10</b>
<b>25%</b>	<b>\$</b>	<b>4,817.03</b>
	<b>\$</b>	<b>14,451.08</b>

**Trans-cab Auto Services Pte Ltd****AAD2001-112**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHB 7514H****Special Nett**

1SET PARKING AID	\$	nd 700.00	220sa
1SET REAR BUMPER CLIP	\$	na 66.00	—
2 REAR WINDSCREEN SEALANT	\$	na 80.00	40sa
1 WINDSCREEN MOULDING	\$	na 100.00	—
1 REAR WINDSCREEN INNER SPONGE SEAL	\$	na 100.00	30sa
1 REAR TAILGATE TOYOTA LOGO	\$	na 47.00	—
1 REAR TAILGATE WORDING 'PRIUS'	\$	na 52.90	—
1 REAR TAILGATE WORDING 'HYBRID'	\$	na 53.50	—
1 REAR TAILGATE STICKER 'TRANS-CAB'	\$	na 80.00	30sa
1 REAR TAILGATE STICKER '6555-3333'	\$	na 80.00	30sa
1 REAR BUMPER PROTECTOR	\$	na 100.00	X
1 REAR LH WHEEL RIM	\$	sa 1,879.40	}
1 REAR LH WHEEL RIM COVER	\$	sa 211.50	
1 SPARE WHEEL RIM	\$	sa 1,879.40	
1 SPARE WHEEL RIM COVER	\$	sa 211.50	
1SET REAR RH FENDER LINER CLIP	\$	na 35.00	
1 REAR LH TYRE 195/65/15	\$	sa 350.00	
1 REAR NUMBER PLATE WITH MOULDING	\$	sa 200.00	
1 SPARE TYRE 195/65/15	\$	sa 350.00	
1SET REAR BUMPER RETAINER LH CLIP	\$	na 30.00	
1SET REAR BUMPER RETAINER RH CLIP	\$	na 30.00	
1SET REAR LH FENDER LINER CLIP	\$	na 35.00	}
1 REAR RH TYRE 195/65/15	\$	sa 350.00	
1 REAR RH WHEEL RIM	\$	sa 1,879.40	
1 REAR RH WHEEL RIM COVER	\$	sa 211.50	
1SET REAR FLOOR UNDER COVER CLIP	\$	na 35.00	
1SET REAR FENDER LINER SCREW	\$	na 30.00	}
1SET EXHAUST PIPE SUPPORT	\$	na 100.00	
1 EXHAUST PIPE GASKET	\$	na 55.00	
<b>TOTAL</b>	<b>\$</b>	<b>9,332.10</b>	

**TOTAL PARTS \$ 23,783.18****LABOUR**

To check steering geometry and computer wheel alignment

\$ na 220.00 X



**Trans-cab Auto Services Pte Ltd**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHB 7514H****AAD2001-112**

To transfer of Tailgate fittings, attachments and perform water seepage test.	\$	170.00	601
To transfer of rear end panel fittings, attachment and perform water seepage test.	\$	170.00	601
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	7,500.00	601
To transfer of Rear Bumper fittings, attachments and perform water seepage test.	\$	170.00	X
To transfer of rear windscreen glass to facilitate bodywork repair.	\$	170.00	1201
To Rust-Proofing Of The Affected Areas.	\$	170.00	301
To reinstall rear bumper parking sensor.	\$	170.00	501
Putty And Spray Painting Of The Affected Portion.	\$	7,500.00	7201
To transfer of rear fender fittings, attachment and perform water seepage test.	\$	380.00	X
To supply and re-do rear luggage floor panel insulation padding.	\$	380.00	X
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	380.00	X
To transfer of rear luggage floor panel fittings, attachment and perform water seepage test.	\$	170.00	X
Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.	\$	380.00	X



**Trans-cab Auto Services Pte Ltd****AAD2001-112**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHB 7514H**

To repair and realign rear exhaust pipe.	\$	170.00	X
To Check Electrical Lighting Concerned.	\$	170.00	201
To transfer of tire, rim and on wheel balancing.	\$	170.00	X
To drop rear exhaust box, renew the same, to repair and realign centre exhaust pipe.	\$	170.00	X
To pull and jack out chassis frame and correct it to symmetrical position with the aid of hydraulic pneumatic jack.	\$	380.00	X
Towing Fees	\$	150.00	X
To supply and re-do rear end panel insulation padding.	\$	380.00	X
<b>TOTAL</b>	<b>\$</b>	<b>19,520.00</b>	
<b>Over All Total</b>	<b>\$</b>	<b>43,303.18</b>	

**(PART-BY-PART) Repair Days****25 Days****5 days**

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer:

Signature:

Date:

## LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC3/TMI20000910/KYF3N2  
Date: 19/02/2020

## REFERENCE

Handling Insurer: Tokio Marine Insurance Singapore Ltd Policy No: MU006244  
Claimant Vehicle No: SHB7514H Insured Vehicle No: SDB5533M  
Date of Loss: 12/01/2020 Nature of Claim: TP Claim No: M2000330

## DESCRIPTION &amp; IDENTIFICATION OF VEHICLE

Reg No: SHB7514H Engine No: 2ZR2C20513  
Make & Model: TOYOTA PRIUS, 1.8 HYBRID CVT (A) Chassis No: JTDKB3FU803080810  
Reg. Date: 31/05/2019 (Man. Year: 2018) Odometer: 121433 km  
Colour: Metallic White/Red  
Engine Capacity: 1798 cc  
Market Value/New Car Price: N/A  
Sum Insured (S\$): Market Value/New Car Price

## CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes  
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

## CONDITION OF TYRES

Front Tyre Size: 195/65R15 Rear Tyre Size: 195/65R15  
Front Left Side: Giti 7 mm Rear Left Side: Giti 5 mm  
Front Right Side: Giti 7 mm Rear Right Side: Giti 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	23,783.17	3,818.65	19,964.52	83.94
Miscellaneous Items	0.00	0.00	0.00	
Labour	19,520.00	1,660.00	17,860.00	91.50
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Gross Total (S\$)</b>	<b>43,303.17</b>	<b>5,478.65</b>	<b>37,824.52</b>	<b>87.35</b>
<b>+ GST 7.00/7.00% (S\$)</b>	<b>3,031.22</b>	<b>383.51</b>	<b>2,647.71</b>	<b>87.35</b>
<b>Nett Amount (S\$)</b>	<b>46,334.39</b>	<b>5,862.16</b>	<b>40,472.23</b>	<b>87.35</b>

## INSPECTION

Date of Assignment: 10/02/2020  
Date Inspected: 14/01/2020 Inspected At: Trans Cab Auto Services Pte Ltd - Amk (HQ)  
Estimated Period of Repair: 5.0 days No 2 Ang Mo Kio St 63  
Singapore 569111

Adjuster: KENNETH KONG

Manager: YVONNE WONG YIN CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

## REPAIR DETAILS

## Reference

<b>Part Source:</b>	MRM-SG	Version: 1.0 (Last Synchronised: 19 Feb 2020)
<b>Parts:</b>	144	TOYOTA PRIUS 1.8 HYBRID CVT (A) (Catalogue:Merimen Singapore 1.0)
<b>Labour:</b>	Repairer's	(Price-denominated Standard List)
<b>Print Code:</b>	(Unsubmitted, no print-code for SHB7514H)	
<b>Validity:</b>	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
<b>Further Info:</b>	Items/values not in reference catalogue are prefixed with an asterisk *.	

## Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Reference	Amount
1	1		*REAR BUMPER	Bent	442.60 FL	-	*442.60 FL
2	1		*REAR BUMPER RE-INFORCEMENT	Bent	332.70 FL	-	*332.70 FL
3	1		*REAR BUMPER TOWING COVER	Serviceable	15.40 FL	-	*- FL
4	1		*REAR BUMPER UNDER COVER (BLACK)	Bent	576.30 FL	-	*576.30 FL
5	1		*REAR BUMPER SIDE RETAINER LH	Serviceable	116.50 FL	-	*- FL
6	1		*REAR BUMPER SIDE RETAINER RH	Serviceable	117.70 FL	-	*- FL
7	1		*SEAL,REAR BUMPER SIDE,LH	Serviceable	88.50 FL	-	*- FL
8	1		*SEAL,REAR BUMPER SIDE,RH	Serviceable	88.50 FL	-	*- FL
9	1		*REAR TAILGATE	Buckled	1,147.80 FL	-	*1,147.80 FL
10	1		*REAR TAILGATE OUTER GARNISH	Cracked	925.60 FL	-	*925.60 FL
11	1		*ANTENNA,ELECTRICAL KEY	Serviceable	72.00 FL	-	*- FL
12	1		*GARNISH,BACK DOOR SIDE,LH	Serviceable	95.60 FL	-	*- FL
13	1		*GARNISH,BACK DOOR SIDE,RH	Serviceable	95.60 FL	-	*- FL
14	1		*MOULDING,BACK DOOR OUTSIDE GARNISH,LOWER RH	Serviceable	56.50 FL	-	*- FL
15	1		*MOULDING,BACK DOOR OUTSIDE GARNISH,LOWER LH	Serviceable	56.50 FL	-	*- FL
16	1		*BOARD ASSY,BACK DOOR TRIM	Serviceable	259.20 FL	-	*- FL
17	1		*REAR TAILGATE WEATHERSTRIP	Serviceable	372.30 FL	-	*- FL
18	1		*COVER,BACK DOOR LOCK	Serviceable	30.20 FL	-	*- FL
19	1		*LOCK ASSY,BACK DOOR,W/COURTESY LAMP SWITCH	Serviceable	467.00 FL	-	*- FL
20	1		*SWITCH ASSY,BACK DOOR OPENER	Serviceable	179.10 FL	-	*- FL
21	1		*SPOILER,SUB ASSY,REAR	Serviceable	1,575.40 FL	-	*- FL
22	1		*STRIKER ASSY,BACK DOOR LOCK	Repair	25.80 FL	-	*- FL
23	1		*PANEL SUB-ASSY,BODY LOWER BACK	Bent	650.30 FL	-	*650.30 FL
24	1		*TAILLAMP LOWER RH	Serviceable	502.00 FL	-	*- FL
25	1		*TAILLAMP UPPER RH	Serviceable	451.80 FL	-	*- FL
26	1		*REAR BUMPER SIDE RH	Serviceable	123.70 FL	-	*- FL
27	1		*REAR BUMPER SIDE LH	Mtg Cracked	123.70 FL	-	*123.70 FL
28	1		*TAILLAMP LOWER LH	Serviceable	502.00 FL	-	*- FL
29	1		*TAILLAMP UPPER LH	Serviceable	443.30 FL	-	*- FL
30	1		*REAR FENDER LH	Repair	871.50 FL	-	*- FL
31	1		*LINER,REAR WHEEL HOUSE,LH	Serviceable	139.80 FL	-	*- FL
32	1		*DUCT ASSY,QUARTER VENT,LH	Serviceable	67.00 FL	-	*- FL
33	1		*DUCT ASSY,QUARTER VENT,RH	Serviceable	67.00 FL	-	*- FL
34	1		*REAR FENDER RH	Repair	871.50 FL	-	*- FL
35	1		*LINER,REAR WHEEL HOUSE,RH	Repair	139.80 FL	-	*- FL
36	1		*BOARD,BACK DOOR TRIM	Serviceable	225.20 FL	-	*- FL
37	1		*PANEL ASSY,DECK TRIM SIDE,RH	Serviceable	355.90 FL	-	*- FL
38	1		*PANEL ASSY,DECK TRIM SIDE,LH	Serviceable	355.90 FL	-	*- FL
39	1		*COVER FLOOR UNDER,NO 1	Serviceable	175.10 FL	-	*- FL
40	1		*COVER FLOOR UNDER,NO 2	Serviceable	241.90 FL	-	*- FL
41	1		*COVER,REAR FLOOR	Serviceable	229.90 FL	-	*- FL
42	1		*COVER,DECK TRIM,REAR	Serviceable	126.70 FL	-	*- FL
43	1		*BOARD,REAR FLOOR,NO 1	Repair	519.00 FL	-	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Reference	Amount
44	1		*BOX,DECK FLOOR,RH	Repair	313.60 FL	-	*-FL
45	1		*BOX,DECK FLOOR,LH	Repair	313.00 FL	-	*-FL
46	1		*BOX,DECK FLOOR,REAR	Serviceable	105.80 FL	-	*-FL
47	1		*PAN,REAR FLOOR	Repair	583.40 FL	-	*-FL
48	1		*EXTENSION,REAR FLOOR SIDE PANEL,RH	Repair	78.30 FL	-	*-FL
49	1		*EXTENSION,REAR FLOOR PAN TO QUARTER PANEL,RH	Serviceable	196.50 FL	-	*-FL
50	1		*EXTENSION,REAR FLOOR SIDE PANEL,LH	Serviceable	78.30 FL	-	*-FL
51	1		*EXTENSION,REAR FLOOR PAN TO QUARTER PANEL,LH	Serviceable	196.50 FL	-	*-FL
52	1		*PIPE ASSY,EXHAUST,TAIL	Repair	1,655.40 FL	-	*-FL
53	1		*TROUGH,BACK DOOR OPENING,LH	Serviceable	103.40 FL	-	*-FL
54	1		*STAY ASSY,BACK DOOR,LH	Serviceable	242.50 FL	-	*-FL
55	1		*STAY ASSY,BACK DOOR,RH	Serviceable	242.50 FL	-	*-FL
56	1		*WIRE,BACK DOOR,NO 2	Serviceable	294.40 FL	-	*-FL
57	1		*WIRE,LUGGAGE ROOM,NO 3	Serviceable	170.70 FL	-	*-FL
58	1		*WIRE,BACK DOOR,NO 1	Serviceable	247.40 FL	-	*-FL
59	1		*SOCKET & WIRE SUB ASSY,REAR COMBINATION LAMP,LH	Serviceable	63.30 FL	-	*-FL
60	1		*SOCKET & WIRE SUB ASSY,REAR COMBINATION LAMP,RH	Serviceable	63.30 FL	-	*-FL
61	1		*SET PARKING AID	Dented	700.00 FS	-	*220.00 FS
62	1		*SET REAR BUMPER CLIP	Necessary	66.00 FS	-	*66.00 FS
63	2		*REAR WINDSCREEN SEALANT	Necessary	80.00 FS	-	*40.00 FS
64	1		*WINDSCREEN MOULDING	Necessary	100.00 FS	-	*100.00 FS
65	1		*REAR WINDSCREEN INNER SPONGE SEAL	Necessary	100.00 FS	-	*30.00 FS
66	1		*REAR TAILGATE TOYOTA LOGO	Necessary	47.00 FS	-	*47.00 FS
67	1		*REAR TAILGATE WORDING PRIUS	Necessary	52.90 FS	-	*52.90 FS
68	1		*REAR TAILGATE WORDING HYBRID	Necessary	53.50 FS	-	*53.50 FS
69	1		*REAR TAILGATE STICKER TRANS-CAB	Necessary	80.00 FS	-	*30.00 FS
70	1		*REAR TAILGATE STICKER 6555-3333	Necessary	80.00 FS	-	*30.00 FS
71	1		*REAR BUMPER PROTECTOR	Not Necessary	100.00 FS	-	*-FS
72	1		*REAR LH WHEEL RIM	Serviceable	1,879.40 FS	-	*-FS
73	1		*REAR LH WHEEL RIM COVER	Serviceable	211.50 FS	-	*-FS
74	1		*SPARE WHEEL RIM	Serviceable	1,879.40 FS	-	*-FS
75	1		*SPARE WHEEL RIM COVER	Serviceable	211.50 FS	-	*-FS
76	1		*SET REAR RH FENDER LINER CLIP	Not Necessary	35.00 FS	-	*-FS
77	1		*REAR LH TYRE 195/65/15	Serviceable	350.00 FS	-	*-FS
78	1		*REAR NUMBER PLATE WITH MOULDING	Serviceable	200.00 FS	-	*-FS
79	1		*SPARE TYRE 195/65/15	Serviceable	350.00 FS	-	*-FS
80	1		*SET REAR BUMPER RETAINER LH CLIP	Not Necessary	30.00 FS	-	*-FS
81	1		*SET REAR BUMPER RETAINER RH CLIP	Not Necessary	30.00 FS	-	*-FS
82	1		*SET REAR LH FENDER LINER CLIP	Not Necessary	35.00 FS	-	*-FS
83	1		*REAR RH TYRE 195/65/15	Serviceable	350.00 FS	-	*-FS
84	1		*REAR RH WHEEL RIM	Serviceable	1,879.40 FS	-	*-FS
85	1		*REAR RH WHEEL RIM COVER	Serviceable	211.50 FS	-	*-FS
86	1		*SET REAR FLOOR UNDER COVER CLIP	Not Necessary	35.00 FS	-	*-FS
87	1		*SET REAR FENDER LINER SCREW	Not Necessary	30.00 FS	-	*-FS
88	1		*SET EXHAUST PIPE SUPPORT	Not Necessary	100.00 FS	-	*-FS
89	1		*EXHAUST PIPE GASKET	Not Necessary	55.00 FS	-	*-FS

F=Franchise part. S=SpcNett, L=ListItemDisc.

Sub Total (S\$) 28,600.20 4,868.40

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Reference	Amount
- List Item Discount on L Items 25.00/25.00% (S\$)					4,817.03	1,049.75	
Total Parts (S\$)					23,783.17		3,818.65

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT	New	220.00	0.00
2	TO TRANSFER OF TAILGATE FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST	New	170.00	60.00
3	TO TRANSFER OF REAR END PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST	New	170.00	60.00
4	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME	New	7,500.00	600.00
5	TO TRANSFER OF REAR BUMPER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST	New	170.00	0.00
6	TO TRANSFER OF REAR WINDSCREEN GLASS TO FACILITATE BODYWORK REPAIR	New	170.00	120.00
7	TO RUST-PROOFING OF THE AFFECTED AREAS	New	170.00	30.00
8	TO REINSTALL REAR BUMPER PARKING SENSOR	New	170.00	50.00
9	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION	New	7,500.00	720.00
10	TO TRANSFER OF REAR FENDER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST	New	380.00	0.00
11	TO SUPPLY AND RE-DO REAR LUGGAGE FLOOR PANEL INSULATION PADDING	New	380.00	0.00
12	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR	New	380.00	0.00
13	TO TRANSFER OF REAR LUGGAGE FLOOR PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST	New	170.00	0.00
14	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH, TO FACILITATE REPAIR	New	380.00	0.00
15	TO REPAIR AND REALIGN REAR EXHAUST PIPE	New	170.00	0.00
16	TO CHECK ELECTRICAL LIGHTING CONCERNED	New	170.00	20.00
17	TO DROP REAR EXHAUST BOX, RENEW THE SAME, TO REPAIR AND REALIGN CENTRE EXHAUST PIPE	New	170.00	0.00
18	TO PULL AND JACK OUT CHASSIS FRAME AND CORRECT IT TO SYMMETRICAL POSITION WITH THE AID OF HYDRAULIC PNEUMATIC JACK	New	380.00	0.00
19	TOWING FEES	New	150.00	0.00
20	TO SUPPLY AND RE-DO REAR END PANEL INSULATION PADDING	New	380.00	0.00
21	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING	New	170.00	0.00
<b>Gross Labour Cost (S\$)</b>			<b>19,520.00</b>	<b>1,660.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >