

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel: 6366 2323 Fax: 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

WIP: 27532

Telefax

Estimate	:	Accident Repairs
Workshop	:	Ubi Road 1
Contact No	:	6366 2323
Fax No	:	6841 1183
Reference	:	PA/OD/0107/2020/NS
Date	:	24-Jan-20

Vehicle NOT IN workshop. Please arrange for survey

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name	:	Mr Tan Choon Heng
Address	:	133 Serangoon Avenue 3 #03-09 Singapore 556113
Telephone	:	HP +65 97869681
Type of Claim	:	Own Damage Claims
Policy No.	:	1900163619
Vehicle No	:	EY 6262 E
Model Code	:	Audi A4 Sedan 2.0 TFSI 8W
Model / Year	:	Sep-19
Engine No	:	CVK 081954
Chassis No	:	WAUZZZF42KA073683
Mileage	:	-
Date In	:	-
Estimated By	:	Johnny Boo / Allan Wu
Accident Date	:	23-Jan-20
Place of Accident	:	CTE To Ang Mo Kio Ave 1

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle EY 6262 E

S/N Nature of Jobs	Estimated Charges	Surveyor's Recommendations
1 To tow vehicle from scene of accident.	S/N \$ 280.00	X
2 To remove, check and reinstall front wire harness for headlights, horns, outside temperature sensor, headlight washer assy and front parking aid.	S/N \$ 480.00	✓
3 To remove and renew aircond condenser and radiator. And charged air cooler. Check electrical fans and control unit. Pressurise cooling system. To carry out vacuum and regas.	S/N \$ 1,200.00	✓
4 To dismantle lhs front door panel trim. To remove and reinstall lhs wing mirror assy.	S/N \$ 350.00	X
SUB TOTAL LABOUR CHARGES		: <u>\$ 2,310.00</u>

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle EY 6262 E

S/N	Nature of Jobs	Estimated Charges	Surveyor's Recommendations
5	To dismantle and renew front bumper, rhs front fender, bonnet and both headlights. To renew front lock carrier and align to position. Re-organise crash management components. Reinstall all parts removed.	\$ 5,250.00	3250 ✓
6	To respray front bumper, rhs front fender, lhs front fender, bonnet, hinges, both A-upper pillars and lhs front door.	\$ 5,600.00	2200 ✓
7	To carry out diagnostic check.	S/N \$ 192.00	✓
TOTAL LABOUR CHARGES		: \$ 13,352.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. EY 6262 E

S/N	Parts Description	Damage Parts & Prices		
		S/Nett	Remarks	
1	FRONT BUMPER <i>Det A</i>	S	2,068.00	1654.40
2	FRONT BUMPER FIXING PARTS <i>not nec</i>	S	553.00	
3	FRONT BUMPER SECURING STRIP <i>Not nec</i>	2 S	67.00	X
4	FRONT BUMPER GRILLE - CENTRE <i>not nec</i>	S	185.00	147.60
5	FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE <i>not nec</i>	S	198.00	
6	FRONT BUMPER AIR GUIDE - LH / RH <i>not nec</i>	2 S	118.00	
7	RADIATOR GRILLE <i>not nec</i>	S	2,058.00	1646.40
8	FRONT BUMPER AIR GUIDE GRILLE - LH / RH <i>not nec</i>	2 S	688.00	275.20
9	FRONT BUMPER CARRIER <i>not nec</i>	S	757.00	605.20
10	FRONT BUMPER FOAM FILLER PIECE <i>not nec</i>	S	117.00	93.60
11	FRONT BUMPER COVER <i>not nec</i>	S	120.00	96
12	FRONT BUMPER GUIDE SECTION - LH <i>not nec</i>	S	34.00	
13	FRONT BUMPER GUIDE SECTION - RH <i>not nec</i>	S	36.00	
14	LOCK CARRIER <i>not nec</i>	S	129.00	103.20
15	FRONT BUMPER SUPPORT - LH / RH <i>not nec</i>	2 S	54.00	42.24
16	CAUTION SIGN STICKER <i>not nec</i>	NEC S	13.00	10.24
17	AIRCON STICKER <i>not nec</i>	NEC S	7.00	5.36
18	EXTERNAL TEMPERATURE SENSOR <i>not nec</i>	S	55.00	X
19	TEMPERATURE SENSOR BRACKET <i>not nec</i>	S	18.00	13.68
20	HORN - LH HIGH TONE <i>not nec</i>	S	38.00	X
SUB TOTAL SPARE PARTS CHARGES		:	<u>\$ 7,313.00</u>	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. EY 6262 E

S/N	Parts Description	Damage Parts & Prices		Remarks
		S/Nett		
21	HORN - RH LOW TONE <i>Not nec</i>	\$	270.00	X
22	SPRING SHACKLE - LH / RH <i>Not nec</i>	2 \$	54.00	X
23	FRONT PARKING AID SENSOR - INNER / OUTER	2	TBC	
24	FRONT PARKING AID SEAL RING	4 \$	14.00	
25	FRONT FENDER - RH <i>Bubbled</i>	\$	722.00	577.60
26	FRONT FENDER ATTACHMENT PARTS <i>Not nec</i>	\$	190.00	X
27	FRONT FENDER CLOSING ELEMENT - RH <i>Not nec</i>	\$	47.00	37.28
28	FRONT FENDER BRACKET - RH	\$	33.00	
29	FRONT FENDER DEFORMATION ELEMENT BRACKET - RH	\$	46.00	
30	FRONT FENDER BRACE - RH <i>Not nec</i>	\$	112.00	
31	FRONT WHEEL HOUSING LINER - RH	\$	228.00	
32	WHEEL HOUSING LINER ATTACHMENT PARTS	\$	219.00	
33	FRONT WHEEL SPOILER - RH <i>Not nec</i>	\$	69.00	
34	WHEEL SPOILER TRIM - RH	\$	34.00	
35	STONE CHIP GUARD - RH <i>Not nec</i>	\$	48.00	37.92
36	BONNET <i>Dented</i>	\$	2,634.00	2107.20
37	BONNET ATTACHMENT PARTS <i>Not nec</i>	\$	388.00	X
38	BONNET LID HINGE - LH / RH	2 \$	574.00	
39	BONNET IMPACT PROTECTION - CENTRE	\$	26.00	20.56
40	BONNET IMPACT PROTECTION - RH	\$	26.00	20.56 ✓
SUB TOTAL SPARE PARTS CHARGES		:	<u>\$ 5,734.00</u>	

Premium Automobiles

11, 12, 13 Road, Singapore 408600
Tel: 6399 2123 Fax: 6341 1183

Telefax

Material List for Accident Vehicle Regn No. EY 6262 E

S/N	Parts Description	Damage Parts & Prices	
		S/Nett	Remarks
41	BONNET IMPACT PROTECTION - LH	5	26.00 20.80 ✓
42	FENDER LEDGE COVER - RH <i>Not nec</i>	5	29.00 X
43	FENDER LEDGE TOP COVER <i>Not nec</i>	5	21.00 X
44	BONNET GAS FILLED STRUT	2 5	224.00
45	BONNET STRIKER - LH / RH	2 5	94.00
46	BONNET LID LOCK	2 5	403.00
47	BONNET BOWDEN CABLE - CENTRE <i>changed</i>	5	54.00 43.20 ✓
48	BONNET BOWDEN CABLE <i>cut Not nec</i>	5	54.00 X
49	BONNET RELEASE LEVER <i>Not nec</i>	5	13.00 X
50	BONNET LID LOCK CABLE	5	69.00
51	PLENUM CHAMBER COVER	5	92.00
52	BONNET SOUND ABSORBER	5	323.00
53	LED HEADLIGHT - LH / RH	2 5	14,642.00 11713.60
54	MAIN LIGHT ELECTRONIC POWER MODULE <i>short</i>	5	732.00 585.20
55	LIGHT CONTROL SYSTEM CONTROL UNIT <i>all short</i>	5	707.00 565.60
56	HEADLIGHT HOSE - LH	5	34.00
57	HEADLAMP ASSEMBLY SPACER <i>Not nec</i>	2 5	75.00 X
58	HEADLAMP ASSEMBLY SPACER <i>Not nec</i>	2 5	79.00 X
59	LIFT CYLINDER - LH / RH	2 5	396.00
60	HEADLIGHT CORRUGATED PIPE <i>Not nec</i>	5	88.00
SUB TOTAL SPARE PARTS CHARGES		: \$ 18,155.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. EY 6262 E

S/N	Parts Description	Damage Parts & Prices		
		S/Nett	Remarks	
61	LOCK CARRIER <i>Not Nec</i>	\$	956.00	X
62	COOLANT REGULATOR SUPPORT <i>Not Nec</i>	2 \$	71.00	X
63	AIRCON CONDENSER <i>bt ✓</i>	\$	586.00	468.80
64	REFRIGERANT LINE PRESSURE SENDER <i>Pressure</i>	\$	179.00	
65	PRESSURE RELIEF VALVE	\$	49.00	
66	RADIATOR <i>bt ✓</i>	\$	766.00	612.40
67	READY MIX COOLANT <i>not ✓</i>	4 \$	169.00	X
68	RADIATOR RUBBER BUSH - LOWER <i>not ✓</i>	2 \$	24.00	
69	CHARGE AIR COOLER <i>not ✓</i>	\$	552.00	
70	CHARGE AIR COOLER PRESSURE HOSE <i>Pressure</i>	\$	336.00	
71	CHARGE AIR COOLER PRESSURE PIPE - LH <i>Pressure</i>	\$	402.00	
72	RADIATOR FAN RING <i>Not Nec</i>	\$	240.00	X
73	RADIATOR FAN <i>Not Nec</i>	\$	1,877.00	X
74	RADIATOR AIR GUIDE - LH / RH <i>can ✓</i>	2 \$	54.00	42.08
75	RADIATOR AIR GUIDE - LH <i>can ✓</i>	2 \$	24.00	17.76
76	RADIATOR AIR GUIDE - UPPER <i>Not Nec</i>	\$	15.00	X
77	RADIATOR AIR GUIDE - LOWER <i>Not Nec</i>	\$	21.00	X
78	AIR INTAKE AIR DUCT - RH <i>Not Nec</i>	\$	21.00	X
79	AIR INTAKE AIR GUIDE <i>Not Nec</i>	\$	50.00	
80	AIR INTAKE AIR FILTER <i>Not Nec</i>	\$	362.00	
SUB TOTAL SPARE PARTS CHARGES		:	\$ 6,754.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. EY 6262 E

S/N	Parts Description	Damage Parts & Prices	
		S/Nett	Remarks
81	AIR INTAKE AIR MASS METRE <i>Acc</i>	\$ 546.00	
82	AIR INTAKE HOSE <i>Acc</i>	\$ 90.00	
83	AIR INTAKE MANIFOLD <i>Acc</i>	\$ 651.00	
84	O-RING <i>Acc</i>	4 \$ 52.00	
85	FRONT NO PLATE <i>Ex</i>	S/N \$ 40.00	✓
86	SUNDRIES <i>Nec</i>	\$ 400.00	166
TOTAL SPARE PARTS CHARGES		: \$ 39,735.00	
TOTAL LABOUR CHARGES		: \$ 13,352.00	
GRAND TOTAL		: \$ 53,087.00	

All charges are not inclusive of GST

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name

:

Adrian King
29/01/20

Surveyed Date

:

Authorised Date

:

Excess Cost

:

Liability

:

Remarks

:

Not Authorised,

SL/S
+2

07 Days (Without Load Carrier)
10 Days (With Load Carrier)

Please Note

- : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,

Premium Automobiles Pte Ltd

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel: (65) 6366 2323 Fax: (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims

Tel: 6841 0055 - Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/0075/2020/N5

4-Feb-20

Raymond Ting

1 of 1

EY 6262 E

Audi A4 SEDAN 2.0 TFSI

Quantity Description

Parts

1

Front reinforcement beam bracket lh

✓

Unit Price

Amount

\$ 214.00 171.20

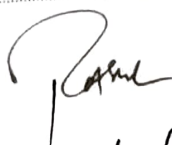
\$ 214.00

TOTAL

\$ 214.00

For Premium Automobiles Pte Ltd

Authorised Signature


05/02/2020