



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2103036

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 29/04/2021
Reference CC6/CTI20001839/Dpa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SH 7350B
Insured Veh. CB 7174P
Claim No. SNM20D200935
Policy No. DMB1SN30252919000
Accident Date 25/01/2020
Inspection Date 03/02/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI20001839/Dpa3q2 Date: 29/04/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	CB 7174P	Veh. Inspected	SH 7350B	
Policy No.	DMB1SN30252919000	Coverage (\$)	0.00	
Claim No.	SNM20D200935	Excess (\$)	0.00	
Assign From		Assign Date	03/02/2020	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI IONIQ	c.c	1580	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	KMHC851CVKU122050	Colour	BLUE	
Odometer	72062 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	MICHELIN	5 mm	
L/H Front Tyre	195/65 R15	MICHELIN	5 mm	
R/H Rear Tyre	195/65 R15	MICHELIN	5 mm	
L/H Rear Tyre	195/65 R15	MICHELIN	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION AND N/S FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	25/01/2020	Inspection Date	03/02/2020	
Survey held at	Blk 9 Sector C #01-42, Sin Ming Industrial Estate			
Repairer	BIFROST AUTO PTE LTD			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			16 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 6

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SH 7350B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR DOOR (RH)	TO REPAIR SEE LABOUR	1,789.90	-
1	REAR DOOR RUBBER (RH)	NOT NECESSARY	270.00	-
1	REAR DOOR LOCK ASSY	NOT NECESSARY	306.40	-
1	REAR DOOR HINGE UPPER (RH)	NOT NECESSARY	73.88	-
1	REAR DOOR HINGE LOWER (RH)	NOT NECESSARY	73.88	-
1	REAR DOOR CHECK (RH)	NOT NECESSARY	85.92	-
1	REAR DOOR TRIM BOARD (RH)	NOT NECESSARY	613.60	-
1	BOOT LID	BUCKLED	2,480.40	2,480.40
1	BOOT LID RUBBER	DEFORMED / TORN	127.40	127.40
2	BOOT LID HINGE (LH/RH) @ \$31.30	TO REPAIR SEE LABOUR	62.60	-
1	BOOT LID LOCK UPPER	DAMAGED	224.00	224.00
1	BOOT LID LOCK LOWER	BENT	137.50	137.50
1	BOOT LID KEY LOCK	NOT NECESSARY	141.00	-
1	BOOT LID 'H' EMBLEM	NECESSARY	28.00	28.00
1	EMBLEM - HYBRID	NECESSARY	24.30	24.30
1	EMBLEM - IONIQ	NECESSARY	31.30	31.30
1	EMBLEM - BLUE DRIVE (RH)	NOT FITTED	26.60	-
1	ANTENNA ASSY - SMARTK	MTG BROKEN	689.50	689.50
1	UNIT AESY-SMARTK CRU (RADAR REBSOR)	NOT NECESSARY	2,910.90	-
1	ASSY BSD-BLIND SPOT RADAR	BROKEN	1,625.00	1,625.00
1	WIRING HARNESS BWS EXT	NOT NECESSARY	988.90	-
1	BOOT LID GLASS, UPPER	NO SUCH PARTS	543.30	-
1	BOOT LID GLASS, LOWER	SHATTERED	384.90	384.90
1	REAR SPOILER	BROKEN	665.40	665.40
2	BOOT LID LAMP (LH/RH) @ \$794.40	O/S BROKEN / N/S NOT NECESSARY	1,588.80	794.40
1	LICENCE LAMP COVER	NOT NECESSARY	35.10	-
1	BOOT LID TRIMBOARD	BROKEN	159.70	159.70
10	BOOT LID TRIMBOARD CLIPS	NECESSARY	11.00	11.00
1	BOOT LID TRIMBOARD CENTRE	BROKEN	69.60	69.60

Report Ref No. CC6/CTI20001839/Dpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BOOTLID GARNISH	NOT NECESSARY	36.10	-
1	BOOTLID LOWER GARNISH	NOT NECESSARY	25.40	-
1	REAR BUMPER	BROKEN	459.40	459.40
1	REAR BUMPER REINFORCEMENT	CRACKED	294.80	294.80
2	REAR BUMPER REINFORCEMENT BRACKET (LH/RH) @ \$138.10		276.20	-
1	REAR BUMPER CENTRE MOULDING ASSY	TORN / DENTED	451.25	451.25
1	REAR BUMPER LOWER CENTRE MOULDING ASSY	NOT NECESSARY	47.50	-
1	REAR BUMPER STAY	NOT NECESSARY	138.10	-
2	REAR BUMPER SIDE BRACKET (LH/RH) @ \$55.80	O/S BROKEN / N/S NOT NECESSARY	111.60	55.80
1	REAR BUMPER COVER CLIPS	NECESSARY	22.00	22.00
1	REAR BUMPER UNDER CENTRE	NOT NECESSARY	53.85	-
2	REAR BUMPER SIDE UNDER (LH/RH) @ \$33.10	O/S DEFORMED / N/S NOT NECESSARY	66.20	33.10
1	REAR BUMPER REAR HOOK	NOT NECESSARY	5.40	-
2	REAR BUMPER REFLECTOR LAMP (LH/RH) @ \$31.90	O/S BROKEN / N/S NOT NECESSARY	63.80	31.90
1	REAR BUMPER FOG LAMP	NOT NECESSARY	201.50	-
1	REAR BUMPER TOWING COVER	NOT NECESSARY	98.80	-
1	REAR BUMPER REVERSE LIGHT (PARKING BRAKE LIGHT)	NOT NECESSARY	257.10	-
2	TAIL LAMP (LH/RH) @ \$870.40	BROKEN / CRACKED	1,740.80	1,740.80
2	TAIL LAMP QUARTER PANEL (LH/RH) @ \$208.90	O/S BUCKLED / N/S NOT NECESSARY	417.80	208.90
1	REAR PANEL	BUCKLED	532.00	532.00
1	REAR PANEL GARNISH	DEFORMED	186.00	186.00
1	REAR PANEL LOWER PANEL	NO SUCH PARTS	39.40	-
1	SPARE TYRE HOLDER	NOT NECESSARY	223.10	-
1	SPARE TYRE PANEL	TO REPAIR SEE LABOUR	892.50	-
1	SPARE TYRE PANEL CUSHION	NO SUCH PARTS	486.70	-
1	REAR TOWING HOOK	NOT NECESSARY	94.60	-
2	PANEL ASSY - REAR FLOOR SIDE (LH/RH) @ \$39.40	TO REPAIR SEE LABOUR	78.80	-

Report Ref No. CC6/CTI20001839/Dpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR FLOOR CHASSIS MEMBER (RH)	TO REPAIR SEE LABOUR	2,846.90	-
1	SPARE TYRE FLIP BOARD	BENT	338.80	338.80
1	EXHAUST PIPE INSULATOR	NOT NECESSARY	35.00	-
1	EXHAUST SILENCER	BENT	943.50	943.50
1	EXHAUST PIPE HANGER	NOT NECESSARY	29.20	-
1	EXHAUST PIPE CENTRE	NOT NECESSARY	573.60	-
1	REAR FENDER (RH)	DENTED	1,768.30	1,768.30
1	REAR FENDER INNER PANEL (RH)	BUCKLED	1,406.20	1,406.20
1	REAR FENDER INNER LINING (RH)	DEFORMED	73.60	73.60
1	REAR FENDER FRT PIECE (RH)	NOT NECESSARY	65.50	-
1	FLAP ASSY-ACTIVE AIR UPR (RH)	NOT NECESSARY	356.00	-
1	ACTUATOR - ACTIVE AIR (RH)	NOT NECESSARY	257.10	-
1	REAR FENDER OUTER CORNER GARNISH (RH)	BROKEN	126.70	126.70
1	REAR FENDER CORNER HARDBOARD COVER	NOT NECESSARY	357.60	-
1	REAR TRAY LUGG SIDE (RH)	BROKEN	473.10	473.10
1	REAR FENDER AIR-DUCT	BROEN / DEFORMED	84.60	84.60
1	REAR FENDER MUDFLAP (RH)	DEFORMED	78.50	78.50
1	REAR WINDSCREEN GLASS	SHATTERED	607.20	607.20
1	REAR WINDSCREEN MOULDING	NECESSARY	48.50	48.50
1	SPEAKER PANEL	NOT NECESSARY	1,274.60	-
1	FUEL TANK SUB HOSE	NOT NECESSARY	109.10	-
1	FUEL TANK UPPER NECK	NOT NECESSARY	221.10	-
1	FUEL LID COVER	NOT NECESSARY	83.30	-
1	REAR TYRE RIM (RH)	NOT NECESSARY	1,124.20	-
1	REAR WHEEL HUP-CAP (RH)	NOT NECESSARY	346.40	-
1	REAR WHEELBEARING ING & HUB	DAMAGED	454.00	454.00
1	REAR TRAILING ARM (RH)	DISTORTED	265.40	265.40
1	REAR ASSIST (RH)	DISTORTED	227.90	227.90
1	REAR SHOCK ABSORBER (RH)	DISTORTED	230.50	230.50
1	REAR SHOCK ABSORBER MOUNTING (RH)	NOT NECESSARY	133.10	-
1	REAR CROSSMEMBER	NOT NECESSARY	1,468.70	-
1	STABILIZER BAR	NOT NECESSARY	387.30	-

Report Ref No. CC6/CTI20001839/Dpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	STABILIZER LINK	NOT NECESSARY	147.30	-
1	REAR UPPER ARM (RH)	DISTORTED	239.50	239.50
1	REAR LOWER ARM (RH)	DISTORTED	393.10	393.10
1	REAR KNUCKLE ARM (RH)	DISTORTED	538.10	538.10
1	REAR WIRING ASSY	NOT NECESSARY	1,521.50	-
1	FRONT BUMPER COVER	BROKEN	1,456.80	1,456.80
1	FRONT BUMPER GRILLE (LH)	CUT	186.90	186.90
1	FRONT BUMPER LOWER STIFFENER	NOT NECESSARY	85.10	-
1	FRONT BUMPER BRACKET TOP (LH/RH)	NOT NECESSARY	35.00	-
1	FRONT BUMPER BRACKET (LH)	BROKEN	28.00	28.00
1	FRONT BUMPER SIDE BRACKET SUPPORT	NOT NECESSARY	12.00	-
1	FRONT BUMPER RETAINER MOUNTING	NOT NECESSARY	135.60	-
10	REAR BUMPER CLIPS	NECESSARY	22.00	22.00
1	HEADLAMP SUPPORT PANEL ASSY	CRACKED	949.30	949.30
1	HEADLAMP (LH)	SCRATCHED / CRACKED	1,198.80	1,198.80
1	DAY LIGHT, LH	CUT / MTG CRACKED	642.50	642.50
1	DAY LIGHT WIRE, LH/RH	NOT NECESSARY	585.50	-
1	FRONT FENDER (LH)	DENTED	490.70	490.70
1	FRONT FENDER APRON PANEL (LH/RH)	NOT NECESSARY	756.20	-
1	FRONT FENDER APRON PANEL UPPER (LH/RH)	NOT NECESSARY	129.60	-
1	FRONT FENDER SHIELD (LH/RH)	NOT NECESSARY	114.70	-
1	FLAP ASSY ACTIVE AIR UPPER, (LH/RH)	NOT NECESSARY	356.00	-
1	ACTUATOR ACTIVE AIR (LH/RH)	NOT NECESSARY	257.10	-
1	FRONT WHEEL RIM (LH)	CUT	1,124.20	1,124.20
1	FRONT WHEEL HUB CAP (LH)	BROKEN	346.40	346.40
1	FRONT WHEEL BEARING	DAMAGED	454.00	454.00
1	FRONT SHOCK ABSORBER (ASSY) (LH)	DISTORTED	372.50	372.50
1	FRONT SHOCK ABSORBER MOUNTING (LH)	NOT NECESSARY	206.90	-
1	FRONT SHOCK ABSORBER FORK (LH)	NOT NECESSARY	206.90	-
1	FRONT SUSPENSION UPPER ARM (LH)	NOT NECESSARY	244.30	-
1	FRONT DRIVE SHAFT (LH)	NOT NECESSARY	936.70	-
1	RACK & PINION ASSY	NOT NECESSARY	887.40	-

Report Ref No. CC6/CTI20001839/Dpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	STG TIE ROD	NOT NECESSARY	125.60	-
1	STG TIE END	NOT NECESSARY	94.70	-
1	STABILIZER BAR	NOT NECESSARY	246.80	-
1	STABILIZER BAR BUSH (LH)	NOT NECESSARY	22.30	-
1	STABILIZER BAR LINK	NOT NECESSARY	92.10	-
1	STABILIZER BRACKET	NOT NECESSARY	10.50	-
1	FRONT SUSPENSION LOWER ARM (LH)	DISTORTED	296.80	296.80
1	KNUCKLE ARM (LH)	DISTORTED	363.60	363.60
	LESS 20% DISCOUNT		-11,315.60	-5,539.67
			45,262.38	22,158.68
	<u>SPECIAL NETT ITEMS</u>			
1	REAR TYRE (RH) (SN)	NOT NECESSARY	216.00	-
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	46.00	46.00
1	REAR BUMPER REVERSE SENSOR (SN)	DAMAGED	180.00	180.00
1	REAR NO. PLATE + TRIM COVER (SN)	BROKEN	25.00	25.00
1	BOOT LID COMFORT LOGO & TEL NO. STICKER (SN)	NECESSARY	30.00	30.00
1	BOOT LID CITY CAB LOGO & TEL NO STICKER (SN)	NOT NECESSARY	30.00	-
1	BOOT LID COMFORT LOGO STICKER (SN)	NECESSARY	8.60	8.60
1	REAR DOOR PROTECTOR (RH) (SN)	NOT NECESSARY	116.20	-
1	REAR DOOR TEL NO. STICKER (RH) (SN)	NOT NECESSARY	10.00	-
1	REAR DOOR COMFORTDELGRO & APPS STICKER (RH) (SN)	NECESSARY	80.00	80.00
1	EMBLEM - BLUE DRIVE (LH/RH) (SN)	NOT NECESSARY	26.60	-
1	FRONT TYRE (LH) (@\$216 DISC 50%) (SN)	CUT	216.00	108.00
			984.40	477.60
	<u>LABOUR</u>			
	PANEL BEATING. INCLUSIVE OF THE REPAIR OF REAR DOOR (RH), BOOT LID HINGE (LH/RH), SPARE TYRE PANEL, PANEL ASSY - REAR FLOOR SIDE (LH/RH) AND REAR FLOOR CHASSIS MEMBER (RH).		2,200.00	1,200.00
	SPRAY PAINTING CHARGE.		1,500.00	1,000.00
	WIRING CHARGE.		50.00	30.00
	TUFF KOTE.		50.00	40.00
	TOWING CHARGE.	NOT NECESSARY	60.00	-

Report Ref No. CC6/CTI20001839/Dpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:6 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE / REFIX CUSHION & UPHOLSTERY REAR.		150.00	80.00
	REMOVE / REFIX REAR WINDSCREEN GLASS.		120.00	80.00
	REMOVE / REFIX REVERSE SENSOR.		120.00	40.00
	REMOVE / REFIX FUEL TANK.	NOT NECESSARY	150.00	-
	REMOVE / REFIX EXHAUST PIPE.		150.00	60.00
	TRANSFER OF DOOR.	NOT NECESSARY	120.00	-
	REMOVE / REFIX UNDERCARRIAGE (RR) & FRONT.		400.00	250.00
	4 WHEEL ALIGNMENT.		120.00	60.00
	RE-SET REAR POWER WINDOW SYSTEM.	NOT NECESSARY	200.00	-
	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE.		480.00	320.00
			5,870.00	3,160.00
GRAND TOTAL			52,116.78	25,796.28
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				20,000.00

Report Ref No. CC6/CTI20001839/Dpa3q2

ANG BRYAN TANI

Automotive Assessor / Investigator

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SH 7350B

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SH 7350B

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

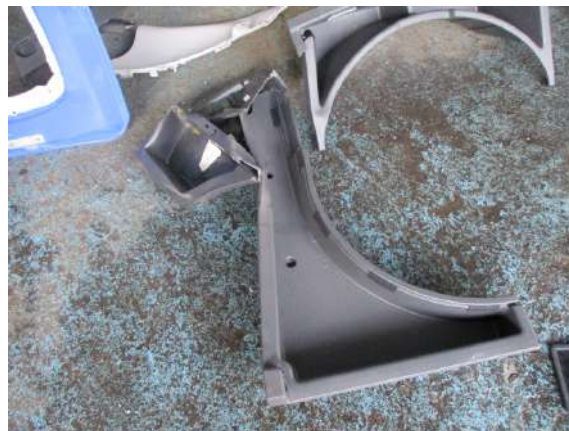



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

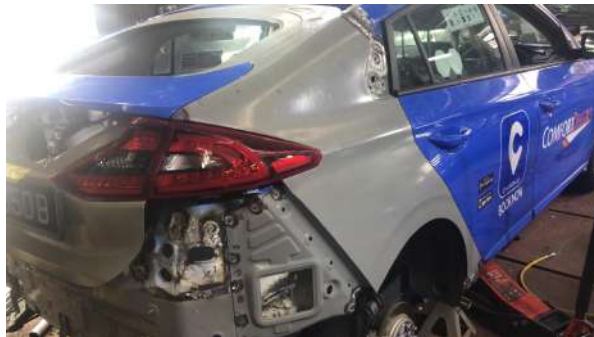



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SH 7350B

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

