



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV No. AC2006644
INV Date 25/09/2020
Reference CC4/FCI20002148/Eea3s2
Code FCI2



PROFESSIONAL SERVICE FEE

Vehicle No. SME 3003S
Insured Veh. SHB 2239K
Claim No. D20000840MFSH
Policy No. D-20094921MFSH
Accident Date 04/02/2020
Inspection Date 11/02/2020

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD

Ref : CC4/FCI20002148/Eea3s2

36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Date : 25-09-2020



Code : FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHB 2239K	Veh. Inspected	SME 3003S
Policy No.	D-20094921MFSH	Coverage (\$)	0.00
Claim No.	D20000840MFSH	Excess (\$)	0.00
Assign From	ERIC WOO	Assign Date	06/02/2020

2. Vehicle Particulars & Condition

Make & Model	KIA CERATO	c.c	1591
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	KNAF3416MK5018968	Colour	WHITE
Odometer	39134	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/55 R16	NEXEN	6 mm
L/H Front Tyre	205/55 R16	NEXEN	6 mm
R/H Rear Tyre	205/55 R16	NEXEN	6 mm
L/H Rear Tyre	205/55 R16	NEXEN	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	04/02/2020	Inspection Date	11/02/2020
Survey held at	CYCLE & CARRIAGE KIA PTE LTD 209 PANDAN GARDENS SINGAPORE 609339		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **3 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SME 3003S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	CARRIER ASSY - FRONT END MODULE (SN)	NOT NECESSARY	675.00	-
1	BEAM COMPLETE - FR BUMPER (SN)	NOT NECESSARY	497.00	-
1	STIFFENER - FR BPR LWR (SN)	NOT NECESSARY	114.00	-
1	ABSORBER - FRONT BUMPER ENERGY (SN)	NOT NECESSARY	84.00	-
1	BRACKET - FR BUMPER UPR SIDE MTG (SN)	BROKEN	22.00	22.00
1	BRACKET - FR BUMPER UPR SIDE MTG (SN)	BROKEN	22.00	22.00
1	LAMP ASSY - SIDE REPEATER, LH (SN)	NOT NECESSARY	143.00	-
1	LAMP ASSY - SIDE REPEATER, RH (SN)	NOT NECESSARY	143.00	-
1	AIR DUCT - FR BUMPER, LH (SN)	NOT NECESSARY	14.00	-
1	AIR DUCT - FR BUMPER, RH (SN)	NOT NECESSARY	14.00	-
1	MOULDING - FRONT BUMPER, LH (SN)	NOT NECESSARY	36.00	-
1	MOULDING - FRONT BUMPER, RH (SN)	NOT NECESSARY	36.00	-
1	GARNISH- RADIATOR GRILLE (SN)	CUT	38.00	38.00
1	GRILLE ASSY - RADIATOR (SN)	NOT NECESSARY	328.00	-
1	RETAINER - BUMPER SIDE MTG (SN)	NOT NECESSARY	1.00	-
1	LAMP ASSY - FRONT FOG, LH (SN)	NOT NECESSARY	303.00	-
1	LAMP ASSY - FRONT FOG, RH (SN)	NOT NECESSARY	303.00	-
1	COVER - FR BUMPER (SN)	TO REPAIR SEE LABOUR	633.00	-
1	CAP - FRONT HOOK (SN)	NOT NECESSARY	9.00	-
1	GRILLE - FRONT BUMPER (SN)	BROKEN	228.00	228.00
1	ORNAMENT - KIA NO.115 (SN)	NECESSARY	32.00	32.00
1	BODY SEALANT (SN)	NOT NECESSARY	80.00	-
1	SUNDRIES (SN)	NECESSARY	50.00	20.00
			3,805.00	362.00
<u>LABOUR</u>				
RENEW ACCIDENT DAMAGED PARTS ON FRONT SUPPORT PANEL, FRONT BUMPER, REPAIR RH FRONT FENDER, REPAIR LH FRONT FENDER. INCLUSIVE OF THE REPAIR OF COVER - FR BUMPER.			2,750.00	825.00
REMOVE AND INSTALL RADIATOR AND A/CON CONDENSER TO FACILITATE REPAIR WORK.		NOT NECESSARY	100.00	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TOP UP A/CON GAS AND CHECK A/CON SYSTEM.	NOT NECESSARY	80.00	-
	PAINT WORK FRONT BUMPER, RH FRONT FENDER, LH FRONT FENDER AND AFFECTED PORTION.		1,680.00	420.00
	SUPPLY FRONT NUMBER PLATE WITH FRAME (ACRLYIC CAR PLATE).		80.00	80.00
	CHECK WIRING AND CHASSIS ELECTRICAL SYSTEM.		50.00	30.00
	PERFORM RUST PREVENTION.	NOT NECESSARY	80.00	-
	TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST USING HI-SCAN PRO TEST.		200.00	200.00
	RE-APPLY PAINT PROTECTION ON AFFECTED PORTION.		250.00	200.00
			5,270.00	1,755.00
GRAND TOTAL			9,075.00	2,117.00

RECOMMENDED COST OF REPAIRS			2,117.00
------------------------------------	--	--	-----------------

Report Ref No. CC4/FCI20002148/Eea3s2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SME 3003S

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

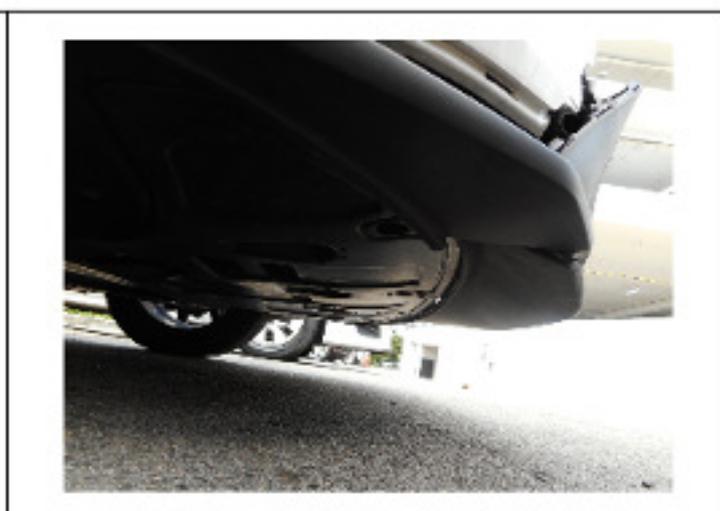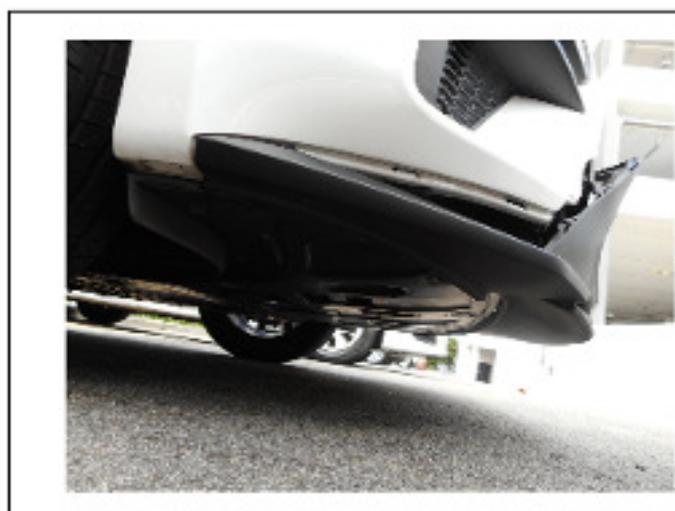



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

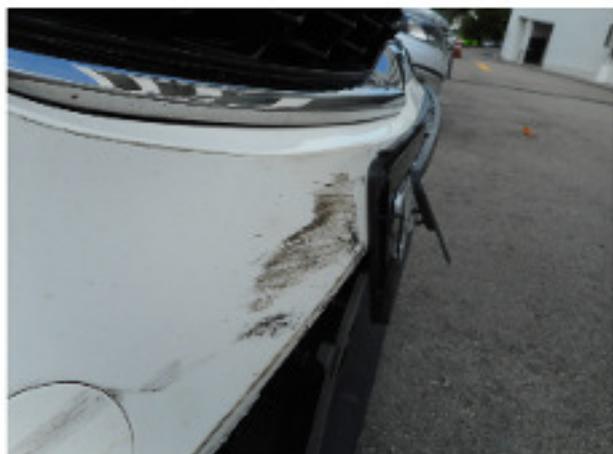



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

