



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV No. AC2005368
INV Date 03/08/2020
Reference CC6/FCI20002759/Uda3q2
Code FCI2



PROFESSIONAL SERVICE FEE

Vehicle No. FBL 3347T
Insured Veh. SHC 153G
Claim No. D20001137MFSH
Policy No. D-18088937MFSH
Accident Date 05/02/2020
Inspection Date 18/02/2020

Description	Total
Survey Inspection	290.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	290.00
GST (7%)	20.30
Grand Total	310.30

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD

Ref : CC6/FCI20002759/Uda3q2

36 ROBINSON ROAD
#16-01 CITY HOUSES SINGAPORE 068877

Date : 03-08-2020



Code : FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHC 153G	Veh. Inspected	FBL 3347T
Policy No.	D-18088937MFSH	Coverage (\$)	0.00
Claim No.	D20001137MFSH	Excess (\$)	0.00
Assign From		Assign Date	18/02/2020

2. Vehicle Particulars & Condition

Make & Model	HONDA CBF190WH	c.c	184
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	LWBMC4696H1104221	Colour	RED
Odometer	21619	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	110-70 R17	RADIAL	6 mm
L/H Front Tyre			mm
R/H Rear Tyre	140-70 R17	RADIAL	6 mm
L/H Rear Tyre			mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S & O/S BODY. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	05/02/2020	Inspection Date	18/02/2020
Survey held at	EROFIA MOTOR TRADING PTE LTD 1 KAKI BUKIT AVENUE 6 #02-62 SINGAPORE 417883		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	4 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. FBL 3347T

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT FENDER	CRACKED	90.00	90.00
2	FRONT FORK	N/S DENTED / BENT	1,100.00	550.00
1	FRONT LAMP SIDE COVER (RED)-R/H	TO REPAIR SEE LABOUR	45.00	-
1	HEAD LAMP ASSY	NOT NECESSARY	220.00	-
1	BRAKE LEVER	SCRATCHED	20.00	20.00
1	BALANCER -R/H	SCRATCHED	18.00	18.00
1	MIRROR -R/H	CUT	55.00	55.00
1	HANDLE BAR -R/H	SERVICEABLE	45.00	-
1	FRONT SIGNAL -R/H	CUT	120.00	120.00
1	REAR SIGNAL -R/H	NOT NECESSARY	120.00	-
1	TANK SIDE COVER FROM -L/H	NOT NECESSARY	150.00	-
1	CLUTCH OUTER COVER	NOT NECESSARY	250.00	-
1	CLUTCH COVER GASKET	NOT NECESSARY	60.00	-
1	AIR VENT -L/H	NOT NECESSARY	50.00	-
1	FRONT BRAKE DISC	NOT NECESSARY	200.00	-
1	RIDER FOOT REST -L/H	BROKEN	35.00	35.00
1	RIDER FOOT REST BRACKET -L/H	CRACKED	120.00	120.00
1	PILLION FOOT REST -L/H	CUT	35.00	35.00
1	PILLION FOOT REST BRACKET -L/H	NOT NECESSARY	85.00	-
1	SIDE STAND	TO REPAIR SEE LABOUR	40.00	-
1	GEAR PEDAL	TO REPAIR SEE LABOUR	40.00	-
1	TROTTLE CABLE	NOT NECESSARY	60.00	-
	LESS 10% DISCOUNT		-295.80	-104.30
			2,662.20	938.70
1	REAR BOX (SN)	CUT	280.00	200.00

Report Ref No. CC6/FCI20002759/Uda3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 10% DISCOUNT		-28.00	-
			252.00	200.00
	<u>SPECIAL NETT ITEMS</u>			
1	BEARING CONE (SN)	NOT NECESSARY	85.00	-
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	20.00	-
1	ENGINE OIL (SN)	NOT NECESSARY	30.00	-
			135.00	-
	<u>LABOUR</u>			
	TO PROVIDE TOWING.		60.00	35.00
	TO PROVIDE LABOUR.INCLUSIVE OF THE REPAIR OF FRONT LAMP SIDE COVER (RED)-R/H AND SIDE STAND .		350.00	220.00
			410.00	255.00
GRAND TOTAL			3,459.20	1,393.70
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				1,100.00

Report Ref No. CC6/FCI20002759/Uda3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. FBL 3347T

INSPECTION





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

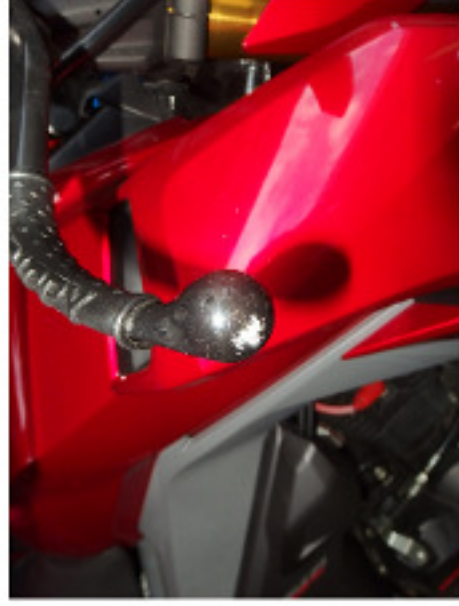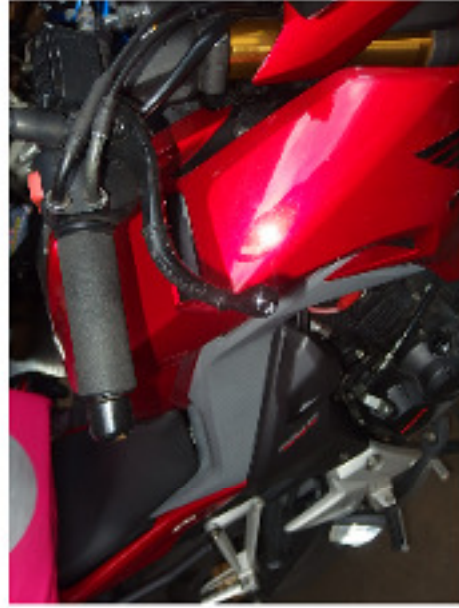




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

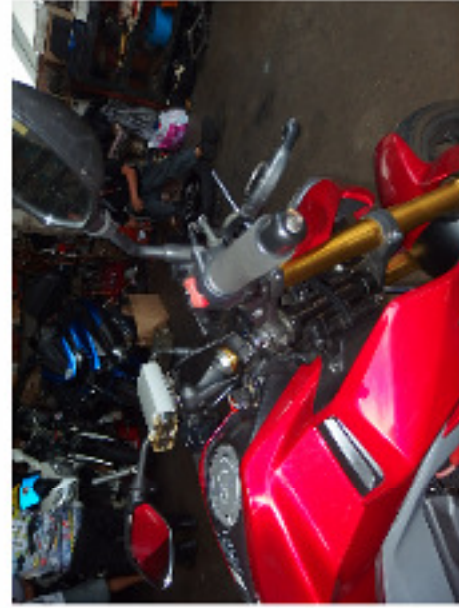




LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

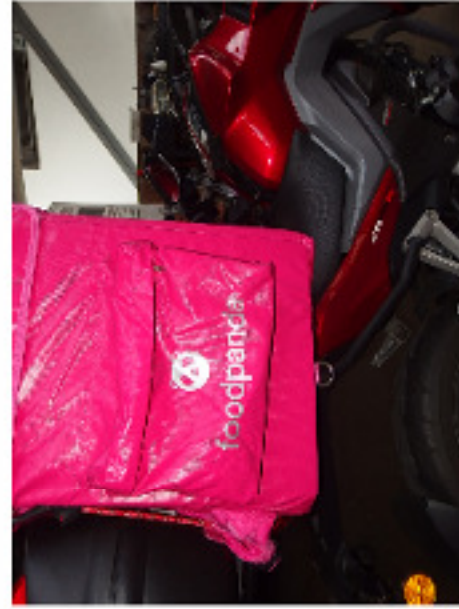



LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. FBL 3347T

RE-INSPECTION





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

