



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2103759

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 28/05/2021
Reference CC4/FCI20002784/Aea3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SJH 1954E
Insured Veh. SH 7089G
Claim No. D20000683MFSH
Policy No. D-20094922MFSH
Accident Date 27/01/2020
Inspection Date 17/02/2020

Description	Total
Third Party Express Settlement	500.00
Subtotal	500.00
GST (7%)	35.00
Grand Total	535.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20002784/Aea3q2	
			Date: 28/05/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SH 7089G	Veh. Inspected	SJH 1954E
	Policy No.	D-20094922MFSH	Coverage (\$)	0.00
	Claim No.	D20000683MFSH	Excess (\$)	0.00
	Assign From	VIC	Assign Date	17/02/2020
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA WISH	c.c	1794
	Engine No.	HIDDEN	Year of Reg.	2008
	Chassis No.	JTDER12W603000411	Colour	BLUE
	Odometer	186445 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195/65 R15	BRIDGESTONE	6 mm
	L/H Front Tyre	195/65 R15	BRIDGESTONE	6 mm
	R/H Rear Tyre	195/65 R15	BRIDGESTONE	6 mm
	L/H Rear Tyre	195/65 R15	BRIDGESTONE	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	27/01/2020	Inspection Date	17/02/2020
	Survey held at	TWINCAR AUTOMOTIVE PTE LTD 2 KAKI BUKIT AVE 2 #01-17 KAKI BUKIT AUTOHUB SINGAPORE 417921		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJH 1954E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	DISTORTED	863.40	487.00
1	FRONT BUMPER LOWER GRILLE	CRACKED	98.70	98.70
1	FRONT BUMPER REINFORCEMENT	BENT	299.30	299.30
2	FRONT BUMPER SIDE RETAINER L/R @\$58.30	O/S DAMAGED	116.60	58.30
1	FRONT BUMPER SPONGE	CRACKED	174.45	174.45
1	FRONT GRILLE	CRACKED	101.30	101.30
2	FRONT HEADLAMP L/R @\$661.70	O/S CUT	1,323.40	661.70
1	FRONT RH BALL JOINT	NOT NECESSARY	182.10	-
1	FRONT RH BUMPER FOGLAMP GARNISH	DEFORMED	35.40	35.40
1	FRONT RH FENDER	DISTORTED	758.20	758.20
1	FRONT RH FENDER INNER PANEL	TO REPAIR SEE LABOUR	677.80	-
1	FRONT RH FENDER INNER SHIELD	TORN	182.25	182.25
1	FRONT RH KNUCKLE ARM	NOT NECESSARY	311.70	-
1	FRONT RH KNUCKLE ARM BEARING	DAMAGED	96.80	96.80
1	FRONT RH LOWER ARM	BENT	421.90	421.90
1	FRONT RH SHOCK ABSORBER	BENT	366.70	366.70
1	FRONT RH SHOCK ABSORBER TOP MOUNTING	NOT NECESSARY	182.95	-
1	FRONT RH STABILIZER LINK	NOT NECESSARY	139.80	-
1	FRONT RH TIE ROD END	NOT NECESSARY	172.25	-
1	FRONT RH WHEELHOUSING	TO REPAIR SEE LABOUR	568.00	-
1	FRONT WASHER TANK	DEFORMED	172.50	172.50
1	FRONT WASHER TANK MOTOR	DAMAGED	204.62	204.62
1	RADIATOR (AUTO)	CRACKED	1,248.10	1,248.10
	LESS 25% DISCOUNT		-2,174.56	-1,341.81
			6,523.66	4,025.41
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	80.00	30.00
1	SET FRONT GRILLE CLIPS (SN)	NECESSARY	30.00	10.00
1	SET FRONT RH FENDER INNER SHIELD CLIPS (SN)	NECESSARY	50.00	30.00

Report Ref No. CC4/FCI20002784/Aea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT RH SPORT RIM (SN)	CUT	600.00	400.00
1	FRONT RH TYRE 195/65R15 (SN)	NOT NECESSARY	350.00	-
1	RADIATOR COOLANT (SN)	NECESSARY	80.00	40.00
			1,190.00	510.00
	LABOUR			
	TO REMOVE ,CHARGE AIR CON PARTS ,VACUUMS ,REFILL AIR CON GAS.		120.00	80.00
	TO REMOVE ,REINSTALL ELECTRICAL WIRING HARNESS ,CHECK LIGHTING AND RESETTING HEADLAMP FOCUSING (TO FR).		80.00	30.00
	TO REMOVE ,CHARGE FRONT SUSPENSION PARTS ,ABSORBER ,LOWER ARM ,KNUCKLE ARM ,WHEEL BEARING ,BEARING HUB ,DRIVE SHAFT ,ANTI-ROLL BAR ,TOP-ARM AND STEERING RACK AND PINION .		380.00	220.00
	TO ROAD TEST DRIVING ,CHECK AND RESETTING WHEEL ALIGNMENT SYSTEM.		120.00	80.00
	TO RE-SPRAY PAINTING ON THE CHARGE BODYPARTS ,REPAIR PORTION ,AND WHERE CONSISTENT TO THE ACCIDENT .		1,200.00	700.00
	TO PROVIDE LABOUR ,WORKMANSHIP TO CHARGE THE ABOVE DAMAGED BODYPARTS ,REPAIR ,RE-CONSTRUCT AND RE-ALIGN BODY STRUCTURE ,BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT .		1,400.00	700.00
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL.		120.00	60.00
			3,420.00	1,870.00
GRAND TOTAL			11,133.66	6,405.41
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,100.00

Report Ref No. CC4/FCI20002784/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJH 1954E

INSPECTION







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

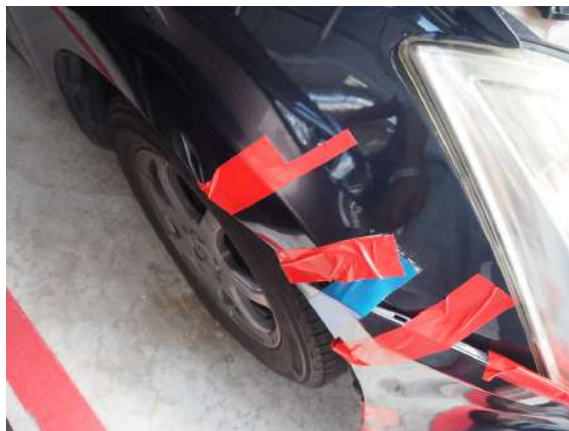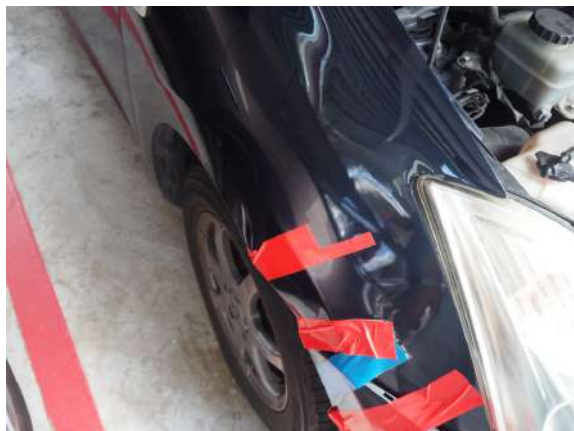



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJH 1954E

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

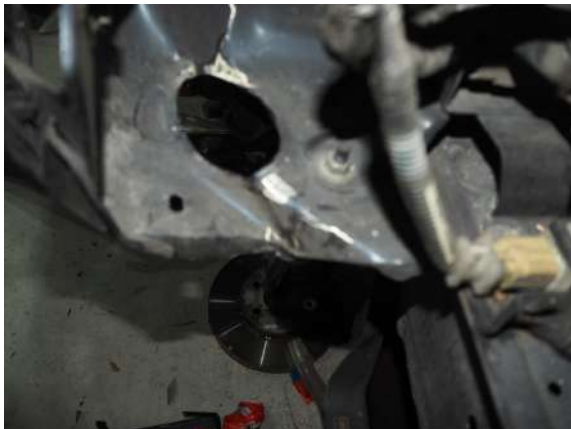



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJH 1954E

RE-INSPECTION

