



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2104789
INV Date 07/07/2021
Reference CC4/LPC20003576/Kpa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMP 4555B
Insured Veh. XE 1865D
Claim No. 19/20/20/VC06/023128
Policy No. Z/19/VC06/105097
Accident Date 01/03/2020
Inspection Date 04/03/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD

300 BEACH ROAD

#17-04/07 THE CONCOURSESINGAPORE 199555

Ref: CC4/LPC20003576/Kpa3q2

Date: 07/07/2021

Code: LPC2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	XE 1865D	Veh. Inspected	SMP 4555B
Policy No.	Z/19/VC06/105097	Coverage (\$)	0.00
Claim No.	19/20/20/VC06/023128	Excess (\$)	0.00
Assign From	ONG LI LI	Assign Date	03/03/2020

2. Vehicle Particulars & Condition

Make & Model	HONDA FREED (A)	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2019
Chassis No.	GB71084369	Colour	METALLIC BLUE
Odometer	31505 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	185/65 R15	YOKOHAMA	5 mm
L/H Front Tyre	185/65 R15	YOKOHAMA	5 mm
R/H Rear Tyre	185/65 R15	YOKOHAMA	5 mm
L/H Rear Tyre	185/65 R15	YOKOHAMA	5 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	01/03/2020	Inspection Date	04/03/2020
Survey held at	OPTIMA WERKZ PTE LTD 9A SERANGOON NORTH AVE 5 SINGAPORE 554500		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **5 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMP 4555B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER	CRACKED	837.50	837.50
1	FRONT BUMPER SIDE BRACKET RH	DISTORTED	68.60	68.60
1	FRONT BUMPER UPPER BRACKET RH	TO REPAIR SEE LABOUR	57.20	-
8	FRONT BUMPER CLIPS @\$5.50	NECESSARY	44.00	44.00
1	FRONT HEADLAMP RH	CUT	1,948.60	1,544.00
1	FRONT FENDER RH	BENT	594.00	440.70
1	FRONT FENDER 'HYBRID' EMBLEM RH	NECESSARY	65.80	65.80
1	FRONT FENDER INNER LINNER RH	TORN	138.00	120.70
10	FRONT FENDER INNER LINNER CLIPS RH @\$5.50	NECESSARY	55.00	55.00
1	FRONT DOOR RH	BENT	1,180.00	950.00
10	FRONT DOOR INNER TRIM CLIPS RH @\$6.80	NOT NECESSARY	68.00	-
1	FRONT BONNET (NPA)	TO REPAIR SEE LABOUR	-	-
1	FRONT DOOR SIDE MIRROR COVER RH (NPA)	TO REPAIR SEE LABOUR	-	-
1	FRONT SUPPORT PANEL (NPA)	TO REPAIR SEE LABOUR	-	-
	LESS 20% DISCOUNT		-1,011.34	-825.26
			4,045.36	3,301.04
<u>LABOUR</u>				
	LABOUR CHARGES TO REMOVE ,REPLACE ,REPAIR ,REFIX & READJUST FRONT ACCIDENT ARE.INCLUSIVE OF THE REPAIR OF FRONT BUMPER UPPER BRACKET RH,FRONT BONNET,FRONT DOOR SIDE MIRROR COVER RH AND FRONT SUPPORT PANEL.		600.00	500.00
	LABOUR CHARGES TO REMOVE ,REINSTALLED FRONT DOOR INNER MECHANISM & ETC.TO EFFECT REPLACE OF FRONT DOOR RH & ETC.		120.00	60.00
	LABOUR CHARGES FOR PAINTING & TO SUPPLY PAINT & FURNISHING MATERIALS AT FRON BONNET ,FRONT BUMPER ,FRONT FENDER RH ,FRONT SUPPORT PANEL ,FRONT DOOR RH & ETC.		1,000.00	600.00
	LABOUR CHARGES TO CHECK WIRING & DOOR CENTRAL LOCKING SYSTEM & ETC BACK TO ORIGINAL OPERATIONS.		80.00	20.00

Report Ref No. CC4/LPC20003576/Kpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO WHEEL ALIGNMENT & BALACING.	NOT NECESSARY	60.00	-
	TO TOWING CHARGES.		100.00	50.00
	TO TOFF KOTE & UNDERSEAL MATERIAL.		150.00	60.00
			2,110.00	1,290.00
	GRAND TOTAL		6,155.36	4,591.04
RECOMMENDED COST OF REPAIRS				4,591.04

Report Ref No. CC4/LPC20003576/Kpa3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 4555B

INSPECTION








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

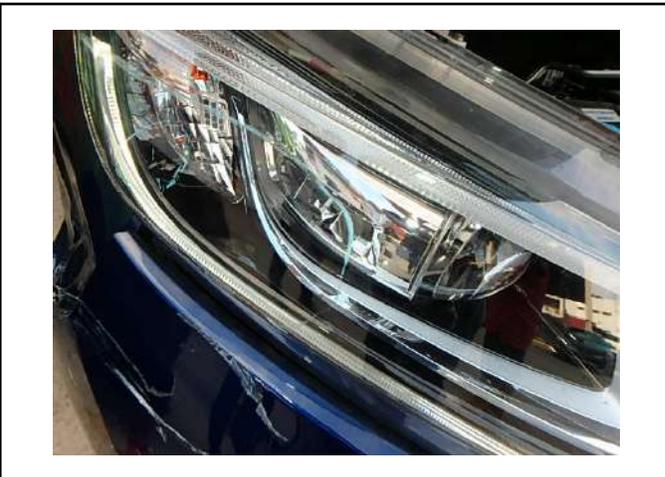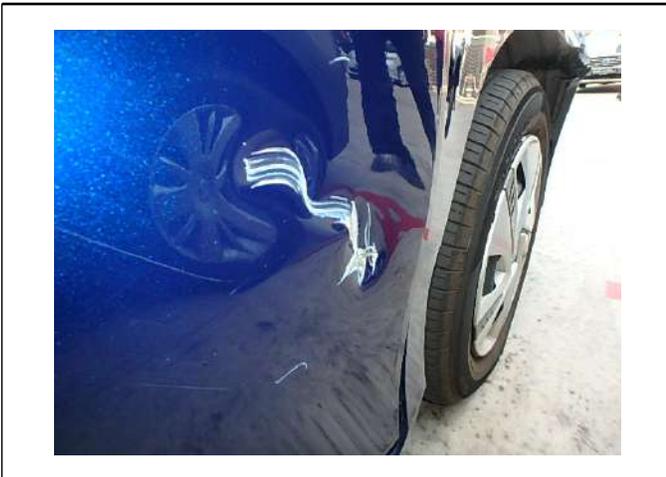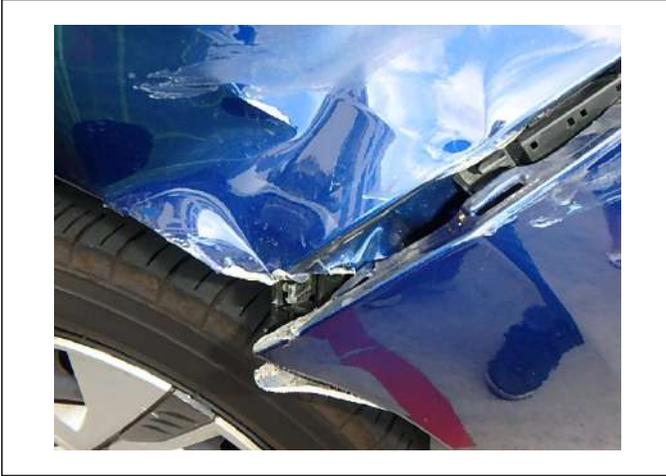



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 4555B

RE-INSPECTION

