

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel: 6366 2323 Fax: 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

WIP : 31604

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0235/2020/NS
Date : 4-Mar-20

Shirley

1682192

Vehicle IN workshop. Please arrange for survey

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr Ch'ng Olivier Kuan Yew
Address : 19 Seletar Road
#04-39
Singapore 807020
Telephone : HP +65 97733377
Type of Claim : Own Damage Claims
Policy No. : 2100501737-02
Vehicle No : **SLG 3233 X**
Model Code : Audi A4 1.8 TFSI MU 8K203
Model / Year : May-13
Engine No : CJE 046540
Chassis No : WAUZZZ8K9DA197545
Mileage : 11140
Date In : 3-Mar-20
Estimated By : Johnny Boo / Allan Wu
Accident Date : 3-Mar-20
Place of Accident : 21 Changi North Rise

Premium Automobiles

15-16 Road 1, Singapore 408594
Tel: 6396 2323 Fax: 6391 1184

Telefax

Estimated Labour Charges for Accident Vehicle SLG 3233 X

S/N	Nature of Jobs		Estimated Charges	Surveyor's Recommendations
1	To tow vehicle from scene of accident.	S/N \$	280.00	X
2	To remove, check and reinstall front wire harness for headlights, horns, outside temperature sensor and headlight washer assy.	S/N \$	360.00	✓
3	To remove and reinstall aircon condenser, charge air cooler and radiator. Check electrical fans and control unit. Pressurise cooling system. To carry out vacuum and regas.	S/N \$	1,200.00	✓ <i>PPS.</i>
4	To dismantle and renew front bumper, lhs front fender, bonnet and lhs headlight. To renew front lock carrier and align to position. Re-organise crash management components. Reinstall all parts removed.	\$	5,250.00	<i>1250 (without lock carrier), 3000 (with lock carrier) PPS.</i>
5	To respray front bumper, lhs front fender, bonnet and hinges	\$	3,000.00	<i>1650</i>
6	To renew lhs front rim. To carry out pre-repair wheel alignment. Check and post-repair wheel alignment check.	S/N \$	520.00	X
7	To carry out pre-repair diagnostic check and post repair diagnostic check.	S/N \$	384.00	<i>182</i>
TOTAL LABOUR CHARGES			: \$ 10,994.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLG 3233 X

		Damage Parts & Prices	
S/N	Parts Description	S/Nett	Remarks
1	FRONT BUMPER <i>Disto ted</i>	\$ 2,169.00	✓ 1735.20
2	FRONT BUMPER FIXING PARTS <i>new</i>	\$ 244.00	+
3	FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE <i>new</i>	\$ 215.00	+
4	FRONT BUMPER GRILLE - LOWER CENTRE <i>new</i>	\$ 127.00	+
5	FRONT BUMPER CLOSING ELEMENT - UPPER CENTRE <i>new</i>	\$ 183.00	+
6	FRONT BUMPER SUPPORT ELEMENT - UPPER <i>Not nec</i>	\$ 56.00	✗
7	RADIATOR GRILLE <i>new cracked.</i>	\$ 1,026.00	✓ 820.80
8	FRONT BUMPER AIR GUIDE GRILLE - LH <i>behind.</i>	\$ 127.00	✓ 101.60
9	FRONT WHEEL SPOILER - LH <i>Not nec</i>	\$ 48.00	✗
10	FRONT BUMPER SIDE REINFORCEMENT BEAM <i>Best</i>	\$ 828.00	✓ 662.40
11	FRONT BUMPER FOAM FILLER PIECE <i>Not nec</i>	\$ 117.00	✗
12	FRONT BUMPER SUPPORT <i>Lt Danged</i>	2 \$ 24.00	✓ 9.36
13	FRONT BUMPER COVER <i>Not nec</i>	\$ 120.00	✗
14	FRONT BUMPER GUIDE SECTION - LH <i>Danged</i>	\$ 34.00	27.12
15	CAUTION SIGN STICKER <i>Not nec</i>	NEC \$ 13.00	✗
16	AIRCON STICKER <i>Not nec</i>	NEC \$ 22.00	✗
17	SIGNAL HORN - LH HIGH TONE <i>Not nec</i>	\$ 189.00	✗
18	SPRING SHACKLE - LH HIGH TONE <i>Not nec</i>	\$ 23.00	✗
19	FRONT FENDER - LH <i>Disto ted</i>	\$ 932.00	✓ 745.20
20	FRONT FENDER ATTACHMENT PARTS <i>Not nec.</i>	\$ 54.00	✗
SUB TOTAL SPARE PARTS CHARGES		: \$	<u>6,551.00</u>

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLG 3233 X

S/N	Parts Description	Damage Parts & Prices	
		S/Nett	Remarks
21	FRONT FENDER BRACKET - LH FRONT <i>Best</i>	\$ 50.00	✓ 39.44
22	DEFORMATION ELEMENT BRACKET - LH REAR <i>Not nec.</i>	\$ 46.00	? X
23	FRONT FENDER BRACE - LH LOWER <i>Best</i>	\$ 112.00	✓ 89.20
24	STONE CHIP GUARD <i>3</i>	\$ 69.00	✓ 54.64
25	ADHESIVE TAPE <i>3m</i>	\$ 52.00	✓ 40.96
26	WHEEL HOUSING LINER - LH <i>Del'd</i>	\$ 226.00	✓ 180.40
27	WHEEL HOUSING LINER ATTACHMENT PARTS <i>Not nec.</i>	\$ 42.00	? X
28	BONNET <i>Distorted</i>	\$ 2,629.00	✓ 2103.20
29	BONNET PROTECTIVE FILM - FRONT <i>n</i>	\$ 43.00	✓ 34.08
30	BONNET ATTACHMENT PARTS <i>Not nec.</i>	\$ 159.00	? X
31	BONNET LID HINGE - LH / RH <i>n</i>	2 \$ 140.00	+
32	BONNET CATC HOOK <i>3</i>	\$ 132.00	+
33	BONNET GAS FILLED STRUT - LH <i>1</i>	\$ 112.00	+
34	BONNET EDGE PROTECTION - FRONT <i>n</i>	\$ 26.00	✓ 20.80
35	BONNET LID LOCK <i>n</i>	\$ 202.00	+
36	BONNET LID LOCK CABLE <i>n</i>	\$ 46.00	+
37	BONNET LOCK COVER <i>n</i>	\$ 21.00	+
• 38	HEADLIGHT MOUNTING - LH <i>Excluded.</i>	\$ 112.00	? ✓ 89.20
• 39	HEADLAMP BRACKET - LH <i>Excluded</i>	\$ 100.00	? ✓ 79.28
40	HEADLIGHT - LH <i>Excluded</i>	\$ 2,208.00	✓ 1766.40
SUB TOTAL SPARE PARTS CHARGES		: \$ 6,527.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLG 3233 X

		Damage Parts & Prices	
S/N	Parts Description	S/Nett	Remarks
41	GAS DISCHARGE LAMP CONTROL UNIT <i>new</i>	\$ 1,074.00	✓ X
42	DAY DRIVING LIGHTS POWER MODULE <i>changed.</i>	\$ 532.00	✓ 425.60
43	GAS DISCHARGE LAMP <i>new</i>	\$ 404.00	+
44	HEADLIGHT RETAINING PLATE - LH <i>new</i>	\$ 23.00	+
45	HEADLIGHT HOSE - LH <i>new</i>	\$ 34.00	+
46	HALOGEN FOG LAMP - LH <i>new</i>	\$ 247.00	+
47	LIFT CYLINDER - LH <i>included.</i>	\$ 198.00	✓ 158.00
48	LIFT CYLINDER HOSE <i>new</i>	\$ 172.00	+
49	LOCK CARRIER <i>changed</i>	\$ 956.00	✓ 764.40
50	LOCK CARRIER BRACE - LH <i>new</i>	\$ 43.00	✓ X
51	RADIATOR AIR GUIDE - LH <i>new</i>	\$ 25.00	✓ X
52	RADIATOR SEALING STRIP <i>new</i>	\$ 15.00	+
53	FRONT NO PLATE <i>new</i>	S/N \$ 60.00	✓
54	FRONT RIM - LH <i>new</i>	TBC	✓
55	SUNDRIES <i>new.</i>	\$ 400.00	✓ 53.04

TOTAL SPARE PARTS CHARGES

: **\$ 17,261.00**

TOTAL LABOUR CHARGES

: **\$ 10,994.00**

GRAND TOTAL

: **\$ 28,255.00**

28705.00

All charges are not inclusive of GST.

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved


Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Name : *Adrian G.*
Surveyed Date : *05/03/20*
Authorised Date :
Excess Cost :
Liability :
Remarks : *Not Authorised, 06 Days (without lock carrier)*

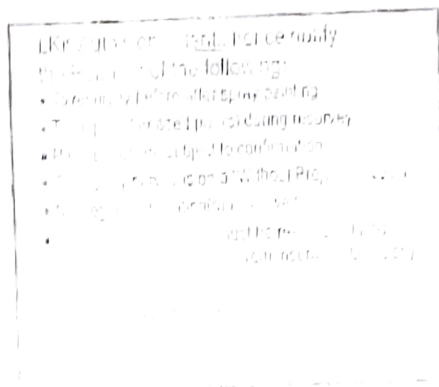

05 Days (with lock carrier)
H.S.

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel. 6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles Pte Ltd

55 Seletar Road 1, Singapore 408699

Tel: (65) 6365 7323 Fax: (65) 6841 1183

Supplementary Estimate 1

Est Rep No: 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Estimate No.

PA/00/0235/2020/NS

Date

10-Mar-20

Service Advisor

Glory Tan

Pages

1 of 1

Regn No

SLG 3233 X

Model No

Audi A4 1.8 TFSI (140) 8K701

Quantity	Description	Unit Price	Amount
Parts			
1	Refrigerant pipe <i>gt ✓</i>	\$ 299.00	238.80
2	Repair kit for quick release coupling <i>nm ✓</i>	\$ 65.00	52.00
3	Coolant <i>nm ✓</i>	\$ 86.00	68.80

TOTAL

\$ 450.00

For Premium Automobiles Pte Ltd

2014/03/2020

Authorised Signature

1. To resurvey the damaged vehicle 2. To display damaged vehicle during resurvey 3. Parts prices are subject to confirmation 4. If the survey is on a "Without Prejudice" basis, any modification(s) is allowed 5. The damaged vehicle must be resurveyed and approved by the Insurance Company
--