



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV No. AC2005206
INV Date 27/07/2020
Reference CC4/FCI20003881/Eea3q2
Code FCI2



PROFESSIONAL SERVICE FEE

Vehicle No. SMK 873K
Insured Veh. SHB 2733A
Claim No. D20001368MFSH
Policy No. D-20094921MFSH
Accident Date 07/03/2020
Inspection Date 10/03/2020

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD	Ref : CC4/FCI20003881/Eea3q2
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877	Date : 27-07-2020
	Code : FCI2



1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHB 2733A	Veh. Inspected	SMK 873K
Policy No.	D-20094921MFSH	Coverage (\$)	0.00
Claim No.	D20001368MFSH	Excess (\$)	0.00
Assign From	MERINA	Assign Date	10/03/2020

2. Vehicle Particulars & Condition

Make & Model	PEUGEOT 3008	c.c	1598
Engine No.	HIDDEN	Year of Reg.	2012
Chassis No.	VF30U5FVABS301900	Colour	WHITE
Odometer	110621	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	FAIR		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	225/50 R17	BRIDGESTONE	5 mm
L/H Front Tyre	225/50 R17	BRIDGESTONE	5 mm
R/H Rear Tyre	225/50 R17	BRIDGESTONE	5 mm
L/H Rear Tyre	225/50 R17	BRIDGESTONE	5 mm

4. Description of Damages

	THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S PORTION. DAMAGES SEE DETAILS.
--	--

5. General Information

Accident Date	07/03/2020	Inspection Date	10/03/2020
Survey held at	MOVA AUTOMOTIVE PTE LTD 15 FAN YONG ROAD SINGAPORE 629792		

5a. Remarks

	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--	--

5b. Estimate Days of Repair

	ESTIMATED NORMAL PERIOD FOR REPAIR: 6 Working Days
--	---



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMK 873K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	TAILLAMP ASSY RH	NOT NECESSARY	400.00	-
1	TAILLAMP LOWER BRACKET RH	CRUSHED	140.00	140.00
1	REAR BUMPER GARNISH -CENTER	BROKEN	1,550.00	1,550.00
1	REAR BUMPER GARNISH -RH	CRUSHED	480.00	480.00
1	REAR BUMPER	BROKEN	980.00	980.00
1	REAR BUMPER REFLECTOR RH	BROKEN	120.00	120.00
1	REAR BUMPER SPONGE	NOT NECESSARY	200.00	-
1	REAR BUMPER REINFORCEMENT	NOT NECESSARY	450.00	-
1	REAR BUMPER BRACKET RH	BENT	145.00	145.00
1	REAR BUMPER RETAINER RH	BROKEN	140.00	140.00
10	REAR BUMPER CLIPS @\$8.00	NECESSARY	80.00	30.00
1	REAR FENDER COWLING RH	TORN	160.00	160.00
1	REAR END PANEL	TO REPAIR SEE LABOUR	950.00	-
1	REAR END PANEL TOP COVER	NOT NECESSARY	380.00	-
1	REAR FENDER INNER TRIM RH (NPA)	NOT NECESSARY	-	-
1	TAILGATE (NPA)	TO REPAIR SEE LABOUR	-	-
1	TAILGATE LOGO	NECESSARY	120.00	120.00
1	TAILGATE EMBLEM -PEUGEOT	NECESSARY	115.00	115.00
1	TAILGATE EMBLEM -3008	NECESSARY	100.00	100.00
	LESS 10% DISCOUNT		-651.00	-408.00
			5,859.00	3,672.00
<u>SPECIAL NETT ITEMS</u>				
1	SET REVERSE SENSOR (SN)	BROKEN	200.00	200.00
			200.00	200.00
<u>LABOUR</u>				
	TO CUT/WELD REAR END PANEL,KNOCK AND STRAIGHTEN REAR FENDER RH ,SPARE WHEEL PANEL.REMOVE AND REPLACE ACCIDENT DAMAGED PARTS.REALIGN ALL CONNECTION.INCLUSIVE OF THE REPAIR OF REAR END PANEL AND TAILGATE.		900.00	700.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	SPRAY PAINT REAR FENDER LH,REAR END PANEL,REAR BUMPER ,REAR BUMPER GARNISH ,TAILGATE.		700.00	700.00
	REMOVE & REFIT LUGGAGE COMPARTMENT INNER TRIM ,GARNISH ,COVERING.		60.00	50.00
	REMOVE & REINSTALL REVERSE SENSOR AND CHECK FUNCTION.		50.00	30.00
			1,710.00	1,480.00
GRAND TOTAL			7,769.00	5,352.00
RECOMMENDED COST OF REPAIRS				5,352.00

Report Ref No. CC4/FCI20003881/Eea3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMK 873K

INSPECTION

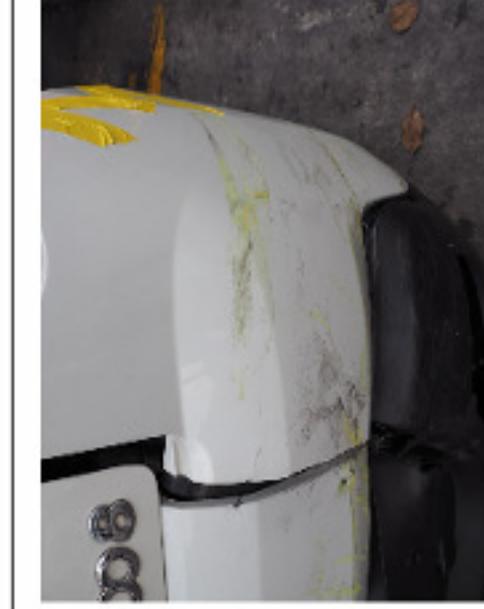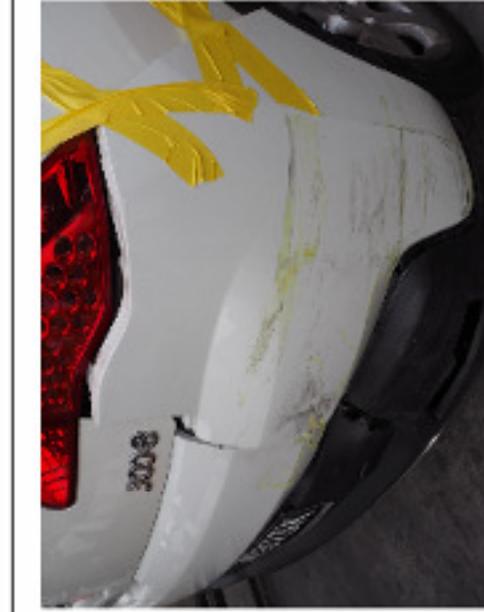



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

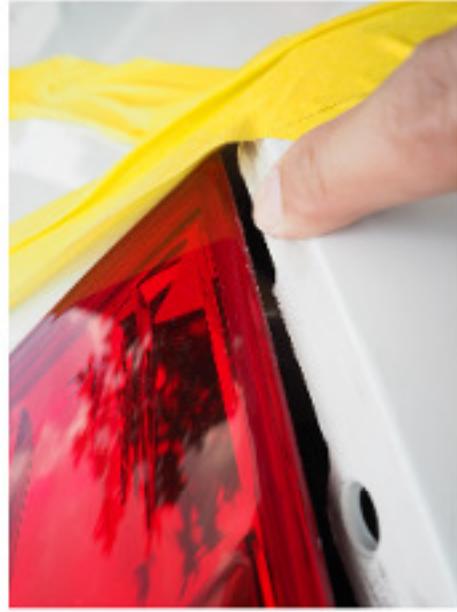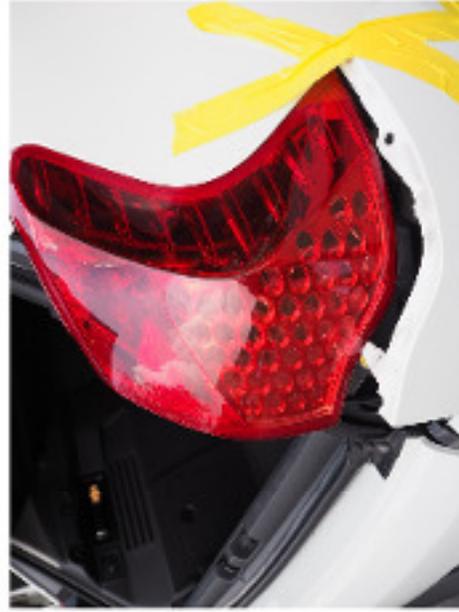



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

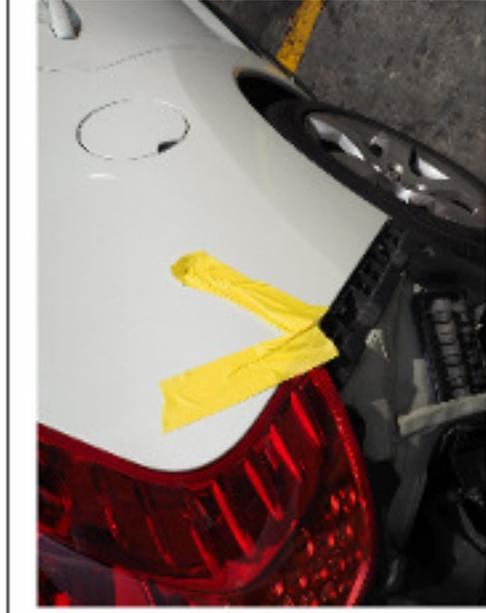



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMK 873K

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

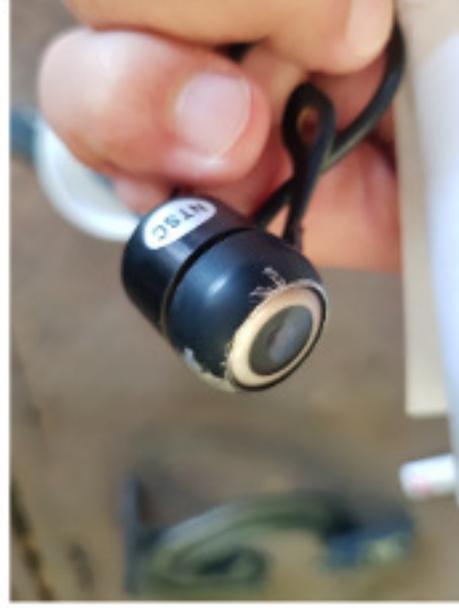



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMK 873K

RE-INSPECTION

