



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV No. AC2103758

INV Date 28/05/2021

Reference CC4/FCI20003960/Aea3q2

Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLM 4464H

Insured Veh. SHC 7021H

Claim No. D20001447MFSH

Policy No. D-20094921MFSH

Accident Date 11/03/2020

Inspection Date 13/03/2020

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Ref: CC4/FCI20003960/Aea3q2 Date: 28/05/2021 Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SHC 7021H	Veh. Inspected	SLM 4464H
Policy No.	D-20094921MFSH	Coverage (\$)	0.00
Claim No.	D20001447MFSH	Excess (\$)	0.00
Assign From	MERINA	Assign Date	13/03/2020
2. Vehicle Particulars & Condition			
Make & Model	NISSAN QASHQAI	c.c	1197
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	SJNFEAJ11U1773827	Colour	WHITE
Odometer	215226 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	215/60 R17	HABILEAD	6 mm
L/H Front Tyre	215/60 R17	HABILEAD	6 mm
R/H Rear Tyre	215/60 R17	HABILEAD	6 mm
L/H Rear Tyre	215/60 R17	HABILEAD	6 mm
4. Description of Damages			
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.		
5. General Information			
Accident Date	11/03/2020	Inspection Date	13/03/2020
Survey held at	2 KAKI BUKIT AVE 2 #01-18		
Repairer	N-51 AUTOMOTIVE PL		
5a. Remarks			
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.		
5b. Estimate Days of Repair			
	ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLM 4464H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	DEFORMED	717.00	717.00
1	REAR BUMPER INNER SPONGE	CRACKED	126.40	126.40
2	REAR BUMPER REINFORCEMENT BRACKET L/R @ \$126.00	BENT	252.00	252.00
2	REAR BUMPE SIDE RETAINER L/R @\$35.90	NECESSARY	71.80	71.80
1	REAR BUMPER TOW HOOK COVER	DEFORMED	16.80	16.80
1	REAR END PANEL	DENTED	482.60	482.60
1	REAR END PANEL ANTENNA SENSOR	CRACKED	285.10	285.10
1	REAR END PANEL INNER TOP GARNISH	DEFORMED	63.50	63.50
1	REAR RH TAILLAMP	CRACKED	323.70	323.70
1	REAR TAILGATE 'QASHQAI' EMBLEM	NOT NECESSARY	87.00	-
1	REAR TAILGATE MECHANISM LOCK	NOT NECESSARY	116.70	-
1	REAR TAILGATE WEATHER STRIP	NOT NECESSARY	158.70	-
1	REAR BUMPER REINFORCEMENT	BENT	619.20	619.20
	LESS 10% DISCOUNT		-332.05	-295.81
			2,988.45	2,662.29
<u>SPECIAL NETT ITEMS</u>				
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	50.00	50.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	DAMAGED	450.00	300.00
1	SET REAR END PANEL INNER TOP GARNISH CLIPS (SN)	NECESSARY	30.00	10.00
1	SET REAR RH TAILLAMP CLIPS (SN)	NECESSARY	20.00	10.00
			550.00	370.00
<u>LABOUR</u>				
	TO REMOVE ,REINSTALL ELECTRICAL WIRING HARNESS ,CHECK LIGHTING AND REWIRE FOR PARKING SENSOR .		50.00	50.00
	TO REMOVE ,REINSTALL ROOF TOP TRIM UPHOLSTERY ,CUSHION SEAT ,TRIM GARNISH ,TRIM LINER CARPET (TO FR).		120.00	50.00
	TO RE-SPRAY PAINTING ON THE CHARGE BODYPARTS ,REPAIR PORTION ,AND WHERE CONSISTENT TO THE ACCIDENT .		900.00	500.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO PROVIDE LABOUR ,WORKMANSHIP TO CHARGE THE ABOVE DAMAGED BODYPARTS ,REPAIR ,RECONSTRUCT AND RE ALIGN BODY STRUCTURE ,BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT .		800.00	600.00
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED PANEL.		50.00	50.00
			1,920.00	1,250.00
GRAND TOTAL			5,458.45	4,282.29
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,400.00

Report Ref No. CC4/FCI20003960/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLM 4464H

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

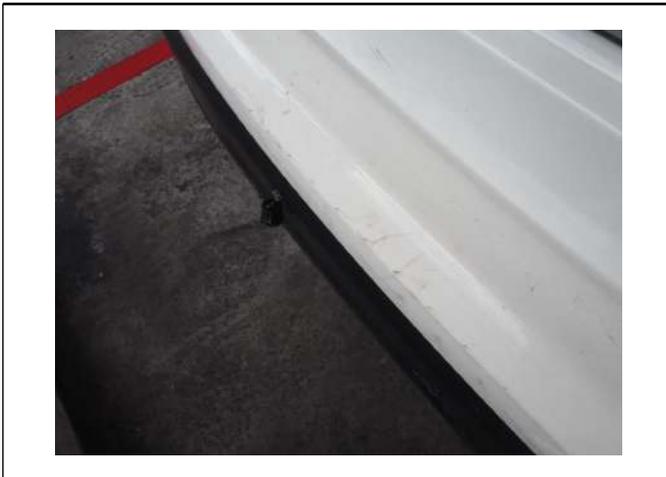



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLM 4464H

RE-INSPECTION

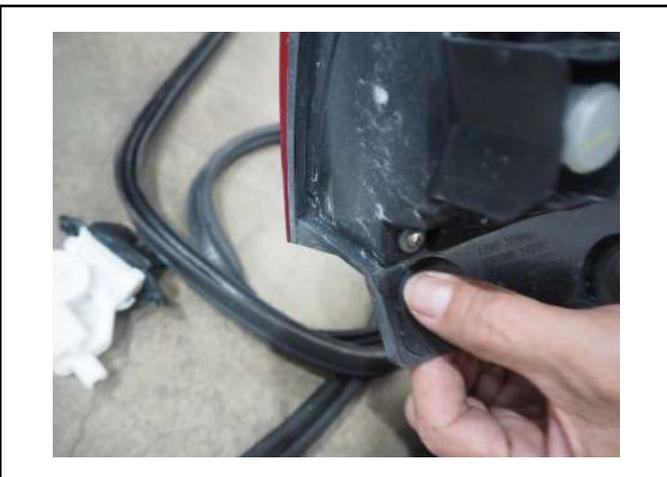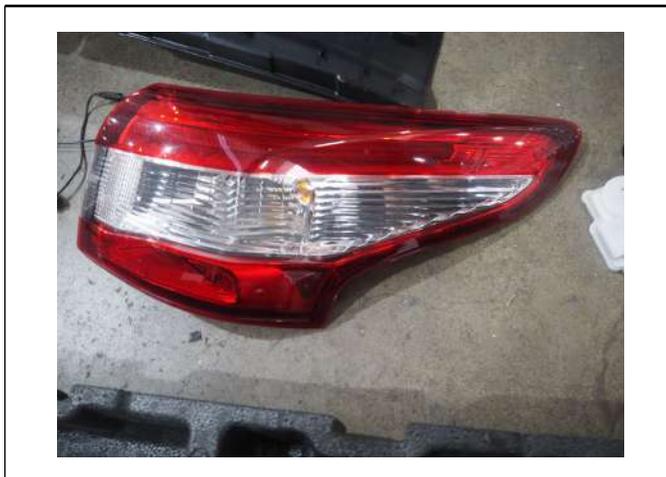



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

