



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2100413
3 ANSON ROAD #16-00	INV Date	19/01/2021
SPRINGLEAF TOWER	Reference	CC3/CTI20003973/Kpa3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SHD 9505K
Insured Veh.	SKM 288M
Claim No.	SNM20D201268
Policy No.	DMPCSN1928701900
Accident Date	10/03/2020
Inspection Date	12/03/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWERSINGAPORE 079909

Ref: CC3/CTI20003973/Kpa3q2

Date: 19/01/2021

Code: CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SKM 288M	Veh. Inspected	SHD 9505K
Policy No.	DMPCSN1928701900	Coverage (\$)	0.00
Claim No.	SNM20D201268	Excess (\$)	0.00
Assign From		Assign Date	12/03/2020

2. Vehicle Particulars & Condition

Make & Model	TOYOTA PRIUS (A)	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	JTDKB3FU803077034	Colour	M . P. WHITE / RED
Odometer	109277 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	GITI	8 mm
L/H Front Tyre	195/65 R15	GITI	8 mm
R/H Rear Tyre	195/65 R15	GITI	9 mm
L/H Rear Tyre	195/65 R15	GITI	9 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S REAR BODY.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	10/03/2020	Inspection Date	12/03/2020
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **3 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 9505K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	MOULDING ASSY,BODY ROCKER PANEL,LH	SERVICEABLE	594.80	-
1	PANEL SUB-ASSY,QUARTER,LH	TO REPAIR SEE LABOUR	871.50	-
1	REAR FENDER LINER	SERVICEABLE	139.80	-
1	DUCT ASSY,QUARTER VENT,LH	SERVICEABLE	67.00	-
1	SEAL,REAR BUMPER SIDE,LH	SERVICEABLE	88.50	-
1	REAR BUMPER	SERVICEABLE	442.60	-
1	REAR BUMPER UNDER COVER (BLACK)	SERVICEABLE	576.30	-
1	REAR BUMPER SIDE RETAINER LH	SERVICEABLE	116.50	-
1	TAILLAMP LOWER LH	SERVICEABLE	502.00	-
1	TAILLAMP UPPER LH	SERVICEABLE	443.30	-
1	REAR BUMPER SIDE LH	SERVICEABLE	123.70	-
1	PANEL SUB-ASSY,REAR DOOR,LH	DENTED / WARPED	1,294.90	1,294.90
1	TAPE,BLACK OUT,NO 1 LH	NECESSARY	21.90	21.90
1	TAPE,BLACK OUT,NO 2 LH	NECESSARY	34.90	34.90
1	TAPE,BLACK OUT,NO 3 LH	NECESSARY	15.40	15.40
1	REAR WHEEL RIM	SERVICEABLE	1,879.40	-
1	REAR WHEEL RIM COVER	SERVICEABLE	211.50	-
	LESS 25% DISCOUNT		-1,856.00	-341.77
			5,568.00	1,025.33
<u>SPECIAL NETT ITEMS</u>				
1	REAR DOOR STICKER "6555-3333" (SN)	NECESSARY	100.00	60.00
1	SET REAR BUMPER CLIP (SN)	NOT NECESSARY	66.00	-
2	REAR WINDSCREEN SEALANT (SN)	NOT NECESSARY	100.00	-
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	150.00	-
1	REAR WINDSCREEN INNER SPONGE SEAL (SN)	NOT NECESSARY	100.00	-
1	SET REAR FENDER LINER CLIP (SN)	NOT NECESSARY	33.00	-
1	REAR TYRE 195/65/15 (SN)	SERVICEABLE	350.00	-
1	SET REAR BUMPER RETAINER CLIP (SN)	NOT NECESSARY	35.00	-
1	SET ROCKER PANEL MOULDING CLIP (SN)	NOT NECESSARY	35.00	-
1	SET TAILLAMP LOWER CLIP (SN)	NOT NECESSARY	25.00	-

Report Ref No. CC3/CTI20003973/Kpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET TAILLAMP UPPER CLIP (SN)	NOT NECESSARY	25.00	-
			1,019.00	60.00
	LABOUR			
	TO TRANSFER OF REAR FENDER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER OF REAR BUMPER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR WINDSCREEN GLASS TO FACILITATE BODYWORK REPAIR.	NOT NECESSARY	170.00	-
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH, TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF PANEL SUB-ASSY, QUARTER, LH.		6,000.00	400.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		6,000.00	660.00
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
	TO REINSTALL REAR BUMPER PARKING SENSOR.	NOT NECESSARY	170.00	-
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	30.00
	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO TRANSFER OF DOOR FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.		170.00	60.00
			14,340.00	1,170.00
GRAND TOTAL			20,927.00	2,255.33
RECOMMENDED COST OF REPAIRS				2,255.33

Report Ref No. CC3/CTI20003973/Kpa3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 9505K

INSPECTION

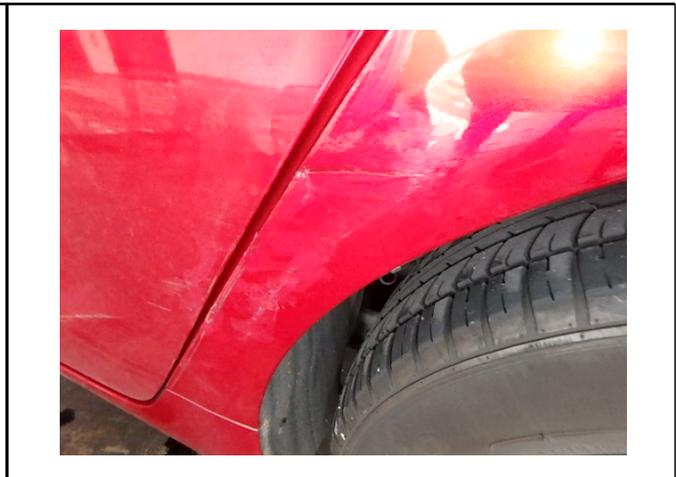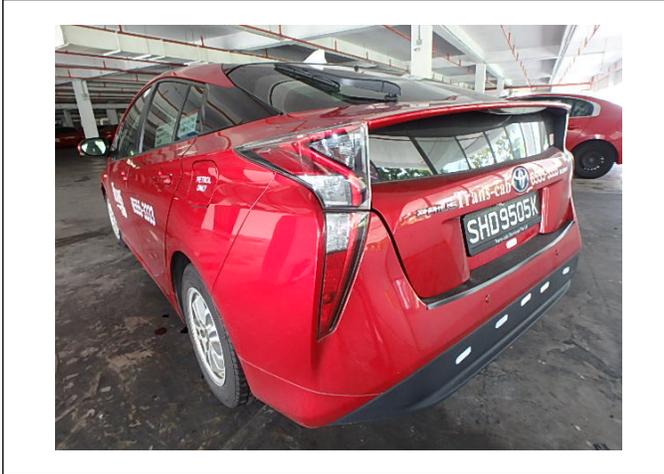




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

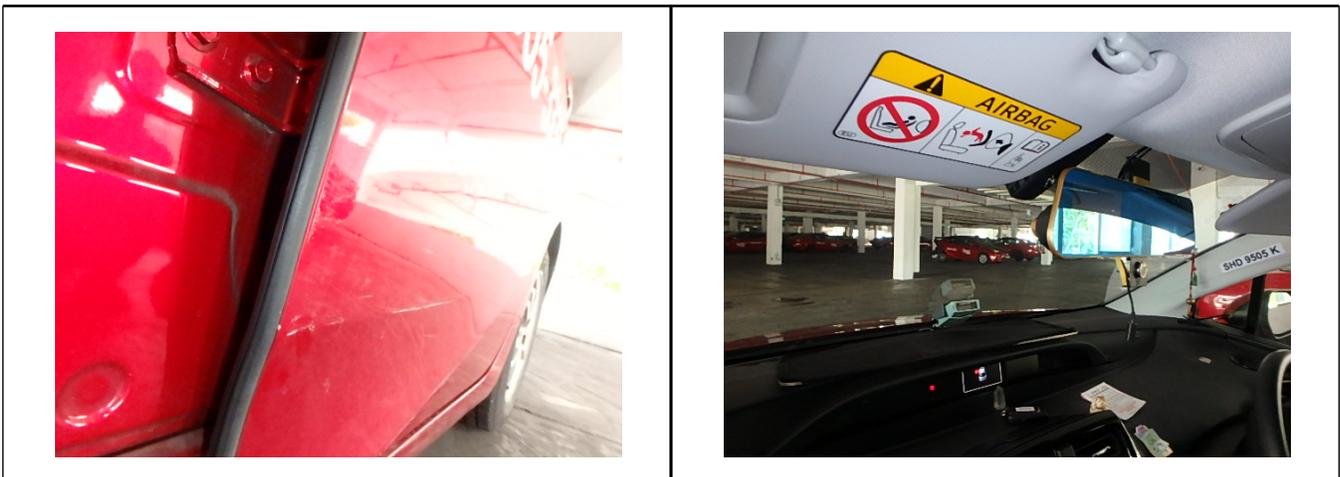





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

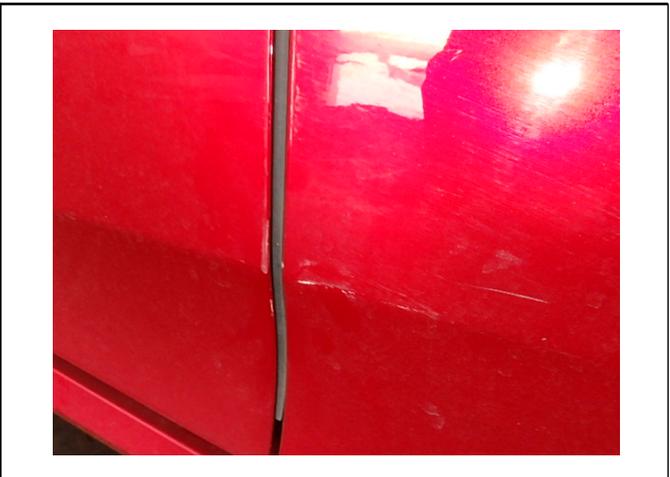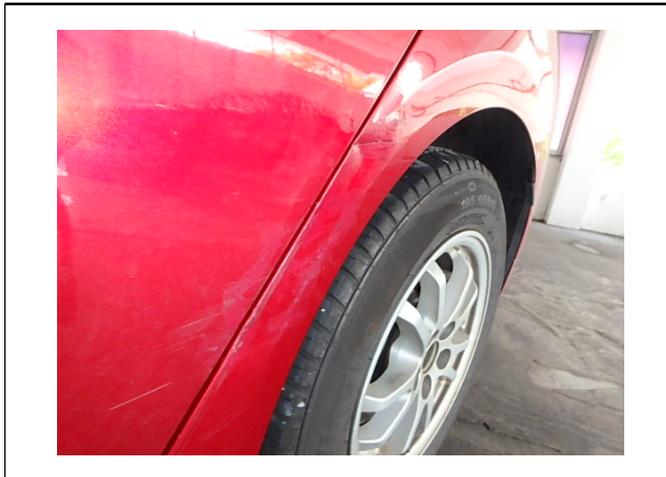



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 9505K

RE-INSPECTION

