



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

SOMPO INSURANCE SINGAPORE PL
50 RAFFLES PLACE
#05-01/06
SINGAPORE LAND TOWER
SINGAPORE 048623

INV No. AC2003504
INV Date 28/04/2020
Reference CS/SMO20004039/Eqf3n2
Code SMO



PROFESSIONAL SERVICE FEE

Vehicle No. SKE 36R
Insured Veh. PC 1083Z
Claim No. CMTD2001144/THE
Policy No.
Accident Date 13/03/2020
Inspection Date 19/03/2020

Description	Total
Survey Inspection	350.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

SOMPO INSURANCE SINGAPORE PL

Ref : CS/SMO20004039/Eqf3n2

50 RAFFLES PLACE

#05-01/06

SINGAPORE LAND TOWERSINGAPORE 048623

Date : 28-04-2020



Code : SMO

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	PC 1083Z	Veh. Inspected	SKE 36R
Policy No.		Coverage (\$)	0.00
Claim No.	CMTD2001144/THE	Excess (\$)	0.00
Assign From	GRACE TEO	Assign Date	16/03/2020

2. Vehicle Particulars & Condition

Make & Model	LEXUS RX300	c.c	1998
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	JTJBAMCA602049464	Colour	WHITE
Odometer	51192	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	235/55 R20	BRIDGESTONE	5 mm
L/H Front Tyre	235/55 R20	BRIDGESTONE	5 mm
R/H Rear Tyre	235/55 R20	BRIDGESTONE	5 mm
L/H Rear Tyre	235/55 R20	BRIDGESTONE	5 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	13/03/2020	Inspection Date	19/03/2020
Survey held at	BORNEO MOTORS (S) PTE LTD 2 PANDAN CRESCENT SINGAPORE 128462		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **3 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKE 36R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	COVER,RR BUMPER (SN)	DENTED	1,030.60	1,030.60
1	EXTENSION,SUB-ASSY (SN)	CUT	570.40	570.40
1	EXTENSION,SUB-ASSY (SN)	NOT NECESSARY	307.20	-
1	RETAINER,RR BUMPER (SN)	NOT NECESSARY	161.10	-
1	RETAINER,RR BUMPER (SN)	NOT NECESSARY	161.10	-
1	EXTENSION,SUB-ASSY (SN)	NOT NECESSARY	318.40	-
4	BUMPER CLIPS (SN)	NECESSARY	16.40	16.40
1	RETAINER,RR BUMPER (SN)	NOT NECESSARY	149.90	-
1	RETAINER,RR BUMPER (SN)	NOT NECESSARY	149.90	-
1	REINFORCEMENT,RR (SN)	NOT NECESSARY	536.10	-
1	ABSORBER,RR BUMPER (SN)	NOT NECESSARY	112.40	-
1	RETAINER,RR BUMPER (SN)	NOT NECESSARY	200.60	-
1	RETAINER,RR BUMPER (SN)	NOT NECESSARY	200.60	-
1	REFLECTOR ASSY (SN)	NOT NECESSARY	48.80	-
1	REFLECTOR ASSY (SN)	NOT NECESSARY	48.80	-
4	CLIP,ULTRASONIC (SN)	NECESSARY	49.20	49.20
4	SENSOR,ULTRASONIC (SN)	NOT NECESSARY	1,963.20	-
2	RETAINER,ULTRASONIC (SN)	NECESSARY	83.20	83.20
2	RETAINER,ULTRASONIC (SN)	NECESSARY	38.40	38.40
1	SUNDRIES (SN)	NECESSARY	100.00	50.00
			6,246.30	1,838.20
<u>LABOUR</u>				
TO REMOVE ALL NECESSARY PARTS.TO ENABLE REPAIRING AND STRAIGHTEN ON REAR BUMPER AND FIX NEW PARTS.			1,732.00	866.00
TO SPRAY PAINT ON REAR BUMPER.			1,484.00	742.00
TO REMOVE AND TRANSFER REAR SENSOR TO NEW BUMPER,REPLACE IF DAMAGE.			216.50	216.50
TO CHECK WIRING AND LIGHTS FUNCTIONING AND CARRY OUT WATER LEAK TEST.			216.50	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO RESET ECU & REPROGRAMME.		216.50	216.50
			3,865.50	2,041.00
GRAND TOTAL			10,111.80	3,879.20
RECOMMENDED COST OF REPAIRS				3,879.20

Report Ref No. CS/SMO20004039/Eqf3n2

CHEN TSUE YEE

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKE 36R

INSPECTION

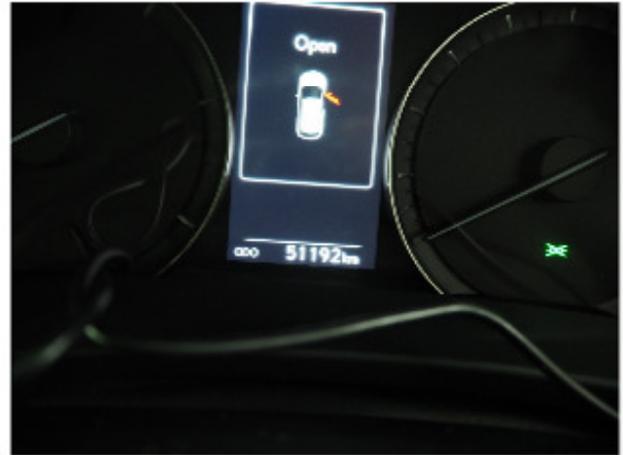




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

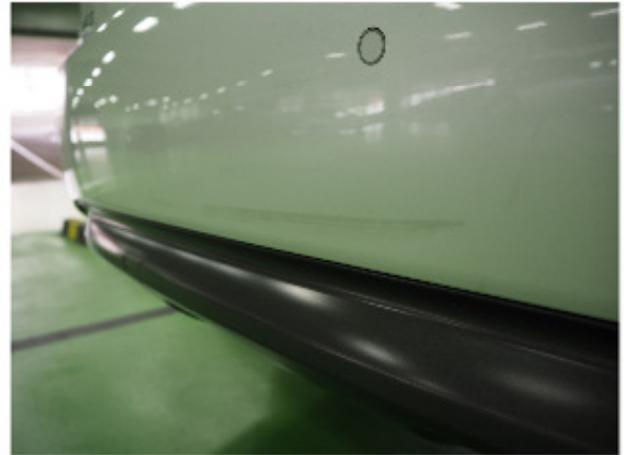



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKE 36R

RE-INSPECTION

