



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

SOMPO INSURANCE SINGAPORE PL
50 RAFFLES PLACE
#05-01/06
SINGAPORE LAND TOWER
SINGAPORE 048623

INV No. AC2003178
INV Date 15/04/2020
Reference CS/SMO20004205/Kvd3n2
Code SMO



PROFESSIONAL SERVICE FEE

Vehicle No. SLU 6579E
Insured Veh. SLK 8853C
Claim No. CMTD2001085/THE
Policy No.
Accident Date 11/03/2020
Inspection Date 24/03/2020

Description	Total
Survey Inspection	250.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	250.00
GST (7%)	17.50
Grand Total	267.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

SOMPO INSURANCE SINGAPORE PL

Ref : CS/SMO20004205/Kvd3n2

50 RAFFLES PLACE

#05-01/06

SINGAPORE LAND TOWERSINGAPORE 048623

Date : 15-04-2020



Code : SMO

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SLK 8853C	Veh. Inspected	SLU 6579E
Policy No.		Coverage (\$)	0.00
Claim No.	CMTD2001085/THE	Excess (\$)	0.00
Assign From	GRACE TEO	Assign Date	18/03/2020

2. Vehicle Particulars & Condition

Make & Model	HONDA VEZEL (A)	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	RU11230301	Colour	METALLIC DARK GREY
Odometer	26831	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/60 R16	DUNLOP	7 mm
L/H Front Tyre	215/60 R16	DUNLOP	7 mm
R/H Rear Tyre	215/60 R16	DUNLOP	7 mm
L/H Rear Tyre	215/60 R16	DUNLOP	7 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	11/03/2020	Inspection Date	24/03/2020
Survey held at	LIM TAN MOTOR PTE LTD BLK 176 SIN MING DRIVE #03-09 SIN MING AUTOCARE SINGAPORE 575721		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **4 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLU 6579E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	BENT	463.70	463.70
2	REAR BUMPER RETAINER @\$17.50	SERVICEABLE	35.00	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	411.90	-
1	REAR END PANEL GARNISH	SERVICEABLE	92.80	-
1	TAIL GATE	BENT	1,050.00	1,050.00
1	TAIL GATE RUBBER	SERVICEABLE	92.80	-
1	TAIL GATE LOCK	SERVICEABLE	157.00	-
1	TAIL GATE VEZEL EMBLEM	NECESSARY	43.00	43.00
1	REAR WINDSCREEN MOULDING	NECESSARY	120.00	120.00
1	REAR BUZZER ASSY SNERT	CRACKED	75.50	75.50
	LESS 20% DISCOUNT		-508.34	-350.44
			2,033.36	1,401.76
<u>SPECIAL NETT ITEMS</u>				
1	REAR BUMPER SENSOR (SN)	SHORTED	200.00	200.00
1	TUBE REAR WINDSCREEN SEALANT (SN)	NECESSARY	40.00	40.00
			240.00	240.00
<u>LABOUR</u>				
	TO PUTTY & SPRAY PAINT.		800.00	400.00
	TO TRANSFER TAIL GATE FITTING.		80.00	60.00
	TO REMOVE & REFIX REAR WINDSCREEN GLASS.		100.00	100.00
	TO ANTI-RUST.		80.00	30.00
	LABOUR CHARGES.INCLUSIVE OF THE REPAIR OF REAR END PANEL.		500.00	400.00
	-		-	-
	-		-	-
	-		-	-
			1,560.00	990.00
GRAND TOTAL			3,833.36	2,631.76
RECOMMENDED COST OF REPAIRS				2,631.76

Report Ref No. CS/SMO20004205/Kvd3n2



Report Ref No. CS/SMO20004205/Kvd3n2

A handwritten signature in black ink, appearing to be 'KSC'.

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01 -25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLU 6579E

INSPECTION







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

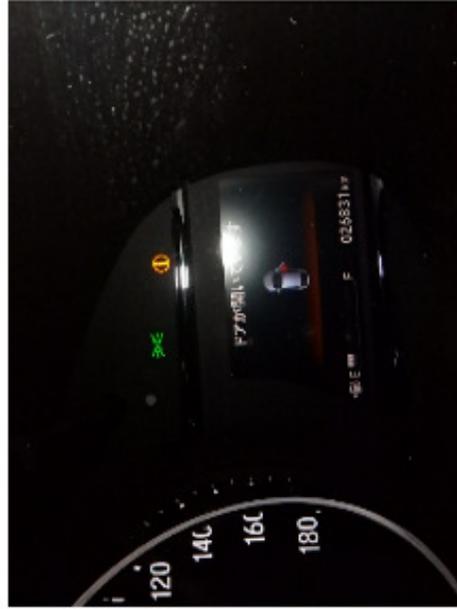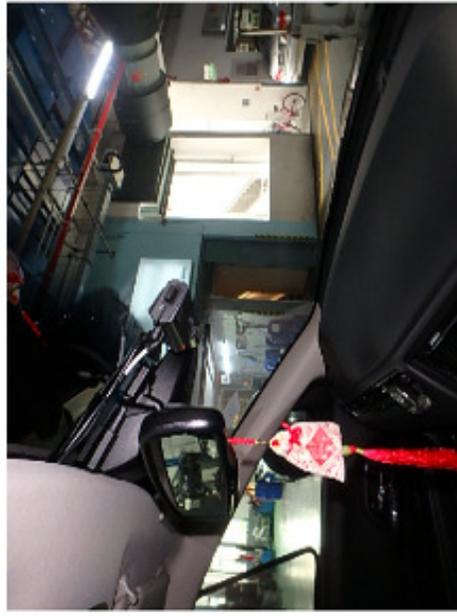



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01 -25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLU 6579E

RE-INSPECTION

