



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2100353

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 15/01/2021
Reference CC4/FCI20004268/Aba3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLZ 9432Z
Insured Veh. SHA 9726E
Claim No. D20001534MFSH
Policy No. D-20094921MFSH
Accident Date 17/03/2020
Inspection Date 20/03/2020

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20004268/Aba3q2	
			Date: 15/01/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SHA 9726E	Veh. Inspected	SLZ 9432Z
	Policy No.	D-20094921MFSH	Coverage (\$)	0.00
	Claim No.	D20001534MFSH	Excess (\$)	0.00
	Assign From	ERIC	Assign Date	20/03/2020
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA SIENTA	c.c	1496
	Engine No.	HIDDEN	Year of Reg.	2018
	Chassis No.	NHP1707125613	Colour	GREEN
	Odometer	202322 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	185/60 R15	HABILEAD	6 mm
	L/H Front Tyre	185/60 R15	HABILEAD	6 mm
	R/H Rear Tyre	185/60 R15	HABILEAD	6 mm
	L/H Rear Tyre	185/60 R15	HABILEAD	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	17/03/2020	Inspection Date	20/03/2020
	Survey held at	2 KAKI BUKIT AVE 2 #01-18		
	Repairer	N-51 AUTOMOTIVE PL		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLZ 9432Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	DEFORMED	950.00	950.00
1	REAR BUMPER LH PROTECTOR GARNISH	DEFORMED	155.00	155.00
1	REAR BUMPER LH REFLECTOR	CRACKED	85.00	85.00
2	REAR BUMPER SIDE RETAINER L/R @\$90.00	N/S DAMAGED	180.00	90.00
1	REAR FENDER AIRVENT LH	DEFORMED	97.00	97.00
1	REAR TAILGATE 'HYBRID SYNERGY DRIVE' EMBLEM	NOT NECESSARY	78.00	-
1	REAR TAILGATE 'LOGO' EMBLEM	NOT NECESSARY	110.00	-
1	REAR TAILLAMP LH	CRACKED	450.00	450.00
1	REAR TAILLAMP LH LOWER BRACKET	CRACKED	83.10	83.10
1	REAR WHEEL HUB CAP LH	NOT NECESSARY	174.00	-
	LESS 25% DISCOUNT		-590.53	-477.53
			1,771.57	1,432.57
<u>SPECIAL NETT ITEMS</u>				
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	50.00	40.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	NOT NECESSARY	250.00	-
1	SET REAR TAILLAMP LH CLIPS (SN)	NECESSARY	30.00	20.00
			330.00	60.00
<u>LABOUR</u>				
	TO REMOVE,REINSTALL ELECTRICAL WIRING HARNESS ,CHECK LIGHTING AND REWIRE FOR PARKING SENSOR .		60.00	60.00
	TO REMOVE,REINSTALL ROOF TOP TRIM UPHOLSTERY ,CUSHION SEAT ,TRIM GARNISH ,TRIM LINER CARPER (TO FR).	NOT NECESSARY	100.00	-
	TO RE-SPRAY PAINTING ON THE CHARGE BODYPARTS ,REPAIR PORTION,AND WHERE CONSISTENT TO THE ACCIDENT .		800.00	500.00
	TO PROVIDE LABOUR WORKMANSHIP TO CHARGE THE ABOVE DAMAGED BODYPARTS ,REPAIR ,RE-CONSTRUCT AND RE- ALIGN BODY STRUCTURE ,BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT .		800.00	400.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL.		50.00	30.00
			1,810.00	990.00
GRAND TOTAL			3,911.57	2,482.57
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,000.00

Report Ref No. CC4/FCI20004268/Aba3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLZ 9432Z

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLZ 9432Z

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

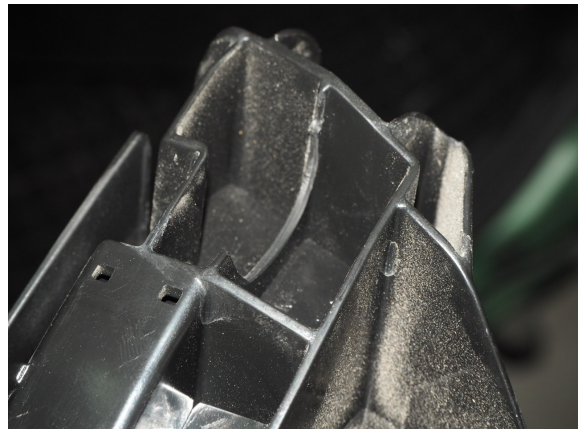



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

