



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV No. AC2005017
INV Date 17/07/2020
Reference CC6/CTI20004418/Aba3n2
Code CTI



PROFESSIONAL SERVICE FEE

Vehicle No. SML 4771P
Insured Veh. PC 296H
Claim No. SNM20D201470
Policy No. DMB1SN3074771900
Accident Date 23/03/2020
Inspection Date 24/03/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CC6/CTI20004418/Aba3n2

3 ANSON ROAD #16-00
SPRINGLEAF TOWERS SINGAPORE 079909

Date : 17-07-2020



Code : CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	PC 296H	Veh. Inspected	SML 4771P
Policy No.	DMB1SN3074771900	Coverage (\$)	0.00
Claim No.	SNM20D201470	Excess (\$)	0.00
Assign From		Assign Date	24/03/2020

2. Vehicle Particulars & Condition

Make & Model	HONDA FREED	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2019
Chassis No.	GB71079113	Colour	BLUE
Odometer	97725	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	185/65 R15	WANLI	6 mm
L/H Front Tyre	185/65 R15	WANLI	6 mm
R/H Rear Tyre	185/65 R15	WANLI	6 mm
L/H Rear Tyre	185/65 R15	WANLI	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	23/03/2020	Inspection Date	24/03/2020
Survey held at	GREEN FOREST AUTOMOBILE PTE LTD 8 KAKI BUKIT AVENUE 4 #05-25 PREMIER @ KAKI BUKIT SINGAPORE 415875		

5a. Remarks

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	7 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SML 4771P

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BOOT LID	DISTORTED	1,350.00	1,180.00
2	REAR BOOT LID HINGES @\$155.20	NOT NECESSARY	310.40	-
1	REAR BOOT LID RUBBER	CUT	205.00	205.00
1	REAR BOOT LID INNER TRIM	CRACKED	680.00	288.00
1	BOOT LID INNER LOCK	DAMAGED	203.10	203.10
1	REAR BOOT LID SHOCK ABSORBER RH	NOT NECESSARY	210.00	-
8	REAR BOOT LID CENTER GARNISH CLIPS @\$5.50	NECESSARY	44.00	20.00
1	REAR BOOT LID CENTRE GARNISH	CUT	285.10	285.10
1	REAR BOOT LID EMBLE LOGO	NECESSARY	60.00	60.00
1	REAR BOOT LID FREED LOGO	NECESSARY	40.00	40.00
1	REAR BOOT LID HYBRID LOGO	NECESSARY	48.00	48.00
1	REAR BOOT LID WIPER	CUT	112.00	112.00
1	REAR BOOT LID WIPER MOTOR	DAMAGED	325.00	325.00
2	REAR BOOT LID SIDE REFLECTOR @\$375.00	CUT	750.00	750.00
1	REAR BOOT LID WINDSCREEN	SHATTERED	1,250.00	1,055.00
1	REAR BOOT LID WINDSCREEN SEAL	NECESSARY	138.20	138.20
1	REAR WINDSCREEN MOULDING	NECESSARY	258.20	258.20
2	REAR NUMBER PLATE LAMP @\$58.00	NOT NECESSARY	116.00	-
1	REAR NUMBER PLATE	NOT NECESSARY	50.00	-
2	REAR BUMPER SIDE REFLECTOR @\$83.10	NOT NECESSARY	166.20	-
1	REAR BUMPER	DEFORMED	1,358.00	921.00
2	REAR BUMPER SIDE BRACKET @\$112.00	NOT NECESSARY	224.00	-
2	REAR BUMPER SIDE RETAINER @\$105.20	NECESSARY	210.40	76.00
8	REAR BUMPER CLIPS @\$5.00	NECESSARY	40.00	40.00
2	REAR TAIL LAMP @\$580.00	N/S CUT / O/S CRACKED	1,160.00	1,160.00
1	REAR END PANEL	DENTED	740.00	528.00
1	REAR END PANEL TOP GARNISH	DEFORMED	284.00	284.00
1	SPARE TYRE PANEL TOP COVER	NOT NECESSARY	485.00	-
1	REAR SPARE TYRE PANEL SEALANT	NOT NECESSARY	220.00	-
2	REAR FENDER INNER TRIM BOARD @\$386.10	N/S CRACKED	772.20	386.10

Report Ref No. CC6/CTI20004418/Aba3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
10	REAR FENDER INNER TRIM BOARD CLIPS @\$5.00	NECESSARY	50.00	30.00
	LESS 20% DISCOUNT		-	-1,678.54
			12,144.80	6,714.16
	<u>SPECIAL NETT ITEMS</u>			
1	REAR BUMPER REVERSE SENSOR (SN)	DAMAGED	300.00	200.00
			300.00	200.00
	<u>LABOUR</u>			
	REMOVE/REFIX REAR WINDSCREEN.		120.00	120.00
	GUM.		50.00	50.00
	REMOVE/REFIX REAR CUSHION .		120.00	60.00
	REMOVE /REFIX REAR REVERSE SENSOR .		100.00	50.00
	TUFF KOTE.		120.00	60.00
	TO CHECK WIRING SYSTEM.		60.00	30.00
	PANEL BEATING.		1,000.00	800.00
	SPRAY PAINTING CHARGES.		1,000.00	800.00
			2,570.00	1,970.00
GRAND TOTAL			15,014.80	8,884.16
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				7,100.00

Report Ref No. CC6/CTI20004418/Aba3n2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SML 4771P

INSPECTION







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

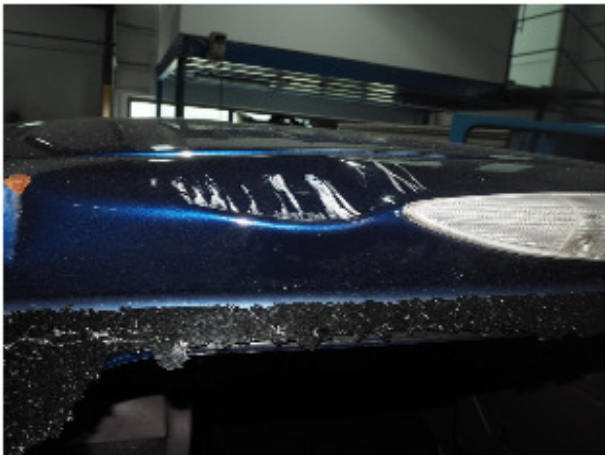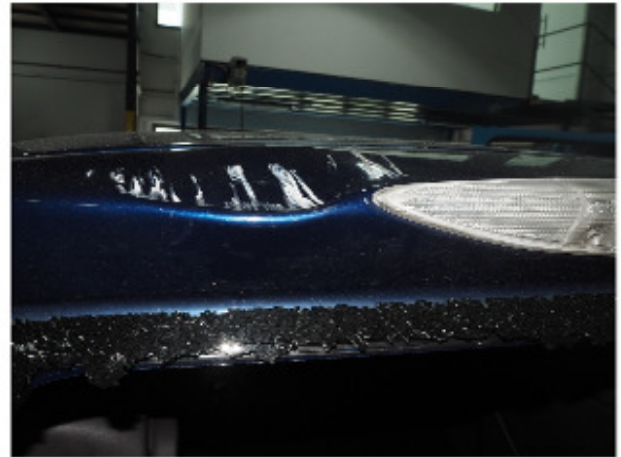



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

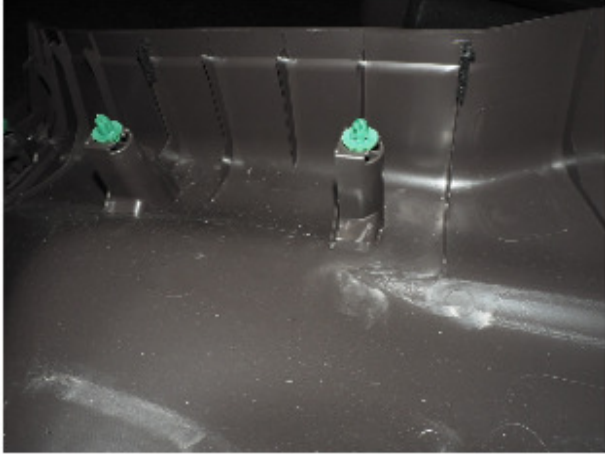




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

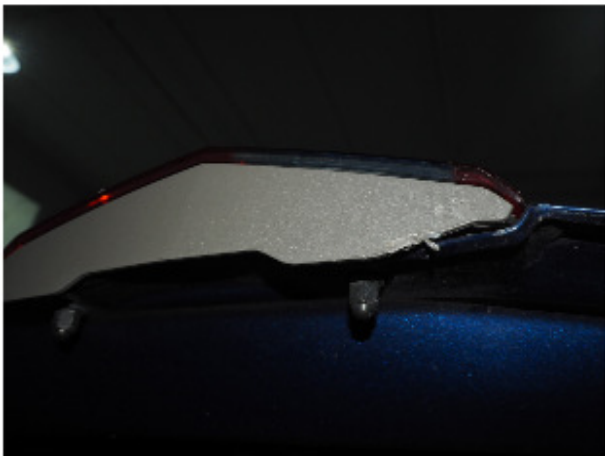



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SML 4771P

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

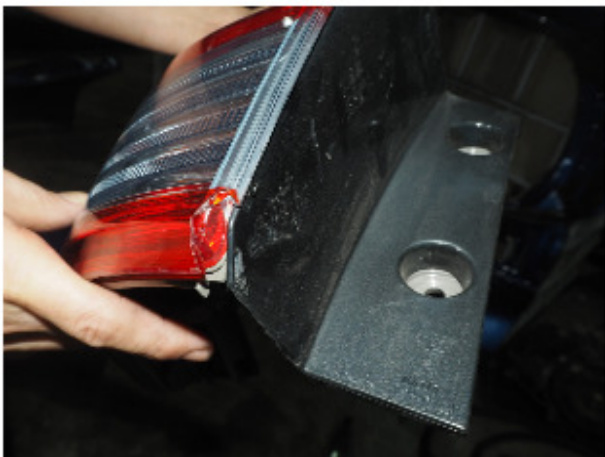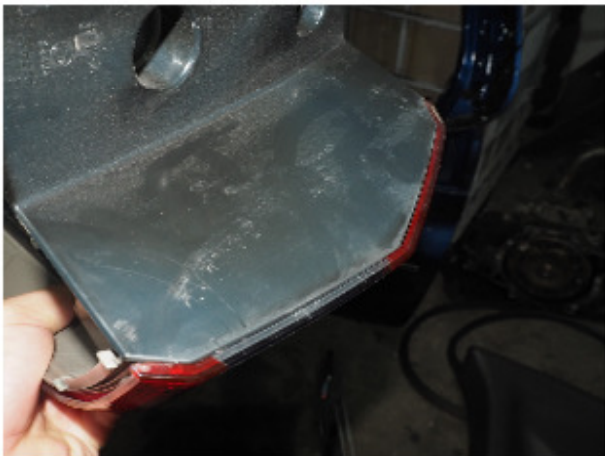



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

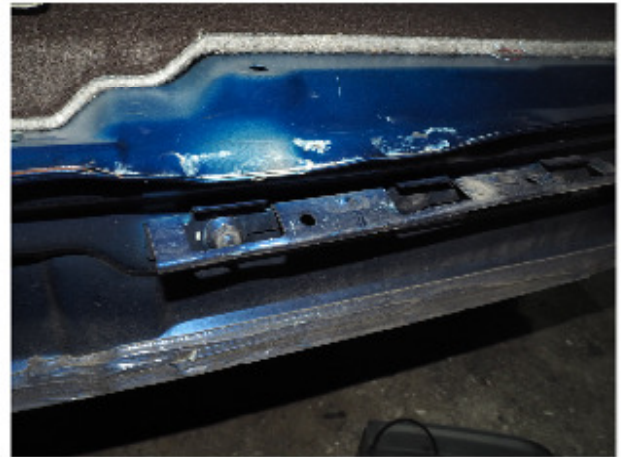



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

