

ASS. REC. BY:

REF: CS/T 20004639 / EVF3

Special Instruction: ✓

Surveyor: Steve

ASSIGNMENT (Office)

From (Person): Derrick Tan

of

TH

Date/Time: 30.3.2020 9.09am

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SLL 9999D

Insured:

at Workshop m/s Hwa Peng Auto

Tel: 63656100

of To Woodlands Industrial Park E9

Policy No:

Claim No:

Sum Insured:

Excess:

1100

Make of Veh:

D.O.A. 24.3.2020

(Client's Record)

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time: 30.3.2020 11.00am

Person Contacted:


Mr Ng

Vehicle IN/OUT

Date/Time	Action/Instruction (✓) Estimate
	SLL 9999D - NBA / III 20004524/4 D.O.A. - 24/03/2020
31/3/20	Revert via merimen.
31/3/20	Rece <u>authorise</u> repair from Meena by merimen
31/3/20	Informed Mr Ng c/A on LS repair ex \$1100 by email

Steve,

Pls check parts prices.

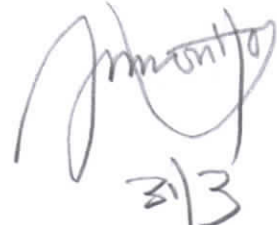

31/3

16/4/20 @ 1019am LS \$12,100 confirmed with Mr Ng (Red 10, 69444, 4790)



華平汽車服務 HWA PENG AUTO SERVICE (1996)

70 Woodlands Industrial Park E9 Singapore 757836

TEL: 6365 6100 FAX: 6365 6101

Spray Painting • Panel Beating • Body Repair • Engine Tuning • Towing Service • Insurance Claim • L.T.A. Inspection Service
Co. Reg 52823719E

ESTIMATE REPORT

Aik Hoe Heng Construction Engineering Works
C/o 70 Woodlands Industrial Park E9
Singapore 757836

Vehicle Number : SLL 9999D
Make And Model : Mercedes Benz
CLA-190
Date of Accident : 24 Mar 2020

S/No	Parts	QTY	Unit Price	List Price
1	Front door (R/H) / <i>DD</i>	1	\$	1,960.00 ✓
2	Front door chrome moulding / <i>BT</i>	1	\$	285.00 ✓
3	Front door glass / <i>CM</i>	1	\$	276.25 ✓
4	Front door outer handle / <i>CM</i>	1	\$	389.50 ✓
5	Front door outer handle bracket (R/H) / <i>BR</i>	1	\$	226.00 ✓
6	Front door inner lock ? Jammed ✓	1	\$	537.00 384 ✓
7	Front door inner lock cover / <i>CM</i>	1	\$	81.30 ✓
8	Front door window regulator ? <i>BT</i> ✓	1	\$	315.00 ✓
9	Front door window regulator motor ? Jammed ✓	1	\$	682.00 500 ✓
10	Front door weatherstrip / <i>AK</i>	1	\$	358.00 280 ✓
11	Front door rivet / <i>AK</i>	1 set	\$	132.00 <i>30</i> ✓
12	Side view mirror assembly / <i>BR</i>	1	\$	1,672.00 1253 ✓
13	Rear door (R/H) / <i>DD</i>	1	\$	1,587.00 ✓
14	Rear door checker X NN	1	\$	130.00 X
15	Rear door hinge ? ✓ <i>BT</i>	2	\$ 158.00	\$ 316.00 ✓
16	Rear door weatherstrip / <i>AK</i>	1	\$	480.00 280 ✓
17	Rear door chrome moulding / <i>BT</i>	1	\$	255.00 ✓
18	Rear door inner lock ? ✓ Jammed	1	\$	690.00 410 ✓
19	Rear door window regulator ? ✓ <i>BT</i>	1	\$	336.00 ✓
20	Rear door window regulator motor ? ✓ Jammed	1	\$	325.00 ✓
21	Rear door rivet / <i>AK</i>	1 set	\$	130.00 <i>30</i> ✓
22	Rear door fender / <i>DD</i>	1	\$	2,080.00 ✓
23	Rear bumper / <i>DD</i>	1	\$	1,642.00 ✓
24	Rear door sensor ? X NN	2	\$ 259.00	\$ 518.00 X
25	Rear wheel rim (R/H) / <i>CM</i>	1	\$	1,021.00 700 ✓
26	Rear wheel bearing ? X NN	1	\$	322.00 X
27	Rear knuckle arm ? X NN	1	\$	1,530.00 X
28	Rear shock absorber X NN	1	\$	522.00 X
29	Rear lower arm ? X NN	1	\$	566.00 X

To be continued page 2



華平汽車服務 HWA PENG AUTO SERVICE (1996)

70 Woodlands Industrial Park E9 Singapore 757836

TEL: 6365 6100 FAX: 6365 6101

Spray Painting • Panel Beating • Body Repair • Engine Tuning • Towing Service • Insurance Claim • L.T.A. Inspection Service
Co. Reg 52823719E

Page 2

S/No	Parts	QTY	Unit Price	List Price
30	Rear thrust arm X NN	1	\$	680.00 X
31	Rear upper arm X NN	1	\$	510.00 X
32	Rear strut arm X NN	1	\$	562.00 X
				\$ 21,116.05
Less 10%				\$ 2,111.61
Total				\$ 19,004.44

Special Nett Item

1	Windscreen sealant / MC	\$	60.00 40/
---	-------------------------	----	-----------

Labour & Misc Charges

To dismantle, replace & panel beating affected parts.	\$	1,200.00 1100/
To spray paint on affected areas.	\$	1,400.00 1000/
To remove & refit rear windscreen glass.	\$	200.00 120/
To remove/refit interior fittings.	\$	250.00 100/
To replace rear under carriage parts.	\$	300.00 ? X
To remove/refit reverse sensors.	\$	80.00 30/
To check wiring.	\$	100.00 /
To check wheel alignment.	\$	100.00 60/
Towing.	\$	100.00 60/
Total	\$	3,790.00
Grand Total :	\$	22,794.44

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Steve (LKK) 00 - Not Author

Excess - ?

30/3/20, 3.00pm

10 days

L/S

By AL sy