



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2100851

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 08/02/2021
Reference CC6/CTI20004944/Upa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLP 5550U
Insured Veh. GBH 9518Z
Claim No. SNM20D201654/C02
Policy No. DMCVSN3073421900
Accident Date 04/04/2020
Inspection Date 06/04/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI20004944/Upa3q2	
			Date: 08/02/2021	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBH 9518Z	Veh. Inspected	SLP 5550U	
Policy No.	DMCVSN3073421900	Coverage (\$)	0.00	
Claim No.	SNM20D201654/C02	Excess (\$)	0.00	
Assign From		Assign Date	06/04/2020	
2. Vehicle Particulars & Condition				
Make & Model	VOLVO V40 (A)	c.c	1596	
Engine No.	HIDDEN	Year of Reg.	2013	
Chassis No.	YV1MZ485BD2009789	Colour	RED/ GREY	
Odometer	124971 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/40 R19	GOODYEAR	6 mm	
L/H Front Tyre	225/40 R19	GOODYEAR	6 mm	
R/H Rear Tyre	225/40 R19	GOODYEAR	6 mm	
L/H Rear Tyre	225/40 R19	GOODYEAR	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	04/04/2020	Inspection Date	06/04/2020	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLP 5550U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	TAILGATE	DENTED / BENT	2,115.00	1,929.00
1	TAILGATE TOP OUTER GARNISH	SCRATCHED / CRACKED	885.00	655.00
1	TAILGATE TOP OUTER GARNISH "VOLVO" EMNLEM	NECESSARY	105.00	62.00
1	TAILGATE INNER LOCK	SERVICEABLE	399.00	-
1	TAILGATE WEATHERSTRIP	TWISTED	322.00	288.00
2	TAILLAMPS @\$650.00	CRACKED	1,300.00	810.00
1	REAR BUMPER TOP	DEFORMED / WARPED	1,820.00	1,566.00
1	REAR BUMPER TOP CENTRE MOULDING	NECESSARY	315.00	315.00
1	REAR BUMPER LOWER	TORN	1,500.00	1,100.00
1	REAR BUMPER LOWER CENTRE GARNISH	TORN	680.00	450.00
2	REAR BUMPER SIDE RETAINERS @\$105.00	NOT NECESSARY	210.00	-
2	REAR BUMPER REFLECTORS @\$250.00	O/S CRACKED	500.00	105.00
1	REAR BUMPER TOW COVER	NOT NECESSARY	30.00	-
2	REAR BUMPER LICENCE PLATE LAMPS @\$115.00	CRACKED (1 PC ONLY)	230.00	112.00
1	REAR BUMPER REINFORCEMENT	BENT	1,150.00	850.00
1	SET REAR BUMPER CLIPS	NECESSARY	60.00	60.00
1	REAR WIPER ARM COVER	CRACKED	211.00	45.00
1	REAR WIPER MOTOR	SERVICEABLE	620.00	-
1	REAR END PANEL OUTER	TO REPAIR SEE LABOUR	1,500.00	-
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	392.00	-
1	REAR FLOOR PANEL	NOT NECESSARY	1,855.00	-
1	REAR FLOOR PANEL TOP BOARD	NOT NECESSARY	615.00	-
1	REAR EXHAUST	NOT NECESSARY	1,220.00	-
1	REAR EXHAUST MOUNTING	NOT NECESSARY	50.00	-
	LESS 10% DISCOUNT		-	-834.70
			18,084.00	7,512.30
	<u>SPECIAL NETT ITEMS</u>			
2	REAR BUMPER PDC SENSORS @\$225.00 (SN)	SHORTED	450.00	200.00

Report Ref No. CC6/CTI20004944/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR BUMPER CENTRE PAD (\$750.00)(50%)(SN)	DEFORMED / TORN	920.00	375.00
1	TAILGATE "3M" STICKER (SN)	NOT NECESSARY	100.00	-
1	SET REAR WRAP STICKER (SN)	NECESSARY	1,000.00	500.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
1	REAR LICENCE PLATE W/HOLDER (SN)	BENT	50.00	40.00
			2,570.00	1,165.00
	LABOUR			
	TO CHECK WIRING.		80.00	30.00
	TO DISMANTLE & REPLACING REVERSE SENSOR.		80.00	50.00
	TO DISMANTLE & REFIX TAILGATE GLASS.		150.00	120.00
	TO TRANSFER TAILGATE MECHANISM.		100.00	60.00
	TO DISMANTLE & REFIX REAR EXHAUST.	NOT NECESSARY	100.00	-
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY.		120.00	80.00
	TO SPRAY RUST PROOFING.		100.00	50.00
	LABOUR FOR PANEL BEATING & REPLACING PARTS.INCLUSIVE OF THE REPAIR OF REAR END PANEL OUTER.		1,200.00	600.00
	TO PUTTY & SPRAY PAINTING.		1,500.00	850.00
			3,430.00	1,840.00
GRAND TOTAL			24,084.00	10,517.30
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				8,300.00

Report Ref No. CC6/CTI20004944/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLP 5550U

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

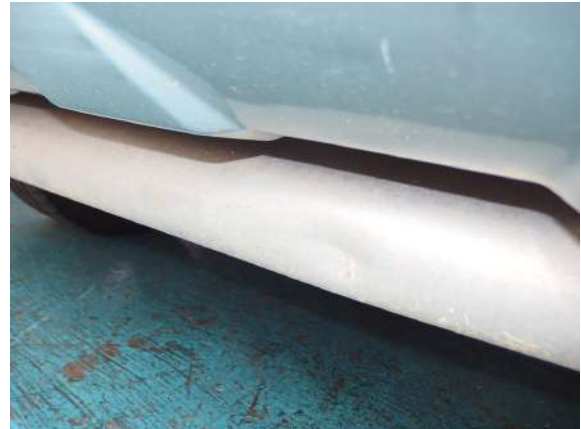



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLP 5550U

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

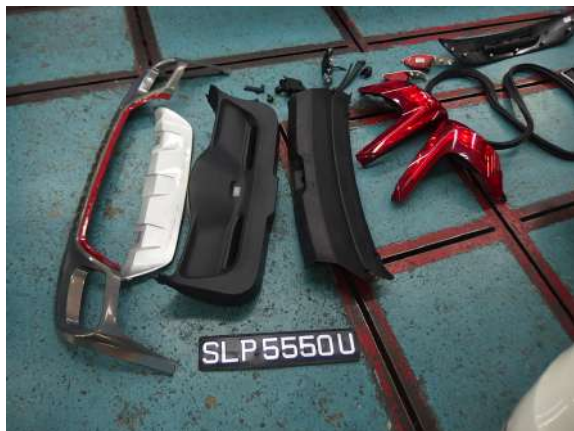



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

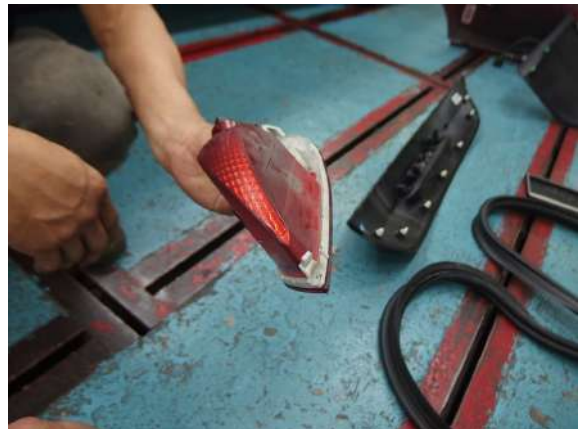




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

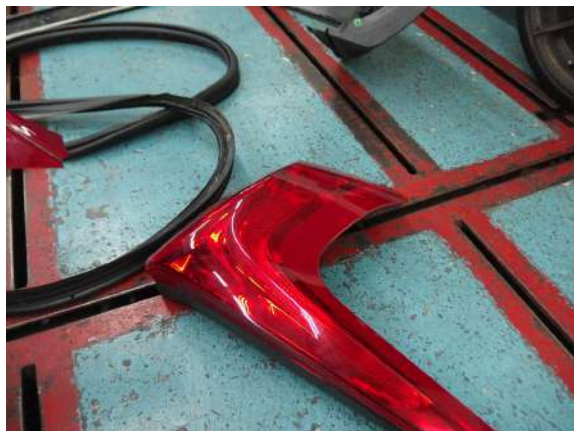



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLP 5550U

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLP 5550U

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

