



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2101375

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 05/03/2021
Reference CC4/FCI20005116/R1ea3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SMK 3324J
Insured Veh. SHB 2280P
Claim No. D20001826MFSH
Policy No. D-20094921MFSH
Accident Date 07/04/2020
Inspection Date 08/06/2020

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20005116/R1ea3q2	
			Date: 05/03/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SHB 2280P	Veh. Inspected	SMK 3324J
	Policy No.	D-20094921MFSH	Coverage (\$)	0.00
	Claim No.	D20001826MFSH	Excess (\$)	0.00
	Assign From	ERIC	Assign Date	09/04/2020
2. Vehicle Particulars & Condition				
	Make & Model	KIA CERATO 1.6 A EX	c.c	1591
	Engine No.	HIDDEN	Year of Reg.	2019
	Chassis No.	KNAF3416MK5031203	Colour	BLUE
	Odometer	16456 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	FAIR		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	205/55 R16	KUMHO	6 mm
	L/H Front Tyre	205/55 R16	KUMHO	6 mm
	R/H Rear Tyre	205/55 R16	KUMHO	6 mm
	L/H Rear Tyre	205/55 R16	KUMHO	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	07/04/2020	Inspection Date	08/06/2020
	Survey held at	CYCLE & CARRIAGE AUTOMOTIVE PTE LTD 209 PANDAN GARDENS SINGAPORE 609339		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMK 3324J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REVERSE SENSOR (SN)	NOT NECESSARY	220.00	-
1	C&C BADGE (SN)	NOT NECESSARY	40.00	-
1	SUNDRIES (SN)	NECESSARY	50.00	20.00
1	COVER -RR BUMPER (SN)	CRACKED	651.00	651.00
1	COVER -RR BUMPER LWR (SN)	CRACKED	241.00	241.00
1	COVER -RR BUMPER UNDER ,LH (SN)	SERVICEABLE	33.00	-
1	COVER -RR BUMPER FOG LAMP ,RH (SN)	SERVICEABLE	19.00	-
1	LAMP ASSY -SIDE T/SIGNAL ,RH (SN)	SERVICEABLE	181.00	-
1	EXTN WIRING ASSY -BWS (SN)	SERVICEABLE	207.00	-
1	BEAM -RR BUMPER (SN)	CRACKED	318.00	318.00
1	STAY -RR BUMPER LH (SN)	SERVICEABLE	65.00	-
1	STAY -RR BUMPER RLH (SN)	SERVICEABLE	65.00	-
1	ANTENNA ASSY -SMARTKEY (SN)	SERVICEABLE	46.00	-
1	BRACKET -RR BEAM UPE MTG ,LH (SN)	SERVICEABLE	9.00	-
1	BRACKET -RR BEAM UPE MTG ,RH (SN)	CRACKED	9.00	9.00
1	BRACKET -RR BEAM LWR ,CTR (SN)	SERVICEABLE	6.00	-
1	BRACKET -RR BEAM LWR MTG (SN)	SERVICEABLE	6.00	-
1	COVER -RR BUMPER UNDER ,RH (SN)	SERVICEABLE	33.00	-
1	BRACKET ASSY -RR BPR SIDE UPR ,L (SN)	SERVICEABLE	25.00	-
1	BRACKET ASSY -RR BPR SIDE UPR ,R (SN)	SERVICEABLE	31.00	-
1	LOGO ASSY -KIA SUB (SN)	NOT NECESSARY	32.00	-
1	EMBLEM -CERATO (SN)	NOT NECESSARY	28.00	-
			2,315.00	1,239.00
	<u>LABOUR</u>			
	TOWING FRONT BT.BATOK ST.25 TO C&C PANDAN GARDENS. (ADDITIONAL)		110.00	110.00
	RENEW RR BUMPER REPAIR RR END PNL ,BOOTLID & RHR FENDER .		2,750.00	1,100.00
	RESPRAY RR BUMPER ,RR END PNL ,BOOTLID ,RHR FENDER & RR FLR PNL .		2,100.00	840.00
	REMOVE & REFIT RR FLR BOARD ,TRIM & CARPET TO FACILITATE REPAIR .		275.00	275.00

Report Ref No. CC4/FCI20005116/R1ea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	CHECK WIRING ELECTRICAL SYSTEM.		50.00	30.00
	TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST USING HI-SCAN PRO TEST.		200.00	200.00
	APPLY ANTI CORROSION ON AFFECTED AREAS.	NOT NECESSARY	120.00	-
	REMOVE & REFIT REVERSE SENSOR .		100.00	80.00
			5,705.00	2,635.00
GRAND TOTAL			8,020.00	3,874.00
RECOMMENDED COST OF REPAIRS				3,874.00

Report Ref No. CC4/FCI20005116/R1ea3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMK 3324J

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

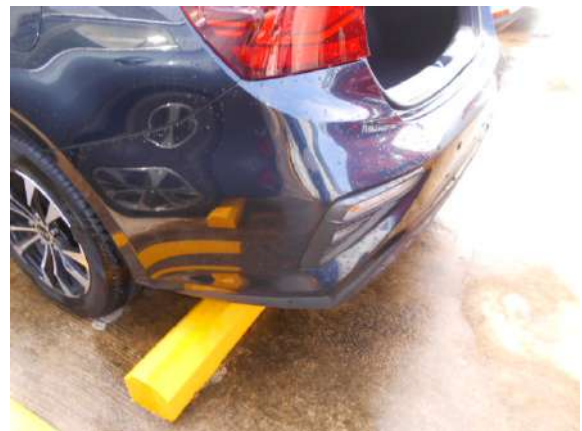



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMK 3324J

RE-INSPECTION

