



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV No. AC2005022
INV Date 17/07/2020
Reference CC6/CTI20005247/Aea3n2
Code CTI



PROFESSIONAL SERVICE FEE

Vehicle No. SLD 864K
Insured Veh. GBG 9884X
Claim No. SNM20D201796
Policy No. DMCVSN3077091901
Accident Date 15/04/2020
Inspection Date 16/04/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CC6/CTI20005247/Aea3n2

3 ANSON ROAD #16-00
SPRINGLEAF TOWERS SINGAPORE 079909

Date : 17-07-2020



Code : CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBG 9884X	Veh. Inspected	SLD 864K
Policy No.	DMCVSN3077091901	Coverage (\$)	0.00
Claim No.	SNM20D201796	Excess (\$)	0.00
Assign From		Assign Date	16/04/2020

2. Vehicle Particulars & Condition

Make & Model	TOYOTA ALTIS	c.c	1598
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	MR053REH104546666	Colour	BLACK
Odometer	141396	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/45 R17	MICHELIN	6 mm
L/H Front Tyre	215/45 R17	MICHELIN	6 mm
R/H Rear Tyre	215/45 R17	MICHELIN	6 mm
L/H Rear Tyre	215/45 R17	MICHELIN	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS

5. General Information

Accident Date	15/04/2020	Inspection Date	16/04/2020
Survey held at	NEW HOCK TECK MOTOR PTE LTD 1 KAKI BUKIT AVENUE 6 #01-43 AUTOBAY @ KAKI BUKIT SINGAPORE 417883		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	6 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLD 864K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BOOT LID	DENTED	685.80	685.80
2	REAR BOOT LID HINGE @\$77.80	NOT NECESSARY	155.60	-
1	REAR BOOT LID EMBLEM LOGO	NECESSARY	66.70	66.70
1	REAR BOOT LID LOCK	DAMAGED	382.00	382.00
1	REAR BOOT LID WEATHERSTRIP	CUT	166.40	166.40
1	REAR BOOT LID REVERSE CAMERA	NOT NECESSARY	450.00	-
1	REAR BOOT LID NUMBER PLATE	NOT NECESSARY	50.00	-
1	REAR BOOT LID CENTER MOULDING	CUT	307.90	307.90
2	REAR BOOT LID SIDE REFLECTOR @\$280.50	CUT	561.00	561.00
1	REAR BUMPER	DEFORMED	482.00	482.00
10	REAR BUMPER CLIP @\$6.50	NECESSARY	65.00	30.00
2	REAR BUMPER SIDE RETAINER @\$104.40	NECESSARY	208.80	208.80
2	REAR BUMPER SIDE REFLECTOR @\$35.10	NOT NECESSARY	70.20	-
1	REAR BUMPER REINFORCEMENT	BENT	381.70	381.70
2	REAR FENDER INNER TRIM BOARD @\$415.10	NOT NECESSARY	830.20	-
16	REAR FENDER INNER TRIM BOARD CLIP @\$6.50	NOT NECESSARY	104.00	-
1	REAR END PANEL	DENTED	581.10	581.10
1	REAR END PANEL TOP GARNISH	DEFORMED	229.40	229.40
1	REAR SPARE TYRE PANEL TOP COVER	DEFORMED	329.00	329.00
1	REAR SPARE TYRE PANEL SEALANT	NOT NECESSARY	450.00	-
1	REAR EXHAUST	NOT NECESSARY	781.10	-
1	REAR END PANEL ANTENNA SENSOR	CRACKED	95.50	95.50
	LESS 25% DISCOUNT		-	-1,126.83
			7,433.40	3,380.47
<u>SPECIAL NETT ITEMS</u>				
1	REAR BUMPER REVERSE SENSOR (SN)	DAMAGED	350.00	200.00
1	SET TRD BODYKIT (SN)	DEFORMED	3,500.00	900.00
			3,850.00	1,100.00
<u>LABOUR</u>				
	TO REMOVE & REFIT CUSHION & TRIM BOARD .		280.00	60.00

Report Ref No. CC6/CTI20005247/Aea3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE & REFIT REAR REVERSE SENSOR .		100.00	50.00
	TO REMOVE & REFIT REVERSE CAMERA.		180.00	50.00
	TO REMOVE & REFIT REAR EXHAUST .	NOT NECESSARY	280.00	-
	TO CHECK WIRING .		100.00	30.00
	TUFF KOTE.		150.00	60.00
	TOWING FEE.	NOT NECESSARY	150.00	-
	PANEL BEATING .		1,500.00	900.00
	SPRAY PAINTING.		1,200.00	1,000.00
			3,940.00	2,150.00
GRAND TOTAL			15,223.40	6,630.47

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,300.00
---	--	--	-----------------

Report Ref No. CC6/CTI20005247/Aea3n2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLD 864K

INSPECTION

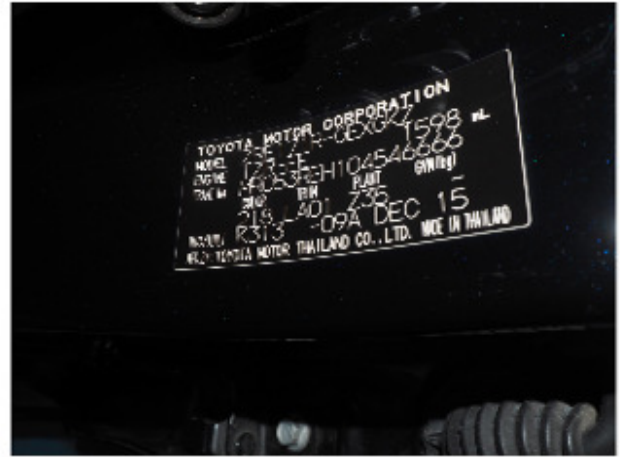



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLD 864K

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

