

ASS. REC. BY:

REF:

A/G/2000 5328/Kg a3

C

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / LWS / TP RES / OD RES / EVA / INV / MY

To Inspect Vehicle No: _____

at Workshop m/s

Trans Cab

of

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____


Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

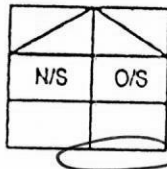

Bal. or Market Value: _____

IDAC Accident Report: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: _____

03 days

Res.: Yes or No

Lum Sum: _____

1.31 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: _____

SHD 5470C

Yr Regn: _____

01, 19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: _____

Toy Pro

c.c

1798

Colour

M.P. White / Red

A/C: _____

Insured / Std / NI / NA

Sp. Reading

101068

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: _____

JTDKB3FU 6030 79168

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size: _____

F: _____

195/65R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Jalim

Front

Rear

R/Bal. _____

9 mm

R/Bal. _____

9

mm

L/Bal. _____

9 mm

L/Bal. _____

9

mm

D.O.A. _____

18/4/20

D.O.I. _____

21/4/2020

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear O/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

4583.10 Car frame

Date/Time, File Pass to?

☐

: Prell. Report

Days Of Repair: _____

1)

☐

: Final Report

Resurvey No. of Trip: _____

Date/Time, File Return to?

2)

Add Fee: _____

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Survey Fee: _____

Transportation: _____

\$ + RS. \$

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 5470C**AAD2004-067***Not Authorised**Resony B4 paint**4583.10*

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration:

21 APR 2020

SHD 5470C

JTDKB3FU603079168

TOYOTA

PRIUS

18.4.2020

Alh

25/01/2019

PART

- | | |
|---|---|
| 1 | REAR BUMPER |
| 1 | REAR BUMPER RE-INFORCEMENT |
| 1 | REAR BUMPER TOWING COVER |
| 1 | GUARD, REAR BUMPER, CENTER |
| 1 | REAR BUMPER SIDE RETAINER LH |
| 1 | REAR BUMPER SIDE RETAINER RH |
| 1 | REAR TAILGATE |
| 1 | REAR TAILGATE OUTER GARNISH |
| 1 | REAR TAILGATE WEATHERSTRIP |
| 1 | PANEL SUB-ASSY, BODY LOWER BACK |
| 1 | TAILLAMP LOWER RH |
| 1 | TAILLAMP UPPER RH |
| 1 | REAR BUMPER SIDE RH |
| 1 | REAR BUMPER SIDE LH |
| 1 | TAILLAMP LOWER LH |
| 1 | TAILLAMP UPPER LH |
| 1 | COVER, DECK TRIM, REAR |
| 1 | COVER, FLOOR UNDER, NO 1 |
| 1 | COVER, FLOOR UNDER, NO 2 |
| 1 | COVER, REAR FLOOR |
| 1 | PANEL SUB-ASSY, QUARTER, RH |
| 1 | REAR FENDER LINER |
| 1 | DUCT ASSY, QUARTER VENT, RH |
| 1 | SEAL, REAR BUMPER SIDE, RH |
| 1 | PAN, REAR FLOOR |
| 1 | MOULDING, BACK DOOR OUTSIDE GARNISH, LOWER RH |

LIST

\$	Bu	442.60	✓
\$	R	332.70	X
\$	MV	15.40	✓
\$	Bu	576.30	✓
\$	Sn	116.50	X
\$	Sn	117.70	X
\$	Bu	1,147.80	✓
\$	CM	925.60	✓
\$	Sn	372.30	X
\$	Sn	650.30	X
\$	CM	502.00	✓
\$	Sn	451.80	X
\$	my CM	123.70	✓
\$	Sn	123.70	} X
\$	Sn	502.00	
\$	Sn	443.30	
\$	Sn	126.70	
\$	Sn	175.10	
\$	Sn	241.90	
\$	Sn	229.90	
\$	R	871.50	
\$	Sn	139.80	}
\$	Sn	67.00	
\$	Sn	88.50	
\$	R	583.40	}
\$	Sn	56.50	

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 5470C**AAD2004-067**

TOTAL	\$	9,424.00
25%	\$	2,356.00
	\$	7,068.00

Special Nett

1SET	PARKING AID	
1SET	REAR BUMPER CLIP	
1	REAR TAILGATE TOYOTA LOGO	} 25%
1	REAR TAILGATE WORDING 'PRIUS'	
1	REAR TAILGATE WORDING 'HYBRID'	
1	REAR TAILGATE STICKER 'TRANS-CAB'	
1	REAR TAILGATE STICKER '6555-3333'	
1	REAR BUMPER PROTECTOR	
1	WHEEL, RIM	
1	TYRE 195/65/15	
1	WHEEL RIM COVER	
1	REAR RH BUMPER RETAINER CLIP	
1	REAR LH BUMPER RETAINER CLIP	
1SET	TAILLAMP LOWER CLIP	
1SET	TAILLAMP UPPER CLIP	
2	REAR WINDSCREEN SEALANT	
1	WINDSCREEN MOULDING	
1	REAR WINDSCREEN INNER SPONGE SEAL	
1SET	REAR FENDER LINER CLIP	
2	END PANEL SEAM SEALANT	

\$	700.00	X
\$	68.00	✓
\$	47.00	✓
\$	52.90	—
\$	53.50	✓
\$	80.00	30% ✓
\$	80.00	30% ✓
\$	120.00	} X
\$	1,879.40	
\$	350.00	
\$	211.50	
\$	35.00	
\$	35.00	} X
\$	35.00	
\$	35.00	
\$	130.00	40% ✓
\$	180.00	✓
\$	120.00	30% ✓
\$	35.00	X
\$	160.00	X

TOTAL \$ 4,407.30**TOTAL PARTS \$ 11,475.30****LABOUR**

To transfer of Tailgate fittings, attachments and perform water seepage test.

\$ 170.00 60%

To Rust-Proofing Of The Affected Areas.

\$ 170.00 X

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 5470C**AAD2004-067**

To transfer of Rear Bumper fittings, attachments and perform water seepage test.	\$	nn	170.00	X
To transfer of rear end panel fittings, attachment and perform water seepage test.	\$	nn	170.00	X
Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.	\$	nn	380.00	X
To check steering geometry and computer wheel alignment	\$	nn	220.00	X
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	nn	380.00	X
Putty And Spray Painting Of The Affected Portion.	\$		7,500.00	6601
To Remove And Refit Rear W/Screen Glass To Facilitate Bodywork Repair.	\$		170.00	1201
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$		7,500.00	4001
To reinstall rear bumper parking sensor.	\$		170.00	501
To transfer of tire, rim and on wheel balancing.	\$	nn	170.00	X
To transfer of Rear Luggage Floor Panel fittings, attachments and perform water seepage test.	\$	nn	380.00	X
To Check Electrical Lighting Concerned.	\$		170.00	
To transfer of Rear Fender fittings, attachments and perform water seepage test.	\$	nn	170.00	X

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 5470C

AAD2004-067

TOTAL	\$	17,890.00
--------------	-----------	------------------

Over All Total	\$	29,365.30
-----------------------	-----------	------------------

(PART-BY-PART) Repair Days

~~25~~ Days

3 days

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	878K
Vehicle Details	
Vehicle No.:	SHD5470C
Vehicle to be Exported:	Yes
Intended Deregistration Date:	20 Apr 2020
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS SDR HATCHBACK (AUTO)
Primary Colour:	Red
Manufacturing Year:	2018
Engine No.:	2ZR2B98684
Chassis No.:	JTDKB3FU603079168
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$26,605.00
Original Registration Date:	25 Jan 2019
First Registration Date:	25 Jan 2019
Transfer Count:	0
Actual ARF Paid:	\$14,247.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	24 Jan 2027
PARF Rebate Amount:	\$10,685.00
Intended COE Rebate Details	
COE Expiry Date:	24 Jan 2027
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$20,838.00
COE Rebate Amount:	\$16,670.00
Total Rebate Amount:	\$27,355.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 20 Apr 2020

OK