



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV No. AC2005741
INV Date 20/08/2020
Reference CC4/FCI20005376/Uka3q2
Code FCI2



PROFESSIONAL SERVICE FEE

Vehicle No. FBK 2469L
Insured Veh. SH 8487J
Claim No. D20001523MFSH/1
Policy No. D-20094922MFSH
Accident Date 15/03/2020
Inspection Date 24/04/2020

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD

Ref : CC4/FCI20005376/Uka3q2

36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Date : 20-08-2020



Code : FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SH 8487J	Veh. Inspected	FBK 2469L
Policy No.	D-20094922MFSH	Coverage (\$)	0.00
Claim No.	D20001523MFSH/1	Excess (\$)	0.00
Assign From	JOANNE YONG	Assign Date	24/04/2020

2. Vehicle Particulars & Condition

Make & Model	YAMAHA YBR 125	c.c	124
Engine No.	HIDDEN	Year of Reg.	2015
Chassis No.	LBPKE1780E0028775	Colour	BLACK
Odometer	12282	Steering	AFFECTED
Brakes	IN ORDER	Modification	SPORTS RIM
General	FAIR		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	2.75-18	OHTSU	6 mm
L/H Front Tyre			mm
R/H Rear Tyre	90-90-18	OHTSU	6 mm
L/H Rear Tyre			mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION AND N/S BODY.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	15/03/2020	Inspection Date	24/04/2020
Survey held at	BAN HOCK HIN CO.PTE LTD NO 6 DEFU LANE 4 SINGAPORE 539410		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **5 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. FBK 2469L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BAR HANDLE	BENT	70.00	70.00
1	BEARING STEERING CONE LOWER	NECESSARY	5.60	5.60
1	BRACKET DETACHABLE LOWER (NEW MODEL)	NOT NECESSARY	140.00	-
1	BRACKET FOOTREST RH	BENT	116.20	116.20
1	BRACKET UNDER FORK	BENT	179.20	179.20
1	CALIPER BRAKE FRONT ASSY	SERVICEABLE	390.60	-
1	COVER CLUTCH	CRACKED	128.10	128.10
1	COVER GUIDE AIR RH	CRACKED	10.70	10.70
1	COVER SIDE LH (BLACK)	CRACKED	117.60	117.60
1	COWLING FRONT (BLACK)	CRACKED	282.80	282.80
1	CRASH BAR	BENT	193.20	193.20
1	CROWN HANDLE	NOT NECESSARY	74.40	-
1	EMBLEM (YAMAHA) FUEL TANK	NOT NECESSARY	8.40	-
1	FOOTREST FRONT	TORN	77.20	77.20
1	FORK FRONT ASSY LH	SERVICEABLE	532.00	-
1	FORK FRONT ASSY RH	SERVICEABLE	532.00	-
1	GASKET CLUTCH COVER	NECESSARY	19.60	19.60
1	GRIP HANDLE LH	TORN	4.20	4.20
1	LAMP SIGNAL FRONT LH	SERVICEABLE	53.90	-
1	LAMP SIGNAL REAR LH	SERVICEABLE	63.00	-
1	LEVER CLUTCH	SERVICEABLE	18.20	-
1	LOCK SIDE COVER	NOT NECESSARY	14.00	-
1	METER IU (12V) NEW MODEL	SERVICEABLE	280.00	-
1	MIRROR LH	CUT	29.40	29.40
1	MIRROR RH	SERVICEABLE	29.40	-
1	MUDGUARD FRONT (RED)	CUT	96.60	96.60
1	NUT	NECESSARY	5.60	5.60
1	PEDAL BRAKE	BENT	86.80	86.80
1	PIPE EXHAUST ASSY	TO REPAIR SEE LABOUR	350.00	-
1	PLATE DISC BRAKE FRONT	BENT	193.20	193.20

Report Ref No. CC4/FCI20005376/Uka3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RACE BALL 1	NECESSARY	11.20	11.20
1	RACE BALL 1	NECESSARY	11.20	11.20
1	RACE BALL LOWER 2	NECESSARY	11.20	11.20
1	RACE BALL UPPER 2	NECESSARY	11.20	11.20
1	RUBBER FOOTREST FRONT	TORN	14.00	14.00
1	SEAL OIL (20X30X4.5)SHAFT KICK STARTER	NECESSARY	3.70	3.70
1	STAY HEADLAMP	SERVICEABLE	67.20	-
1	SWITCH BRAKE REAR	NOT NECESSARY	15.40	-
2	SEAL DUST FORK @\$7.50 (ADDITIONAL)	NECESSARY	15.00	15.00
2	BOL SEAL OIL FORK @\$12.00 (ADDITIONAL)	NECESSARY	24.00	24.00
2	TUBE INNER FORK @\$96.00 (ADDITIONAL)	BENT	192.00	192.00
	LESS 10% DISCOUNT		-	-190.95
			4,478.00	1,718.55
	<u>SPECIAL NETT ITEMS</u>			
1	STICKER FUEL TANK (SN)	NECESSARY	42.00	42.00
1	STICKER FUEL TANK (SN)	NECESSARY	42.00	42.00
1	STICKER FUEL TANK (SN)	NECESSARY	42.00	42.00
1	TANK FUEL ASSY (RED) (SN)	DENTED	550.20	120.00
			676.20	246.00
	<u>LABOUR</u>			
	TRANSPORT CHARGES.		56.00	35.00
	LABOUR.INCLUSIVE OF THE REPAIR OF PIPE EXHAUST ASSY .		504.00	320.00
			560.00	355.00
	GRAND TOTAL		5,714.20	2,319.55
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			1,850.00

Report Ref No. CC4/FCI20005376/Uka3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. FBK 2469L

INSPECTION

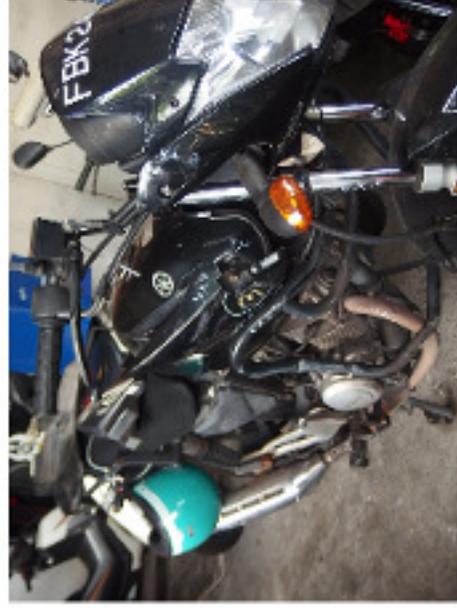



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

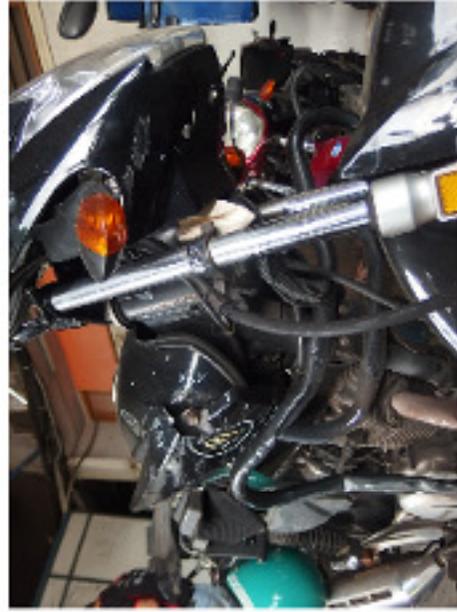



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

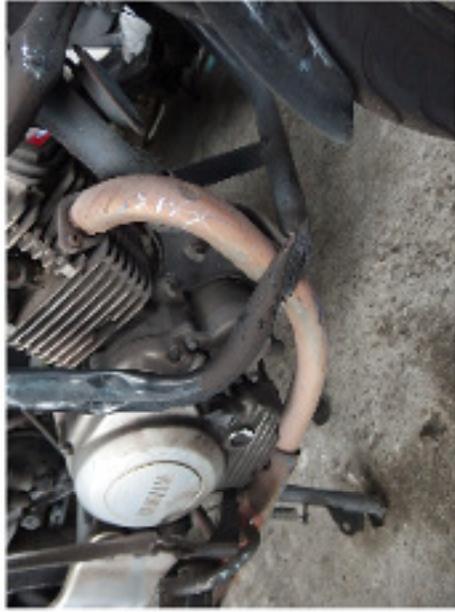



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

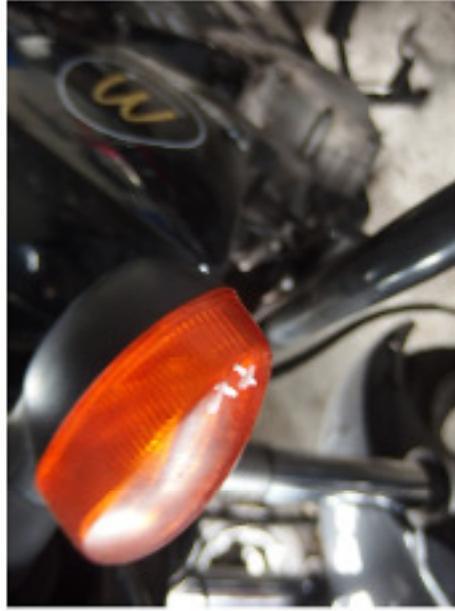



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

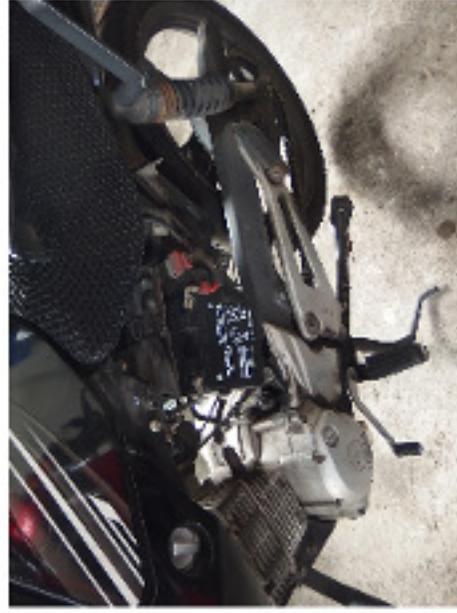




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

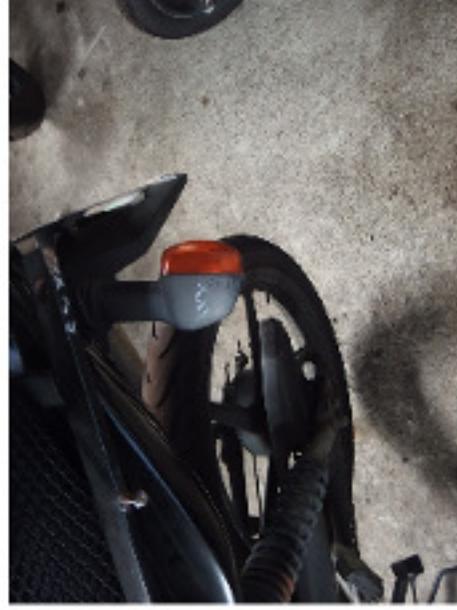



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payco Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408833

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199507198R GST Reg. No. 19-9507198-R

PHOTOGRAPHS FOR VEHICLE NO. FBK 2469L

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199507198R GST Reg. No. 19-9507198-R

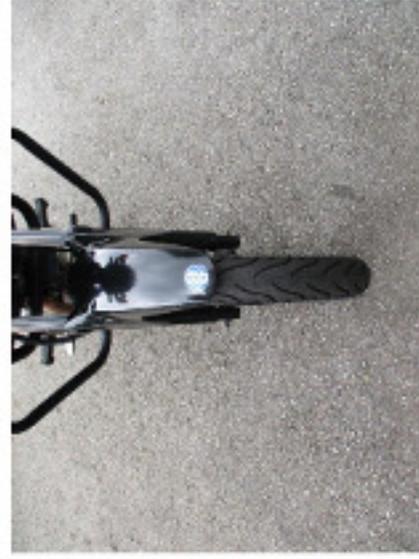



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199507198R GST Reg. No. 19-9507198-R

