



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2102345

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 08/04/2021
Reference CC6/FCI20005523/Uga3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SBB 1168J
Insured Veh. SHA 4457P
Claim No. D20002035MFSH
Policy No. D-18088936MFSH
Accident Date 30/04/2020
Inspection Date 04/05/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC6/FCI20005523/Uga3q2	
			Date: 08/04/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHA 4457P	Veh. Inspected	SBB 1168J	
Policy No.	D-18088936MFSH	Coverage (\$)	0.00	
Claim No.	D20002035MFSH	Excess (\$)	0.00	
Assign From	CHRIS	Assign Date	04/05/2020	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA CAMRY (A)	c.c	2362	
Engine No.	HIDDEN	Year of Reg.	2008	
Chassis No.	ACV403161285	Colour	SILVER	
Odometer	419053 KM	Steering	AFFECTED	
Brakes	IN ORDER	Modification	NIL	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	MICHELIN	6 mm	
L/H Front Tyre	215/60 R16	MICHELIN	6 mm	
R/H Rear Tyre	215/60 R16	MICHELIN	6 mm	
L/H Rear Tyre	215/60 R16	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION & O/S BODY.THE UNDERCARRIAGE AFFECTED DUE TO COLLISION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	30/04/2020	Inspection Date	04/05/2020	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			10 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SBB 1168J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT DOOR O/S	BADLY DENTED	1,415.10	1,366.10
2	FRONT DOOR HINGES @\$105.00	BENT	210.00	171.00
1	FRONT DOOR CHECKER O/S	TWISTED	166.00	166.00
1	FRONT DOOR OUTER PILLAR O/S	BADLY DENTED	971.10	825.10
1	FRONT DOOR GLASS OUTER MOULDING O/S	NOT NECESSARY	165.10	-
1	FRONT DOOR GLASS REGULATOR O/S	BENT	399.00	299.50
1	FRONT DOOR GLASS REGULATOR MOTOR O/S	SHORTED / JAMMED	485.50	485.50
1	FRONT DOOR INNER RUBBER O/S	TORN	299.10	211.30
1	FRONT DOOR INNER TRIM BOARD O/S	DEFORMED / TORN	1,045.10	745.50
1	SET FRONT DOOR INNER TRIM BOARDCLIPS O/S	NECESSARY	50.00	50.00
1	FRONT DOOR INNER LOCK O/S	SHORTED / JAMMED	392.30	392.30
1	FRONT DOOR OUTER HANDLE O/S	NOT NECESSARY	245.50	-
1	FRONT DOOR SPEAKER O/S	NOT NECESSARY	250.00	-
1	REAR DOOR O/S	BADLY DENTED	1,399.10	1,315.10
2	REAR DOOR HINGES @\$105.00	NOT NECESSARY	210.00	-
1	REAR DOOR CHECKER O/S	NOT NECESSARY	166.00	-
1	REAR DOOR INNER LOCK O/S	NOT NECESSARY	390.50	-
1	REAR DOOR INNER TRIM BOARD O/S	DEFORMED / TORN	971.10	705.30
1	REAR DOOR INNER RUBBER O/S	NECESSARY	288.50	210.50
1	REAR DOOR GLASS OUTER MOULDING O/S	NOT NECESSARY	165.10	-
1	REAR DOOR GLASS REGULATOR O/S	NOT NECESSARY	322.00	-
1	REAR DOOR GLASS MOTOR O/S	NOT NECESSARY	450.00	-
1	REAR FENDER O/S	TO REPAIR SEE LABOUR	1,299.10	-
1	REAR SHOCK ABSORBER O/S	NOT NECESSARY	422.30	-
1	REAR LOWER ARM O/S	NOT NECESSARY	281.50	-
1	REAR WHEEL HUB BEARING O/S	NOT NECESSARY	450.00	-
1	REAR BUMPER	TO REPAIR SEE LABOUR	1,031.00	-
1	ROCKER PANEL GARNISH O/S	CUT / TORN	799.10	745.30

Report Ref No. CC6/FCI20005523/Uga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	ROCKER PANEL GARNISH INNER SPONGE O/S	TORN	225.30	188.20
1	CENTRE PILLAR OUTER O/S	BADLY DENTED	922.30	699.50
1	CENTRE PILLAR INNER O/S	TO REPAIR SEE LABOUR	1,066.30	-
1	BONNET	BUCKLED	1,488.20	1,415.10
1	BONNET LOCK	TWISTED	166.20	166.20
2	BONNET HINGES @\$95.00	NOT NECESSARY	190.00	-
1	BONNET RUBBER	NECESSARY	62.00	62.00
1	BONNET INSULATOR	NOT NECESSARY	282.00	-
1	SET BONNET INSULATOR CLIPS	NOT NECESSARY	50.00	-
1	FRONT BUMPER	DISTORTED	1,088.20	681.10
1	FRONT BUMPER TOW COVER	TORN	35.00	35.00
1	FRONT BUMPER CENTRE GRILLE	TORN	148.50	148.50
2	FRONT FOG LAMPS @\$450.00	O/S CRACKED	900.00	415.20
2	FRONT FOG LAMP GRILLES @\$103.00	O/S MISSING	206.00	88.20
1	FRONT BUMPER REINFORCEMENT	BENT	482.30	392.30
1	FRONT BUMPER TOP RUBBER	TORN	112.00	82.30
1	SET FRONT BUMPER CLIPS	NECESSARY	50.00	50.00
2	FRONT BUMPER RETAINERS @\$65.00	BENT	130.00	130.00
1	FRONT BUMPER LOGO	NECESSARY	64.50	64.50
1	FRONT GRILLE	CRACKED	381.10	381.10
1	FRONT GRILLE CHROME MOULDING	CRACKED	188.50	188.50
2	HEADLAMP HIDS @\$2850.00	CRACKED	5,700.00	3,700.20
1	FRONT SUPPORT PANEL	BENT / TWISTED	1,225.10	866.30
1	FRONT AIR DUCT	CRACKED	299.20	205.50
1	AIR CON CONDENSER	BENT / TWISTED	1,298.10	1,298.10
1	AIR CON CONDENSER SIDE GARNISH O/S	TORN	125.10	125.10
1	RADIATOR	SERVICEABLE	1,688.10	-
1	RADIATOR FAN COWLING	CRACKED	411.20	411.20
1	WIPER TANK	DEFORMED	311.20	266.30
1	WIPER TANK MOTOR	NOT NECESSARY	185.00	-
1	HORN UNIT	NOT NECESSARY	105.00	-
1	FRONT FENDER O/S	DISTORTED	899.10	719.10

Report Ref No. CC6/FCI20005523/Uga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	FRONT FENDER INNER SHIELDS @\$281.00	TORN	562.00	297.00
1	SET FRONT FENDER INNER SHIELD CLIPS	NECESSARY	50.00	50.00
1	FRONT FENDER SIGNAL LAMP O/S	BROKEN	88.20	88.20
1	FRONT SHOCK ABSORBER O/S	SERVICEABLE	422.30	-
1	FRONT LOWER ARM O/S	SERVICEABLE	411.50	-
1	FRONT KNUCKLE ARM O/S	BENT	488.50	488.50
1	FRONT KNUCKLE ARM BEARING O/S	NECESSARY	295.00	215.00
1	FRONT STEERING RACK ASSY	NOT NECESSARY	2,821.10	-
1	FRONT ENGINE CROSS MEMBER	BENT / TWISTED	2,005.30	1,866.50
1	FRONT WINDSCREEN	CRACKED	1,566.20	1,566.20
1	FRONT WINDSCREEN MOULDING	NECESSARY	188.80	121.30
1	DASHBOARD	TORN	1,806.00	1,220.50
1	AIR BAG DRIVER	ACTIVATED	2,288.10	1,922.30
1	AIR BAG SPIRAL SENSOR	ACTIVATED	293.50	293.50
1	KNEE AIR BAG UNIT	ACTIVATED	1,566.20	1,245.50
1	PASSENGER AIR BAG	ACTIVATED	3,115.10	2,866.30
1	AIR BAG CONTROL UNIT	ACTIVATED	1,005.20	950.00
2	FRONT SAFETY BELTS @\$850.00	ACTIVATED	1,700.00	1,510.20
1	FRONT CHASSIS MEMBER	TO REPAIR SEE LABOUR	919.10	-
	LESS 25% DISCOUNT		-14,204.18	-8,792.25
			42,612.52	26,376.75
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT LICENCE PLATE W/HOLDER (SN)	BROKEN	50.00	40.00
1	FRONT WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00
1	FRONT WINDSCREEN SOLAR FILM (SN)	NECESSARY	200.00	150.00
1	FRONT HUB CAP O/S (SN)	CUT	200.00	120.00
1	REAR HUB CAP O/S (SN)	TO REPAIR SEE LABOUR	200.00	-
1	BOL RADIATOR COOLANT (SN)	NECESSARY	50.00	20.00
1	BOL AIR CON OIL (SN)	NOT NECESSARY	50.00	-
			800.00	370.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO DISMANTLE & REFIX REVERSE SENSOR.	NOT NECESSARY	80.00	-
	TO CONDUCT WHEEL ALIGNMENT.		120.00	60.00
	TO REFILL AIR CON GAS.		120.00	100.00
	TO DISMANTLE & REPLACED FRONT WINDSCREEN.		120.00	120.00
	TO DISMANTLE & REFIX ENGINE FOR FACILITATE REPAIR CHASSIS.		150.00	150.00
	TO DISMANTLE & REPLACED FRONT UNDER CARRIAGE.		500.00	300.00
	TO DISMANTLE & REPLACED FRONT DASHBOARD.		500.00	260.00
	TO DISMANTLE & REPLACED AIR BAG SYSTEM.		380.00	250.00
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY.	NOT NECESSARY	500.00	-
	TO REPROGRAMME & RESET AIR BAG SYSTEM.		380.00	100.00
	TO TRANSFER DOOR MECHANISM.		120.00	120.00
	TO SPRAY RUST PROOFING.		120.00	120.00
	LABOUR FOR PANEL BEATING & REPLACING PARTS.INCUSIVE OF THE REPAIR OF REAR FENDER O/S,REAR BUMPER,CENTRE PILLAR INNER O/S,FRONT CHASSIS MEMBER AND REAR HUB CAP O/S.		3,000.00	2,000.00
	TO PUTTY & SPRAY PAINTING.		2,500.00	1,500.00
	TO CHECK WIRING.		80.00	30.00
			8,670.00	5,110.00
GRAND TOTAL			52,082.52	31,856.75
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				20,000.00

Report Ref No. CC6/FCI20005523/Uga3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SBB 1168J

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

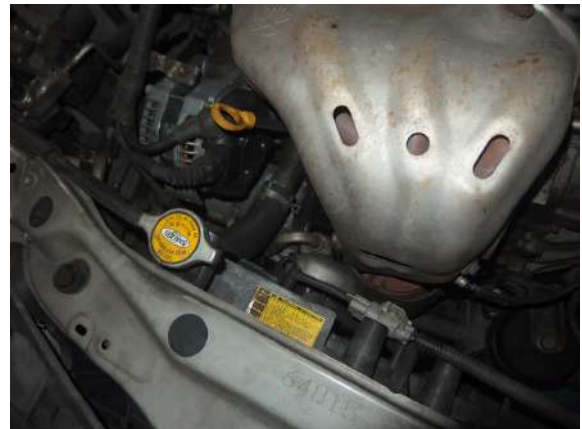



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

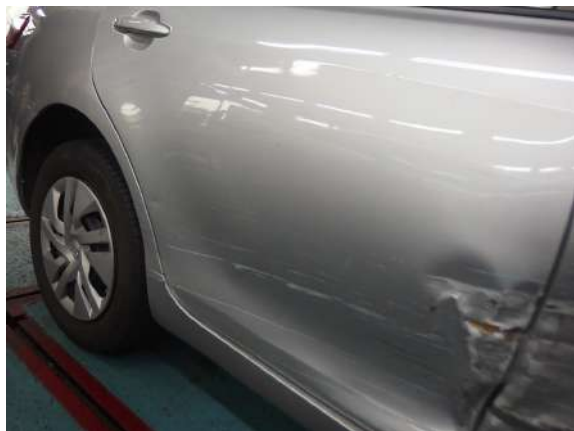




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

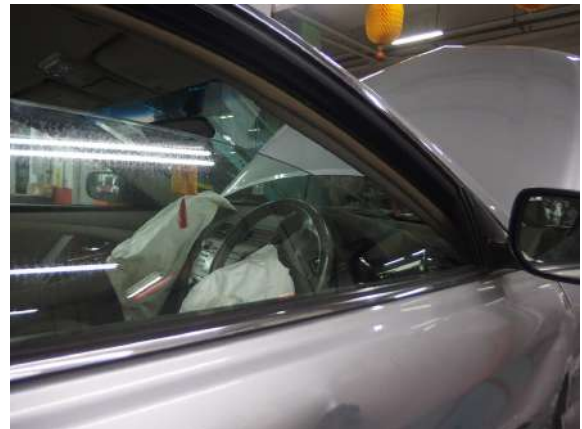



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

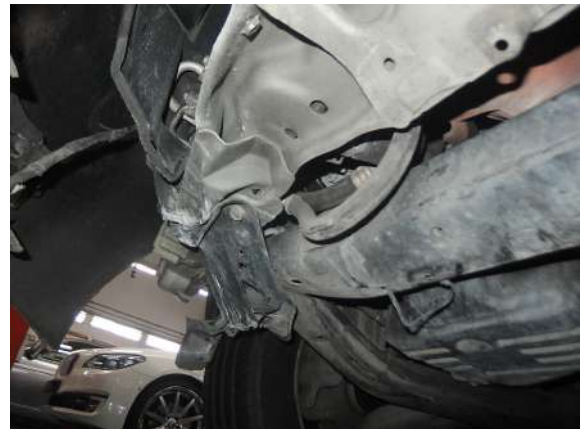



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SBB 1168J

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

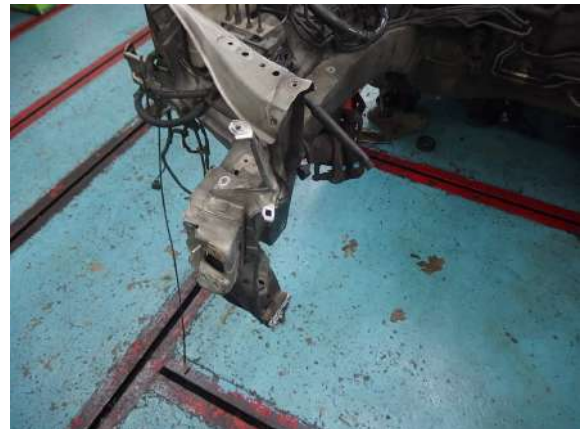




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

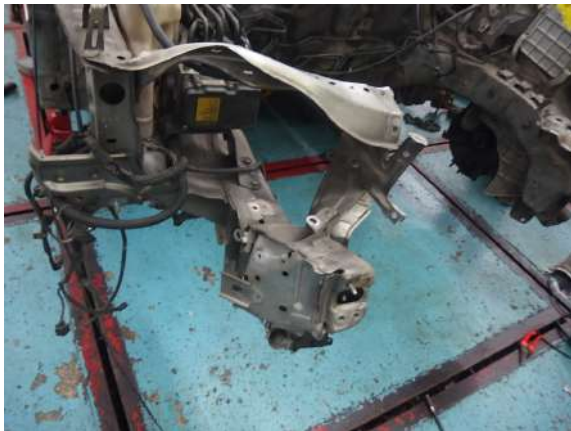



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SBB 1168J

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

