



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

AUTO & GENERAL INSURANCE (S) PL
(BUDGET DIRECT INSURANCE)
190 CLEMENCEAU AVENUE #03-01
SINGAPORE SHOPPING CENTRE
SINGAPORE 239924

INV No. AC2004237
INV Date 01/06/2020
Reference CS/AGI20005736/Utf3q2
Code AGI



PROFESSIONAL SERVICE FEE

Vehicle No. GBE 2031Y
Insured Veh. SJG 3565L
Claim No. C10005074
Policy No.
Accident Date 30/12/2019
Inspection Date 14/05/2020

Description	Total
Survey Inspection	450.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	450.00
GST (7%)	31.50
Grand Total	481.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AUTO & GENERAL INSURANCE (S) PL

Ref : CS/AGI20005736/Utf3q2

(BUDGET DIRECT INSURANCE)
190 CLEMENCEAU AVENUE #03-01
SINGAPORE SHOPPING CENTRESINGAPORE
239924

Date : 01-06-2020



Code : AGI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SJG 3565L	Veh. Inspected	GBE 2031Y
Policy No.		Coverage (\$)	0.00
Claim No.	C10005074	Excess (\$)	0.00
Assign From	STANLEY LAI	Assign Date	14/05/2020

2. Vehicle Particulars & Condition

Make & Model	NISSAN NV350 (M)	c.c	2488
Engine No.	HIDDEN	Year of Reg.	2015
Chassis No.	JN1MC2E26Z0003919	Colour	SILVER
Odometer	142009	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195 R15	BRIDGESTONE	6 mm
L/H Front Tyre	195 R15	BRIDGESTONE	6 mm
R/H Rear Tyre	195 R15	BRIDGESTONE	6 mm
L/H Rear Tyre	195 R15	BRIDGESTONE	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	30/12/2019	Inspection Date	14/05/2020
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **5 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBE 2031Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FRONT DOOR REAR PILLAR OUTER N/S	BADLY DENTED	919.30	845.20
1	SLIDING DOOR N/S	BADLY DENTED	2,488.20	1,325.40
1	SLIDING DOOR INNER TRIM BOARD N/S	DEFORMED / TORN	685.00	366.50
1	SLIDING DOOR INNER LOWER ROLLER N/S	BENT	295.00	245.30
1	SLIDING DOOR INNER LOCK N/S	SERVICEABLE	288.30	-
1	SLIDING DOOR INNER RUBBER N/S	TWISTED	366.20	266.50
1	SLIDING DOOR OUTER HANDLE N/S	NOT NECESSARY	292.50	-
1	REAR FENDER N/S	BADLY DENTED	2,880.00	2,006.90
1	REAR FENDER OUTER MOULDING N/S	NOT NECESSARY	422.30	-
1	REAR WHEEL HUB CAP N/S	CUT	180.00	180.00
1	REAR WHEEL BEARING N/S	NOT NECESSARY	250.00	-
1	REAR SHOCK ABSORBER N/S	NOT NECESSARY	252.00	-
1	REAR AXLE BEAM	NOT NECESSARY	1,880.00	-
	LESS 10% DISCOUNT		-	-523.58
			11,198.80	4,712.22
LABOUR				
	TO CHECK WIRING.		50.00	20.00
	TO SPRAY RUST PROOFING.		100.00	100.00
	TO TRANSFER SLIDING DOOR MECHANISM.		100.00	50.00
	TO DISMANTLE & REFIX INNER TRIM,PARTITION ETCS.		500.00	150.00
	TO CONDUCT WHEEL ALIGNMENT.	NOT NECESSARY	100.00	-
	TO DISMANTLE & REFIX REAR UNDER CARRIAGE.	NOT NECESSARY	380.00	-
	LABOUR FOR PANEL BEATING & REPLACING PARTS.		1,500.00	1,000.00
	TO PUTTY & SPRAY PAINTING.		1,200.00	600.00
	-		-	-
	-		-	-
	-		-	-
			3,930.00	1,920.00
GRAND TOTAL			15,128.80	6,632.22



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,300.00
---	--	--	-----------------

Report Ref No. CS/AGI20005736/Utf3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBE 2031Y

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

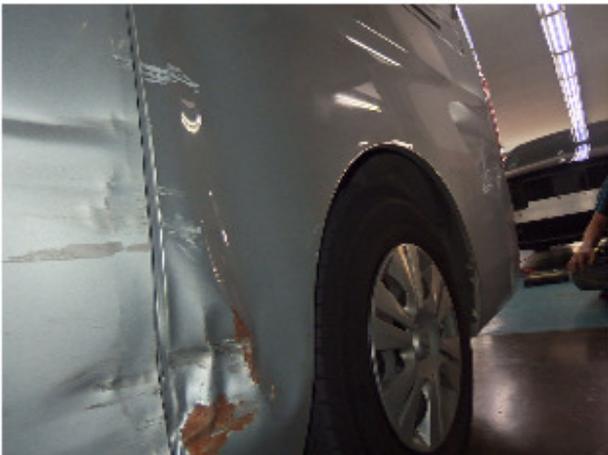





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

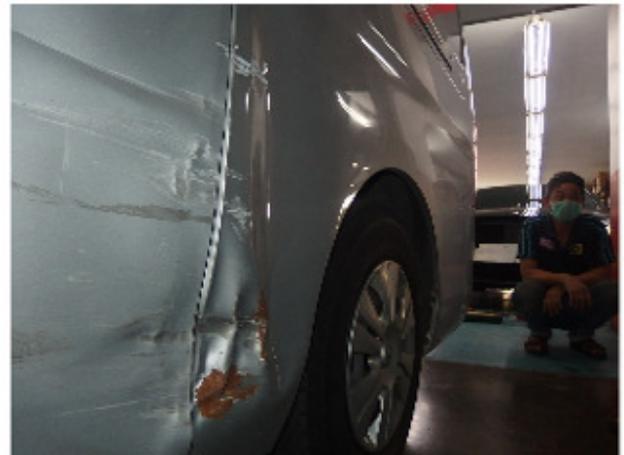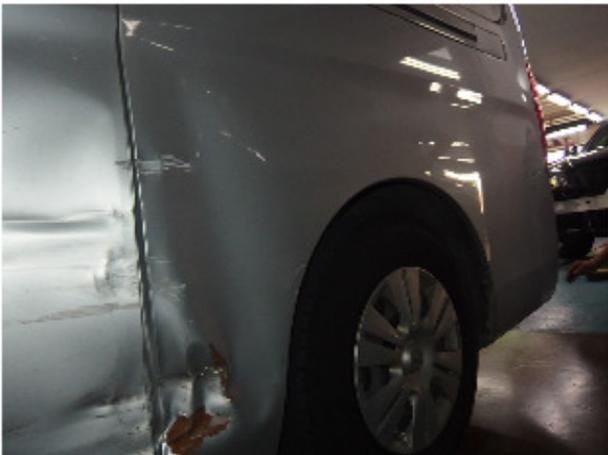




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

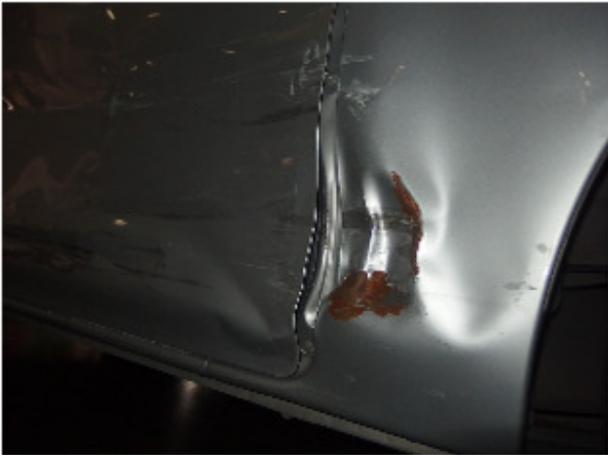




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

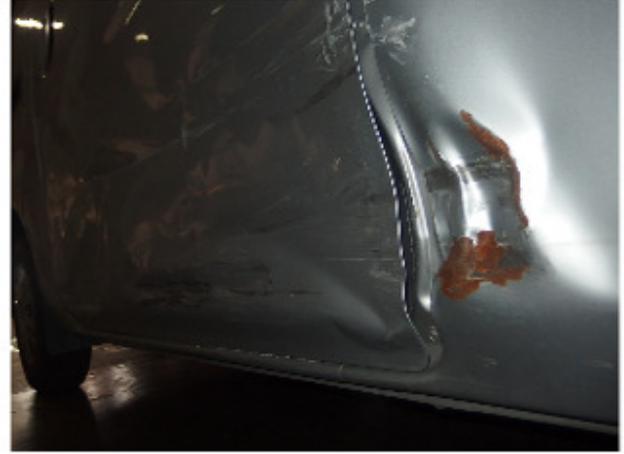



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

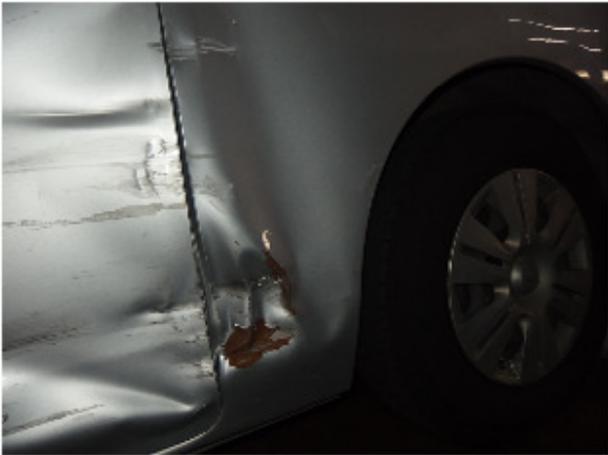



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBE 2031Y

RE-INSPECTION

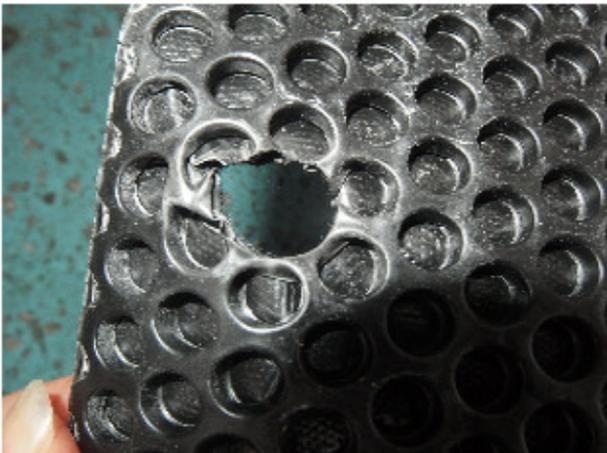



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

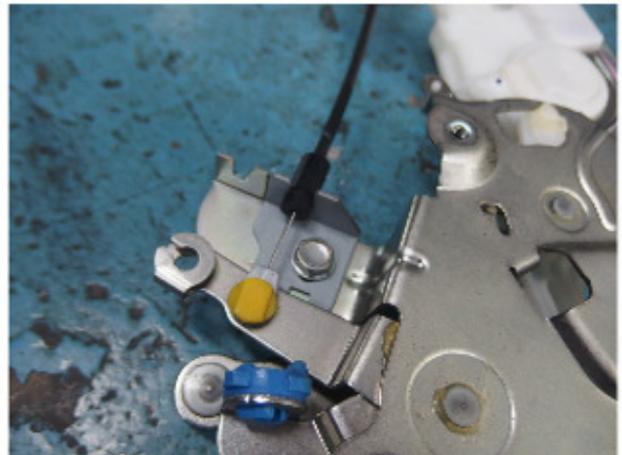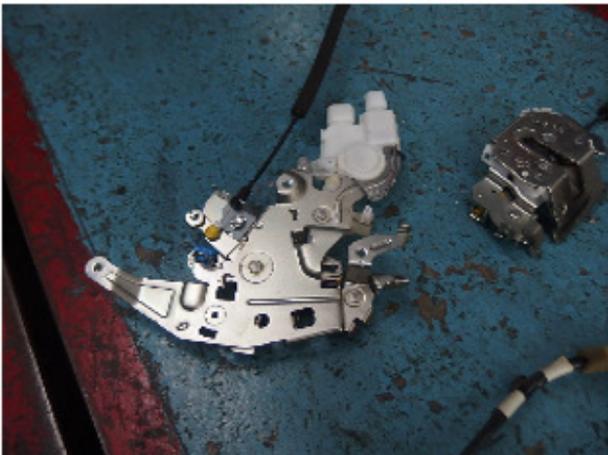



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBE 2031Y

RE-INSPECTION

