



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV No. AC2006242
INV Date 11/09/2020
Reference CC4/FCI20006016/Eba3q2
Code FCI2



PROFESSIONAL SERVICE FEE

Vehicle No. SMD 362E
Insured Veh. SHC 3710D
Claim No. D20002254MFSH
Policy No. D-20094922MFSH
Accident Date 26/05/2020
Inspection Date 29/05/2020

Description	Total
Third Party Express Settlement	500.00
Subtotal	500.00
GST (7%)	35.00
Grand Total	535.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD

Ref : CC4/FCI20006016/Eba3q2

36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Date : 11-09-2020



Code : FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHC 3710D	Veh. Inspected	SMD 362E
Policy No.	D-20094922MFSH	Coverage (\$)	0.00
Claim No.	D20002254MFSH	Excess (\$)	0.00
Assign From	MAY CHUA	Assign Date	28/05/2020

2. Vehicle Particulars & Condition

Make & Model	MERCEDES BENZ GLA180	c.c	1595
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	WDC1569422J508612	Colour	BLUE
Odometer	18110	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	235/50 R18	CONTINENTAL	5 mm
L/H Front Tyre	235/50 R18	CONTINENTAL	5 mm
R/H Rear Tyre	235/50 R18	CONTINENTAL	5 mm
L/H Rear Tyre	235/50 R18	CONTINENTAL	5 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	26/05/2020	Inspection Date	29/05/2020
Survey held at	NINETEEN AUTOWERKS PTE. LTD. 15 KAKI BUKIT ROAD 4 #01-53 BARTLEY BIZ CENTRE SINGAPORE 417807		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **5 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMD 362E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	BROKEN	1,385.00	1,385.00
1	REAR BUMPER SIDE RETAINER	BROKEN	75.00	75.00
1	REAR BUMPER SIDE REVERSE SENSOR	NOT NECESSARY	355.00	-
1	REAR FENDER -L/H	TO REPAIR SEE LABOUR	2,255.00	-
1	REAR FENDER WHEEL ARCH GARNISH	CUT	325.00	325.00
1	REAR ALLOY WHEEL RIM (LH)	CUT	1,780.00	900.00
1	REAR WHEEL HUB WITH BEARING	JAMMED	425.00	425.00
1	REAR SHOCK ABSORBER	NOT NECESSARY	520.00	-
1	REAR KNUCKLE ARM	NOT NECESSARY	1,265.00	-
1	REAR DOOR -L/H	DENTED	2,025.00	2,025.00
1	REAR DOOR RUBBER	NECESSARY	320.00	320.00
	LESS 10% DISCOUNT		-1,073.00	-545.50
			9,657.00	4,909.50
<u>SPECIAL NETT ITEMS</u>				
1	REAR TYRE (SN)	NOT NECESSARY	600.00	-
1	ROCKER PANEL SIDE SKIRT 'S PLATINUM' (SN)	CUT	850.00	500.00
			1,450.00	500.00
<u>LABOUR</u>				
	TO REMOVE,REPLACED DAMAGED LAMPS AND CHECK UP REAR WIRING .		80.00	30.00
	TO REMOVE AND REFIT REAR REVERSE SENSOR .		150.00	30.00
	TO REMOVE AND REFIT REAR UNDERCARRIAGE .		300.00	150.00
	TO CONDUCT WHEEL ALIGNMENT .		180.00	60.00
	TO REMOVE,REFIT DOOR FITTINGS AND REPLACE DAMAGED PARTS ,TRANSFER ALL .		150.00	80.00
	TO APPLY UNDERCOATING.		100.00	30.00
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR FENDER -L/H .		1,400.00	500.00
	TO RE-SPRAY PAINTING ON THE AFFECTED AREAS.		1,200.00	600.00
			3,560.00	1,480.00



GRAND TOTAL		14,667.00	6,889.50
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,500.00

Report Ref No. CC4/FCI20006016/Eba3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMD 362E

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

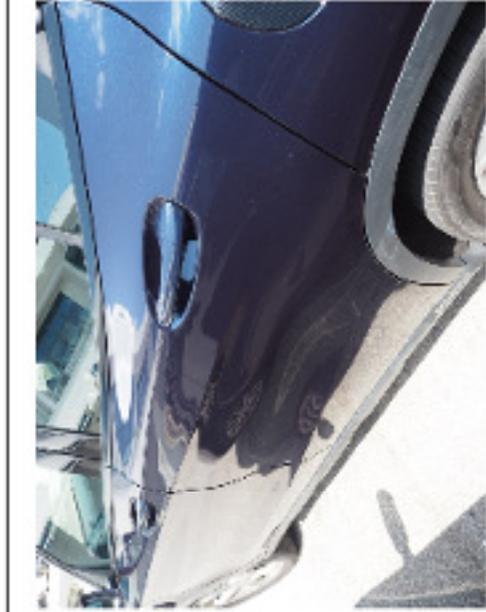



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMD 362E

RE-INSPECTION

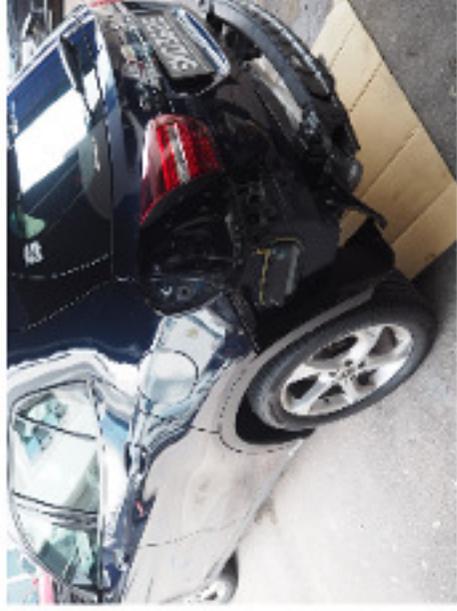



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMD 362E

RE-INSPECTION

