

ASS. REC. BY:

Paul

REF:

CC3/A14 2000 6091/R143

9940

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: SLP 7744P

at Workshop m/s PREMIUM

of 281, MEMORA RD

Insured: AIG

Policy No.

Claims No.


Sum Insured: Excess: TBA

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

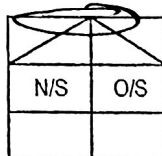

Bal. or Market Value: 142K

IDAC Accident Rpt: Consistent?: Yes or No

GIA / PR Seen: Consistent?: Yes or No

Est. Repairs: days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: Person Contacted:

Vehicle: IN / OUT

Veh No:

SLP 7744P

Yr Regn:

2017 / Jun

Type: Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Audi Q5 SPORT 2.0 TFSI Qu c.c. 1984

Colour:

BLUE

A/C:

Insured / Std / NI / NA

Sp. Reading

34881

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WAY222F434 2022456

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Under / Jammed / Leaked / Burnt or

Brake: Under / Jammed / Leaked / Burnt or

Modi: Nil / Rim / STD A/Rim or

Tyre Size:

F:

255/45R20

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

08/05/2021

D.O.I.

02/06/2020

Survey held at

PREMIUM

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Preli. Report

☐

: Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

Photos

Others

TOTAL

Rep. Form:

Lump Sum / L.B.I.:

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech. Invs (\$☐ : Weekend (\$

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

WIP : 35937

Telefax

Estimate	:	Accident Repairs
Workshop	:	Ubi Road 1
Contact No	:	6366 2323
Fax No	:	6841 1183
Reference	:	PA/OD/0384/2020/NS
Date	:	1-Jun-20

Vehicle NOT IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name	:	Mr Stoupas Jeremy Constatntine
Address	:	25 Cove Way #15-18 Singapore 096209
Telephone	:	+(HP) 82231196
Type of Claim	:	Own Damage Claim
Policy No.	:	2100510117-02
Vehicle No	:	SLP 7744 P
Model Code	:	Audi Q5 2.0 TFSI qu
Model / Year	:	Jun-17
Engine No	:	DAX 005239
Chassis No	:	WAUZZZFY3H2022456
Mileage	:	-
Date In	:	-
Estimated By	:	Johnny Boo / Allan Wu
Accident Date	:	8-May-20
Place of Accident	:	Along Road 1 Lower Delta Road

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLP 7744 P

S/N	Nature of Jobs	Estimated Charges	Surveyor's Recommendations
1	To remove, check and reinstall front wire harness for headlights. Horns, outside temperature sensor, headlight washer assy and front parking aid.	S/N \$ 480.00	360
2	To remove and renew aircon condenser, charged air cooler, radiator. Check electrical fans and control unit. Pressurise cooling system. To carry out vacuum and regas.	S/N \$ 1,400.00	?
3	To dismantle and renew front bumper, rhs front fender, bonnet, and rhs headlight. To renew front lock carrier and align to position. Re-organise crash management components. Reinstall all parts removed.	\$ 6,000.00	1000
4	To respray front bumper, front bumper lower spoiler, rhs front fender, bonnet and both front wheel arch trims.	\$ 5,000.00	1650
5	To carry out diagnostic check.	S/N \$ 192.00	
TOTAL LABOUR CHARGES		: <u>\$ 13,072.00</u>	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLP 7744 P

S/N	Parts Description	<u>Damage Parts & Prices</u>	
		S/Nett	Remarks
1	FRONT BUMPER <i>de /</i>	\$	2,445.00
2	FRONT BUMPER FIXING PARTS <i>?</i>	\$	254.00
3	FRONT BUMPER SECURING STRIP - RH <i>?</i>	\$	35.00
4	FRONT BUMPER CLOSING ELEMENT - LH / RH <i>?</i>	2 \$	210.00
5	FRONT BUMPER GRILLE - CENTRE <i>cm /</i>	\$	134.00
6	FRONT BUMPER FRONT SPOILER <i>scr /</i>	\$	709.00
7	FRONT BUMPER UNDERRUN BAR <i>?</i>	\$	447.00
8	FRONT BUMPER CLOSING ELEMENT <i>?</i>	\$	161.00
9	RADIATOR GRILLE <i>cm /</i>	\$	3,327.00
10	QUATTRO INSCRIPTION <i>rec /</i>	\$	90.00
11	STRIKER PLATE <i>?</i>	\$	230.00
12	FRONT BUMPER AIR GUIDE GRILLE - RH <i>scr /</i>	\$	537.00
13	FRONT BUMPER END CAP - RH <i>X</i>	\$	86.00
14	FRONT PARKING AID SEAL RING <i>rec /</i>	4 \$	14.00
15	FRONT BUMPER CARRIER <i>?</i>	\$	857.00
16	FRONT BUMPER FOAM FILLER PIECE <i>?</i>	\$	269.00
17	FRONT BUMPER FOAM FILLER PIECE COVER <i>?</i>	\$	120.00
18	FRONT BUMPER GUIDE SECTION - RH <i>?</i>	\$	36.00
19	FRONT BUMPER BRACKET - RH <i>?</i>	\$	239.00
20	CAUTION SIGN STICKER <i>?</i>	NEC \$	13.00

SUB TOTAL SPARE PARTS CHARGES : \$10,213.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLP 7744 P

		<u>Damage Parts & Prices</u>	
<u>S/N</u>	<u>Parts Description</u>	<u>S/Nett</u>	<u>Remarks</u>
21	AIRCON STICKER ?	NEC \$	18.00
22	HORN - RH HIGH TONE ?	\$	184.00
23	FRONT FENDER - RH X	\$	1,344.00
24	FRONT FENDER ATTACHMENT PARTS X	\$	62.00
25	FRONT FENDER BRACE - RH X	\$	212.00
26	FRONT FENDER BRACKET - RH X	\$	17.00
27	BONNET 64 ✓	\$	3,824.00
28	BONNET ATTACHMENT PARTS ?	\$	133.00
29	BONNET LIF HINGE - LH / RH X	2 \$	304.00
30	BONNET STRIKER - LH / RH X	2 \$	226.00
31	BONNET SOUND ABSORBER X	\$	299.00
32	BONNET IMPACT PROTECTION - LH / RH / CENTRE 73 rec ✓	\$	78.00
33	BONNET LID LOCK X	2 \$	403.00
34	BONNET RELEASE ELEMENT X	\$	54.00
35	BONNET BOWDEN CABLE - CENTRE X	\$	54.00
36	BONNET RELEASE ELEVER X	\$	13.00
37	LED HEADLIGHT - RH ?	\$	7,462.00
38	LIFT CYLINDER - RH X	\$	132.00
39	LIFT CYLINDER HOSE X	\$	118.00
40	WHEEL HOUSING LINER - RH X	\$	248.00
SUB TOTAL SPARE PARTS CHARGES		:	<u>\$ 15,185.00</u>

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLP 7744 P

S/N	Parts Description	Damage Parts & Prices	
		S/Nett	Remarks
41	WHEEL HOUSING LINER ATTACHMENT PARTS X	\$ 36.00	
42	WHEEL SPOILER X	\$ 146.00	
43	FRONT WHEEL COVER - LH / RH 2 rec ✓	2 \$ 1,190.00	
44	HEADLIGHT MOUNTING - RH ?	\$ 112.00	
45	LOCK CARRIER ?	\$ 1,206.00	
46	AIRCON CONDENSER ?	\$ 566.00	
47	RADIATOR ?	\$ 838.00	
48	RADIATOR FAN RING ?	\$ 389.00	
49	RADIATOR FAN ?	\$ 2,226.00	
50	RADIATOR AIR GUIDE - UPPER ?	\$ 45.00	
51	RADIATOR AIR GUIDE - CENTRE ?	\$ 40.00	
52	RADIATOR AIR GUIDE - LH / RH ?	2 \$ 106.00	
53	RADIATOR LOUVRE ?	\$ 504.00	
54	SERVOMOTOR ?	\$ 172.00	
55	CHARGE AIR COOLER ?	\$ 746.00	
56	CHARGE AIR COOLER SEAL RING ?	2 \$ 84.00	
57	TEMPERATURE SENSOR BRACKET ?	\$ 15.00	
58	FRONT NO PLATE 64 ✓	S/N \$ 60.00	
59	SUNDRIES ?	\$ 400.00	
TOTAL SPARE PARTS CHARGES		: \$ 34,279.00	
TOTAL LABOUR CHARGES		: \$ 13,072.00	
GRAND TOTAL		: <u>\$ 47,351.00</u>	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name

: Rasul - Hp 90010068

Surveyed Date

: 02/06/2020 @ 1150

Authorised Date

:

Excess Cost

:

5 days

Liability

:

EXCESS: TBA

Remarks

:

Revert
Resurvey before paint

Please Note

: This estimate is based on visual inspection of the affected vehicle.

Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.

For inspection of vehicle, please refer to Ms Norah Khai at

Tel: 6768 9828 for appointment.

Yours faithfully,

Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: