



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

AUTO & GENERAL INSURANCE (S) PL
(BUDGET DIRECT INSURANCE)
190 CLEMENCEAU AVENUE #03-01
SINGAPORE SHOPPING CENTRE
SINGAPORE 239924

INV No. AC2005513
INV Date 12/08/2020
Reference CS/AGI20006259/Atf3n2
Code AGI



PROFESSIONAL SERVICE FEE

Vehicle No. SMM 2111C
Insured Veh. SMJ 7808J
Claim No. C10006073
Policy No.
Accident Date 26/03/2020
Inspection Date 09/06/2020

Description	Total
Survey Inspection	350.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
AUTO & GENERAL INSURANCE (S) PL		Ref : CS/AGI20006259/Atf3n2		
(BUDGET DIRECT INSURANCE) 190 CLEMENCEAU AVENUE #03-01 SINGAPORE SHOPPING CENTRESINGAPORE 239924		Date : 12-08-2020		
		Code : AGI		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SMJ 7808J	Veh. Inspected	SMM 2111C	
Policy No.		Coverage (\$)	0.00	
Claim No.	C10006073	Excess (\$)	0.00	
Assign From	IVY RATILLA	Assign Date	08/06/2020	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI AVANTE	c.c	1591	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	KMHD841CMKU907673	Colour	SILVER	
Odometer	17046	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	NEXEN	6 mm	
L/H Front Tyre	195/65 R15	NEXEN	6 mm	
R/H Rear Tyre	195/65 R15	NEXEN	6 mm	
L/H Rear Tyre	195/65 R15	NEXEN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	26/03/2020	Inspection Date	09/06/2020	
Survey held at	CS MOTORWERKZ PTE LTD 25 KAKI BUKIT RD 4 #06-58 SYNERGY @KB SINGAPORE 417800			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		2 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMM 2111C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	DEFORMED	1,212.90	520.40
1	REAR LOWER BUMPER (BLACK)	CUT	432.20	383.00
2	REAR LOWER BUMPER REFLECTOR L/R @\$143.20	N/S CRACKED	286.40	143.20
1	REAR BUMPER REINFORCEMENT	NOT NECESSARY	749.60	-
2	REAR BUMPER SIDE BRACKET L/R @\$112.00	NOT NECESSARY	224.00	-
1	REAR BUMPER INNER SPONGE	NOT NECESSARY	180.00	-
1	REAR END PANEL	NOT NECESSARY	1,075.00	-
1	REAR BOOT LIP	NOT NECESSARY	986.50	-
1	REAR BOOT LIP RUBBER SEAL	NOT NECESSARY	225.00	-
1	REAR BOOT LIP LOCK	NOT NECESSARY	320.00	-
1	REAR BOOT LIP LOCK HOOK	NOT NECESSARY	112.00	-
2	REAR BOOT LIP TAILLAMP ASSY L/R @\$432.00	NOT NECESSARY	864.00	-
1	REAR BOOT LIP GARNISH	NOT NECESSARY	297.10	-
2	REAR BOOT LIP HING L/R @\$158.00	NOT NECESSARY	316.00	-
2	REAR TAILLAMP ASSY L/R @\$689.70	NOT NECESSARY	1,379.40	-
1	HYUNDAI LOGO	NOT NECESSARY	59.00	-
1	"AVANTE" EMBLEM	NOT NECESSARY	95.00	-
	LESS 10% DISCOUNT		-881.41	-
	LESS 20% DISCOUNT		-	-209.32
			7,932.69	837.28
<u>SPECIAL NETT ITEMS</u>				
1	SET REAR REVERSE SENSOR (SN)	DAMAGED	250.00	200.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	SET BOOT INNER TRIM CLIPS (SN)	NOT NECESSARY	40.00	-
1	REAR NUMBER PLATE & CASE (SN)	NOT NECESSARY	60.00	-
1	SET REAR REVERSE SENSOR (SN)	REPEATED	250.00	-
			630.00	230.00
<u>LABOUR</u>				
	TO STRAIGHTEN AND PANEL BEATING ALL THE ABOVE PARTS & TO REMOVE AND REFIT ALL THE ABOVE PARTS,ADJUST TO REALIGN THE SAME.		900.00	200.00

Report Ref No. CS/AGI20006259/Atf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CHECK AND RECTIFY ELECTRICAL SYSTEM.		70.00	30.00
	TO REMOVE & REFIX REAR BOOT LIP COMPONENTS.	NOT NECESSARY	150.00	-
	TO REMOVE & REFIX REVERSE SENSORS.		100.00	50.00
	TO PUTTY,RE-SPRAY AND POLISH AFFECTED AREAS.		850.00	200.00
	TO RUST PROOF AFFECT AREAS.	NOT NECESSARY	50.00	-
			2,120.00	480.00
GRAND TOTAL			10,682.69	1,547.28

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			1,200.00
---	--	--	-----------------

Report Ref No. CS/AGI20006259/Atf3n2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMM 2111C

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMM 2111C

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

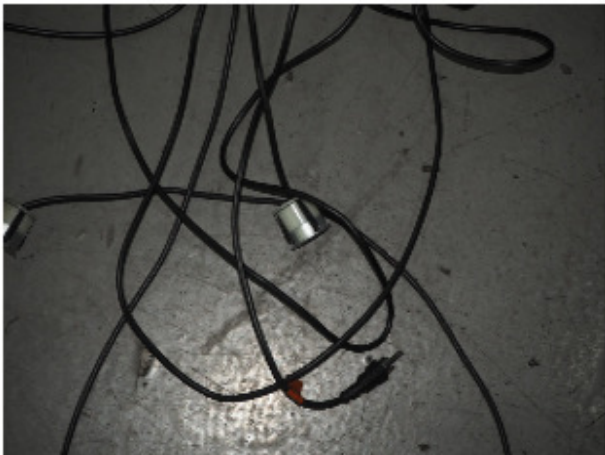



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMM 2111C

RE-INSPECTION

