



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2103717

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 27/05/2021
Reference CC4/FCI20006267/Des3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SHA 7964Y
Insured Veh. SH 6096S
Claim No. D20002363MFSH
Policy No. D-20094922MFSH
Accident Date 08/06/2020
Inspection Date 12/06/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Ref: CC4/FCI20006267/Des3q2

Date: 27/05/2021

Code: FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SH 6096S	Veh. Inspected	SHA 7964Y
Policy No.	D-20094922MFSH	Coverage (\$)	0.00
Claim No.	D20002363MFSH	Excess (\$)	0.00
Assign From	VIC	Assign Date	12/06/2020

2. Vehicle Particulars & Condition

Make & Model	HYUNDAI I40	c.c	1685
Engine No.	HIDDEN	Year of Reg.	2015
Chassis No.	KMHLB41UMGU077270	Colour	BLUE
Odometer	749242 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/60 R16	HANKOOK	5 mm
L/H Front Tyre	205/60 R16	HANKOOK	5 mm
R/H Rear Tyre	205/60 R16	HANKOOK	5 mm
L/H Rear Tyre	205/60 R16	HANKOOK	5 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	08/06/2020	Inspection Date	12/06/2020
Survey held at	BIFROST AUTO PTE LTD 8 KAKI BUKIT AVENUE 4 #01-49 PREMIER @ KAKI BUKIT SINGAPORE 415875		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **8 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHA 7964Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	REAR BUMPER	DISTORTED	1,106.00	553.00
1	REAR BUMPER CLIP	NECESSARY	19.00	19.00
1	REAR BUMPER SPONGE	NOT NECESSARY	119.50	-
1	REAR BUMPER UNDER COVER	NOT NECESSARY	228.00	-
1	REAR FENDER	BUCKLED	2,171.40	2,171.40
1	REAR FENDER UNDER SHIELD (LH)	NOT NECESSARY	338.60	-
1	REAR FENDER AIR-DUCT (LH)	NOT NECESSARY	51.60	-
1	REAR FENDER TRIM BOARD (LH)	NOT NECESSARY	688.75	-
1	REAR DOOR (LH)	DENTED	2,201.10	2,201.10
1	REAR DOOR RUBBER (LH)	NOT NECESSARY	185.40	-
1	REAR DOOR HINGE UPPER (LH)	NOT NECESSARY	114.50	-
1	REAR DOOR HINGE LOWER (LH)	NOT NECESSARY	123.50	-
1	REAR DOOR CHECK (LH)	NOT NECESSARY	92.90	-
1	ROCKER PANEL OUTER GARNISH (LH)	CUT / BROKEN	732.80	732.80
1	ROCKER PANEL OUTER	NOT NECESSARY	1,380.50	-
1	REAR TYRE RIM (LH)	BENT	650.60	325.30
1	REAR TYRE WHEEL CAP	CUT / BENT	214.20	107.10
1	REAR WHEEL BEARING ING & HUB	DAMAGED	724.00	401.40
1	REAR TRAILING ARM (LH)	DISTORTED	384.00	384.00
1	REAR ASSIST (LH)	DISTORTED	219.40	219.40
1	REAR SHOCK ABSORBER (LH)	DISTORTED	683.70	276.30
1	REAR SHOCK ABSORBER MOUNTING (LH)	NOT NECESSARY	162.60	-
1	ABS SENSOR	NOT NECESSARY	217.90	-
1	REAR LOWER ARM (LH)	DISTORTED	353.80	353.80
1	REAR KNUCKLE ARM (LH)	DISTORTED	545.60	545.60
1	FRONT FENDER (LH)	DENTED	566.30	566.30
1	FRONT FENDER SHIELD (LH)	SERVICEABLE	174.90	-
1	FRONT DOOR (LH)	DENTED	2,256.40	2,256.40
1	FRONT DOOR RUBBER	NOT NECESSARY	196.00	-
1	FRONT DOOR HINGE UPPER (LH)	NOT NECESSARY	113.60	-
1	FRONT DOOR HINGE LOWER (LH)	NOT NECESSARY	125.70	-

Report Ref No. CC4/FCI20006267/Des3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT DOOR CHECK (LH)	NOT NECESSARY	91.80	-
1	FRONT WHEEL RIM (LH)	DISTORTED	650.60	325.30
1	KNUCKLE ARM (LH)	DISTORTED	595.90	552.00
1	FRONT WHEEL BEARING HUB ASSY (LH)	DAMAGED	673.20	301.80
1	FRONT SUSPENSION LOWER ARM (LH)	DISTORTED	1,104.00	595.80
1	FRONT SHOCK ABSORBER ASSY (LH)	DISTORTED	684.40	342.20
1	FRONT SHOCK ABSORBER MOUNTING (LH)	NOT NECESSARY	217.60	-
1	STG TIE ROD (LH)	NOT NECESSARY	186.40	-
1	STG TIE TIE (LH)	NOT NECESSARY	125.20	-
1	STABILIZER BAR ASSY	NOT NECESSARY	463.70	-
1	STABILIZER BAR LINK (LH)	NOT NECESSARY	68.10	-
1	ABS SENSOR	NOT NECESSARY	217.90	-
	LESS 20% DISCOUNT		-4,444.21	-2,646.00
			17,776.84	10,584.00
<u>SPECIAL NETT ITEMS</u>				
1	REAR BUMPER MAT (SN)	NOT NECESSARY	50.00	-
1	REAR BUMPER REVERSE SENSOR (SN)	NOT NECESSARY	118.00	-
1	REAR BUMPER ADVERTISEMENT LOGO (SN)	NECESSARY	50.00	50.00
1	REAR FENDER ADVERTISEMENT LOGO (LH) (SN)	NECESSARY	100.00	100.00
1	REAR DOOR COMFORTDELGRO & APPS STICKER (LH) (SN)	NECESSARY	80.00	80.00
1	REAR DOOR ADVERTISEMENT LOGO (LH) (SN)	NECESSARY	100.00	100.00
1	ROCKER PANEL ADVERTISEMENT (LH) (SN)	NECESSARY	120.00	120.00
1	REAR TYRE (LH)	NOT NECESSARY	216.00	-
1	FRONT FENDER ADVERTISEMENT LOGO (SN)	NECESSARY	100.00	100.00
1	FRONT DOOR COLOURED COMFORT LOGO (SN)	NECESSARY	75.00	75.00
1	FRONT DOOR ADVERTISEMENT LOGO (SN)	NECESSARY	100.00	100.00
1	FRONT TYRE (LH) (SN)	NOT NECESSARY	216.00	-
			1,325.00	725.00
<u>LABOUR</u>				
	PANEL BEATING.		1,800.00	1,000.00
	SPRAY PAINTING CHARGE.		1,600.00	1,000.00
	WIRING CHARGE.		160.00	30.00

Report Ref No. CC4/FCI20006267/Des3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TUFF KOTE.		140.00	40.00
	TOWING CHARGE.	NOT NECESSARY	80.00	-
	REMOVE/REFIX CUSHION & UPHOLSTERY REAR .		150.00	80.00
	REMOVE/REFIX REVERSE SENSOR .	NOT NECESSARY	120.00	-
	REMOVE/REFIX UNDERCARRIAGE (RR).		400.00	150.00
	RE-SET REAR ABS SYSTEM.	NOT NECESSARY	400.00	-
	REMOVE/REFIX FUEL TANK.	NOT NECESSARY	80.00	-
	TRANSFER OF DOOR MECHANISM FRONT .		80.00	60.00
	RE-SET FRT POWER WINDOW SYSTEM.	NOT NECESSARY	200.00	-
	TRANSFER OF DOOR MECHANISM REAR .		80.00	60.00
1	RE-SET REAR POWER WINDOW SYSTEM.	NOT NECESSARY	200.00	-
	FOUR WHEEL ALIGNMENT .		120.00	60.00
	REMOVE/ REFIX UNDERCARRIAGE (FRT).		400.00	150.00
	RE-SET FRT ABS SYSTEM.	NOT NECESSARY	200.00	-
	REMOVE/REFIX FUSE BOX.	NOT NECESSARY	120.00	-
	REMOVE/REFIX CUSHION & UPHOLSTERY REAR .	NOT NECESSARY	90.00	-
	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE.		550.00	150.00
			6,970.00	2,780.00
	GRAND TOTAL		26,071.84	14,089.00
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			11,200.00

Report Ref No. CC4/FCI20006267/Des3q2

ANG BRYAN TANI

Automotive Assessor / Investigator

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd





51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 7964Y

INSPECTION

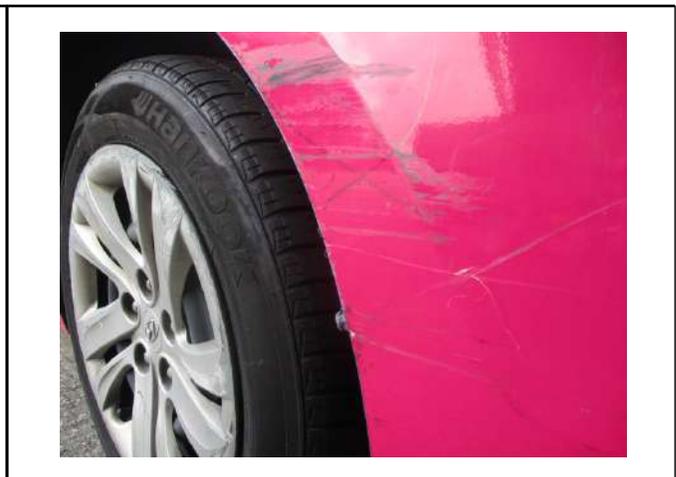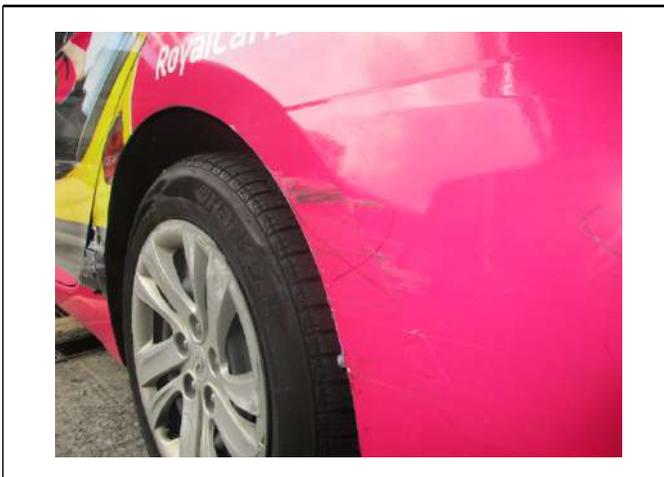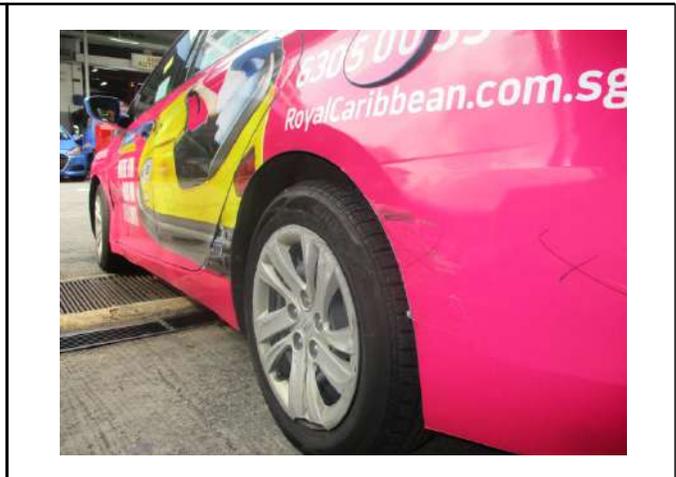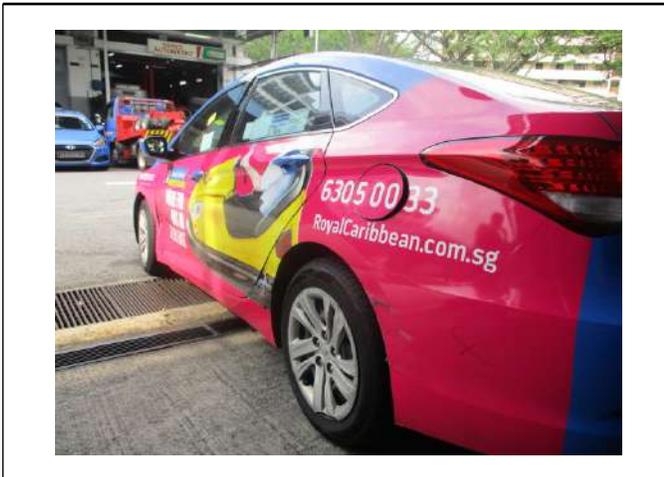






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

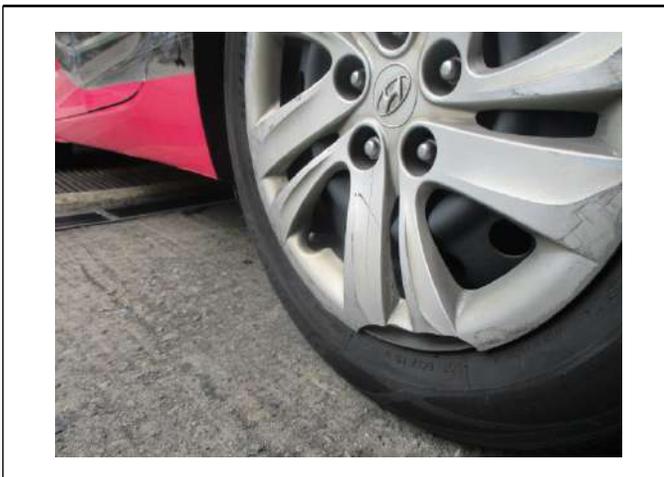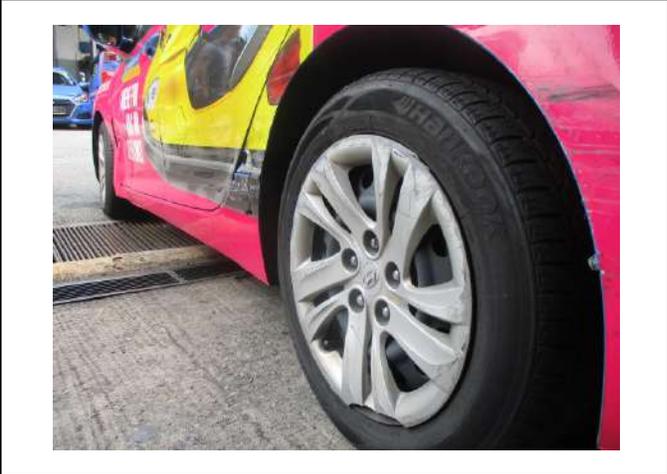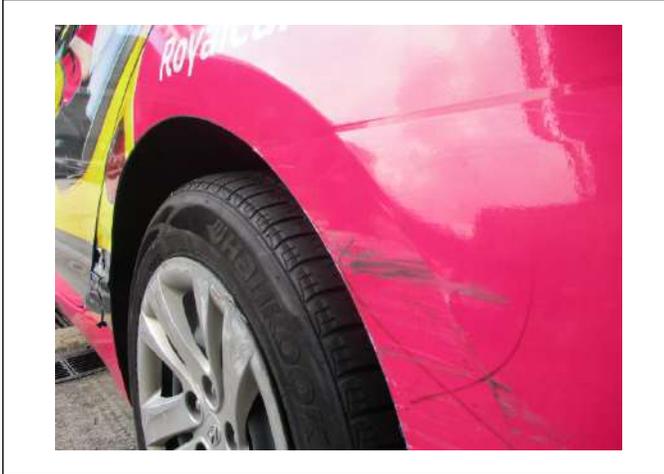




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

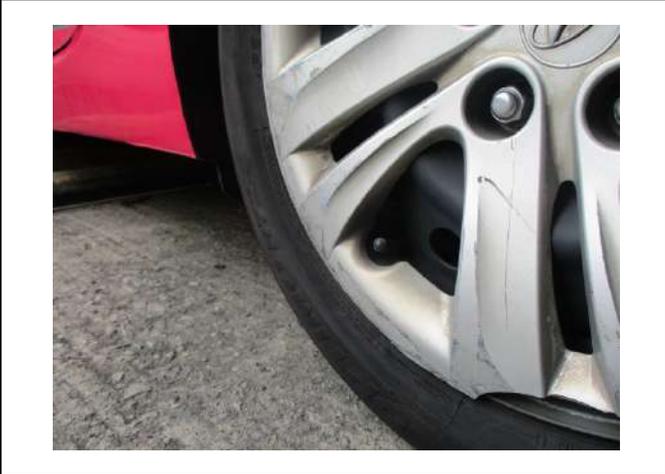






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

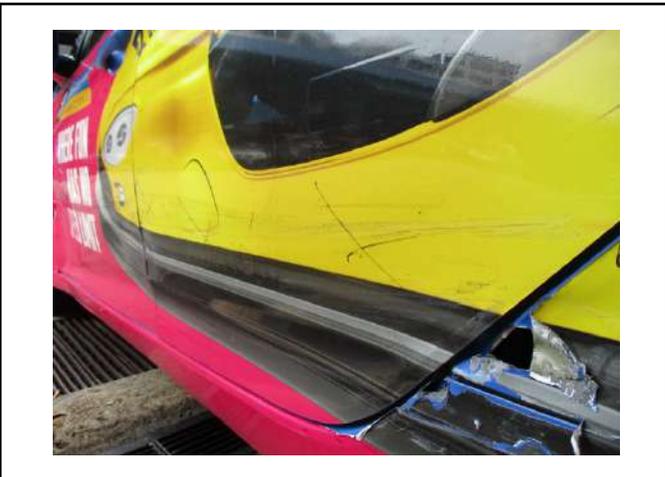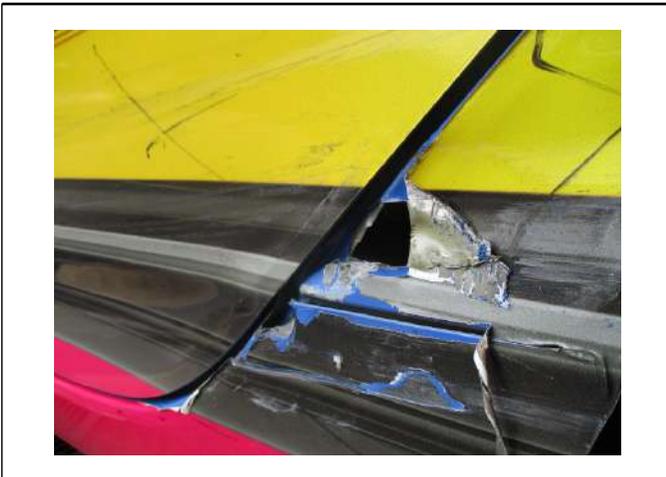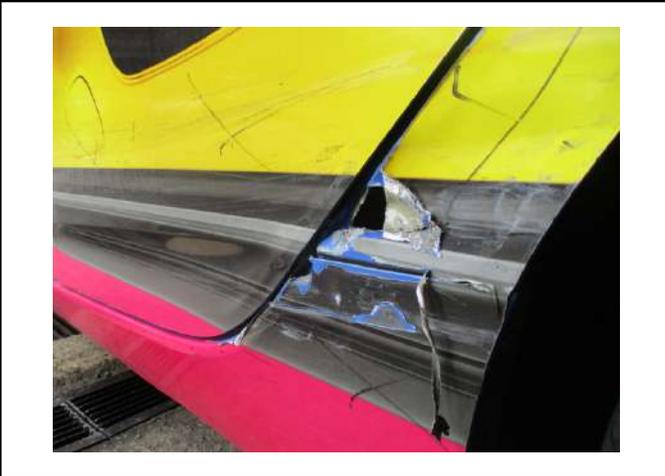



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

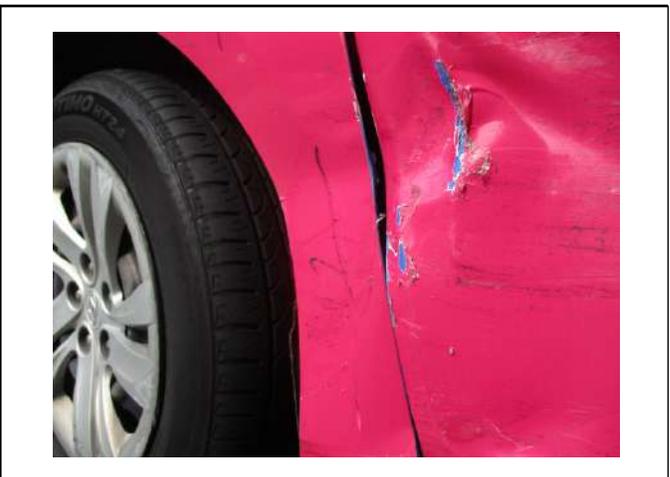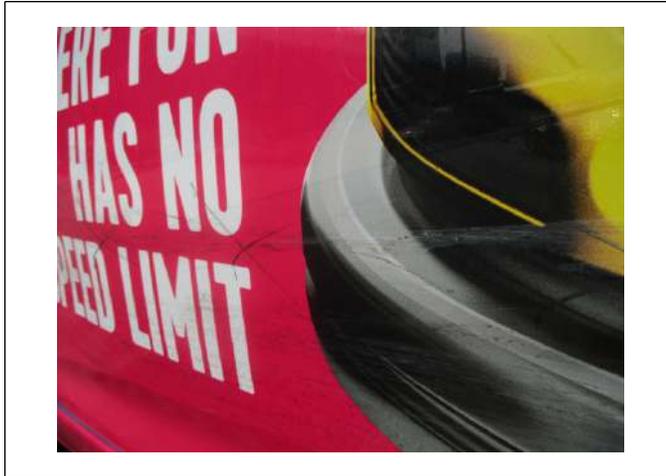



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

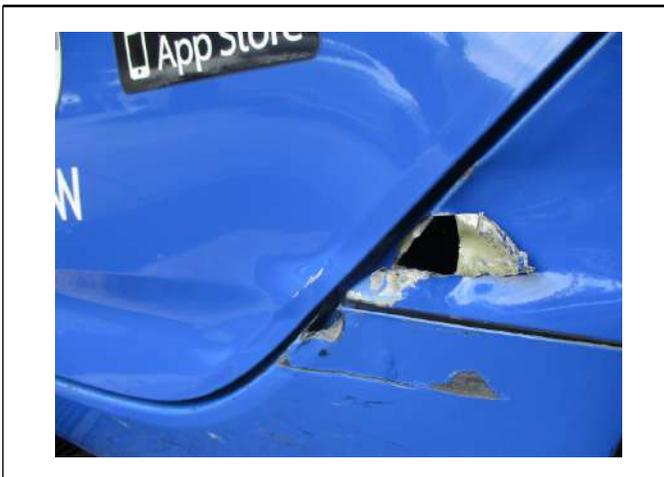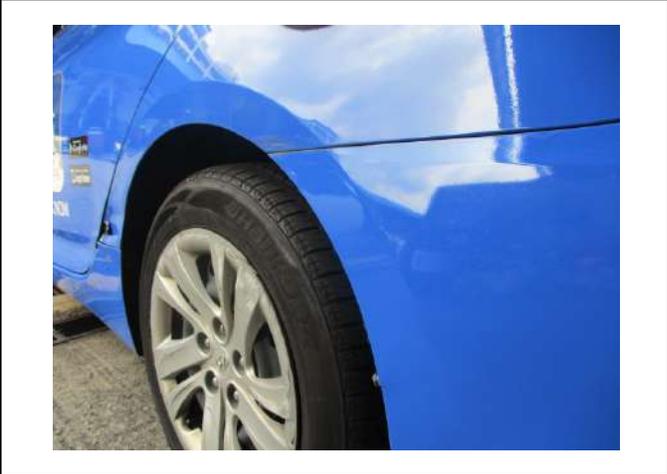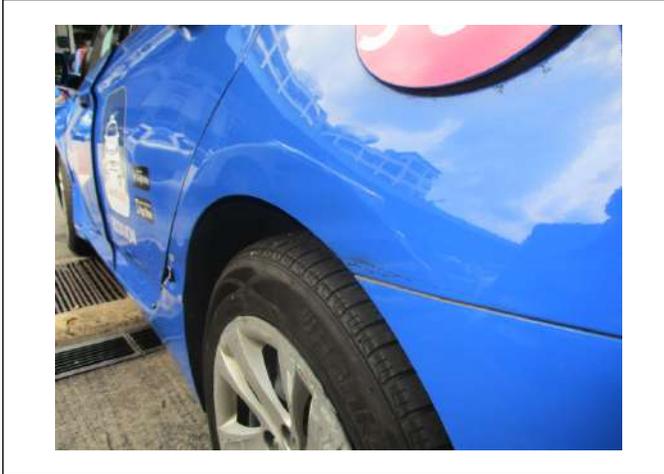







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

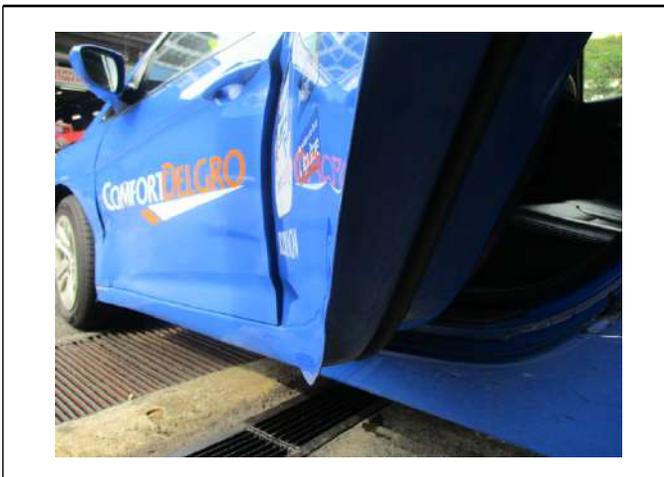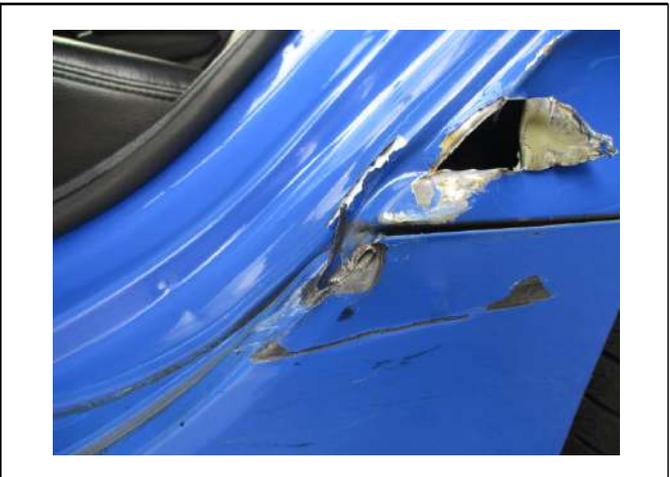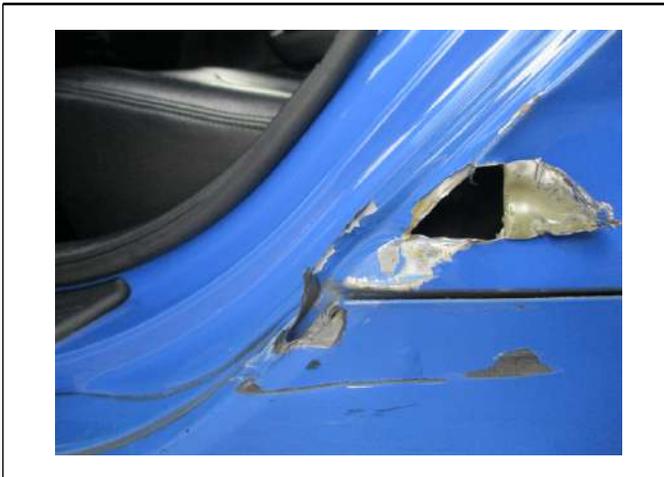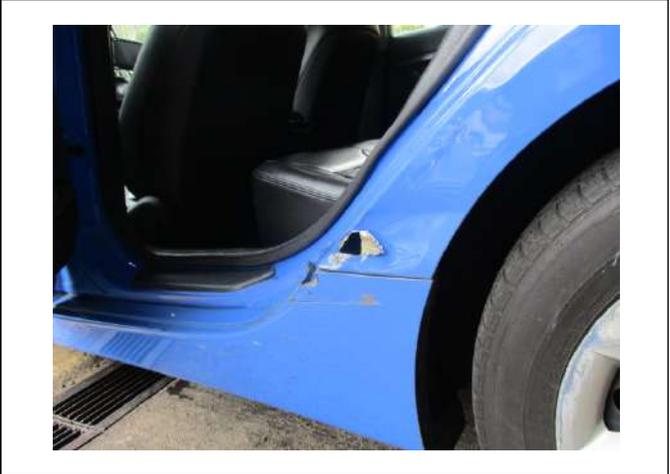






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

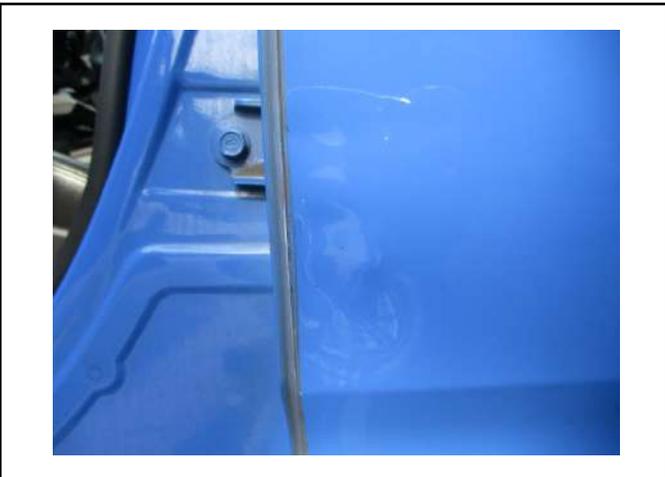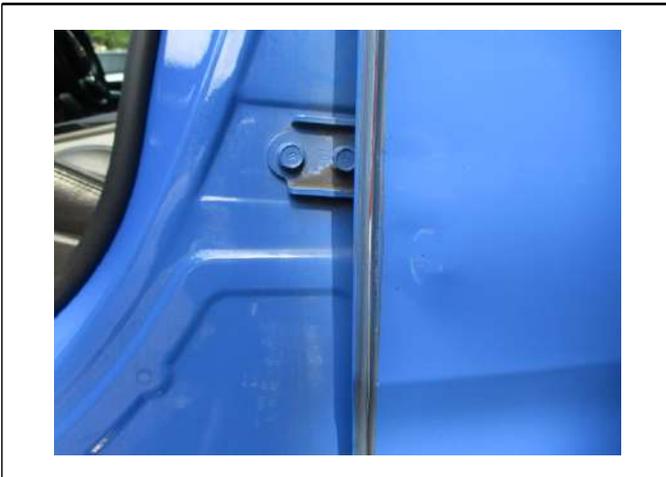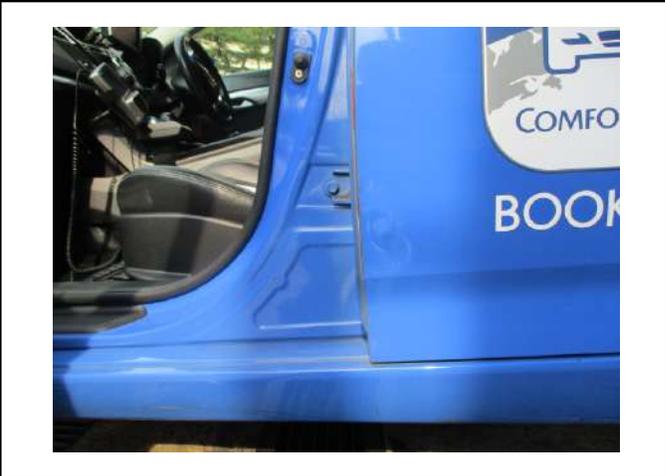




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

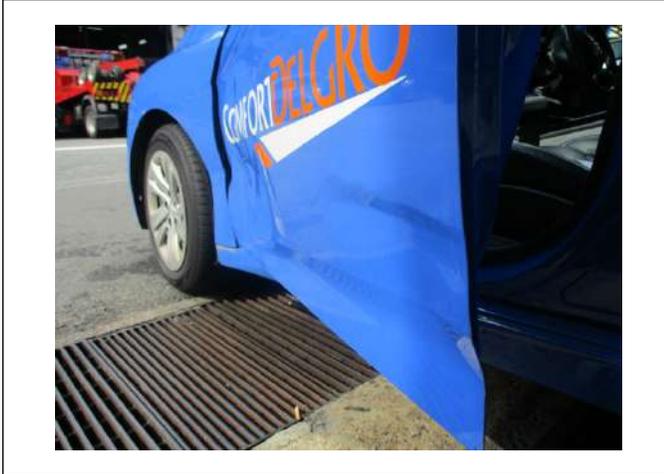





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

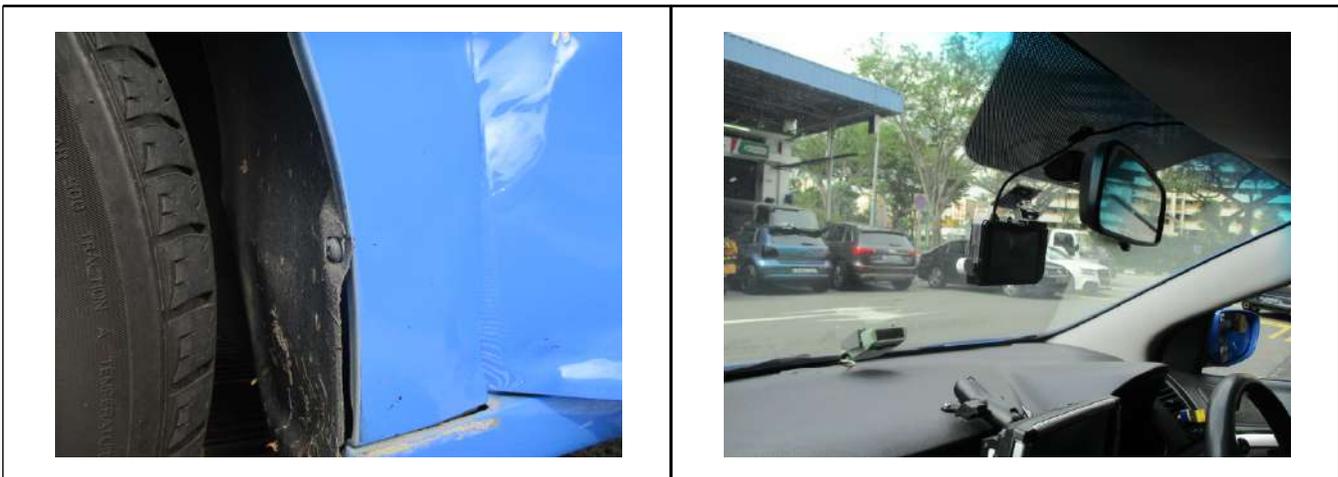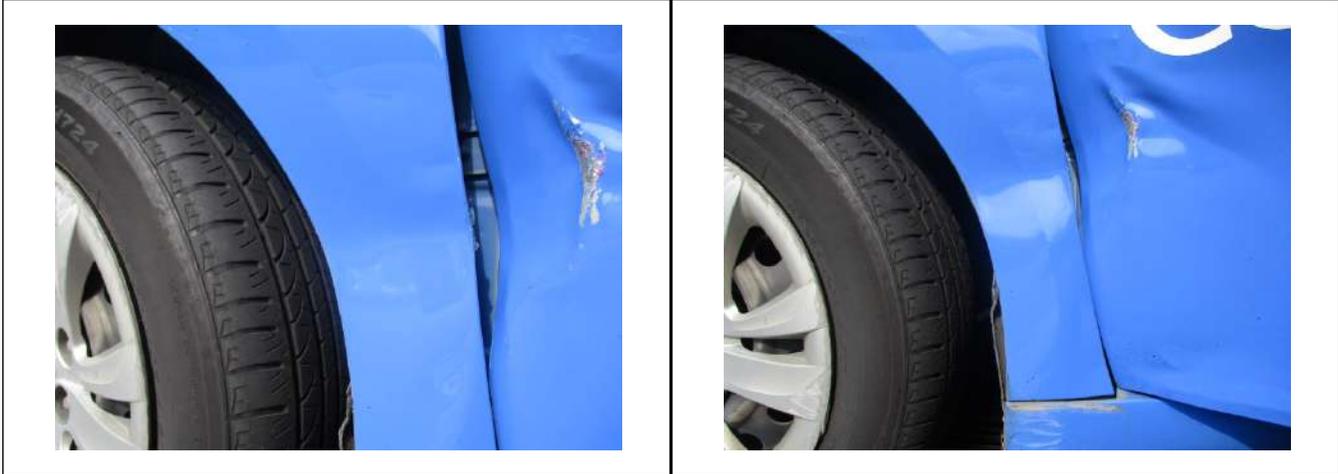




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

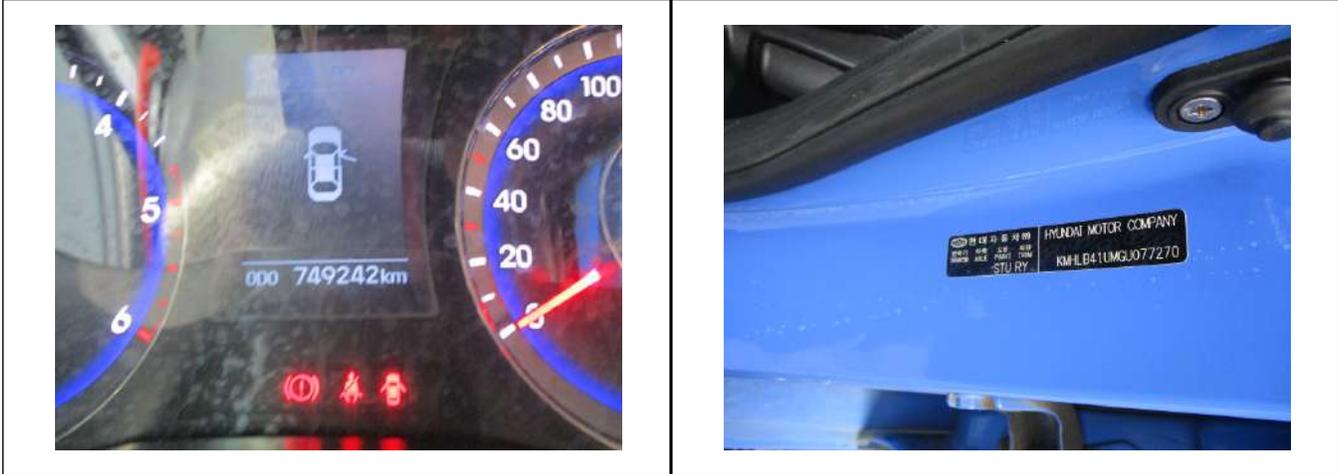



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 7964Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

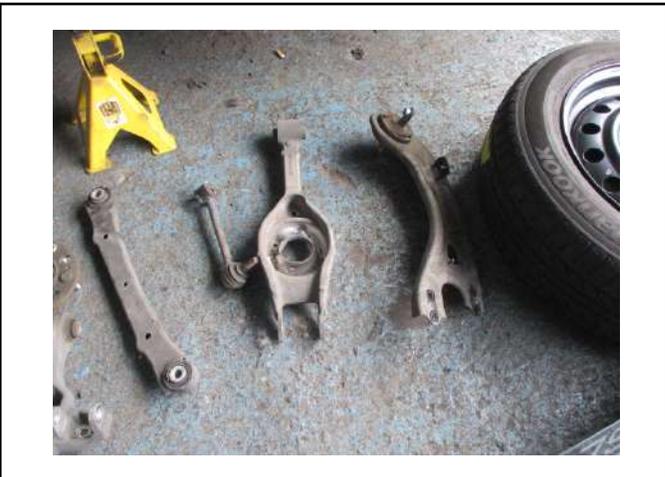



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

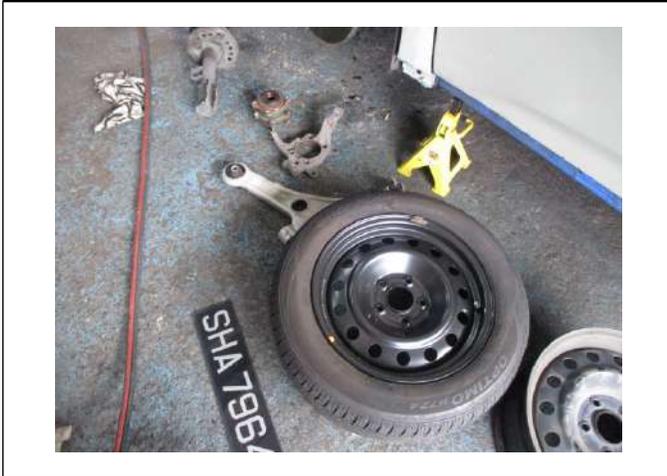



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

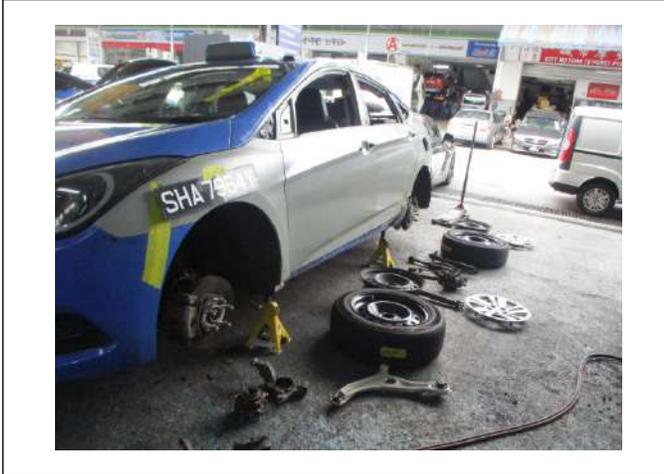



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 7964Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

