



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



TAX INVOICE

NTUC INCOME INSURANCE CO-OPERATIVE LTD INV No. NA2003220
73 BRAS BASAH ROAD
#05-01 NTUC TRADE UNION HOUSE
SINGAPORE 189556

INV Date 25/06/2020
Reference NS/INC20006280/T1qf3n2
Code INC4



PROFESSIONAL SERVICE FEE

Vehicle No. SHC 1972C
Insured Veh. SMC 7429G
Claim No. MT/1094433-002
Policy No.
Accident Date 12/06/2020
Inspection Date 12/06/2020

Description	Total
Survey Inspection	160.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	160.00
GST (7%)	11.20
Grand Total	171.20

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'National Assessment Centre Services'

National Assessment Centre Services

HYN




National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC20006280/T1qf3n2				
73 BRAS BASAH ROAD #05-01 NTUC TRADE UNION HOUSESINGAPORE 189556			Date: 25-06-2020	
Code: INC4				
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SMC 7429G	Veh. Inspected	SHC 1972C	
Policy No.		Coverage (\$)	0.00	
Claim No.	MT/1094433-002	Excess (\$)	0.00	
Assign From		Assign Date	12/06/2020	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI IONIQ	c.c	1580	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	KMHC851CVLU190286	Colour	BLUE	
Odometer	37175	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	MICHELIN	6 mm	
L/H Front Tyre	195/65 R15	MICHELIN	6 mm	
R/H Rear Tyre	195/65 R15	MICHELIN	6 mm	
L/H Rear Tyre	195/65 R15	MICHELIN	6 mm	
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
Accident Date	12/06/2020	Inspection Date	12/06/2020	
Survey held at	COMFORTDELGRO ENGINEERING PTE LTD 59 LOYANG DRIVE SINGAPORE 508969			
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR: 3 Working Days			



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 1972C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	DEFORMED	459.40	459.40
1	REAR BUMPER CENTER-BLACK	CRACKED	451.25	451.25
1	REAR BUMPER FOG LAMP	NOT NECESSARY	201.50	-
1	REAR BUMPER REINFORCEMENT	BENT	294.80	294.80
1	REAR BUMPER LWR MOULDING	DEFORMED	155.00	155.00
1	REAR BUMPER STAY LH	BENT	138.10	138.10
1	REAR BUMPER STAY RH	BENT	138.10	138.10
1	REAR BUMPER REFLECTOR RH	NOT NECESSARY	31.90	-
1	REAR BUMPER REFLECTOR LH	NOT NECESSARY	31.90	-
10	REAR BUMPER CLIPS	NECESSARY	22.00	22.00
1	TAILGATE EMBLEM HYBRID	NECESSARY	24.30	24.30
1	TAILGATE EMBLEM-IONIQ	NECESSARY	31.30	31.30
1	REAR BUMPER TOW COVER	DEFORMED	5.40	5.40
	LESS 20% DISCOUNT		-396.99	-343.93
			1,587.96	1,375.72
<u>NETT ITEMS</u>				
1	TAILGATE COMFORTDELGRO (N)	NECESSARY	30.00	30.00
1	TAILGATE 65521111 (N)	NECESSARY	30.00	30.00
1	TAILGATE APPS (N)	NECESSARY	40.00	40.00
1	REVERSE SENSOR (N)	NOT WORKING	180.00	180.00
1	REAR NO.PLATE W/TRIM COVER (N)	CRACKED	55.00	55.00
	LESS 10% DISCOUNT		-33.50	-33.50
			301.50	301.50
<u>SPECIAL NETT ITEMS</u>				
1	REAR BUMPER MAT (SN)	NECESSARY	50.00	50.00
			50.00	50.00
<u>LABOUR</u>				
	PANEL BEATING-TAILGATE ETC.		700.00	640.00
	SPRAYPAINT CHARGE.		500.00	400.00

Report Ref No. NS/INC20006280/T1qf3n2



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	R/I REVERSE SENSOR.		120.00	30.00
			1,320.00	1,070.00
GRAND TOTAL			3,259.46	2,797.22
RECOMMENDED COST OF REPAIRS (CONFIRMED)				2,797.22

Report Ref No. NS/INC20006280/T1qf3n2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,
MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H

PHOTOGRAPHS FOR VEHICLE NO. SHC 1972C

INSPECTION





National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H





National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H





National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H





National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H





National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H






National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H

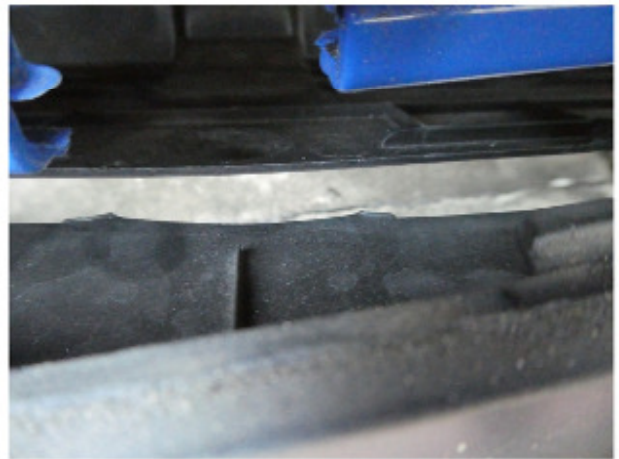



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H





National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H

PHOTOGRAPHS FOR VEHICLE NO. SHC 1972C

RE-INSPECTION





National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H

PHOTOGRAPHS FOR VEHICLE NO. SHC 1972C

RE-INSPECTION

