



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV No. AC2004830
INV Date 08/07/2020
Reference CC6/CTI20006340/Uda3q2
Code CTI



PROFESSIONAL SERVICE FEE

Vehicle No. GBA 4441E
Insured Veh. GBJ 7194B
Claim No. SNM20D202146
Policy No.
Accident Date 09/06/2020
Inspection Date 16/06/2020

Description	Total
Survey Inspection	350.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CC6/CTI20006340/Uda3q2

3 ANSON ROAD #16-00
SPRINGLEAF TOWERSINGAPORE 079909

Date : 08-07-2020



Code : CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBJ 7194B	Veh. Inspected	GBA 4441E
Policy No.		Coverage (\$)	0.00
Claim No.	SNM20D202146	Excess (\$)	0.00
Assign From		Assign Date	16/06/2020

2. Vehicle Particulars & Condition

Make & Model	TOYOTA DYNA (M)	c.c	2982
Engine No.	HIDDEN	Year of Reg.	2007
Chassis No.	JTFAT35Y203000986	Colour	RED
Odometer	419225	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195 R15	AUSTONE	6 mm
L/H Front Tyre	195 R15	AUSTONE	6 mm
R/H Rear Tyre	155 R12 (D)	DUNLOP	6/6 mm
L/H Rear Tyre	155 R12 (D)	DUNLOP	6/6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	09/06/2020	Inspection Date	16/06/2020
Survey held at	LIU'S BROTHER AUTO ENGINEERING WORKSHOP 1 KAKI BUKIT AVENUE 6 #01-01 AUTOBAY @ KAKI BUKIT SINGAPORE 417883		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **4 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBA 4441E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER	BENT	481.60	481.60
1	FRONT GRILLE	CRACKED	488.30	488.30
2	FRONT HEAD LAMP @\$704.35	HOLDER CRACKED	1,408.70	1,408.70
1	FRONT PANEL	TO REPAIR SEE LABOUR	1,265.50	-
1	FRONT PANEL TOP BLACK GARNISH	SCRATCHED	328.50	328.50
2	FRONT CORNER TOP BLACK GARNISH @\$199.75	O/S SCRATCHED	399.50	199.75
	LESS 25% DISCOUNT		-	-726.71
			4,372.10	2,180.14
<u>SPECIAL NETT ITEMS</u>				
1	SET FRONT BUMPER CLIPS (SN)	NOT NECESSARY	54.50	-
1	SET FRONT GRILLE CLIPS (SN)	NOT NECESSARY	45.00	-
1	FRONT PANEL SEALANT (SN)	NOT NECESSARY	60.00	-
1	SET FRONT 'CORPORATE' ADVERTISEMENT & ARTWORK STICKER (SN)	NECESSARY	400.00	200.00
1	FRONT NUMBER PLATE 'METAL' (SN)	BENT	28.00	14.00
			587.50	214.00
<u>LABOUR</u>				
	TO CHECK ALL WIRING & ELECTRICAL COMPONENT FOR PROPER FUNCTION .		50.00	20.00
	TO REMOVE & REFIX AIR CON ,REFILL AIR CON GAS & TEST FOR LEAKAGES.	NOT NECESSARY	100.00	-
	LABOR FOR PANEL BEATING ,CUT ,WELD & STRAIGHTEN & REPLACING PARTS ETCS.INCLUSIVE OF THE REPAIR OF FRONT PANEL .		600.00	300.00
	TO PUTTY & SPRAY PAINTING & INCLUDING TOUCH UP PAINT ON ACCIDENT AFFECTED A.		980.00	500.00
	TO APPLY RUST PROOFING ,RESEAL TUFF-COATING TREATMENT ON ACCIDENT AREA.	NOT NECESSARY	50.00	-
			1,780.00	820.00
GRAND TOTAL			6,739.60	3,214.14



RECOMMENDED COST OF LUMP SUM REPAIRS (TP ITS PRE-ACCIDENT CONDITION)			2,550.00
---	--	--	-----------------

Report Ref No. CC6/CTI20006340/Uda3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBA 4441E

INSPECTION

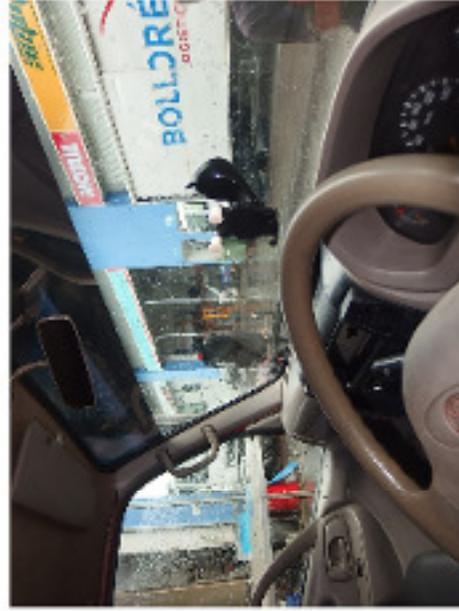



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

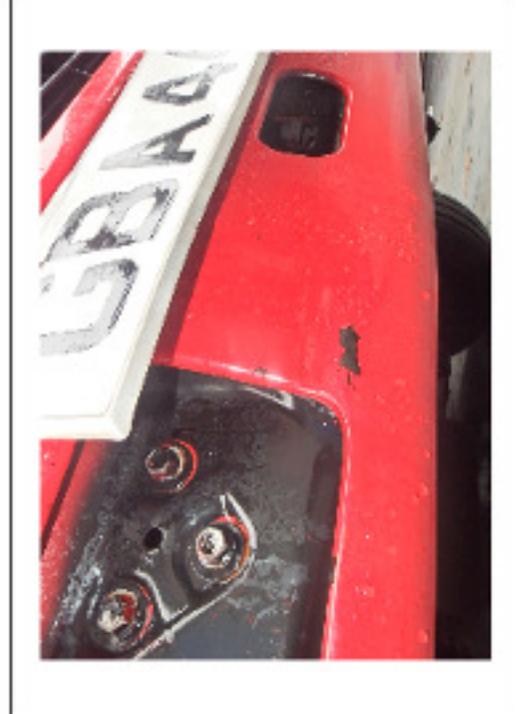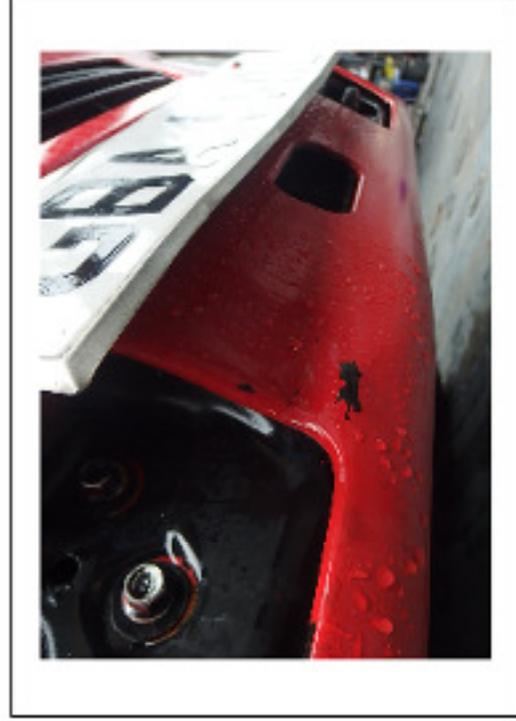



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

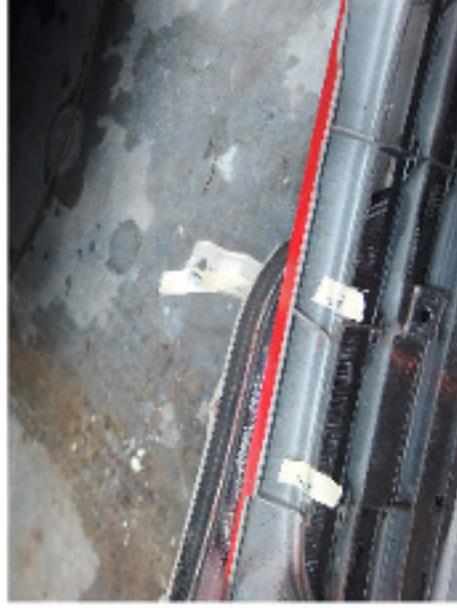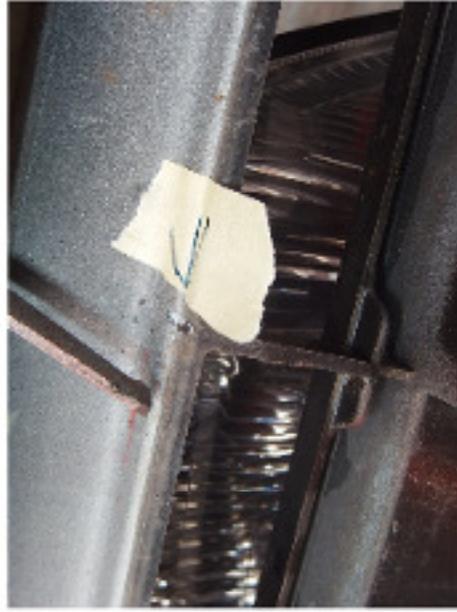




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

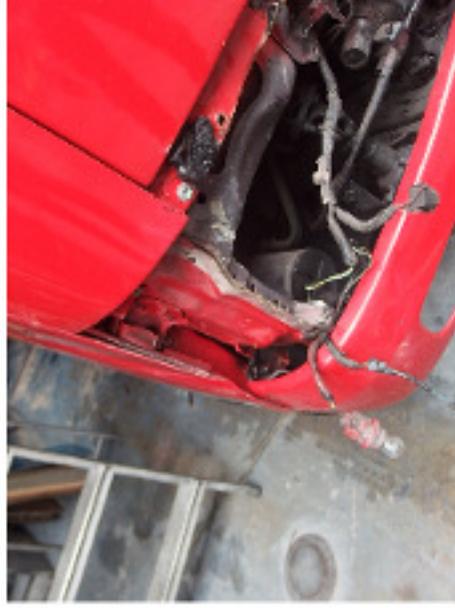



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBA 4441E

RE-INSPECTION

