



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV No. AC2006304
INV Date 14/09/2020
Reference CC4/FCI20006400/Uea3q2
Code FCI2



PROFESSIONAL SERVICE FEE

Vehicle No. SJL 7492K
Insured Veh. SHA 1577X
Claim No. D20002433MFSH
Policy No. D-20094922MFSH
Accident Date 14/06/2020
Inspection Date 18/06/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD

Ref : CC4/FCI20006400/Uea3q2

36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Date : 14-09-2020



Code : FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHA 1577X	Veh. Inspected	SJL 7492K
Policy No.	D-20094922MFSH	Coverage (\$)	0.00
Claim No.	D20002433MFSH	Excess (\$)	0.00
Assign From		Assign Date	17/06/2020

2. Vehicle Particulars & Condition

Make & Model	MITSUBISHI LANCER	c.c	1584
Engine No.	HIDDEN	Year of Reg.	2008
Chassis No.	JMYSTCS3A8U009824	Colour	RED
Odometer	152232	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/50 R15	WONDER	6 mm
L/H Front Tyre	195/50 R15	WONDER	6 mm
R/H Rear Tyre	195/50 R15	WONDER	6 mm
L/H Rear Tyre	195/50 R15	WONDER	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	14/06/2020	Inspection Date	18/06/2020
Survey held at	RICO 60 AUTO SERVICES PTE LTD 8 KAKI BUKIT AVENUE 4 #02-24 PREMIER @ KAKI BUKIT SINGAPORE 415875		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	7 Working Days
-------------------------------------	-----------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJL 7492K

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR WINDSCREEN MOULDING (N)	NECESSARY	361.00	121.00
1	BOOTLID (N)	DENTED / BENT	1,176.00	684.00
2	BOOTLID HANDLE PANEL (NPA)(N)	NOT NECESSARY	-	-
1	BOOTLID LOCK CYLINDER (N)	NOT NECESSARY	769.00	-
2	BOOTLID CARPLATE LAMP (L+R) (N)	NOT NECESSARY	176.00	-
1	BOOTLID LOCK(N)	TWISTED	576.00	149.00
1	BOOTLID LOCK CATCH (N)	NOT NECESSARY	171.00	-
2	BOOTLID HINGE (L+R) (N)	NOT NECESSARY	176.00	-
2	BOOTLID STOPPER (N)	NOT NECESSARY	88.00	-
1	BOOTLID WEATHERSTRIP (N)	TWISTED	416.00	197.00
2	TAIL LAMP (L+R) (N)	CRACKED	1,246.00	796.00
2	TAIL LAMP PANEL (L+R) (N)	N/S BENT	1,048.00	145.00
1	REAR BUMPER (N)	DISTORTED	1,171.00	698.00
2	REAR BUMPER RETAINER (L+R)	N/S BENT	426.00	52.00
1	REAR BUMPER REINFORCEMENT BAR (N)	BENT	499.00	171.00
2	REAR BUMPER BRACKET (L+R) (N)	NO SUCH PARTS	256.00	-
1	REAR BUMPER UNDERCOVER (N)	NO SUCH PARTS	418.00	-
2	REAR FENDER (L+R) (N)	N/S BODLY DENTED / BUCKLED	4,276.00	795.00
2	REAR FENDER INNER TRIM (L+R) (N)	N/S TORN	1,846.00	242.00
2	REAR FENDER COWLING (L+R) (N)	N/S TORN	642.00	98.00
1	END PANEL (N)	BADLY DENTED / BENT	1,109.00	442.00
1	END PANEL TOP GARNISH (N)	TWISTED	516.00	167.00
1	SPAREWHEEL PANEL (N)	TO REPAIR SEE LABOUR	1,471.00	-
1	SPAREWHEEL PANEL TOP BOARD (N)	NO SUCH PARTS	419.00	-
1	SPAREWHEEL PANEL TOP BOARD TOP MAT(N) (NPA)	NOT NECESSARY	-	-
1	EXHAUST GASKET (N)	NOT NECESSARY	79.00	-
2	EXHAUST BRACKET (L+R) (N)	NOT NECESSARY	144.00	-

Report Ref No. CC4/FCI20006400/Uea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 10% DISCOUNT		-	-475.70
			19,475.00	4,281.30
	<u>SPECIAL NETT ITEMS</u>			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	120.00	40.00
1	BOOTLID SPOILER (SN)	NOT NECESSARY	2,000.00	-
10	BOOTLID INNER TRIM CLIPS (SN)	NOT NECESSARY	100.00	-
1	REAR CARPLATE (SN)	NOT NECESSARY	120.00	-
4	TAIL LAMP CLIPS (L+R) (SN)	NOT NECESSARY	80.00	-
10	REAR BUMPER CLIPS (SN)	NECESSARY	100.00	50.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	SHORTED	300.00	200.00
1	REAR BUMPER LOWER (SN)	DISTORTED	3,000.00	680.00
1	REAR FENDER SEALANT (SN)	NOT NECESSARY	120.00	-
20	REAR FENDER INNER TRIM CLIPS (SN)	NOT NECESSARY	200.00	-
20	REAR FENDER COWLING CLIPS (SN)	NOT NECESSARY	200.00	-
1	END PANEL SEALANT (SN)	NECESSARY	120.00	50.00
10	END PANEL TOP GARNISH CLIPS (SN)	NOT NECESSARY	100.00	-
1	SPAREWHEEL PANEL SEALANT (SN)	NOT NECESSARY	120.00	-
1	EXHAUST PIPE (SN)	NOT NECESSARY	6,000.00	-
1	EXHAUST HEAT SHIELD (SN)	NOT NECESSARY	1,000.00	-
1	EXHAUST CHROME TOP (SN)	NOT NECESSARY	2,000.00	-
			15,680.00	1,020.00
	<u>LABOUR</u>			
	TO RNR ACCIDENT DAMAGE PARTS ,CUT/WELD ,KNOCK & REALIGN .INCLUSIVE OF THE REPAIR OF SPAREWHEEL PANEL .		3,600.00	1,200.00
	TO PUTTY AND RESPRAY ACCIDENT AFFECTED AREA.		3,000.00	1,200.00
	TO RUST PROOF ACCIDENT AFFECTED AREA.		250.00	80.00
	TO RNR REAR WINDSCREEN .		400.00	120.00
	TO RNR REAR BOOT MECHANISM .		400.00	50.00
	TO RNR REAR LUGGAGE COMPARTMENT .}		400.00	80.00
	TO RNR UPHOLSTERY ,GARNISH AND ATTACHMENT PARTS.}		400.00	-
	TO RNR REVERSE SENSOR & CHECK FUNCTION .		120.00	50.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO RNR EXHAUST SYSTEM AND ATTACHMENT PARTS.	NOT NECESSARY	250.00	-
	TO CHECK WIRING LAYOUT AND TAIL LAMP FUNCTION .		150.00	20.00
	TO DO DIAGNOSIS AND RESET,REPROGRAM OR CODING FAULT CODE.	NOT NECESSARY	400.00	-
	TO DO WATER LEAK TEST.	NOT NECESSARY	80.00	-
	TO RNR FUEL TANK TO ASSIST WORK LOAD.		250.00	60.00
			9,700.00	2,860.00
GRAND TOTAL			44,855.00	8,161.30
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,500.00

Report Ref No. CC4/FCI20006400/Uea3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJL 7492K

INSPECTION






LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

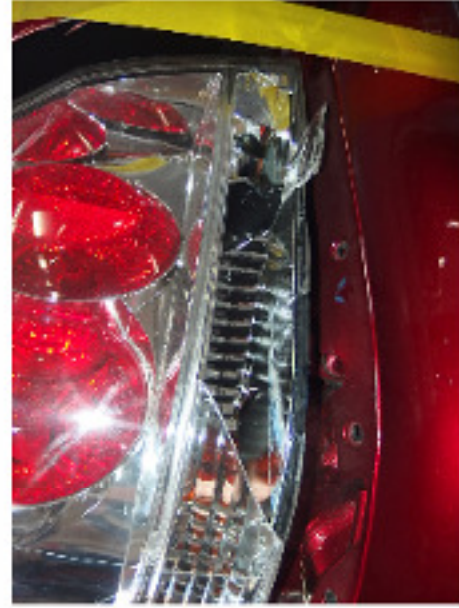



LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

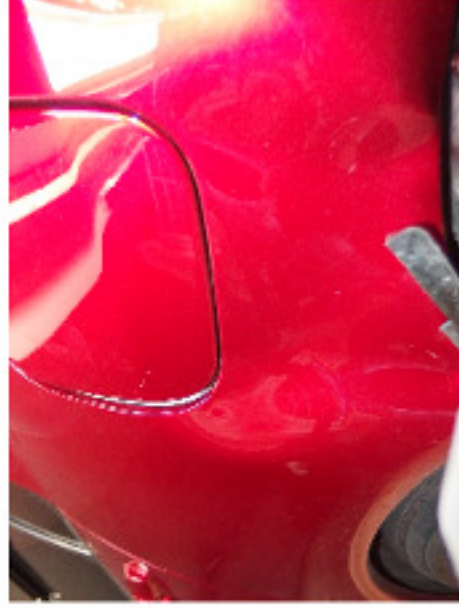



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199507198R GST Reg. No. 19-9507198-R

PHOTOGRAPHS FOR VEHICLE NO. SJL 7492K

RE-INSPECTION

