



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2102712

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 16/04/2021
Reference CC3/CTI20006617/T1es3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHA 9517S
Insured Veh. SKX 2827L
Claim No. SNM20D202222
Policy No. DMPCSN3080331901
Accident Date 23/06/2020
Inspection Date 23/06/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWERSINGAPORE 079909

Ref: CC3/CTI20006617/T1es3q2

Date: 16/04/2021

Code: CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SKX 2827L	Veh. Inspected	SHA 9517S
Policy No.	DMPCSN3080331901	Coverage (\$)	0.00
Claim No.	SNM20D202222	Excess (\$)	0.00
Assign From		Assign Date	23/06/2020

2. Vehicle Particulars & Condition

Make & Model	HYUNDAI IONIQ	c.c	1580
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	KMHC851CVKU106598	Colour	YELLOW
Odometer	275448 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	DAVANTI	6 mm
L/H Front Tyre	195/65 R15	DAVANTI	6 mm
R/H Rear Tyre	195/65 R15	DAVANTI	6 mm
L/H Rear Tyre	195/65 R15	DAVANTI	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	23/06/2020	Inspection Date	23/06/2020
Survey held at	COMFORTDELGRO ENGINEERING PTE LTD 59 LOYANG DRIVE SINGAPORE 508969		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **4 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHA 9517S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	TO REPAIR SEE LABOUR	459.40	-
1	REAR FENDER-LH	TO REPAIR SEE LABOUR	1,768.30	-
1	REAR WHEEL COVER-LH	CUT	346.40	346.40
1	REAR DOOR-LH	TO REPAIR SEE LABOUR	1,789.90	-
1	FRONT DOOR-LH	TO REPAIR SEE LABOUR	1,797.20	-
1	FRONT FENDER-LH	BENT	490.70	490.70
1	FRONT WHEEL COVER-LH	CUT	346.40	346.40
1	FRONT BUMPER-LH	TO REPAIR SEE LABOUR	418.30	-
1	MOULDING ASSY - SIDE (ADDITIONAL)		290.00	290.00
1	MOULDING ASSY (ADDITIONAL)		116.20	116.20
	LESS 20% DISCOUNT		-1,564.56	-317.94
			6,258.24	1,271.76
<u>SPECIAL NETT ITEMS</u>				
1	REAR DOOR APP STICKER (SN)	CUT	80.00	80.00
1	FRONT DOOR COMFORTDELGRO STICKER (SN)	NECESSARY	75.00	75.00
			155.00	155.00
<u>LABOUR</u>				
	LABOUR CHARGE. INCLUSIVE OF THE REPAIR OF REAR BUMPER, REAR FENDER-LH, REAR DOOR-LH, FRONT DOOR-LH AND FRONT BUMPER-LH.		1,200.00	800.00
	SPRAY PAINTING CHARGE.		1,200.00	1,000.00
	TUFF KOTE.		100.00	40.00
	WIRING CHARGE.	NOT NECESSARY	100.00	-
	TRANSFER OF DOOR-FRT,REAR.	NOT NECESSARY	300.00	-
			2,900.00	1,840.00
GRAND TOTAL			9,313.24	3,266.76



RECOMMENDED COST OF REPAIRS			3,266.76
------------------------------------	--	--	-----------------

Report Ref No. CC3/CTI20006617/T1es3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 9517S

INSPECTION

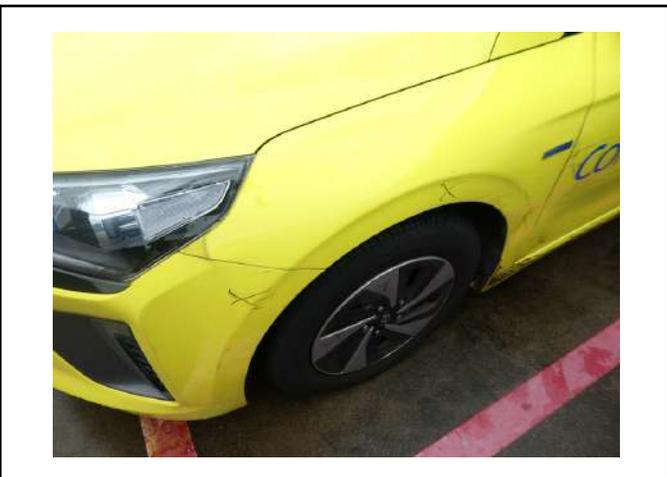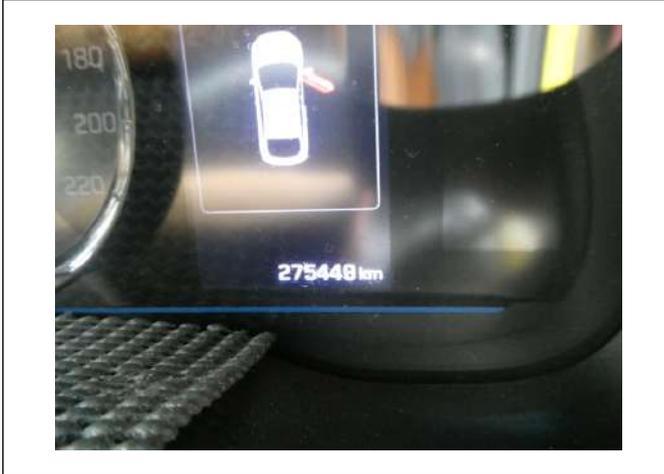




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

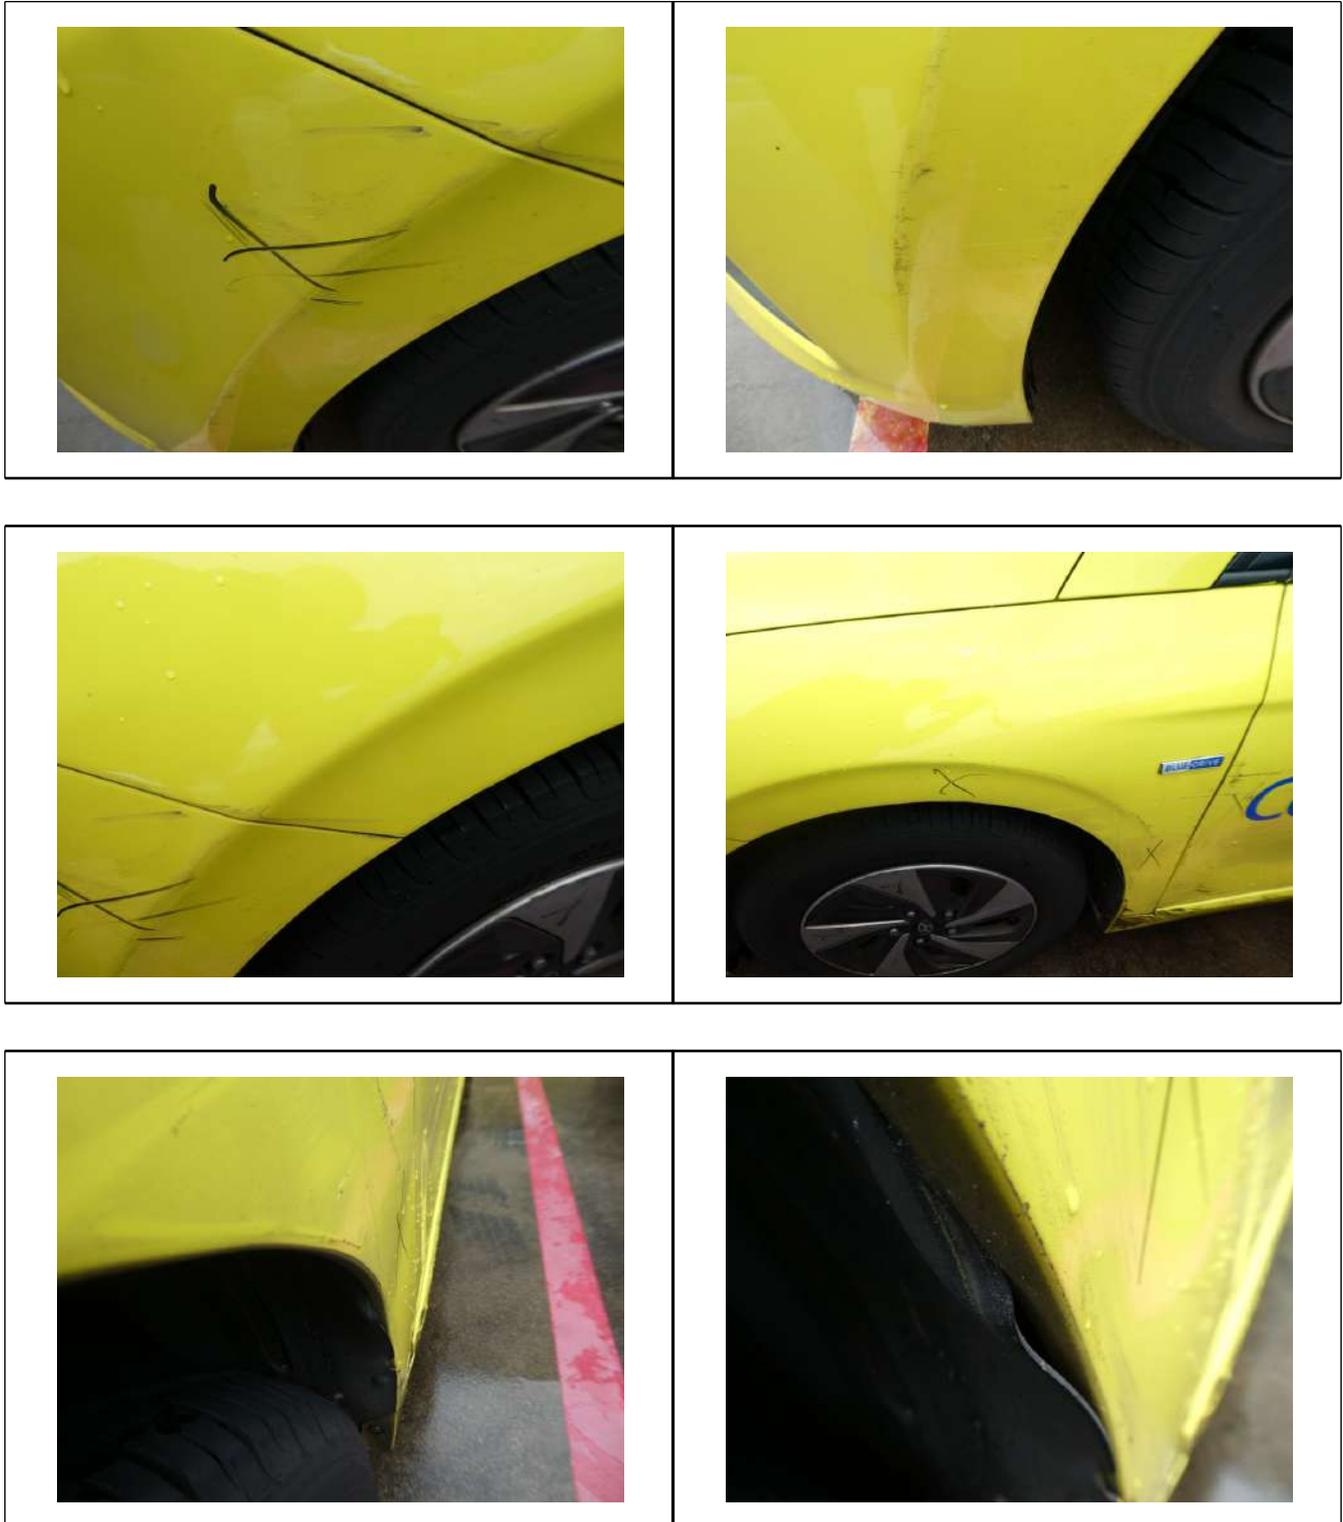







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

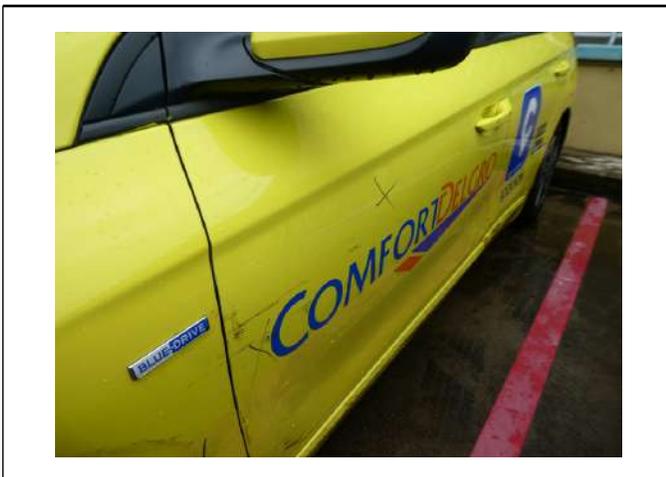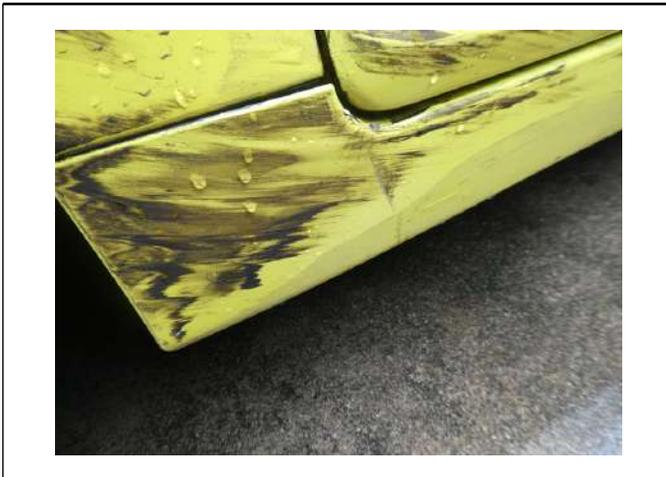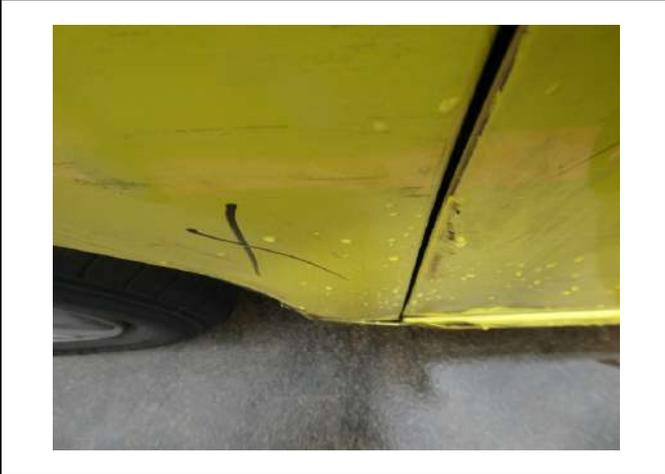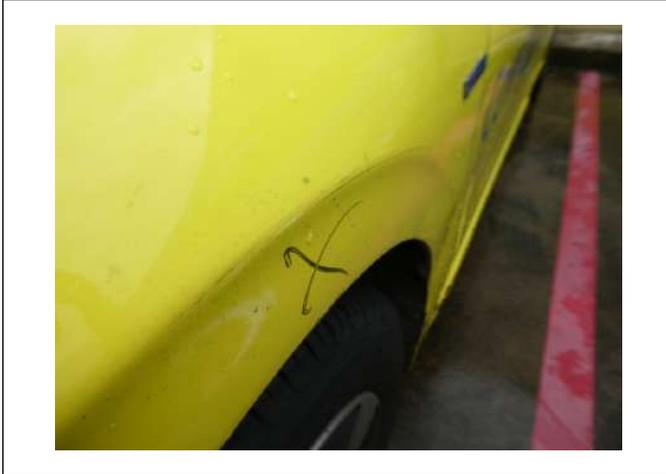




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

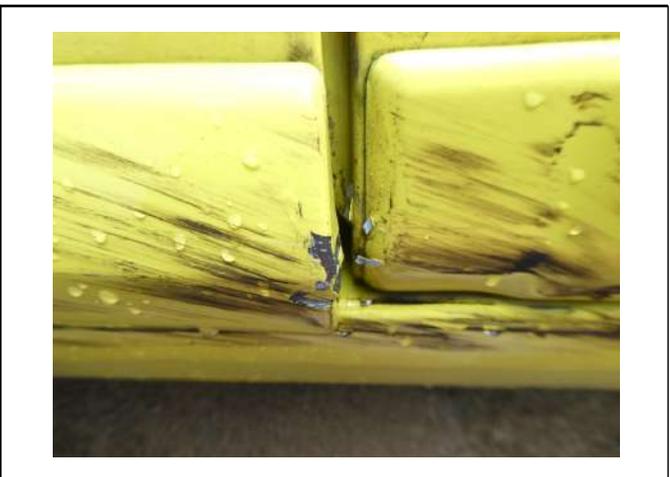





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

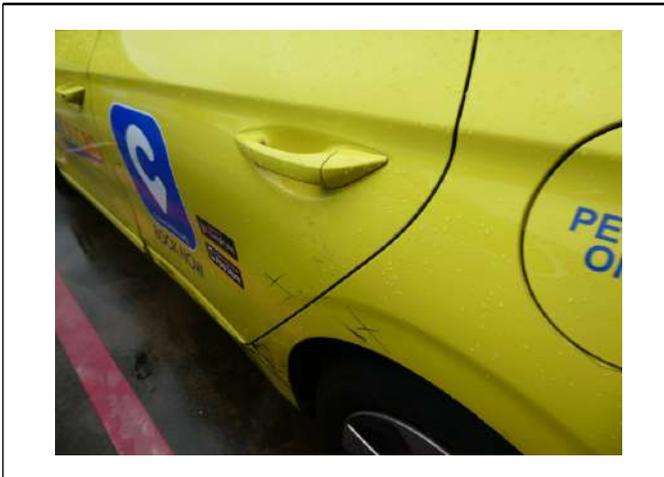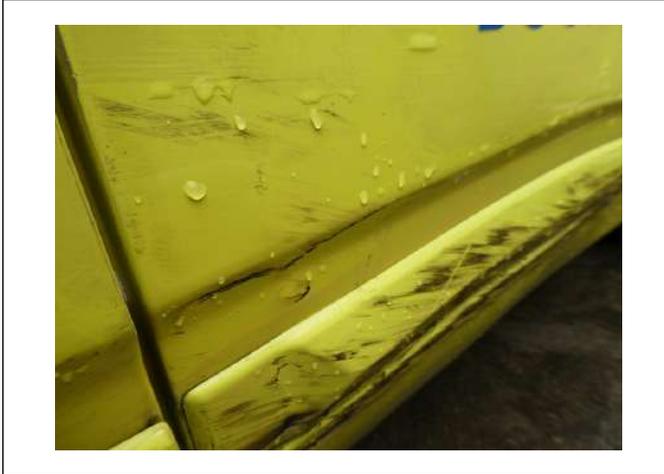




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

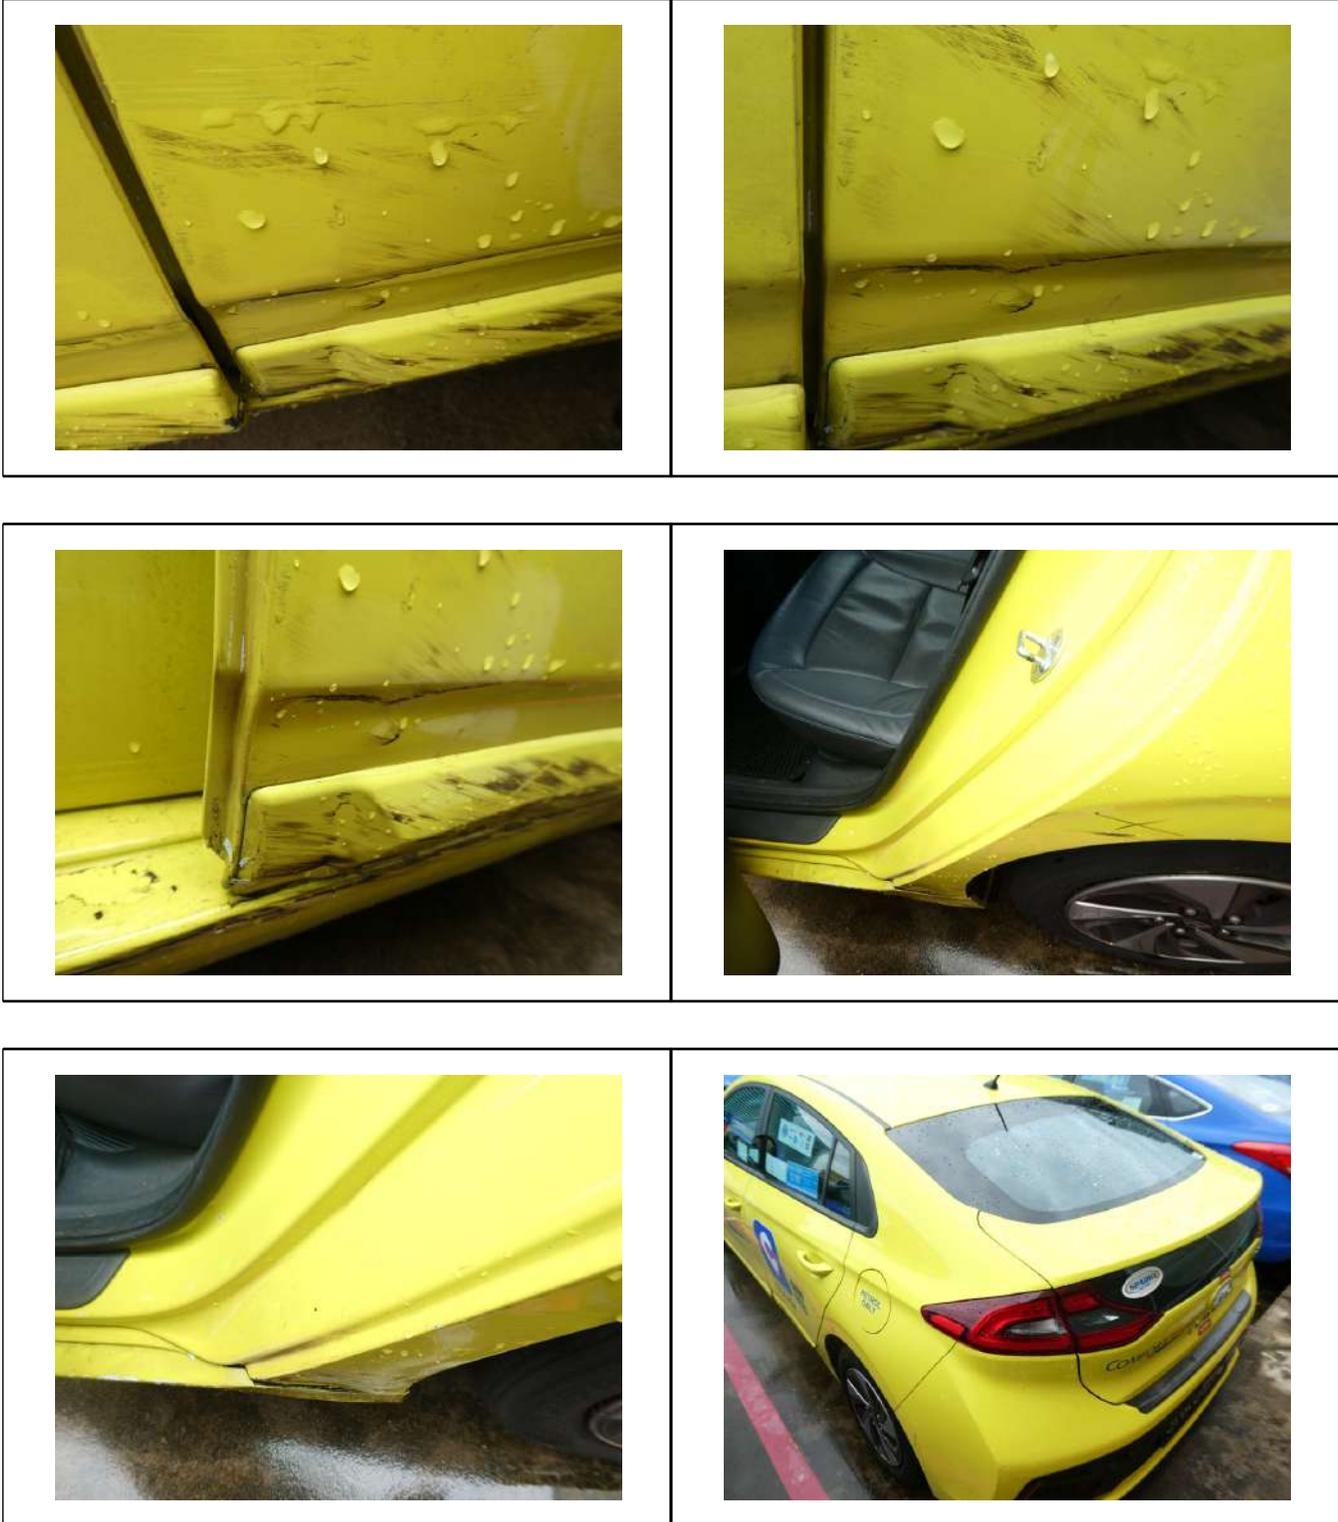




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

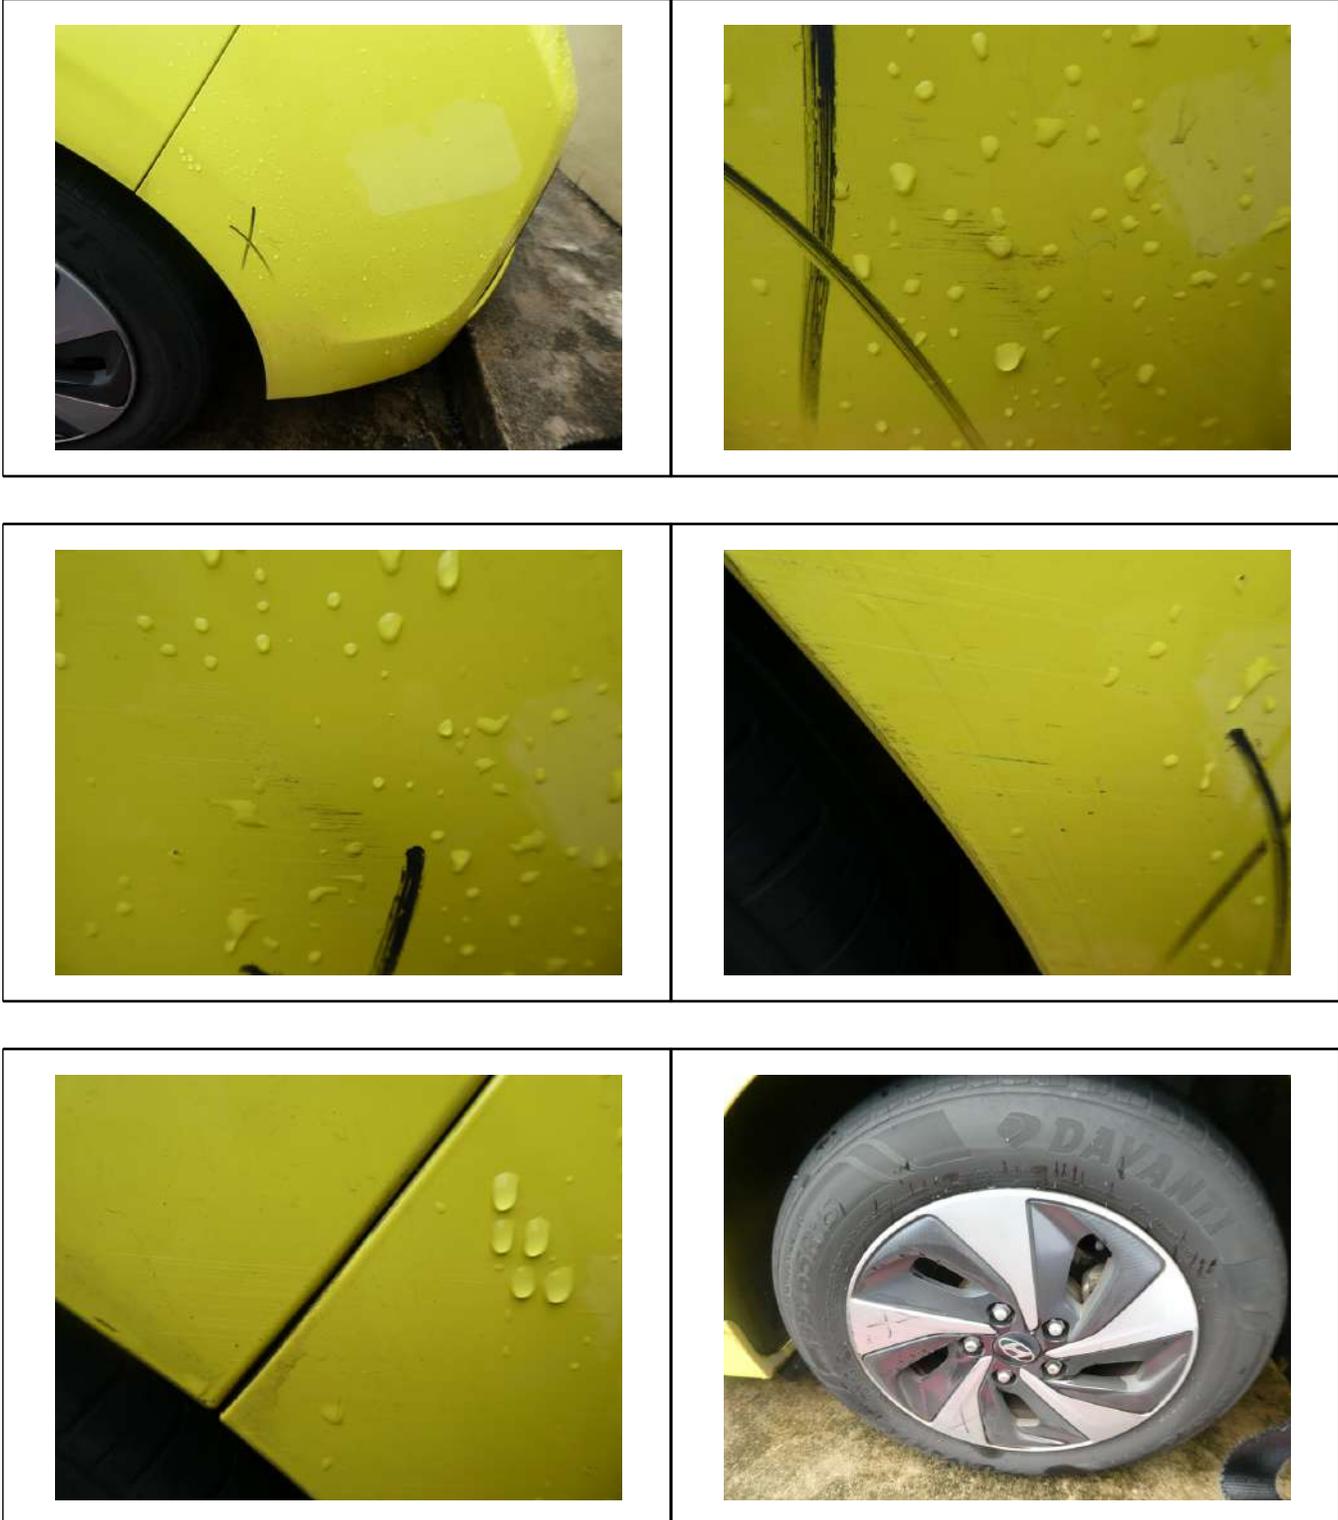



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

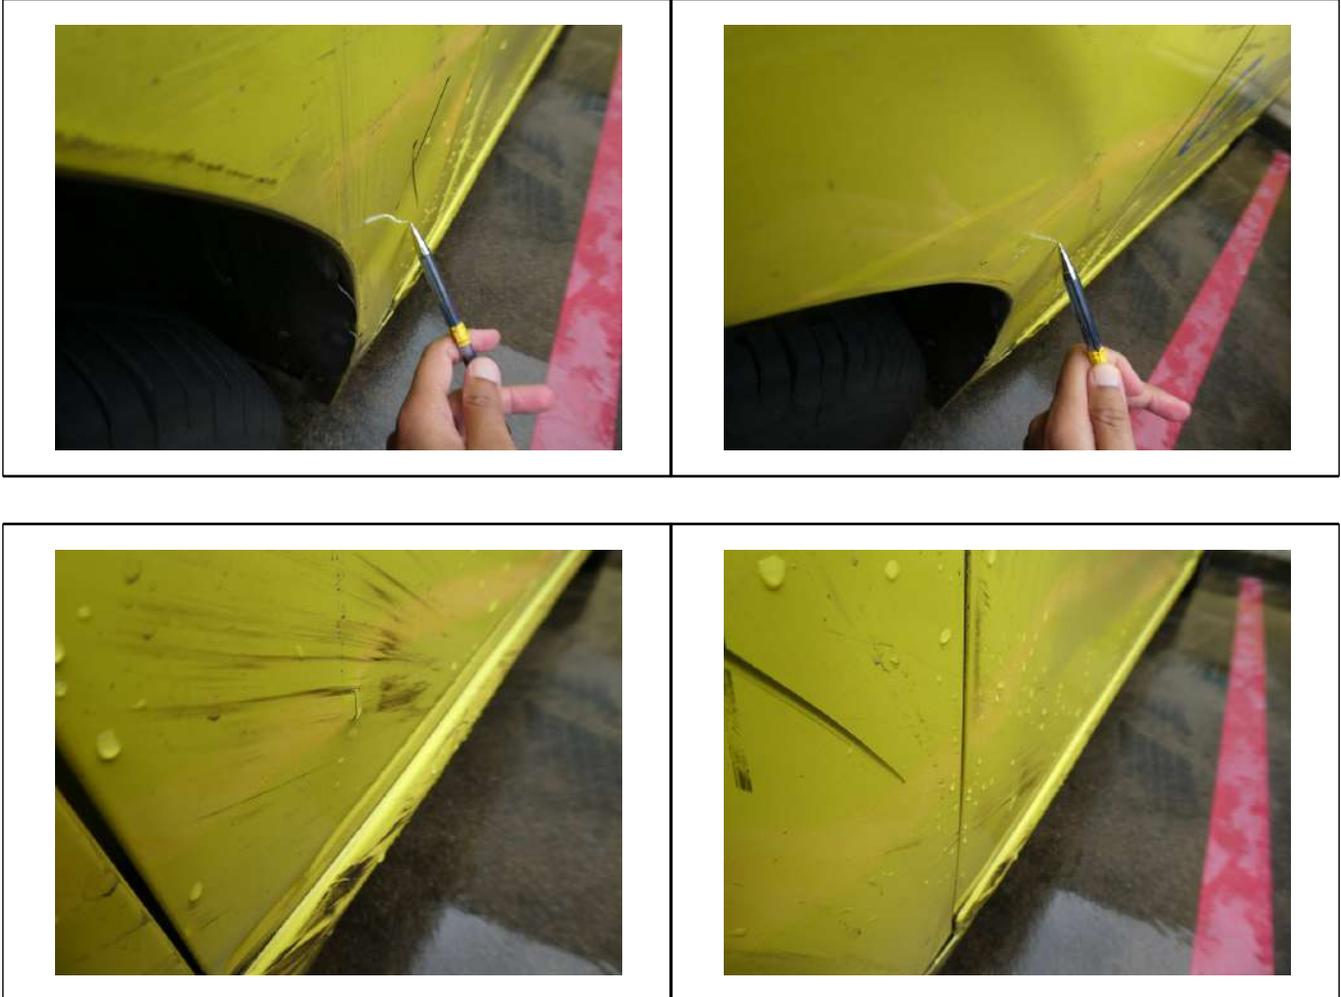



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 9517S

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

