



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

LONPAC INSURANCE BHD  
300 BEACH ROAD  
#17-04/07 THE CONCOURSE  
SINGAPORE 199555

INV No. AC2007716  
INV Date 17/11/2020  
Reference CC6/LPC20006808/Ugs3q2  
Code LPC2



#### PROFESSIONAL SERVICE FEE

Vehicle No. YQ 1824Y  
Insured Veh. YL 9760X  
Claim No. 20/20/20/VC05/023366  
Policy No. Z20VC05004979  
Accident Date 28/05/2020  
Inspection Date 30/06/2020

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (7%)</b>	<b>28.00</b>
<b>Grand Total</b>	<b>428.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD

Ref : CC6/LPC20006808/Ugs3q2

300 BEACH ROAD  
#17-04/07 THE CONCOURSESINGAPORE 199555

Date : 17-11-2020



Code : LPC2

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	YL 9760X	<b>Veh. Inspected</b>	YQ 1824Y
<b>Policy No.</b>	Z20VC05004979	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	20/20/20/VC05/023366	<b>Excess (\$)</b>	0.00
<b>Assign From</b>		<b>Assign Date</b>	30/06/2020

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	MITSUBISHI CANTER (M)	<b>c.c</b>	2998
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2019
<b>Chassis No.</b>	FEB71GA30011	<b>Colour</b>	WHITE
<b>Odometer</b>	24559	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	NIL
<b>General</b>	GOOD		

### 3. Conditions of Tyres

	Size	Make	Balance
<b>R/H Front Tyre</b>	215/75 R17.5	DUNLOP	6 mm
<b>L/H Front Tyre</b>	215/75 R17.5	DUNLOP	6 mm
<b>R/H Rear Tyre</b>	215/75 R17.5 (D)	DUNLOP	6/6 mm
<b>L/H Rear Tyre</b>	215/75 R17.5 (D)	DUNLOP	6/6 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY.  
DAMAGES SEE DETAILS.

### 5. General Information

<b>Accident Date</b>	28/05/2020	<b>Inspection Date</b>	30/06/2020
<b>Survey held at</b>	LIU'S BROTHER AUTO ENGINEERING WORKSHOP 1 KAKI BUKIT AVENUE 6 #01-01 AUTOBAY @ KAKI BUKIT SINGAPORE 417883		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.  
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **4 Working Days**



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. YQ 1824Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	<b>REPLACEMENT OF PARTS</b>	CRACKED		
	TO CUT OUT AND REFABRICATE;REALIGN ETCS (LOCAL REPAIR)(SN)		6,000.00	2,500.00
			6,000.00	2,500.00
	<b>LABOUR</b>			
	TO PUTTY & SPRAY PAINTING & INCLUDING TOUCH UP PAINT ON ACCIDENT AFFECTED AREAS.		800.00	600.00
			800.00	600.00
<b>GRAND TOTAL</b>			<b>6,800.00</b>	<b>3,100.00</b>
<b>RECOMMENDED COST OF REPAIRS</b>				<b>3,100.00</b>

Report Ref No. CC6/LPC20006808/Ugs3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



# LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. YQ 1824Y

INSPECTION

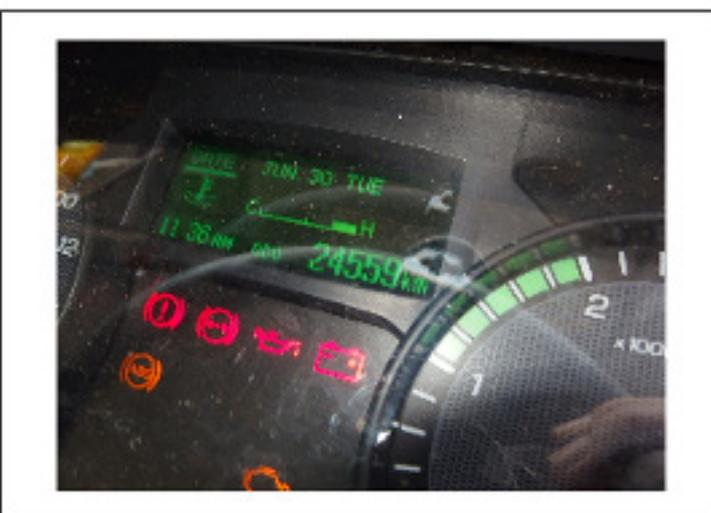



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. YQ 1824Y

RE-INSPECTION

