

ASSIGNMENT

COE Dec 2025

From: \_\_\_\_\_ Date: \_\_\_\_\_

Veh No: SHA 2246 U Yr Regn: Dec / 2017

Estimated Cost: \_\_\_\_\_

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

Truck / Trailer or \_\_\_\_\_

To Inspect Vehicle No: \_\_\_\_\_

Make: Hyundai I40 o.c. 1685

at Workshop m/s \_\_\_\_\_

Colour: Blue A/C: Insured / Std / NI / NA

of \_\_\_\_\_

Sp. Reading: 222036 T/Radio: Insured / Std / NI / NA

Insured: \_\_\_\_\_

Eng/No: D4FDGU712998

Policy No. 29141713MKF.

C/No: KMHLEB41UMHU098613

Claims No. 625487

Gen. Cond: Good / Fair / Poor / Burnt

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

Steering: Inorder / Jammed / Leaked / Burnt or \_\_\_\_\_

(Client's Record)

Brake: Inorder / Jammed / Leaked / Burnt or \_\_\_\_\_


Make of Veh: \_\_\_\_\_

Modi: Nil / S/Rim / STD A/Rim or \_\_\_\_\_

(Policy Condition)

Tyre Size: F: 205/60 R16

Remark: The veh had commenced its repair at the time of inspection.

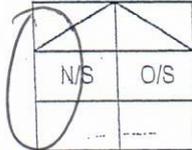

R: \_\_\_\_\_

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Hankook

Bal. or Market Value: \_\_\_\_\_

Front

Rear

IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No

R/Bal. 5 mm

R/Bal. 5 mm

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

L/Bal. 5 mm

L/Bal. 5 mm

Est. Repairs: 10 days Res.: Yes or No

D.O.A. 30/06/2020

D.O.I. 02/07/2020

Lum Sum: 20 % 3 Val.: Yes or No

Survey held at Sifrost Sin Ming

CA / REV / REP. / 24 HRS

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

H/S Portion

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	MSG SLQ 9499 D
07/07/2020	3:45 pm visited to Koh Ming Shao via Metron
28/12/2020	Final of 15 (7000/-) with 10 days of repair (red to 28/12/20, 63%)

Date/Time, File Pass to? : Preli. Report

Days Of Repair: 10

1) 29/12/2020 : Final Report

Resurvey No. of Trip: 2

Date/Time, File Return to?

Survey Fee:	
Transportation:	
S+RS SI	
Photos	
Others	
TOTAL	

2)

Add Fee: : Site Insp (\$ \_\_\_\_\_)

: Interview (\$ \_\_\_\_\_)

: Tech. Invs (\$ \_\_\_\_\_)

: Weekend (\$ \_\_\_\_\_)

Report Format: MEL-TP

Lump Sum / L.P. (\$) (7000)



FRONT WHEEL RIM (LH) <i>Demol</i> <i>Photo 325-30</i>	1	\$650.60	\$650.60	✓
KNUCKLE ARM (LH) <i>distorted</i> 552.00	1	\$595.90	\$595.90	✓
FRONT WHEEL BEARING HUB ASSY (LH) <i>Demol</i> 540.50	1	\$673.20	\$673.20	✓
FRONT SUSPENSION LOWER ARM (LH) <i>1st</i> 529.30 <del>342.70</del>	1	\$1,104.00	\$1,104.00	✓
FRONT SHOCK ABSORBER ASSY (LH) <i>1st</i> 342.20	1	\$684.40	\$684.40	✓
FRONT SHOCK ABSORBER MOUNTING (LH) <i>NH</i>	1	\$217.60	\$217.60	X
STG TIE ROD (LH) <i>1st</i>	1	\$186.40	\$186.40	✓
STG TIE END (LH) <i>1st</i>	1	\$125.20	\$125.20	✓
STABILIZER BAR ASSY <i>distorted</i> 252.30	1	\$463.70	\$463.70	✓
STABILIZER BAR LINK (LH) <i>distorted</i>	1	\$68.10	\$68.10	✓
ABS SENSOR <i>NH</i>	1	\$217.90	\$217.90	X
FRONT DRIVE SHAFT (LH) <i>distorted</i> 1030.80	1	\$2,061.60	\$2,061.60	✓
RACK & PINION ASSY <i>Demol</i> 969.60	1	\$1,820.00	\$1,820.00	✓
GEARBOX MOUNTING LH <i>NH</i>	1	\$596.10	\$596.10	X
ENGINE UNDER COVER <i>NH</i>	1	\$334.60	\$334.60	X
ENGINE CROSS MEMBER <i>distorted</i>	1	\$2,094.40	\$2,094.40	✓
INTER COOLER <i>NH</i>	1	\$1,032.50	\$1,032.50	X
HOSE B TO INTER COOLER <i>NH</i>	1	\$229.70	\$229.70	X
HOSE C TO INTER COOLER INLET <i>NH</i>	1	\$294.50	\$294.50	X
WIRING-ENGINE W/ FUSE BOX <i>NH</i>	1	\$3,326.00	\$3,326.00	X
<b>SUB TOTAL</b> 20172.70			\$43,541.90	
<b>LESS 20%</b>			\$8,708.38	
<b>DISCOUNTED TOTAL</b> 16138.16			\$34,833.52	
Rear Door Comfortdelgro & Apps Sticker(LH) <i>Nec</i> SN	1	\$ 80.00	\$ 80.00	✓
REAR DOOR ADVERTISEMENT LOGO (LH) <i>Nec</i> SI SN	1	\$100.00	\$100.00	✓
ROCKER PANEL ADVERTISEMENT(LH) <i>Nec</i> SN	1	\$ 120.00	\$ 120.00	✓
FRONT FENDER ADVERTISEMENT LOGO <i>Nec</i> SN	1	\$100.00	\$100.00	✓
FRONT DOOR COLOURED COMFORT LOGO <i>Nec</i> SN	1	\$75.00	\$75.00	✓
FRONT DOOR ADVERTISEMENT LOGO <i>Nec</i> SN	1	\$100.00	\$100.00	✓
FRONT WINDSCREEN SEALANT <i>1st NH</i> SN	1	\$45.00	\$45.00	✓ X
FRONT ERP STICKER <i>1st NH</i> SN	1	\$26.00	\$26.00	✓ X
FRONT TYRE (LH) <i>SVC</i> SN	1	\$216.00	\$216.00	X
<b>SUB TOTAL</b> 575.00			\$862.00	
<b>Labour Charge</b>				
Panel Beating	1	\$1,800.00	\$1,800.00	1200/-
Spray Painting Charge	1	\$1,600.00	\$1,600.00	1000/-
Wiring Charge	1	\$160.00	\$160.00	30/-
Tuff Kote	1	\$160.00	\$160.00	40/-
Towing Charge	1	\$80.00	\$80.00	60/- NH
Transfer of Door Mechanism FRONT	1	\$80.00	\$80.00	NH 60/-
Re-set Frt Power Window System	1	\$200.00	\$200.00	NH
Transfer of Door Mechanism REAR	1	\$80.00	\$80.00	60/-
Re-set Rear Power Window System	1	\$200.00	\$200.00	NH
Four Wheel Alignment	1	\$120.00	\$120.00	NH 60/-
Remove/Refix Undercarriage (Frt)	1	\$400.00	\$400.00	150/-
Re-set Frt ABS System	1	\$200.00	\$200.00	NH
Remove/Refix Radiator	1	\$90.00	\$90.00	NH
Remove/Refix Aircon & Refill Gas	1	\$130.00	\$130.00	NH
Remove/Refix Fuse Box	1	\$120.00	\$120.00	NH
Remove/Refix Front Windscreen Glass	1	\$120.00	\$120.00	3 NH
Remove/Refix Engine	1	\$600.00	\$600.00	NH


Remove/Refix Dashboard	1	\$350.00	\$350.00
Diagnostic & Resetting To Erase Fault Code	1	\$550.00	\$550.00
<b>TOTAL LABOUR</b>			<b>\$7,040.00</b>
<b>ESTIMATE TOTAL</b>			<b>\$ 42,735.52</b>

2750.00  
150/-

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

02/07/2020 @ 1700hrs  
 Not Author  
 L/Sinner 10 days.  
 Ryan  
 LKK Auto

19463.16  
 Supp 2022.24  
 21485.40  
 L/S 17000/-

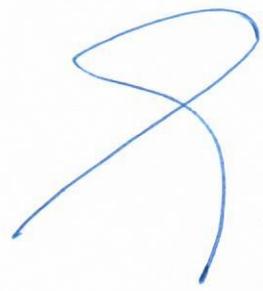

Check part prices.

**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
 Signature:  
 Date:

45737.12

# BIFROST AUTO PTE LTD

## REPAIR ESTIMATE

DATE: 3-Jul-20

MODEL: HYUNDAI I40

INSURANCE: MSIG

VEHICLE NO.: SHA2246U (S)

DESCRIPTION	QTY	LIST PRICE	AMOUNT
DOOR CENTRE PILLAR OUTER (LH) <i>Dents</i>	1	\$2,527.80	\$2,527.80
DOOR CENTRE PILLAR INNER <i>HN</i>	1	\$1,224.20	\$1,224.20
<b>SUB TOTAL</b>			<b>\$3,752.00</b>
<b>LESS 20%</b>			<b>\$750.40</b>
<b>DISCOUNTED TOTAL</b>			<b>\$3,001.60</b>

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

*Iyan*  
*Lkk Auto*

2022.24

✓  
X