

ASS. REC. BY:

REF:

FWD / 2000 6944 / Ksf3

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

PNPV2019-00017315

Claims No.

1202000018813

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

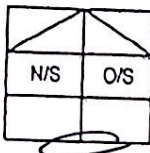

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

04

days

Res.: Yes or No

Lump Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SLV 4215M

Yr Regn: 28/12/2017

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or

Make:

Toyota Pro

c.c

1797

Colour

M. Silver

A/C: Insured / Std / NI / NA

Sp. Reading

325830

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

ZVW51

6053283

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD / RIM or

Tyre Size:

F:

195/65R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Davanni

Front

Rear

R/Bal.

8

mm

R/Bal.

8

mm

L/Bal.

8

mm

L/Bal.

8

mm

D.O.A.

2/7/20

D.O.I.

6/7/2020

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1/ GIA not ready

LS \$3600, 4 days (Red \$7356.79, 67%)

Date/Time, File Pass to?

☐

: Prel. Report

1) 11/11 Typist

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: 4

Resurvey No. of Trip: 2

Survey Fee:

Transportation:

S + RS, SI

Fees

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format :

MER-TP

Lump Sum / I.B.L. (\$

3600

H C AUTO PTE LTD

160 Sin Ming Drive # 05-09 Sin Ming Auto City Singapore 575722

Tel : 6457 0678 Fax : 6457 8287

Co. Reg. No. : 200820153N

Date : 02 / 07 / 2020

ESTIMATE COSTS OF REPAIR

M/s Andric Leasing

C/o 160 Sin Ming Drive

05-09 Sin Ming Auto City

Singapore 575722

Dear Sir / Madam ,

Vehicle no. : SLV 4215 M - Toyota Prius Hybrid 1.8E CVT

Accident date : 02 / 07 / 2020

*Not Authorized
U/Sing @?
Recovery After Pain
Today*

Quantity	Descriptions	Amount (S\$)
1	1 pc tail gate	<i>Am</i> \$ 1,211.40 ✓
2	1 pc tail gate 'Toyota' logo	\$ <i>Am</i> 60.30 ✓
3	1 pc tail gate 'PRIUS' emblem	\$ <i>Am</i> 65.60 ✓
4	1 pc tail gate Hybrid Synergy Drive emblem	\$ <i>Am</i> 51.90 ✓
5	1 pc tail gate inner lock	\$ <i>Am</i> 472.45 X
6	1 pc tail gate inner lock catch	\$ <i>Am</i> 48.90 X
7	1 pc tail gate garnish	\$ <i>CM</i> 960.00 ✓
8	1 pc tail gate inner trim	\$ <i>Am</i> 568.00 X
9	1 pc rear weather-strip	\$ <i>Am</i> 353.40 X
10	1 pc o/s tail lamp top	\$ <i>Am</i> 501.30 X
11	1 pc o/s tail lamp bottom	\$ <i>Am</i> 486.20 ✓
12	1 pc rear bumper top	\$ <i>Am</i> 1,358.50 ✓
13	1 pc rear bumper bottom	\$ <i>Am</i> 946.20 ✓
14	2 pcs rear bumper side cover 1 @ 188.00	<i>claiming</i> <i>CM</i> 376.00 ✓
15	1 pc o/s rear bumper lower cover (side)	\$ <i>Am</i> 112.00 X
16	1 pc n/s rear bumper lower cover (side)	\$ <i>Am</i> 115.00 X
17	1 pc rear bumper lower cover (center)	\$ 183.00 ?
18	2 pcs rear bumper side retainer 1 @ 94.80	\$ <i>Am</i> 189.60 X
19	2 pcs rear bumper bracket 1 @ 87.10	\$ <i>Am</i> 174.20 X
20	1 pc rear bumper tow cover	\$ <i>Am</i> 67.90 X
21	1 pc rear bumper reinforcement	\$ 507.20 ?
		\$ 8,809.05
	Less 25%	\$ 2,202.26
		\$ 6,606.79
22	1 pc rear no. plate	\$ <i>Am</i> 100.00 sn X
23	2 pcs rear windscreen glass inner seal 1 @ 60.00	\$ <i>Am</i> 120.00 sn <i>60.00</i>
24	2 pcs rear windscreen glass gum 1 @ 60.00	\$ <i>Am</i> 120.00 sn <i>60.00</i>
25	1 set rear reverse sensor	\$ <i>Am</i> 350.00 sn X
	Balance C/FD	\$ 7,296.79

H C AUTO PTE LTD

160 Sin Ming Drive # 05-09 Sin Ming Auto City Singapore 575722

Tel : 6457 0678 Fax : 6457 8287

Co. Reg. No. : 200820153N

Balance B/FD (SLV 4215 M)

\$ 7,296.79

Labour charges

\$ 1,600.00 500

To putty and spray painting

\$ 1,400.00 600

Re-seal anti rust

~ \$ 200.00 X

To check ,repair wiring

\$ 120.00 20

To transfer tail gate

\$ 120.00 60

To remove and refix rear both windscreen glass

\$ 220.00 180

\$ 10,956.79

Plus : 7% GST

\$ 766.98

Grand total

\$ 11,723.76

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Date of Accident : 02/07/2020 Accident Time : 1210hrs (24-HR-FORMAT)
Accident Place : Bishan street 12
Vehicle Reg.No (Car plate No.) : SLV 4215 M
Vehicle Make/Model : Toyota Prius Hybrid 1.8
Insurance company : Etiga Policy No: MOD15695
Owner or Company Names /IC NO : Andric Leasing 48503800E
Owner or Company Contact No. : _____ Owner's HP _____ Company Tel _____
DRIVER'S Name & IC no. : Lee Kun Ho S26020696
DRIVER'S Date of Birth : 02/03/1952 DRIVER'S License Pass Date 06/12/2005
Relationship bet. Owner & Driver : Spouse \ Parents \ Children \ Sibling \ Employee \ Others : Hirer
DRIVER'S ADDRESS : Blk 503 A Canberra Link #07-07 (S) 751503
DRIVER'S Contact No. / Alt No. : 1) 9728 1328 2) _____
DRIVER'S Occupation : INDOOR OUTDOOR (eg. working inside or outside of an ofc)
Email Address : _____
Weather & Road Surface : CLEAR & DRY \ RAINING & WET \ AFTER RAIN & WET
Reporting type : Reporting Only \ Claim Other Party \ Claim Own Ins.
Number of Passengers (including Driver): 1
Was there any video Captured by car camera: YES \ NO
Exact purpose for which vehicle was being used at the time of accident: Private use \ Work purpose

Other Party Driver's Particulars) (If any)

Vehicle No : SK2 2207R
Vehicle Make/Model : Mazda 3
Name DRIVER : Tan Cher Siong
IC NO. DRIVER : S0157359D
DRIVER'S Contact & add : _____

Vehicle No : _____
Vehicle Make/Model : _____
Name DRIVER : _____
IC NO. DRIVER : _____
DRIVER'S Contact & add : _____