



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV No. AC2006203
INV Date 09/09/2020
Reference CC4/FCI20007236/Gka3q2
Code FCI2



PROFESSIONAL SERVICE FEE

Vehicle No. SLQ 3705Z
Insured Veh. SHC 8736Y
Claim No. D20002730MFSH
Policy No. D-20094922MFSH
Accident Date 07/07/2020
Inspection Date 13/07/2020

Description	Total
Survey Inspection	386.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	386.00
GST (7%)	27.02
Grand Total	413.02

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD

Ref : CC4/FCI20007236/Gka3q2

36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Date : 09-09-2020



Code : FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHC 8736Y	Veh. Inspected	SLQ 3705Z
Policy No.	D-20094922MFSH	Coverage (\$)	0.00
Claim No.	D20002730MFSH	Excess (\$)	0.00
Assign From	CATHAN HENG	Assign Date	13/07/2020

2. Vehicle Particulars & Condition

Make & Model	KIA SORENTO 2.2	c.c	2199
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	KNAPH81BSH5353761	Colour	WHITE
Odometer	81021	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	235/55 R19	KUMHO	6 mm
L/H Front Tyre	235/55 R19	KUMHO	6 mm
R/H Rear Tyre	235/55 R19	KUMHO	6 mm
L/H Rear Tyre	235/55 R19	KUMHO	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION.THE UNDERCARRIAGE AFFECTED DUE TO COLLISION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	07/07/2020	Inspection Date	13/07/2020
Survey held at	BIFROST AUTO PTE LTD 8 KAKI BUKIT AVENUE 4 #01-49 PREMIER @ KAKI BUKIT SINGAPORE 415875		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **6 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLQ 3705Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER	CUT	675.80	675.80
2	FRONT BUMPER RETAINER @\$25.90	O/S CRACKED / N/S NOT NECESSARY	51.80	16.00
1	FRONT BUMPER TOWING COVER	NOT NECESSARY	23.70	-
1	FRONT BUMPER SENSOR	DAMAGED	212.50	212.50
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	587.10	-
1	RHS FRONT BUMPER FOG LIGHT	BROKEN	594.60	565.80
1	RHS FRONT BUMPER FOG LIGHT COVER	CUT	104.30	90.60
1	FRONT LOWER BUMPER	CUT	698.70	655.50
1	FRONT RADIATOR GRILLE	NOT NECESSARY	812.50	-
1	FRONT LOWER BUMPER GRILLE	NOT NECESSARY	164.70	-
1	RHS FRONT FENDER	TO REPAIR SEE LABOUR	478.40	-
1	RHS FRONT FENDER SHIELD	DEFORMED	89.70	89.70
1	RHS FRONT FENDER ARCH	DEFORMED	104.70	104.70
1	RHS HEADLAMP	CRACKED	2,310.50	2,210.00
1	RHS FRONT ABSORBER (NPA)	NOT NECESSARY	-	-
1	RHS FRONT KNUCKLE (NPA)	NOT NECESSARY	-	-
1	RHS FRONT LOWER ARM (NPA)	NOT NECESSARY	-	-
1	RHS FRONT KNUCKLE BEARING	JAMMED	315.50	279.00
1	FRONT BUMPER SPONGE (ADDITIONAL)	CRACKED	143.50	121.60
2	FRONT SUPPORT PANEL @\$763.70 (ADDITIONAL)	CRACKED	1,527.40	760.00
1	RHS FRONT HEADLAMP NOZZLE (ADDITIONAL)	BROKEN	236.90	213.00
	LESS 10% DISCOUNT		-913.23	-599.42
			8,219.07	5,394.78
<u>SPECIAL NETT ITEMS</u>				
10	FRONT BUMPER CLIP @\$6.00 (SN)	NECESSARY	60.00	30.00
10	FRONT FENDER ARCH CLIP @\$6.00 (SN)	NECESSARY	60.00	20.00
1	RHS FRONT RIM (SN)	CUT	1,200.00	450.00
1	RHS FRONT TYRE (SN)	CUT	950.00	150.00
			2,270.00	650.00

Report Ref No. CC4/FCI20007236/Gka3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO DISMANTLE,REPLACE,CUT,WELD, KNOCK OUT DENTS TO STRAIGHTEN ACCIDENT PARTS AS-MENTION.INCLUSIVE OF THE REPAIR OF RHS FRONT FENDER.		900.00	700.00
	TO PUTTY AND SPRAY PAINT ON ALL ACCIDENT DAMAGE PARTS AND OTHER ACCIDENT.		800.00	450.00
	TO CHECK WIRING SYSTEM TO FACILITATE REPAIR AND REFIT THE SAME.		50.00	30.00
	APPLY RUST PROOFING ON THE ADJACENT PANELS.	NOT NECESSARY	50.00	-
	TO SUPPLY UNDER COATING/PUTTY ON PARTS REPLACED.	NOT NECESSARY	50.00	-
	TO PERFORM WATER SEEPAGE TEST AFTER REPAIR.	NOT NECESSARY	80.00	-
	TO REMOVE AND REFIT FRONT REVERSE SENSOR.		80.00	40.00
	RESET ENGINE MANAGEMENT SYSTEM WITH DIAGNOSTIC FAULT.	NOT NECESSARY	150.00	-
	TO CONDUCT HEADLAMP FOCUS.	NOT NECESSARY	150.00	-
	TO REMOVE AND REFIT UNDER CARRIAGE.		350.00	50.00
	TO RESET WHEEL ALIGNMENT.		150.00	60.00
			2,810.00	1,330.00
	GRAND TOTAL		13,299.07	7,374.78
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,900.00

Report Ref No. CC4/FCI20007236/Gka3q2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLQ 3705Z

INSPECTION

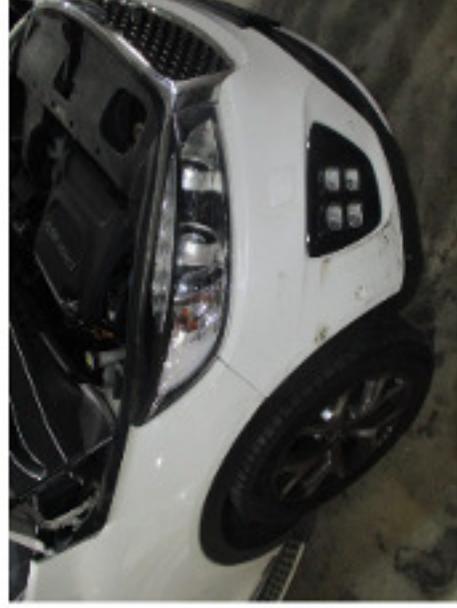



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

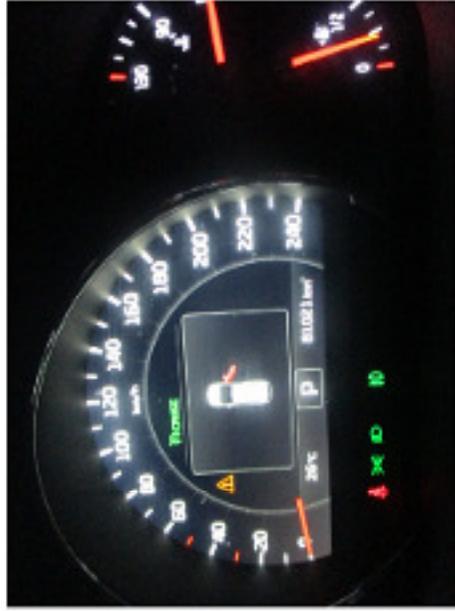



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLQ 3705Z

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

