

ASS. REC. BY:

REF:

ASSIGNMENT

CJB 2024 March

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

| | |
|-----|-----|
| N/S | O/S |
| | |

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 15 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SHC 7042 Y Yr Regn: 2016 / March

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Hyundai I40 C.C. 1685Colour: Yellow A/C: Insured / Std / NI / NASp. Reading: N.A. T/Radio: Insured / Std / NI / NAEng/No: D4FDDU395096C/No: KMHLB41UMGU085493Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim orTyre Size: F: 205/60 R16R: 11

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Hankook

Front

Rear

R/Bal. S mm R/Bal. S mmL/Bal. S mm L/Bal. S mmD.O.A. 03/07/2020 D.O.I. 15/07/2020Survey held at Bifrost Sin Ming

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Front o/s 7 o/s Rear 7 o/s Body

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

First Capital SHA 1517 UVehicle below 44 mths.BV 48.7KLTA 34.2KNV 14.5K.29/01/22 Jpnew 4S 21050/- at 15 days Jpnew

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

S + RS, SI

Photos

Others

TOTAL

Report Format: _____

Lump Sum / I.B.I.: (\$ _____)

Add Fee:

☐

: Site Insp (\$ _____)

☐

: Interview (\$ _____)

☐

: Tech. Invs (\$ _____)

☐

: Weekend (\$ _____)

BIFROST AUTO PTE LTD

REPAIR ESTIMATE

DATE: 9-Jul-20

MODEL: HYUNDAI I40

INSURANCE: FCI

VEHICLE NO.: SHC7042Y

| DESCRIPTION | QTY | LIST PRICE | AMOUNT |
|---|-----|------------|------------|
| REAR DOOR (RH) <i>Dent / St</i> | 1 | \$2,201.10 | \$2,201.10 |
| ROCKER PANEL OUTER GARNISH (RH) <i>cut</i> | 1 | \$732.80 | \$732.80 |
| ROCKER PANEL OUTER <i>HN</i> | 1 | \$1,380.50 | \$1,380.50 |
| BONNET <i>Dent</i> | 1 | \$2,265.90 | \$2,265.90 |
| BONNET RUBBER (LH) <i>HN</i> | 1 | \$35.70 | \$35.70 |
| BONNET RUBBER (RH) <i>HN</i> | 1 | \$35.70 | \$35.70 |
| BONNET HINGE (LH/RH) <i>st</i> | 2 | \$126.70 | \$253.40 |
| BONNET LOCK <i>st</i> | 1 | \$142.40 | \$142.40 |
| BONNET ABSORBER (LH ONLY) <i>HN</i> | 1 | \$61.60 | \$61.60 |
| BONNET INSULATOR <i>HN</i> | 1 | \$202.50 | \$202.50 |
| BONNET SEAL <i>HN</i> | 1 | \$31.90 | \$31.90 |
| BONNET INSULATOR CLIPS <i>HN</i> | 1 | \$15.00 | \$15.00 |
| BONNET CABLE <i>st</i> | 1 | \$69.60 | \$69.60 |
| RADIATOR GRILLE H EMBLEM <i>HN</i> | 1 | \$129.50 | \$129.50 |
| RADIATOR GRILLE <i>broken</i> 1110-50 | 1 | \$1,480.00 | \$1,480.00 |
| FRONT BUMPER COVER <i>turn</i> | 1 | \$1,052.20 | \$1,052.20 |
| FRONT BUMPER SPONGE <i>turn</i> | 1 | \$379.20 | \$379.20 |
| FRONT BUMPER REINFORCEMENT <i>st / Dent</i> | 1 | \$588.40 | \$588.40 |
| FRONT BUMPER GRILLE (LH/RH) <i>o/s cut n/s HN</i> | 2 | \$149.20 | \$298.40 |
| FRONT BUMPER LIP <i>HN</i> | 1 | \$152.00 | \$152.00 |
| FRONT BUMPER BRACKET TOP (LH/RH) <i>HN</i> | 2 | \$44.80 | \$89.60 |
| FRONT BUMPER BRACKET (LH/RH) <i>HN</i> | 2 | \$49.20 | \$98.40 |
| FRONT BUMPER RETAINER MOUNTING <i>HN</i> | 1 | \$76.20 | \$76.20 |
| FRONT BUMPER GRILLE AIR DUCT (RH) <i>src</i> | 1 | \$126.20 | \$126.20 |
| HEADLAMP SUPPORT PANEL ASSY <i>broken</i> | 1 | \$907.40 | \$907.40 |
| HEADLAMP (RH) <i>broken</i> 1388-00 | 1 | \$2,776.00 | \$2,776.00 |
| HEADLAMP SUPPORT TOP COVER <i>Crack</i> | 1 | \$222.60 | \$222.60 |
| RADIATOR <i>st</i> 850-20 | 1 | \$1,637.20 | \$1,637.20 |
| RADIATOR GUARD (LH/RH) <i>o/s broken n/s HN</i> | 2 | \$76.50 | \$153.00 |
| COOLANT <i>HN</i> | 1 | \$45.00 | \$45.00 |
| RADIATOR FAN BLADE, COWLING, MOTOR ASSY <i>HN</i> | 1 | \$1,194.20 | \$1,194.20 |
| RADIATOR HOSE UPPER <i>src</i> | 1 | \$229.50 | \$229.50 |
| RADIATOR HOSE LOWER <i>HN</i> | 1 | \$135.60 | \$135.60 |
| HORN UNIT (RH) <i>HN</i> | 1 | \$72.30 | \$72.30 |
| HORN WIRE <i>HN</i> | 1 | \$156.60 | \$156.60 |
| AIR FILTER <i>HN</i> | 1 | \$45.70 | \$45.70 |
| AIR CLEANER COVER <i>HN</i> | 1 | \$228.60 | \$228.60 |
| AIR CLEANER BOTTOM ASSY <i>HN</i> | 1 | \$325.00 | \$325.00 |
| AIR CLEANER HOSE <i>HN</i> | 1 | \$432.60 | \$432.60 |
| AIR DUCT <i>HN</i> | 1 | \$171.70 | \$171.70 |
| FRONT FENDER (RH) <i>Dent / Bnc</i> | 1 | \$566.30 | \$566.30 |
| FRONT FENDER APRON PANEL (RH) <i>Bnc</i> | 1 | \$637.00 | \$637.00 |
| FRONT FENDER SHIELD (RH) <i>dent / turn</i> | 1 | \$174.90 | \$174.90 |


| | | | | | |
|---|----------|---|------------|-------------|-----------------|
| AIRCON CONDENSER <i>ist</i> | | 1 | \$947.80 | \$947.80 | <i>✓</i> |
| AIRCON SUCTION & LIQUID HOSE <i>ist</i> | | 1 | \$549.10 | \$549.10 | <i>✓</i> |
| AIRCON DISCHARGE HOSE <i>ist</i> | | 1 | \$194.40 | \$194.40 | <i>✓</i> |
| FRONT DOOR (RH) <i>Don</i> | | 1 | \$2,256.40 | \$2,256.40 | <i>✓</i> |
| FRONT DOOR RUBBER <i>src</i> | | 1 | \$196.00 | \$196.00 | <i>X</i> |
| FRONT DOOR POWER MOTOR <i>HN</i> | | 1 | \$442.10 | \$442.10 | <i>X</i> |
| FRONT DOOR HINGE UPPER (RH) <i>HN</i> | | 1 | \$113.60 | \$113.60 | <i>X</i> |
| FRONT DOOR HINGE LOWER (RH) <i>HN</i> | | 1 | \$125.70 | \$125.70 | <i>X</i> |
| FRONT DOOR CHECK (RH) <i>HN</i> | | 1 | \$91.80 | \$91.80 | <i>X</i> |
| FRONT DOOR TRIM BOARD (RH) <i>HN</i> | | 1 | \$997.40 | \$997.40 | <i>X</i> |
| FRONT WHEEL RIM (RH) <i>distro</i> 325.30 | | 1 | \$650.60 | \$650.60 | <i>✓</i> |
| KNUCKLE ARM (RH) <i>distro</i> 552.00 | | 1 | \$595.90 | \$595.90 | <i>✓</i> |
| FRONT WHEEL BEARING HUB ASSY (RH) <i>Don</i> 540.50 | | 1 | \$673.20 | \$673.20 | <i>✓</i> |
| FRONT SUSPENSION LOWER ARM (RH) <i>ist</i> 529.30 | | 1 | \$1,104.00 | \$1,104.00 | <i>✓</i> |
| FRONT SHOCK ABSORBER ASSY (RH) <i>ist</i> 342.20 | | 1 | \$684.40 | \$684.40 | <i>✓</i> |
| FRONT SHOCK ABSORBER MOUNTING (RH) <i>HN</i> | | 1 | \$217.60 | \$217.60 | <i>X</i> |
| STG TIE ROD (RH) <i>distro</i> | | 1 | \$186.40 | \$186.40 | <i>✓</i> |
| STG TIE END (RH) <i>distro</i> | | 1 | \$125.20 | \$125.20 | <i>✓</i> |
| STABILIZER BAR ASSY <i>HN</i> | | 1 | \$463.70 | \$463.70 | <i>X</i> |
| STABILIZER BAR LINK (RH) <i>HN</i> | | 1 | \$68.10 | \$68.10 | <i>X</i> |
| ABS SENSOR <i>HN</i> | | 1 | \$217.90 | \$217.90 | <i>X</i> |
| FRONT DRIVE SHAFT (RH) <i>distro</i> 1030.80 | | 1 | \$2,061.60 | \$2,061.60 | <i>✓</i> |
| RACK & PINION ASSY <i>Don</i> 1191.30 | | 1 | \$1,820.00 | \$1,820.00 | <i>✓</i> |
| FRONT CHASSIS MEMBER (RH) <i>sign</i> | | 1 | \$1,060.70 | \$1,060.70 | <i>X</i> |
| ENGINE MOUNTING RH <i>HN</i> | | 1 | \$401.60 | \$401.60 | <i>X</i> |
| INTER COOLER <i>HN</i> | | 1 | \$1,032.50 | \$1,032.50 | <i>X</i> |
| SENSOR ASSY IMPACT - FRONT IMPACT <i>actuator</i> | | 1 | \$1,180.50 | \$1,180.50 | <i>✓</i> |
| | | | | | |
| SUB TOTAL | 23848.30 | | | \$40,467.60 | |
| LESS 20% | | | | \$8,093.52 | |
| DISCOUNTED TOTAL | 19078.64 | | | \$32,374.08 | |
| | | | | | |
| Rear Door Comfortdelgro & Apps Sticker(RH) <i>HN</i> SN | | 1 | \$ 80.00 | \$ 80.00 | <i>✓</i> |
| FRONT DOOR CITYCAB LOGO (RH) <i>HN</i> SN | | 1 | \$30.00 | \$30.00 | <i>✓</i> |
| FRONT TYRE (RH) <i>HN</i> SN | | 1 | \$216.00 | \$216.00 | <i>X</i> |
| | | | | | |
| SUB TOTAL | 110.00 | | | \$326.00 | |
| | | | | | |
| Labour Charge | | | | | |
| Panel Beating | | 1 | \$1,600.00 | \$1,600.00 | <i>1200/-</i> |
| Spray Painting Charge | | 1 | \$1,400.00 | \$1,400.00 | <i>1000/-</i> |
| Wiring Charge | | 1 | \$160.00 | \$160.00 | <i>30/-</i> |
| Tuff Kote | | 1 | \$160.00 | \$160.00 | <i>40/-</i> |
| Towing Charge | | 1 | \$80.00 | \$80.00 | <i>HN</i> |
| Transfer of Door Mechanism FRONT | | 1 | \$80.00 | \$80.00 | <i>60/-</i> |
| Re-set Frt Power Window System | | 1 | \$200.00 | \$200.00 | <i>HN</i> |
| Transfer of Door Mechanism REAR | | 1 | \$80.00 | \$80.00 | <i>60/-</i> |
| Re-set Rear Power Window System | | 1 | \$200.00 | \$200.00 | <i>HN</i> |
| Four Wheel Alignment | | 1 | \$120.00 | \$120.00 | <i>60/-</i> |
| Remove/Refix Undercarriage (Frt) | | 1 | \$400.00 | \$400.00 | <i>150/-</i> |
| Re-set Frt ABS System | | 1 | \$200.00 | \$200.00 | <i>HN</i> |
| Remove/Refix Radiator | | 1 | \$90.00 | \$90.00 | <i>50/-</i> |
| Remove/Refix Aircon & Refill Gas | | 1 | \$130.00 | \$130.00 | <i>80/-</i> |
| Remove/Refix Engine | | 1 | \$600.00 | \$600.00 | <i>250/- HN</i> |
| Remove/Refix Dashboard | | 1 | \$350.00 | \$350.00 | <i>HN</i> |

| | | | | |
|--|---------|----------|--------------|-------|
| Remove/Refix Steering Rack/Wheel/Dr Shaft | 1 | \$150.00 | \$150.00 | 44 |
| Remove/Refix Air Bag/Steering Wheel/Dashboard/Seat | 1 | \$550.00 | \$550.00 | 250/- |
| Diagnostic & Resetting To Erase Fault Code | 1 | \$550.00 | \$550.00 | 150/- |
| TOTAL LABOUR | 3130.00 | | \$7,100.00 | |
| ESTIMATE TOTAL | | | \$ 39,800.08 | |
| This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company. | | | | |


15/07/2020 e 1400hrs

NA Annual

2/5mm ¹⁵ days.

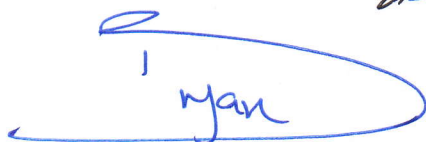
Ryan

LKK Auto

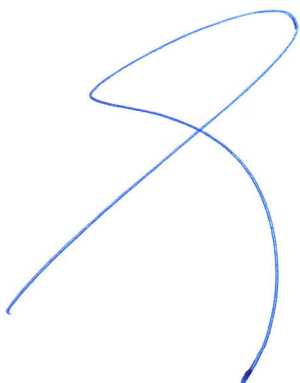

Proude Book Value

=====

22318.64

Supp 6608.36

28927.00

L/s 21000/-

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

BIFROST AUTO PTE LTD

REPAIR ESTIMATE

DATE: 17-Jul-20

MODEL: HYUNDAI I40

VEHICLE NO.: SHC7042Y (S)

INSURANCE: First Capital

| DESCRIPTION | QTY | LIST PRICE | AMOUNT |
|--|-----|------------|------------|
| HEADLAMP (LH) <i>mainly broken</i> 1388.00 | 1 | \$2,776.00 | \$2,776.00 |
| RADIATOR EXPANSION TANK <i>broken</i> | 1 | \$163.80 | \$163.80 |
| FRONT FENDER SHIELD (LH) <i>damaged replaced</i> | 1 | \$174.90 | \$174.90 |
| FRONT SAFETY BELT ASSY (LH/RH) <i>actuated</i> | 2 | \$477.20 | \$954.40 |
| WIPER PANEL TOP GARNISH <i>cut / broken</i> | 1 | \$476.60 | \$476.60 |
| ENGINE UNDER COVER <i>turn</i> | 1 | \$334.60 | \$334.60 |
| ENGINE CROSS MEMBER <i>Et</i> | 1 | \$2,094.40 | \$2,094.40 |
| WIPER TANK <i>broken</i> | 1 | \$380.55 | \$380.55 |
| ENGINE TOP COVER <i>broken</i> | 1 | \$438.80 | \$438.80 |
| STEERING WHEEL AIR BAG <i>actuated</i> | 1 | \$1,830.60 | \$1,830.60 |
| FAN BELT <i>turn</i> | 1 | \$198.70 | \$198.70 |
| SUB TOTAL | | | \$9,823.35 |
| LESS 20% | | | \$1,964.67 |
| DISCOUNTED TOTAL | | | \$7,858.68 |

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

T. Ryan
LKK Auto

8260.45
20% 6608.36

[Signature]