



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

QBE INSURANCE (SINGAPORE) PTE LTD

INV No. AC2101026

1 RAFFLES QUAY #29-10 SOUTH TOWER
SINGAPORE 048583

INV Date 18/02/2021
Reference CC6/QBE20007402/Upa3q2
Code QBE

PROFESSIONAL SERVICE FEE

Vehicle No. SMT 825C
Insured Veh. SLB 150Y
Claim No. VC013816
Policy No. 8-V0021534-MVA-R001
Accident Date 17/07/2020
Inspection Date 17/07/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
QBE INSURANCE (SINGAPORE) PTE LTD 1 RAFFLES QUAY #29-10 SOUTH TOWERSINGAPORE 048583			Ref: CC6/QBE20007402/Upa3q2	
			Date: 18/02/2021	
			Code: QBE	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLB 150Y	Veh. Inspected	SMT 825C	
Policy No.	8-V0021534-MVA-R001	Coverage (\$)	0.00	
Claim No.	VC013816	Excess (\$)	0.00	
Assign From		Assign Date	17/07/2020	
2. Vehicle Particulars & Condition				
Make & Model	MERCEDES BENZ CLA200 (A)	c.c	1595	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	WDD1173432N474002	Colour	BLUE	
Odometer	49576 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	235/40 R18	PIRELLI	8 mm	
L/H Front Tyre	235/40 R18	PIRELLI	8 mm	
R/H Rear Tyre	235/40 R18	PIRELLI	8 mm	
L/H Rear Tyre	235/40 R18	PIRELLI	8 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	17/07/2020	Inspection Date	17/07/2020	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMT 825C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BOOTLID	TO REPAIR SEE LABOUR	2,018.00	-
1	BOOTLID REAR LOGO	NOT NECESSARY	105.00	-
1	BOOTLID 'CLA 200' EMBLEM	NOT NECESSARY	82.00	-
1	BOOTLID C&C LOGO	NOT NECESSARY	68.00	-
1	BOOTLID CHROME MOULDING	NOT NECESSARY	194.00	-
1	BOOTLID INNER LOCK	NOT NECESSARY	280.00	-
1	BOOTLID LOCK PUMP	NOT NECESSARY	650.00	-
1	BOOTLID LOCK STRIKER	NOT NECESSARY	62.00	-
1	BOOTLID WEATHERSTRIP	TWISTED	292.00	292.00
2	BOOTLID STOPPERS @ \$8.00	NOT NECESSARY	16.00	-
1	BOOTLID INNER HANDLE	NOT NECESSARY	53.00	-
2	BOOTLID HINGES @ \$145.00	NOT NECESSARY	290.00	-
1	BOOTLID INNER TRIM BOARD	NOT NECESSARY	215.00	-
1	REAR BUMPER	DENTED / DEFORMED	1,658.00	1,615.32
1	REAR BUMPER CENTRE CHOME MOULDING	SCRATCHED	185.00	185.00
1	REAR BUMPER CENTRE BLACK GARNISH	DEFORMED / GRAZED	660.00	585.00
2	REAR BUMPER SIDE RETAINERS	NOT NECESSARY	72.00	-
1	REAR BUMPER INNER RETAINER	CRACKED	168.00	168.00
2	REAR BUMPER LOWER BRACKETS @ \$20.00	SERVICEABLE	40.00	-
1	REAR BUMPER REINFORCEMENT	BENT	655.00	655.00
1	REAR BUMPER LOWER TRAY	DEFORMED / CRACKED	650.00	499.25
1	REAR END PANEL	BADLY DENTED	1,415.00	1,290.00
1	REAR END PANEL TOP GARNISH	TWISTED	426.00	415.00
2	TAILLAMPS @ \$1260.00	CRACKED	2,520.00	1,710.00
2	TAILLAMPS HOUSING PANELS @ \$150.00	NOT NECESSARY	300.00	-
2	REAR FENDERS @ \$1600.00	TO REPAIR SEE LABOUR	3,200.00	-
2	REAR FENDER INNER TRIMS @ \$212.00	NOT NECESSARY	424.00	-
1	REAR SPARE TYRE TOP BOARD	NOT NECESSARY	889.00	-

Report Ref No. CC6/QBE20007402/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR SPARE TYRE BOARD (FIBRE)	NOT NECESSARY	415.00	-
1	REAR FLOOR PANEL	NOT NECESSARY	1,310.00	-
4	REAR PDS SENSORS @ \$265.00	SHORTED 2PCS ONLY	1,060.00	490.00
	LESS 10% DISCOUNT		-	-790.46
			20,372.00	7,114.11
	<u>SPECIAL NETT ITEMS</u>			
1	BOOTLID C&C LOGO (SN)	NOT NECESSARY	45.00	-
1	REAR LICENCE PLATE W/HOLDER (SN)	NOT NECESSARY	50.00	-
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
1	REAR WINDSCREEN SEALANT (SN)	NOT NECESSARY	50.00	-
1	REAR EXHAUST CHROME O/S (SN)	BENT	250.00	200.00
			445.00	250.00
	<u>LABOUR</u>			
	TO RESET AND PROGRAMME. }		120.00	50.00
	TO CHECK WIRING. }		100.00	-
	TO DISMANTLE & REPLACING REVERSE SENSOR.		100.00	50.00
	TO TRANSFER BOOTLID MECHANISM.	NOT NECESSARY	180.00	-
	TO DISMANTLE & REFIX SEAT, CUSHION UPHOLSTERY.		180.00	80.00
	TO DISMANTLE & REPLACING REAR EXHAUST.	NOT NECESSARY	180.00	-
	TO SPRAY ANTI RUST PROOFING.		150.00	30.00
	LABOUR FOR PANEL BEATING, CUT, WELD, STRAIGHTEN REPLACING PARTS. INCLUSIVE OF THE REPAIR OF BOOTLID AND REAR FENDERS.		1,000.00	680.00
	TO PUTTY & SPRAY PAINTING.		1,500.00	800.00
			3,510.00	1,690.00
GRAND TOTAL			24,327.00	9,054.11

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			7,200.00
---	--	--	-----------------

Report Ref No. CC6/QBE20007402/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMT 825C

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

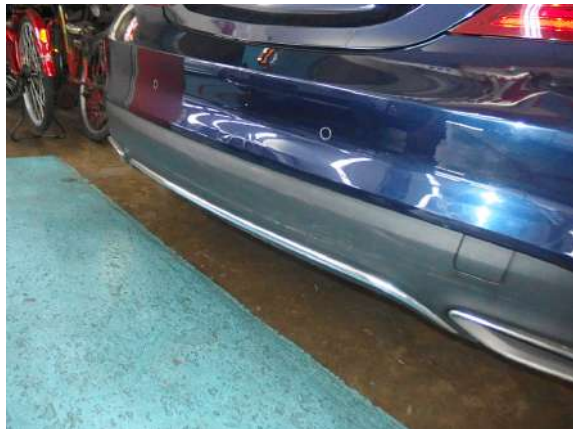




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

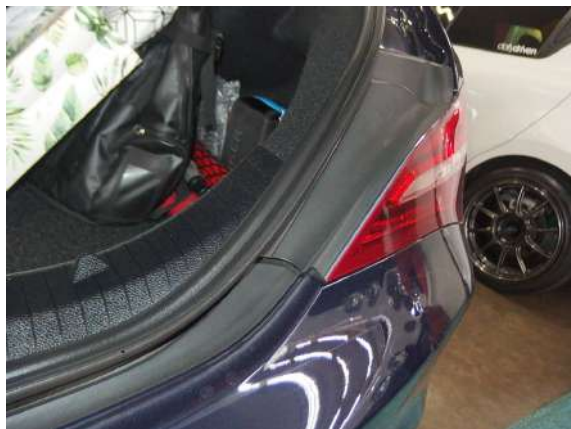



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMT 825C

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

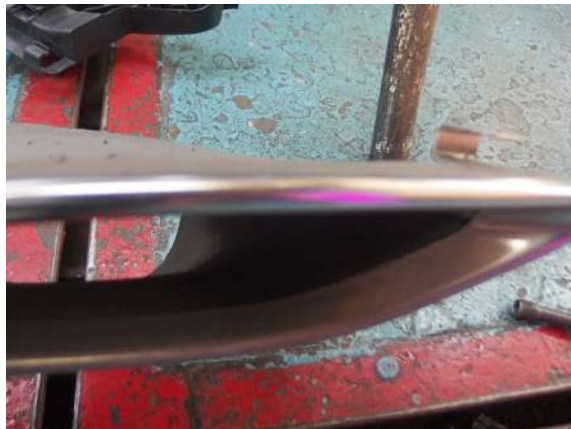



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMT 825C

RE-INSPECTION

